



June 25, 2013

Mr. Jon Rilling
 Accretive Capital Partners, LLC
 12275 El Camino Real, Suite 110
 San Diego, CA 92130

RE: Lilac Hills Ranch (TM 5571) - Sight Distance Analysis at Circle R Drive and Mtn Ridge Rd

Dear Jon:

Per your request, we have conducted the Sight Distance Analysis at the intersection of Circle R Drive and Mountain Ridge Road in Valley Center (see Figure 1 - Vicinity Map) to determine adequate sight distance per the San Diego County Public Road Standards requirements. For this analysis, it was assumed the existing alignment of Mountain Ridge Road would remain the same as it approaches Circle R Drive from the north.

The speed survey was completed between September 11, 2012 and September 16, 2012 by National Data and Surveying Services. Average speeds range from 34.7 to 37.0 mph while the 85th percentile, speeds were in the range of 41.3-44.0 mph (see table below). For this analysis, a 45 mph prevailing speed was used. Per the County of San Diego sight distance requirements, the minimum corner intersection sight distance is 450' for a prevailing speed of 45 mph.

Circle R Drive, just east of Mountain Ridge Road						
	ADT	Average Speed (mph)		85th Percentile Speed (mph)		Heavy Vehicle %
		EB	WB	EB	WB	
Weekday	1,822	34.7	36.7	41.3	44.0	2.0%
Weekend	1,407	34.5	37.0	41.5	44.0	2.5%

The line of sight from Observation Point 'B' looking east is of 450' has been achieved due to recent clearing performed in April 2013 along the existing public road within APN 129-390-18 between the existing pavement of Circle R Drive and an existing public road easement granted per PM 17205. It is recommended that this area be kept clear by means of preventative maintenance to maintain adequate sight distance at this Intersection. The County has prescriptive easement rights to this portion of Circle R Drive, a public road. Since the required clearing area is between the existing pavement to the north and an existing public road easement to the south, the County should have the right to clear this area to establish the required line of sight to assure public safety for the use of this existing public road as part of their normal maintenance responsibilities. However, a clear space easement should be obtained over this area (as illustrated on Figure 2) from the offsite property owner (APN 129-390-18) to ensure maintenance rights in perpetuity. Additionally, this clearing area falls within the 50' fire buffer area required by the Deer Springs Fire Protection District along all existing property lines.

The current line of sight for the eastbound traffic as seen from Observation Point 'B' on Mountain Ridge Road looking west toward Object Target 'C' on Circle R Drive is also adequate and neither maintenance nor clearing is recommended at this time.

Profiles through both lines of sight and photos are provided for clarity (Figures 3-6).

If you have any particular questions or require additional information, please do not hesitate to call.

Sincerely,

LANDMARK CONSULTING



Mark A. Brencick, P.E., P.L.S.
 President

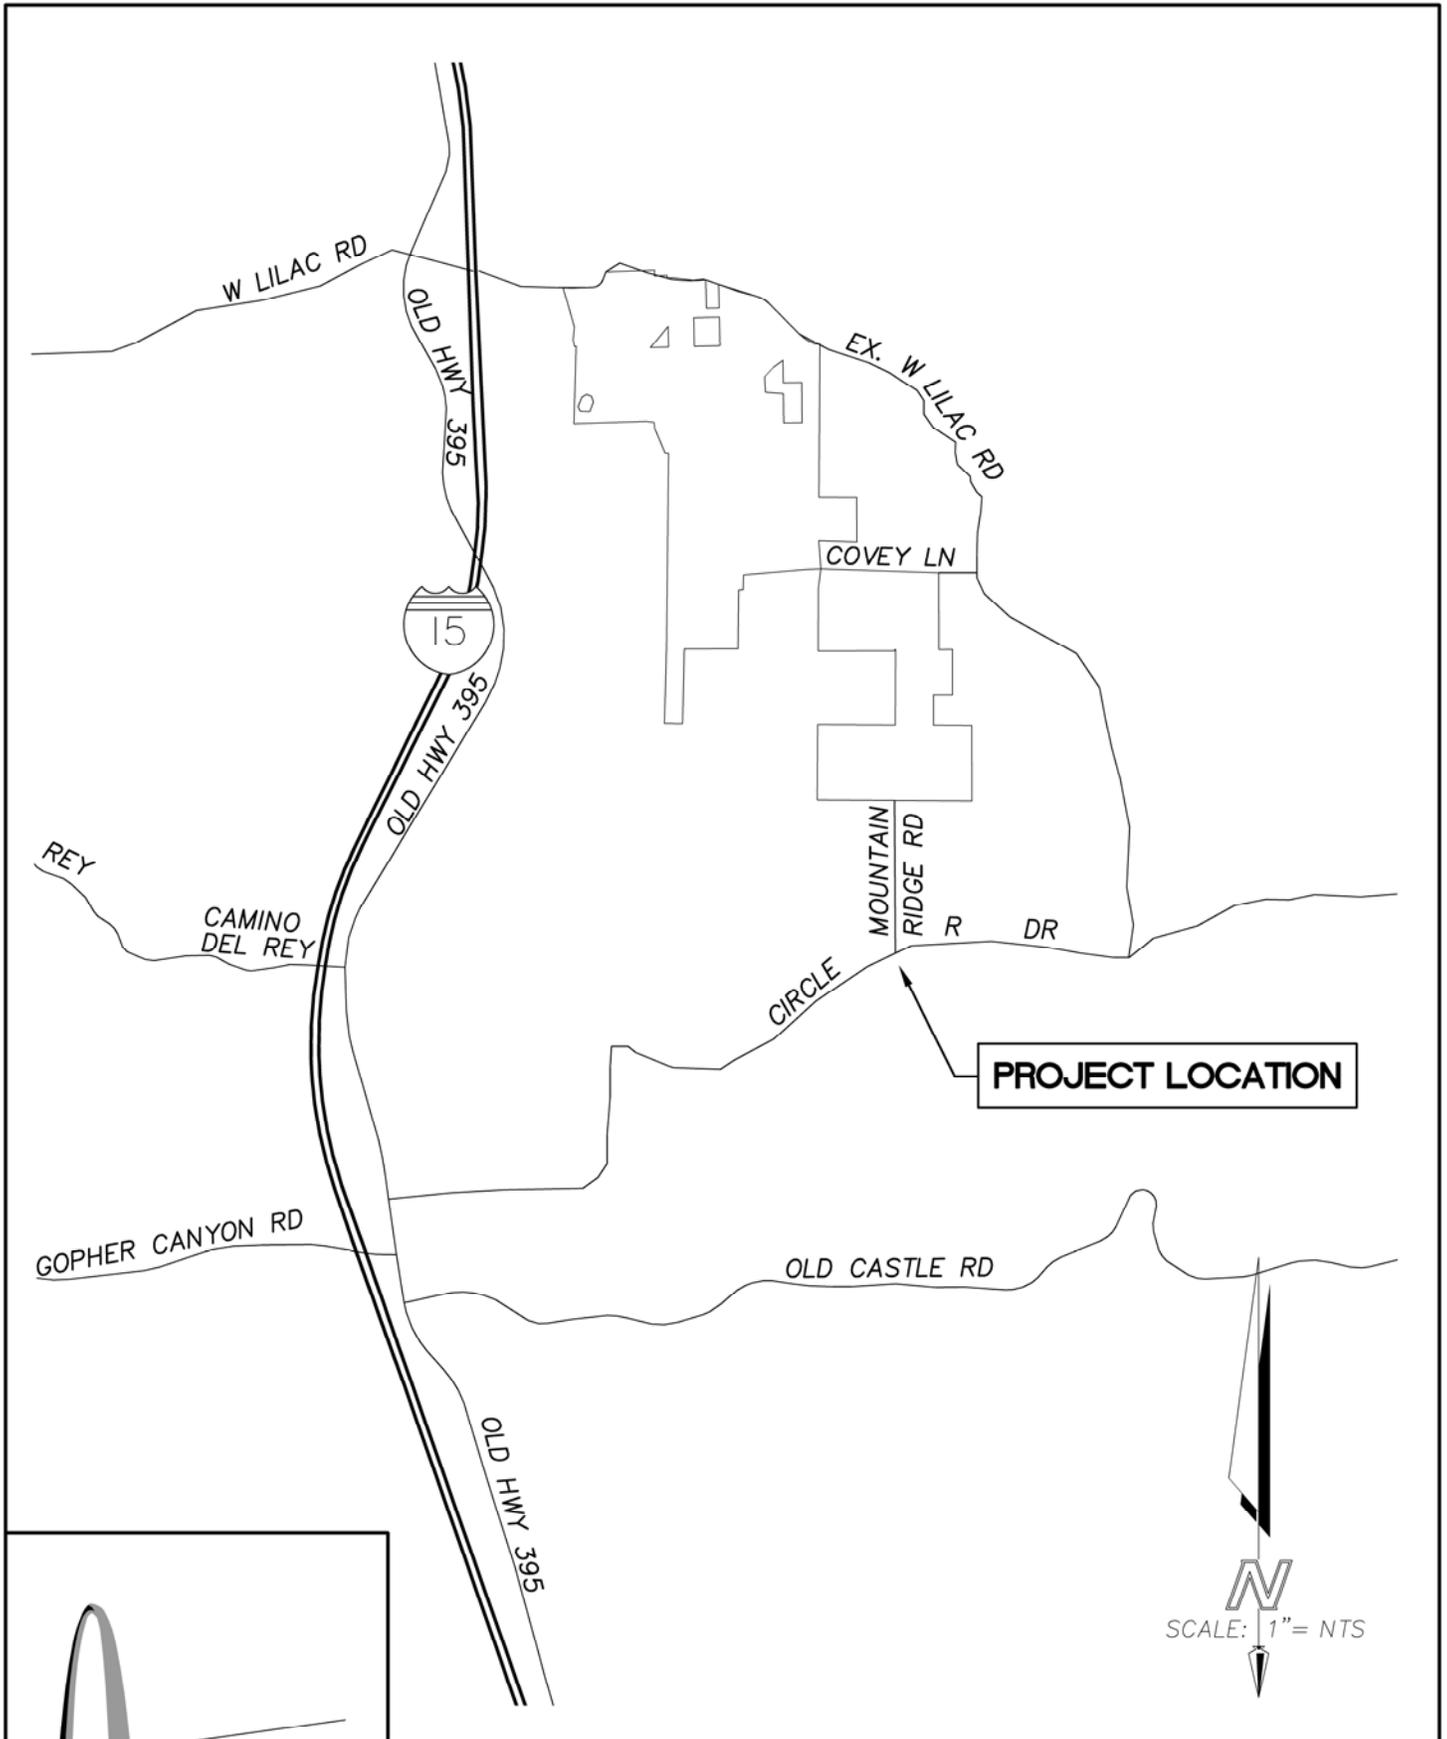


FIGURE 1
VICINITY MAP

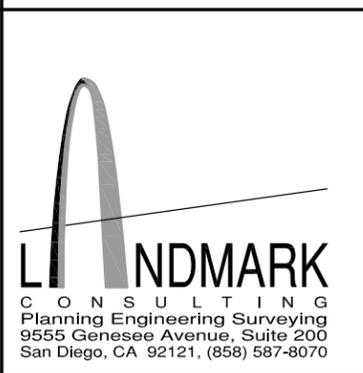
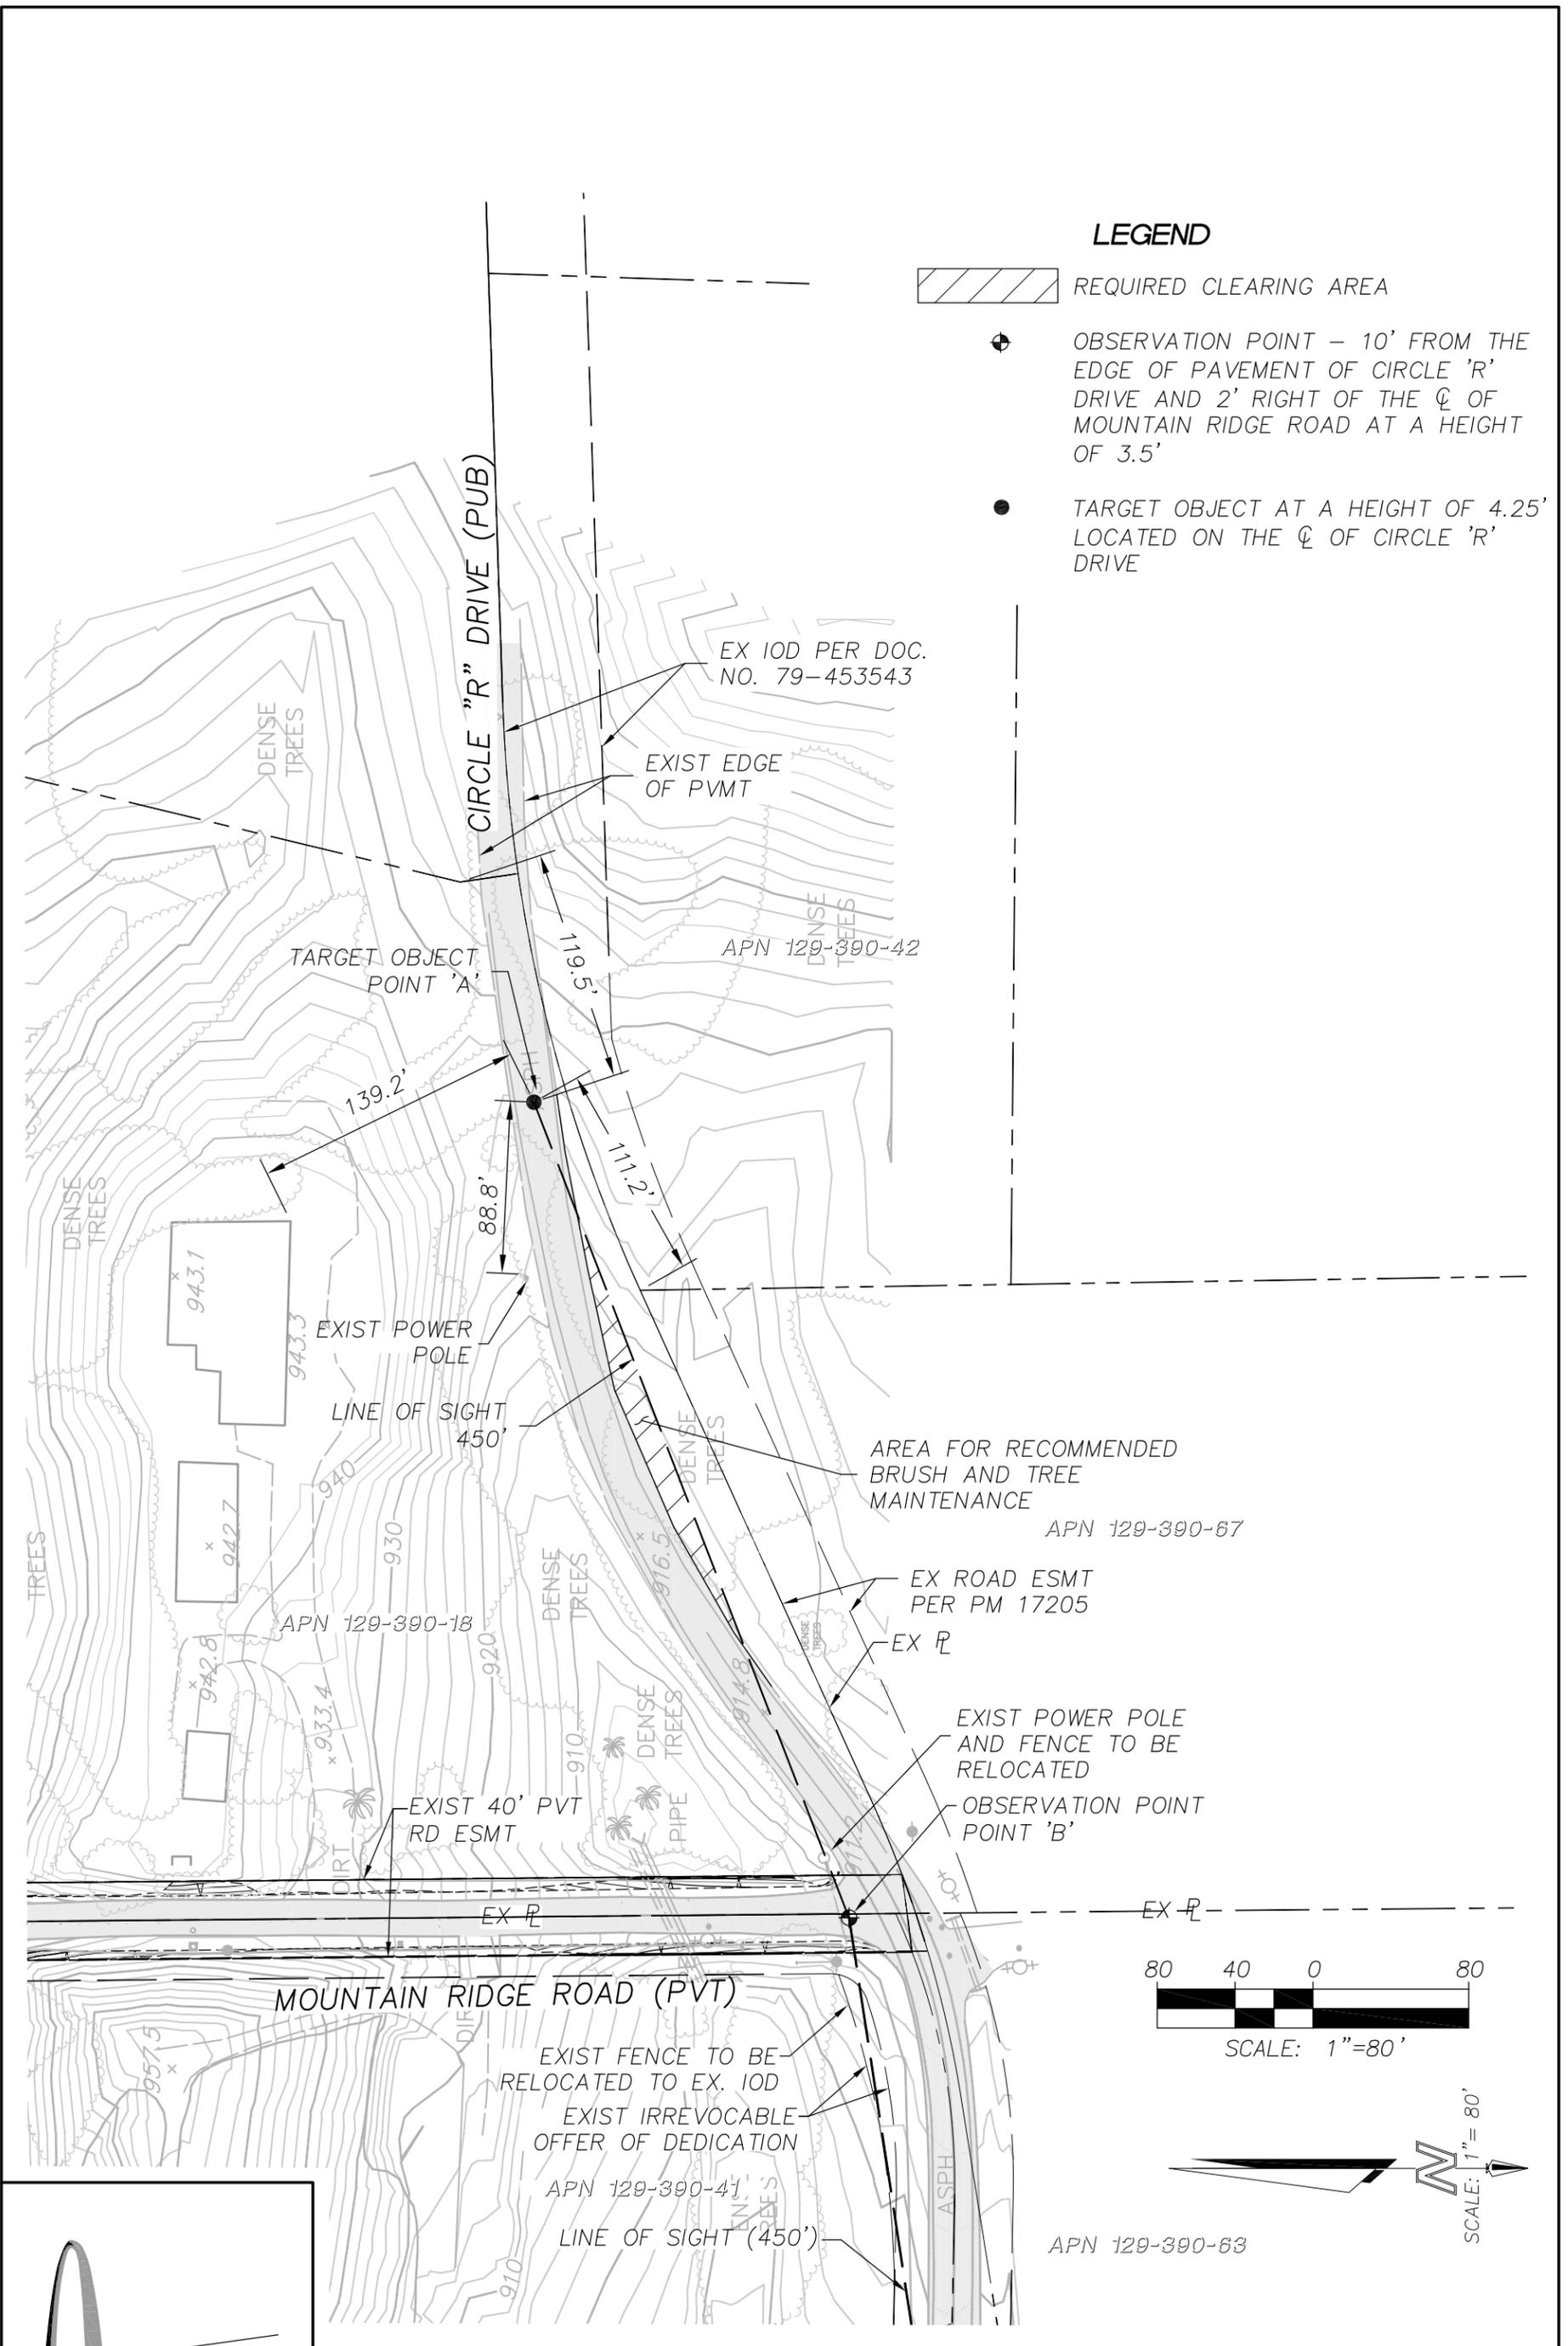


FIGURE 2
SIGHT DISTANCE ANALYSIS
CIRCLE R DRIVE AND MOUNTAIN RIDGE RD

PROFILE: CIRCLE R EAST

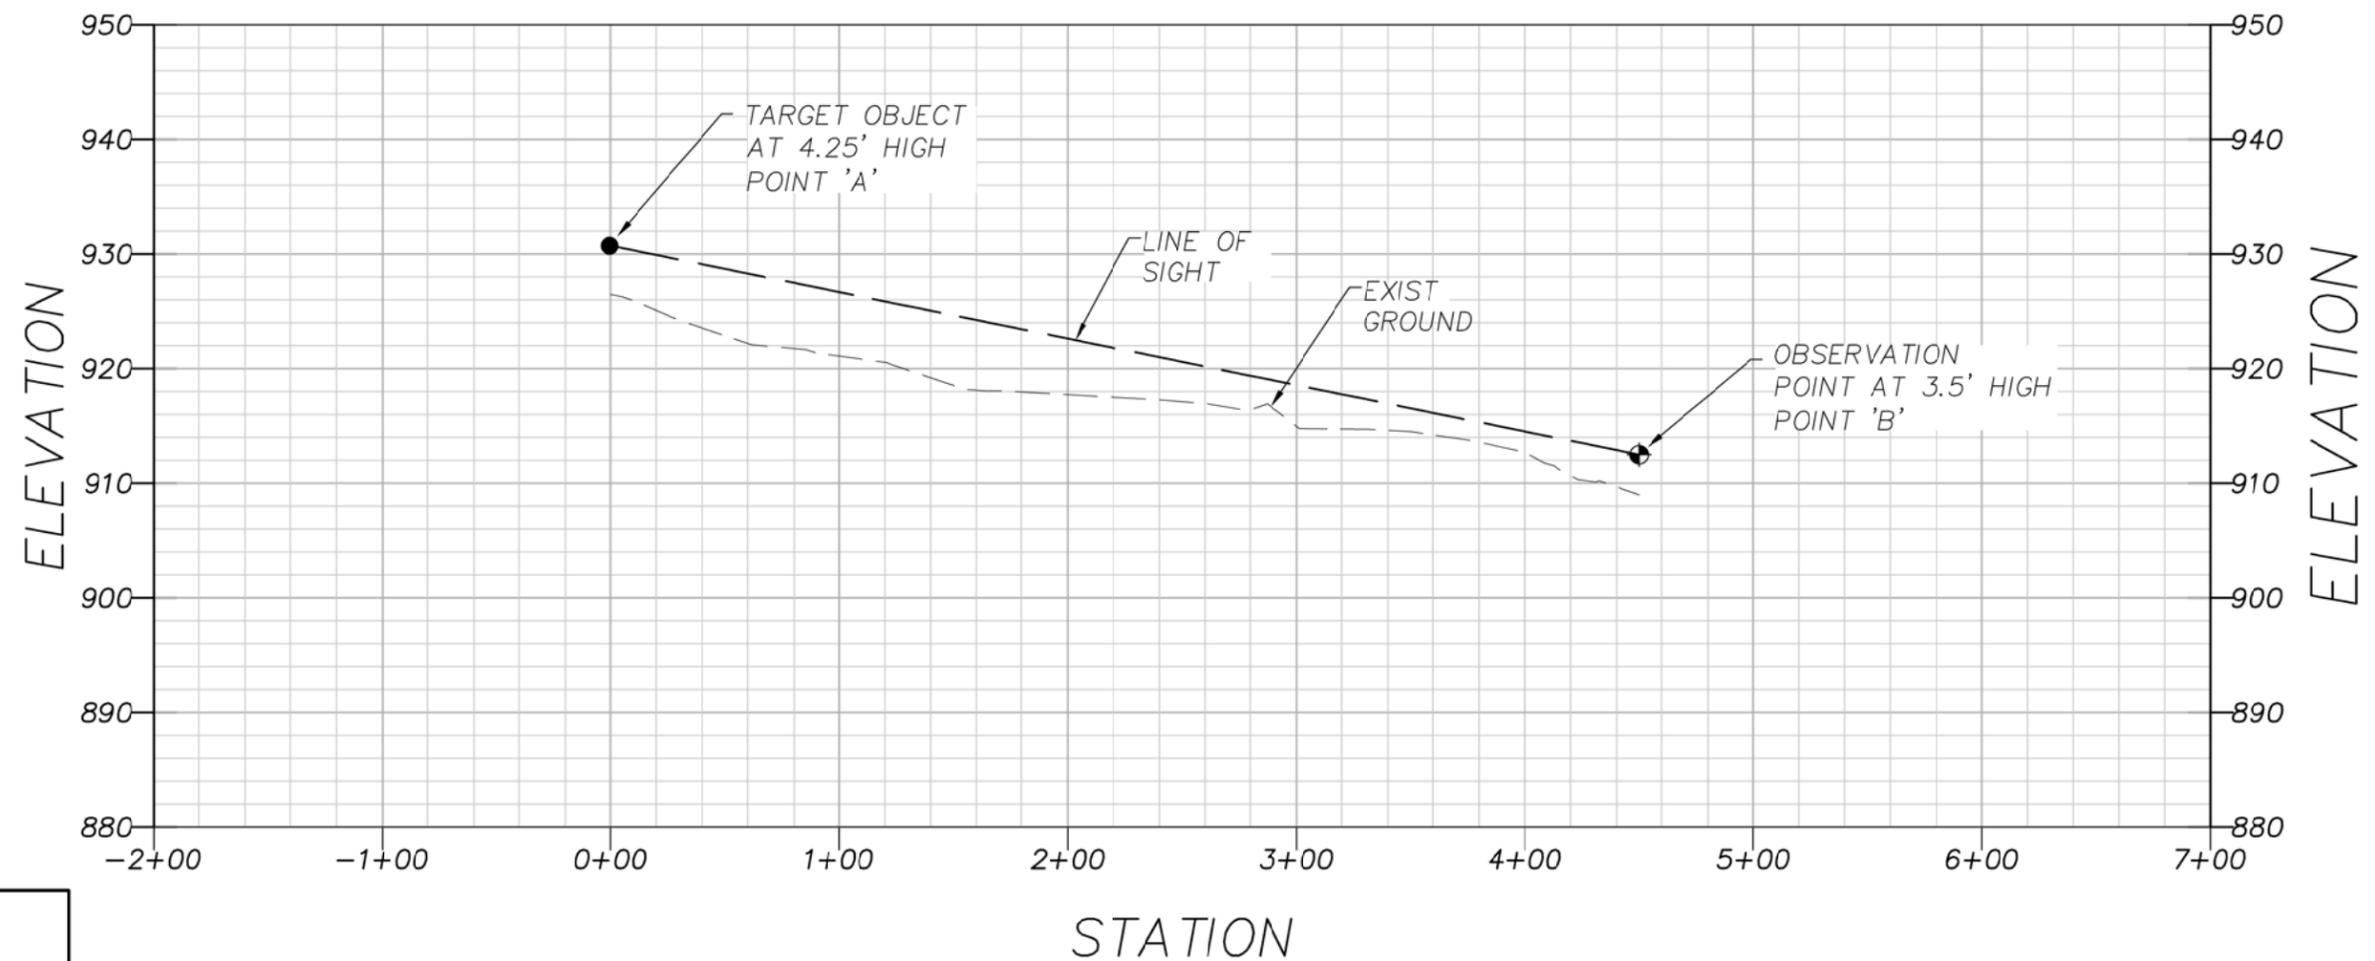


FIGURE 3
LINE OF SIGHT PROFILE FOR MTN RIDGE RD AND CIRCLE R DR (WESTBOUND TRAFFIC)



PROFILE: CIRCLE R WEST

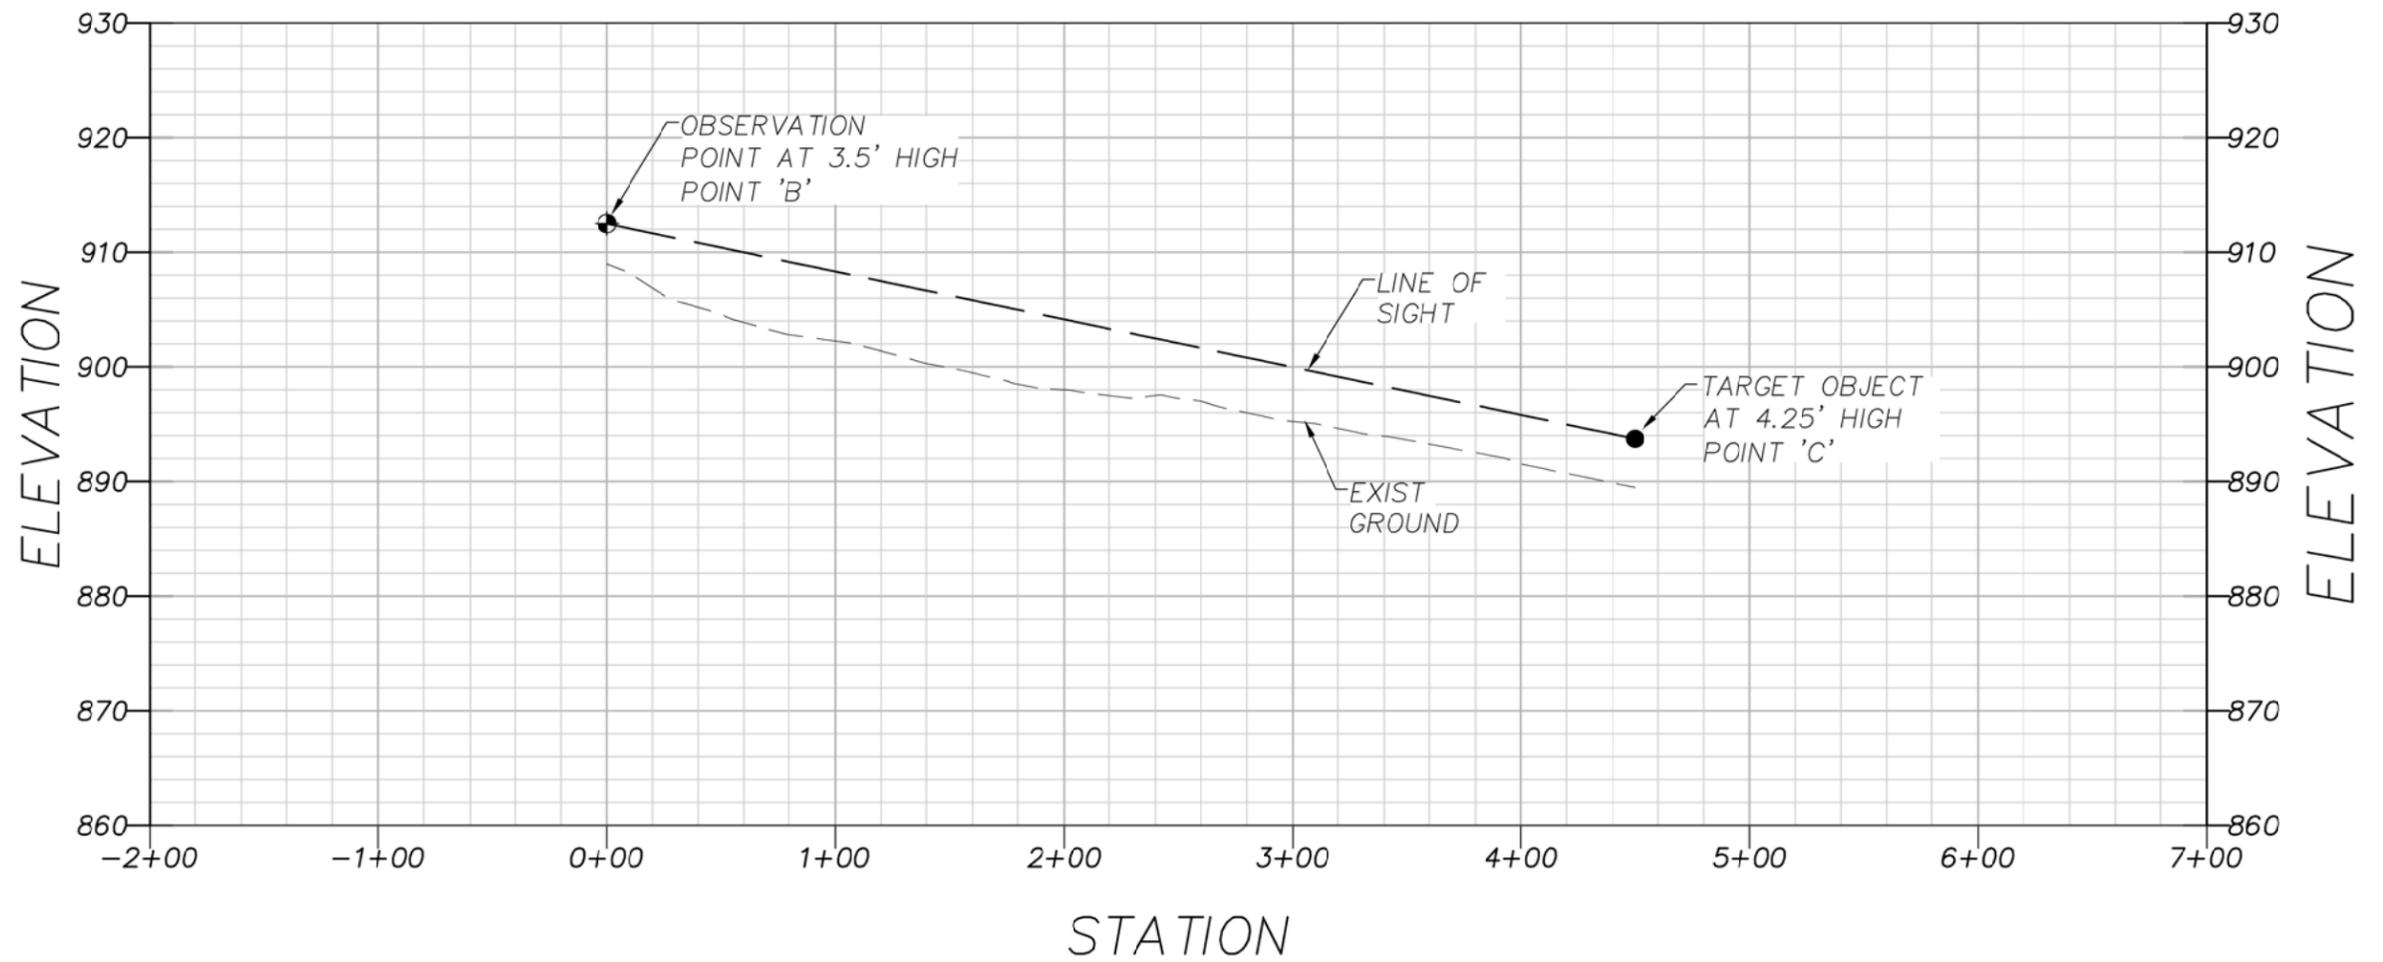


FIGURE 4
LINE OF SIGHT PROFILE FOR MTN RIDGE RD AND CIRCLE R DR (EASTBOUND TRAFFIC)



FROM MOUNTAIN RIDGE ROAD LOOKING WEST ONTO
CIRCLE "R" DRIVE



FROM MOUNTAIN RIDGE ROAD LOOKING EAST ONTO
CIRCLE "R" DRIVE