



Phase I Environmental Site Assessment

County of San Diego APNs 282-141-32-00, -33-00 and -34-00
Ramona, California 92065

April 2, 2026

Prepared For:

Woodcrest Real Estate Ventures
2428 Montecito Road
Ramona, CA 92065

Project Number 26-03-005

Prepared by:

Weis Environmental, LLC
1938 Kellogg Avenue, Suite 116
Carlsbad, CA 92008
(760) 585-7070
www.weisenviro.com



1938 Kellogg Avenue, Suite 116, Carlsbad, CA 92008
(760) 585-7070
www.weisenviro.com

April 2, 2026

Woodcrest Real Estate Ventures
2428 Montecito Road
Ramona, CA 92065

Subject: Phase I Environmental Site Assessment
County of San Diego APNs 282-141-32-00, -33-00 and -34-00
Ramona, California 92065
Project Number 26-03-005

To Whom It May Concern:

Weis Environmental, LLC has completed the contracted environmental consulting services for the above-referenced project. The services were performed in accordance with our proposal and agreement fully executed by all parties. The Phase I Environmental Site Assessment has been performed in accordance with ASTM International (ASTM) Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process, ASTM Designation E1527-21 and Title 40 of the Code of Federal Regulations (40 CFR) Part 312. We appreciate the opportunity to be of service to you on this project. Please contact us if you have any questions or comments regarding this report or if we can be of further assistance.

Sincerely,

Weis Environmental, LLC

A handwritten signature in black ink that reads "Daniel Weis". The signature is written in a cursive, flowing style.

Daniel Weis, R.E.H.S.
Environmental Manager

TABLE OF CONTENTS

1.0 INTRODUCTION	1
1.1 Purpose	1
1.2 Scope of the Assessment	1
1.3 Limitations and Exceptions	2
1.4 Special Terms and Conditions	3
1.5 Limiting Conditions and Deviations	3
1.6 Data Failure and Data Gaps	3
1.7 Reliance	3
2.0 SITE DESCRIPTION	4
2.1 Location and Legal Description	4
2.2 Site and Vicinity Characteristics	4
2.3 Current Use of the Site	4
2.4 Description of Site Improvements	4
2.5 Utilities	5
2.6 Description of Adjoining Properties	5
3.0 PHYSICAL SETTING	6
3.1 Topography	6
3.2 Hydrology	6
3.3 Geology	6
3.4 Hydrogeology	7
3.5 Oil and Gas Exploration	7
4.0 USER PROVIDED INFORMATION	8
4.1 Title Records	8
4.2 Environmental Liens	8
4.3 Activity and Use Limitations	8
4.4 Specialized or Actual Knowledge or Experience	8
4.5 Commonly Known or Reasonably Ascertainable Information	8
4.6 Valuation Reduction for Environmental Issues	8
4.7 Owner, Property Manager and Occupant Information	9
4.8 Reason for Performing Phase I ESA	9
4.9 Proceedings Involving the Site	9
5.0 REGULATORY RECORDS REVIEW	10
5.1 Standard ASTM Regulatory Database Search	10
5.2 Non-ASTM Regulatory Database Search	14
5.3 Regulatory Agency File Reviews	14
6.0 HISTORICAL RESOURCE REVIEW	16
6.1 Aerial Photographs	16
6.2 Topographic Maps	18
6.3 Fire Insurance Maps	18
6.4 City Directories	19
6.5 Other Historical Sources	19

7.0	SITE RECONAISSANCE	20
7.1	Methodology and Limiting Conditions	20
7.2	Current General Site and Vicinity Characteristics	20
7.3	Indications of Past Site and Vicinity Uses	20
7.4	Site-Specific Observations	20
8.0	INTERVIEWS	23
8.1	Site Owner.....	23
8.2	Key Site Manager.....	23
8.3	Current Occupants.....	23
8.4	Local Government Official	23
8.5	Other Parties.....	23
9.0	ADDITIONAL SERVICES – NON-SCOPE ASTM CONSIDERATIONS.....	24
10.0	FINDINGS AND OPINIONS.....	25
11.0	CONCLUSIONS AND RECOMMENDATIONS	26
12.0	ENVIRONMENTAL PROFESSIONAL STATEMENT	27
13.0	ASSUMPTIONS.....	28
14.0	DEFINITIONS.....	29
15.0	REFERENCES	32
15.1	Documents, Plans and Reports.....	32
15.2	Personal Communications.....	32
15.3	Agencies Consulted.....	32

FIGURES

- Figure 1 Vicinity Map
- Figure 2 Site Plan
- Figure 3 Topographic Map

APPENDICES

- Appendix A Regulatory Database Report
- Appendix B Regulatory Agency Records
- Appendix C Historical Resources
- Appendix D Photographs
- Appendix E Interview Questionnaire
- Appendix F Qualifications

1.0 INTRODUCTION

This report presents the methods and findings of a Phase I Environmental Site Assessment (ESA) of the property identified by County of San Diego Assessor's Parcel Numbers (APNs) 282-141-32-00, -33-00 and -34-00 in the community of Ramona, San Diego County, California (Site) performed in conformance with the contract/agreement for this assignment and the scope and limitations of ASTM Standard Practice E1527-21 and United States Environmental Protection Agency (EPA) Standards and Practices for All Appropriate Inquiries (AAI) as published in 40 Code of Federal Regulations (CFR) Part 312. EPA promulgated the AAI rule that became effective in November 2006 and the EPA has indicated that the ASTM E1527-21 practice is consistent with the requirements of AAI and may be used to comply with the provisions of the AAI rule.

1.1 Purpose

The purpose of the ASTM E1527-21 practice (framework for this Phase I ESA) is to define good commercial and customary practice in the United States of America for conducting an ESA of a parcel of real estate with respect to the range of contaminants within the scope of the Comprehensive Environmental Response, Compensation and Liability Act (CERCLA) (Title 42 United States Code [U.S.C.] Section 9601) and petroleum products. As such, this practice is intended to permit a user to satisfy one of the requirements to qualify for the innocent landowner, contiguous property owner, or bona fide prospective purchaser limitations on CERCLA liability (hereinafter, the "landowner liability protections," or "LLPs"): that is, the practice that constitutes all appropriate inquiries into the previous ownership and uses of the property consistent with good commercial and customary practice as defined at 42 U.S.C. Section 9601(35)(B).

In defining a standard of good commercial and customary practice for conducting this Phase I ESA of the Site, the goal of the processes established by the ASTM E1527-21 practice is to identify, to the extent feasible, recognized environmental conditions. The term recognized environmental condition is defined as (1) the presence of hazardous substances or petroleum products in, on, or at a property due to a release to the environment; (2) the likely presence of hazardous substances or petroleum products in, on, or at a property due to a release or likely release to the environment; or (3) the presence of hazardous substances or petroleum products in, on, or at a subject property under conditions that pose a material threat of a future release to the environment. In addition, controlled recognized environmental conditions, historical recognized environmental conditions and/or de minimis conditions, if identified during the completion of the assessment, are discussed herein. Definitions of these terms and other key terminology relevant to the practice are included in Section 14.0 of this report.

1.2 Scope of the Assessment

In general terms, this Phase I ESA included the acquisition of readily available/accessible and practically reviewable regulatory records and historical information, a subject property reconnaissance, interviews and preparation of this written report of findings. A more detailed description of the four primary components of the Phase I ESA is presented below.

Records Review - A review of Federal, State, Tribal and local standard ASTM and non-ASTM regulatory databases for a myriad of environmental identifiers including but not limited to properties with underground storage tanks (USTs), properties with leaking USTs, properties that have reported



spills/releases that did not occur from a leaking UST, businesses that utilize hazardous materials and/or generate hazardous waste and hazardous waste disposal locations. The regulatory review may also include public records requests with one or more Federal, State, Tribal and/or local agencies. A review of historical sources is also completed to help ascertain previous land uses of the property in question and in the surrounding area.

Site Reconnaissance - A property inspection and viewing of adjacent and surrounding properties for conditions that could be recognized environmental conditions.

Interviews - Interviews with present and past owners, operators and/or occupants of a property and local government officials.

Reporting - Evaluation of the information gathered during the completion of the Phase I ESA and the subsequent preparation of a written report.

1.3 Limitations and Exceptions

Concerns regarding liability under CERCLA and analogous State laws, have been a primary driver for Phase I ESA assignments in commercial real estate transactions. While the ASTM E1527-21 practice can be used in many contexts, familiarity with CERCLA and its potential LLPs is critical in understanding and applying the ASTM E1527-21 practice. We advise consultation with legal counsel if further inquiry or information is desired.

AAI represents the minimum level of inquiry necessary to support the LLPs. However, it is important to understand that additional inquiry ultimately may be necessary or desirable for legal as well as business reasons depending upon the outcome of this inquiry and the particular risk tolerances of a given user. For example, additional inquiry may assist a user of a Phase I ESA in determining whether they would have continuing obligations in the event they acquire a given property and may also assist the user in defining the scope of future steps to be taken to satisfy such obligations. In addition, a user may be concerned about business environmental risks or non-scope ASTM considerations that do not fall within the definition of a recognized environmental condition. This assessment also excludes subsurface or other invasive exploration, unless specifically documented herein. Users are also cautioned that Federal, State, Tribal and local laws may impose environmental assessment obligations that are beyond the scope of the ASTM E1527-21 practice.

The evaluation, opinion and conclusions presented herein are based solely on visual observations and regulatory, historical and personal knowledge that existed at the time our assessment was completed. The use of the gathered information is exclusively for the purposes outlined in this report and only for the Site. Our firm can make no warranty, either express or implied, except that the services conducted were performed in accordance with generally accepted environmental assessment practices applicable at the time and location of the assessment and that the conclusions of the assessment have been based in part on professional judgment/experience, an interpretation of readily available data and the standard of care normally followed by similar professionals practicing in a similar locale and under similar circumstances. Any opinions presented cannot apply to Site changes, of which our firm is unaware and has not had the opportunity to evaluate. In addition, this report cannot feasibly include any evaluation of undocumented activities at the Site or on adjacent or nearby properties. Lastly, a Phase I ESA meeting or exceeding this practice and completed less than 180 days prior to the date of acquisition of a given property or (for transactions not involving an acquisition) the date of the intended transaction is presumed to be valid.



1.4 Special Terms and Conditions

This Phase I ESA was prepared in accordance with the terms and conditions of the contract/agreement for the work as executed between our firm and the client. There are no other special terms and conditions established between our firm and the client pertinent to the findings of this ESA or methodology used to complete this assessment. In addition, our firm has no final or other vested interest in the Site or adjacent/surrounding properties, or in any entity that owns or occupies the Site or adjacent/surrounding properties.

1.5 Limiting Conditions and Deviations

There were no significant limiting conditions that would inhibit our ability to identify recognized environmental conditions noted during the completion of this assessment. In addition, there were no deviations from the ASTM E1527-21 standard noted during the completion of this assessment. Any limiting conditions that are not considered to be ones that would inhibit our ability to identify recognized environmental conditions at the Site are referenced in applicable sections of this report.

1.6 Data Failure and Data Gaps

No instances of data failure were encountered during the completion of this assessment. In addition, no data gaps of significance (i.e., those that would inhibit our ability to identify recognized environmental conditions) were identified during the completion of this assessment. Any data gaps that are not considered to be ones that would inhibit our ability to identify recognized environmental conditions at the Site are referenced in applicable sections of this report.

1.7 Reliance

This report has been prepared for the exclusive use of the client (User) under a written agreement for completion of the assessment. This report may not be relied upon by any other person or entity without the written consent of both our firm and our client. The scope of services performed for this assessment may not be appropriate to satisfy the specific needs of other users, and any use or reuse of this document would be at the sole risk of said users. Any other party seeking liability protection under CERCLA must take independent action to accomplish its objective.



2.0 SITE DESCRIPTION

2.1 Location and Legal Description

Location and legal description information is presented in the table below.

Location/Legal Consideration	Details
Legal Physical Addresses	2019-2021 W Main Street and 2037 Highway 67
APNs	San Diego County APNs 282-141-32-00, -33-00, and -34-00.
Property Size	Reported 127,602 square feet (2.93 acres).
General Orientation Relative to Roadways or Other Landmarks	Generally northeast of Julian Street, northwest of Main Street, southwest of Letton Street, and southeast of Vermont Street.

A Vicinity Map is included as Figure 1. A Site Plan is included as Figure 2.

2.2 Site and Vicinity Characteristics

The Site and the surrounding vicinity are situated in the community of Ramona that consists primarily of residential and commercial properties, vacant land, and public roadways. Additional details pertaining to the Site and its adjoining properties are provided in the sections below.

2.3 Current Use of the Site

The Site is currently developed with a vacant warehouse building, a single-tenant retail building occupied by a dulcería, and a multi-tenant retail building occupied by a barbershop and massage therapist, with one vacant unit.

2.4 Description of Site Improvements

Information pertaining to improvements at the Site is presented in the table below.

Improvement Consideration	Details
Access Point(s)	Via Vermont Street and Main Street to the northwest and southeast, respectively.
Primary Building(s)	Three retail/commercial buildings and one vacant warehouse totaling a combined approximately 6,000 square feet. 2019-2021 Main Street: One multi-tenant retail building constructed between 1985 and 1994 based on a review of historical aerial imagery. 2037 Highway 67: One single-tenant retail building and one vacant auto repair warehouse constructed between 1974 and 1981 based on a review of historical aerial imagery.
Reported Framing	Concrete masonry units and wood.
Building Exteriors	Steel cladding and stucco.
Reported Foundation	Concrete slabs-on-grade.



Improvement Consideration	Details
Other Improvements	Gravel parking/storage lots are present at the southwestern and northern portions of the Site. Storage containers, sheds, vehicles, and other equipment are present throughout the Site, primarily at the southwestern gravel lot, the northern gravel lot, and the former auto repair area at the northwestern portion of the Site. A food truck was present in the eastern portion of the Site. Additional improvements include asphalt and concrete paving, minor landscaping, fencing, and other miscellaneous improvements.
Utilities and Other Features	Indicators of various subsurface features (including utilities) are present throughout the Site. The nature of each of the features at the Site is unknown and cannot be ascertained by visual evaluation. A higher level of confidence regarding the nature of extent of any subsurface features can be obtained from a utility or geophysical consultant.

2.5 Utilities

Utilities that are reported to be present at the Site or provide service in the surrounding area are noted below along with their municipal provider where applicable.

Utility	Provider (Where Applicable)
Potable Water	Ramona Municipal Water District
Sewage Maintenance	Ramona Municipal Water District
Electrical	San Diego Gas & Electric
Natural Gas	San Diego Gas & Electric
Solid Waste Disposal	Ramona Disposal Service

2.6 Description of Adjoining Properties

Adjoining properties are defined as any real property or properties, the border of which is contiguous or partially contiguous with that of the subject property of a Phase I ESA, or that would be contiguous or partially contiguous with that of a subject property but for a street, road or other public thoroughfare separating them. To the extent feasible, our firm performed a visual inspection of adjoining properties from the Site boundaries and along public rights-of-way. We did not encroach onto adjoining private property during the completion of this assessment. The following table identifies the adjoining property uses:

Direction	Adjoining Property Use
Northwest	Vermont Street followed by single-family residential.
Northeast	Single-family residential and Dr. Malcolm J. Boykin DDS at 2005 Main Street.
Southeast	Main Street followed by Kahoots pet supply store at 2020 Main Street and vacant land.
Southwest	Sunbelt Rentals equipment rental agency at 2055 Main Street.



3.0 PHYSICAL SETTING

3.1 Topography

General topographic information pertaining to the Site is presented in the table below.

Topographic Consideration	Details
Topographic Map Reference	San Pasqual, California 7.5-minute quadrangle.
Improvements or Features Depicted on Map	None.
Elevation	Average elevation of approximately 1,420 feet above mean sea level.
Local/Regional Gradient	Generally northwest towards the Santa Maria Creek.
Adjoining Improvements or Features Depicted on Map	Surrounding roads are depicted on the map.

3.2 Hydrology

General hydrologic information pertaining to the Site is presented in the table below.

Hydrologic Consideration	Details
Hydrologic Unit	Ramona Hydrologic Subarea of the Santa Maria Valley Hydrologic Area of the San Dieguito Hydrologic Unit.
Substantial Hydrologic Features	None identified.
Precipitation Infiltration Potential	Minimal at the majority of the Site due to the presence of existing paving/gravel and other improvements.
Surface Water Flows	Any surface water would appear to flow to adjoining roadways towards the municipal stormwater conveyance system.
Drainage from Nearby and Adjoining Properties	Insignificant.

3.3 Geology

General geologic information pertaining to the Site is presented in the table below.

Geologic Consideration	Details
California Geomorphic Province	Peninsular Ranges.
Mapped Soils or Formation	Alluvium, lake, playa, and terrace deposits. Unconsolidated and semi-consolidated.
Description of Soils or Formation	Varying amounts of sands, silts, clays and gravels.



3.4 Hydrogeology

General hydrogeologic information pertaining to the Site is presented in the table below.

Hydrogeologic Consideration	Details
Groundwater Basin or Unit	Ramona Hydrologic Subarea of the Santa Maria Valley Hydrologic Area of the San Dieguito Hydrologic Unit.
Beneficial Uses	Yes.
Estimated Depth to Groundwater	Relatively shallow (less than 15 feet).
Estimated Flow of Groundwater	Groundwater is reported to flow south-southwest at a nearby property to the northeast but may vary at the Site.
Known Site or Regional Groundwater Contamination Issues	Unauthorized release cases from leaking USTs have been reported in the area and in some cases with groundwater impacts reported. Based on a review of available information, such impacts do not appear to have migrated to the Site.

3.5 Oil and Gas Exploration

According to online resources provided by the California Department of Conservation, Geologic Energy Management Division (CalGEM), there are no oil, gas or geothermal wells located on the Site or its adjoining properties.



4.0 USER PROVIDED INFORMATION

A representative of the client (i.e., User) of this report was interviewed during the completion of this assessment. The questions posed during the interview are defined by the ASTM E1527-21 practice and were either conveyed verbally or by way of a written questionnaire.

The user also provided our firm with any land title records and judicial records that may be available for the Site as part of the required evaluation for environmental liens and activity and use limitations (AULs) in connection with the subject property of a Phase I ESA. As stated in the ASTM E1527-21 practice, it is the responsibility of the user of the report to provide any available records pertaining to environmental liens and AULs that may exist in connection with a given property. Any land title and judicial records provided to our firm are discussed below. If such information is not discussed in the sections below, it was not provided by the user of the report.

In addition to the contact information obtained, the user of the report was also asked if they are aware of other useful documents that may exist and if so whether copies can be provided to the environmental professional within reasonable time and cost constraints. Typical useful documents are listed in Section 10.8.1 of the ASTM E1527-21 practice and include but are not limited to environmental assessment reports, compliance audits and permits, registrations for tank and other aboveground or underground systems, safety plans, spill prevention and other facility-related plans, geological/geotechnical studies and environmental governmental agency notices and/or correspondence.

4.1 Title Records

Title records were not provided to us during the completion of this assessment.

4.2 Environmental Liens

The User is unaware of environmental liens in connection with the Site.

4.3 Activity and Use Limitations

The User is unaware of AULs in connection with the Site.

4.4 Specialized or Actual Knowledge or Experience

The User indicated that the Site was previously used for automobile repair activities. The User is unaware of environmental concerns at the Site resulting from such prior activities.

4.5 Commonly Known or Reasonably Ascertainable Information

The User is unaware of commonly known or reasonably ascertainable information within the local community that is material to recognized environmental conditions in connection with the Site.

4.6 Valuation Reduction for Environmental Issues

The User is unaware of information pertaining to an undervalued purchase price of the Site relative to the estimated fair market value of the Site due to the presence of contamination.



4.7 Owner, Property Manager and Occupant Information

The Site is currently owned and managed by PrimeTime Development and Progressive Properties, Inc. The Site is currently occupied by a dulcería, barbershop, and massage therapist.

4.8 Reason for Performing Phase I ESA

The User has commissioned this Phase I ESA as part of the planned development of the Site as a hotel. The Phase I ESA is also being completed to assist the client in complying with 40 CFR Part 312.

4.9 Proceedings Involving the Site

The User is unaware of pending, threatened or past litigation and administrative proceedings relevant to hazardous substances or petroleum products in, on or from the Site. The client is also unaware of notices from any governmental entity regarding any possible violation of environmental laws or possible liability relating to hazardous substances or petroleum products in connection with the Site.



5.0 REGULATORY RECORDS REVIEW

Our firm commissioned the preparation of a regulatory database report from Environmental Risk Information Services (ERIS) as part of the regulatory records review. Federal, State, Tribal, and local government environmental databases are searched. Certain databases are specifically required by the ASTM E1527-21 practice and are referenced as “standard ASTM regulatory databases.” Such databases are searched to at least the minimum search distance around a given property as defined in the practice. Other regulatory databases are also searched that are not specifically referenced in ASTM E1527-21. Such databases are referenced as “non-ASTM regulatory databases” and are searched within varying radii around a given property as selected by the database provider.

Descriptions of each database searched and the dates that the regulatory databases were last updated by the applicable agencies are included in the report. The extent of historical information varies with each database and current information is determined by what is publicly available at the time of an update. Databases are updated in accordance with ASTM E1527-21, which states that government information from nongovernmental sources may be considered current if the source updates the information at least every 90 days, or, for information that is updated less frequently than quarterly by the government agency, within 90 days of the date the government agency makes the information available to the public.

Our firm also reviewed unplottable sites listed in the database report by cross-referencing reasonably ascertainable information pertaining to such properties that may include facility names, street names, zip codes or other information. Unplottable sites are ones that cannot be formally mapped or geocoded due to various reasons, including limited geographic information. Any unplottable sites that we identify within the specified search radii have been evaluated as part of the preparation of this report. A copy of the regulatory database report is included in Appendix A.

5.1 Standard ASTM Regulatory Database Search

The tables below present the standard Federal, State, Tribal and local ASTM databases that were searched, including the search distances from the Site. Below the tables are descriptions of any listings for the Site that may appear in the databases. Adjoining or nearby properties listed in databases indicative of releases of hazardous substances and/or petroleum products are also discussed, if in our professional opinion they have the potential to impact the Site. This practice of discussing only properties of anticipated environmental concern to the Site is noted in ASTM E1527-21, which states that the environmental professional may make statements applicable to multiple properties listed in regulatory databases that are not likely to have current or former releases of hazardous substances and/or petroleum products with the potential to migrate to a given subject property. Our professional judgment and opinions discussed herein are based on several factors including the nature of the regulatory database listings, distance of the off-site listed properties from the Site, orientation of the listed properties relative to the Site, interpreted direction of groundwater flow and/or regulatory case status information for the various properties as described in the databases.



The following Federal standard ASTM databases were searched:

Standard Environmental Record Source Name	Regulatory Database Identification	Search Distance from Site (Miles)
Lists of Federal National Priorities List (NPL) (Superfund) sites	NPL – Proposed NPL – Superfund Record of Decision (ROD)	1.0
Lists of Federal Delisted NPL sites	Deleted NPL	1.0
Lists of Federal sites subject to CERCLA removals and CERCLA orders	CERCLIS - SEMS – SEMS Archive – ODI – IODI	0.5
Lists of Federal CERCLA sites with No Further Remedial Action Planned (NFRAP)	CERCLIS NFRAP	0.5
Lists of Federal Resource Conservation and Recovery Act (RCRA) facilities undergoing Corrective Action	RCRA CORRACTS – Department of Energy (DOE) Formerly Utilized Sites Remedial Action Program (FUSRAP)	1.0
Lists of Federal RCRA Treatment, Storage and Disposal (TSD) facilities	RCRA-TSDF	0.5
Lists of Federal RCRA generators	RCRA LQG – RCRA SQG – RCRA VSQG – RCRA NON GEN – FEMA UST – HIST GAS STATIONS – FRP – DELISTED FRP – REFN – BULK TERMINAL	0.25
Federal institutional control/engineering control registries	LUCIS – FED ENG – FED INST – RCRA CONTROLS – NPL IC	0.5
Federal Emergency Response Notification System (ERNS) List	ERNS	Site
Lists of Federal brownfield sites	FED BROWNFIELDS	0.5
Lists of sites with Federal environmental liens	CERCLIS LIENS – SEMS LIENS	Site Only

Site – The Site is not listed on the standard Federal ASTM regulatory databases.

Adjoining Properties – Adjoining properties listed on the standard Federal ASTM regulatory databases are as follows:

Database(s)	Business Name	Address or Other Locational Reference	Details	Release(s) Reported and Nature of Release(s)	Recognized Environmental Condition to Site?
RCRA NON GEN	BJ's Rentals, Inc., Sunbelt Rentals PC 1326	Southwestern- adjoining – 2055 Main Street	Businesses are not generators of hazardous waste. No violations have been reported.	None	No

Other Properties – There are multiple listings pertaining to properties in the surrounding area that are identified on the RCRA TSD, RCRA VSQG, and RCRA NON GEN standard Federal ASTM databases. None of these listings are indicative of releases of hazardous substances or petroleum



products to the subsurface that are considered to have the potential to significantly impact the Site. These properties are not considered to be recognized environmental conditions to the Site.

The following State, Tribal, and local standard ASTM databases were searched:

Standard Environmental Record Sources Name	Regulatory Database Identification	Search Distance from Site (Miles)
Lists of state-and tribal "Superfund" equivalent sites	RESPONSE – HWP	1.0
Lists of state-and tribal hazardous waste facilities	ENVIROSTOR – DELISTED ENVS	1.0
Lists of state and tribal landfills and solid waste disposal facilities	SWF/LF – LDS – SWAT – WMUD – SWRCB SWF – Construction and Demolition (C & D) DEBRIS RECY – CONTAINER RECY – RECYCLING – PROCESSORS	0.5
Lists of state and tribal leaking storage tanks	LUST – DELISTED LST – UST CLOSURE – CLEANUP SITES – DELISTED CLEANUP – INDIAN LUST – DELISTED ILST	0.5
Lists of state and tribal registered storage tanks	UST – HHSS – AST – AST SWRCB – TANK OIL GAS – DELISTED TNK – CERS TANK – DELISTED CTNK – HIST TANK – UST SWEEPS – INDIAN UST – DELISTED IUST – DELISTED COUNTY	0.25
State and tribal institutional control/engineering control registries	LUR – HLUR - DEED	0.5
Lists of state and tribal voluntary cleanup sites	VCP	0.5
Lists of state and tribal brownfield sites	CALSITES	0.5
Local Agency Databases	SWF SANDIEGO – LOP SANDIEGO – HAZ SANDIEGO – UST SANDIEGO – SAM SANDIEGO	Site to 0.5

Site – The Site is listed on the standard State, Tribal, and local ASTM regulatory databases as follows:

Database(s)	Business Name	Address or Other Locational Reference	Details	Release(s) Reported and Nature of Release(s)	Recognized Environmental Condition to Site?
HAZ SANDIEGO	Prestige II Auto Collision, Superior Automotive	2037 Main Street	Businesses are associated with inactive permits for the generation of hazardous waste associated with auto repair activities. No violations have been reported.	None	No

Adjoining Properties – Adjoining properties are listed on the standard State, Tribal, and local ASTM regulatory databases as follows:



Database(s)	Business Name	Address or Other Locational Reference	Details	Release(s) Reported and Nature of Release(s)	Recognized Environmental Condition to Site?
HAZ SANDIEGO	Malcolm J. Boykin, DDS	Northeastern-adjointing – 2005 Main Street	Business is associated with an active permit for the generation of medical waste. No violations have been reported.	None	No
AST, CERS TANK, HAZ SANDIEGO, LOP SANDIEGO, LUST, SAM SANDIEGO, UST SWEEPS	BJ's Rentals, Inc., Sunbelt Rentals PC 1326, BJ's Rental Store, HSS RENTX	Southwestern-adjointing – 2055 Main Street	Several violations have been reported with noted returns to compliance. BJ's Rental Store and HHSS RENTX are associated with an inactive permits for the generation of hazardous waste associated with automobile repair activities. Sunbelt Rentals PC 1326 is associated with active permits for the storage of hazardous materials, including diesel, gasoline, hydraulic oils/motor oil, propane, waste oil, waste oily absorbent. Several violations have been reported with noted returns to compliance. The property is associated with one inactive UST containing motor vehicle fuel and possible one active UST (contents not reported). A release of gasoline to soil was reported in February 1991. The case was closed by the County of San Diego Department of Environmental Health (DEH) in April 1992.	Yes. Release of gasoline to soil reported in February 1991. Case closed April 1992.	No.

Other Properties – There are multiple listings pertaining to properties in the surrounding area that are identified on the C&D DEBRIS RECY, LDS, LUST, UST, HHSS, UST SWEEPS, AST, DELISTED TNK, CERS TANK, HIST TANK, CLEANUP SITES, LOP SANDIEGO, HAZ SANDIEGO, UST SANDIEGO, and SAM SANDIEGO standard State, Tribal, and local ASTM databases. None of these listings are indicative of releases of hazardous substances or petroleum products to the subsurface that are considered to have the potential to significantly impact the Site. These properties are not considered to be recognized environmental conditions to the Site.



5.2 Non-ASTM Regulatory Database Search

Non-ASTM regulatory database listings are described below.

Site – The Site is listed on the HAZ GEN and HAZNET non-ASTM regulatory database listings. Two California EPA ID numbers are reported as being associated with the Site. The first ID number references a total of a reported 0.59 tons of hazardous waste removed from the Site from 2009 to 2011, including unspecified solvent mixtures, organic solids, waste oil and mixed oil, and pharmaceutical waste. The second ID number references a reported 0.35 tons of asbestos-containing waste removed from the Site in 1993. No violations have been reported.

Adjoining and Surrounding Properties – Several adjoining and surrounding properties are listed on various non-ASTM databases, some of which are also listed on ASTM databases described above. Database listings include FINDS/FRS, PFAS IND, FUDS, MRDS, INSP COMP ENF, SCH, HAZNET, HAZ GEN, HIST MANIFEST, CERS HAZ and EMISSIONS. None of these listings are indicative of releases of hazardous substances or petroleum products to the subsurface that are considered to have the potential to significantly impact the Site. These properties are not considered to be recognized environmental conditions to the Site.

5.3 Regulatory Agency File Reviews

If a property being assessed under a Phase I ESA or any of the adjoining properties are identified on one or more of the above-referenced standard environmental record sources, pertinent regulatory files and/or records associated with such listings should be reviewed to assist the environmental professional in evaluating potential recognized environmental conditions. However, if in the environmental professional's opinion, such a review is not warranted, file reviews need not be conducted if the environmental professional provides justification for not doing so.

Agency file reviews for the Site and select adjoining properties completed during this assessment (if deemed warranted) are noted below. If no adjoining properties are discussed, this indicates that the environmental professional did not require a review of any such records in order to provide a professional opinion regarding recognized environmental conditions. The agency inquiries were performed by way of on-line searches/queries of published databases and/or direct inquiries with public records clerks at one or more agencies. Milena LaBarbiera conducted the agency file reviews during the completion of this assessment. Copies of regulatory agency records are included in Appendix B.

Regulatory Agency	Jurisdiction	Date of Inquiry or Request	Contact	Response or Information from Agency
United States EPA Envirofacts/ECHO/ TRIS	Federal	3/19/2026	Online https://enviro.epa.gov/ https://echo.epa.gov/facilities/facility-search https://www.epa.gov/toxics-release-inventory-tri-program	No Records Identified
California DTSC	State	3/19/2026	Online https://www.envirostor.dtsc.ca.gov/public https://hwts.dtsc.ca.gov/	Records Identified



Regulatory Agency	Jurisdiction	Date of Inquiry or Request	Contact	Response or Information from Agency
State Water Resources Control Board (SWRCB)/Regional Water Quality Control Board (RWQCB)	State	3/20/2026	Online https://geotracker.waterboards.ca.gov/ https://geotracker.waterboards.ca.gov/historical_ust_facilities	No Records Identified
County of San Diego DEH	Local	3/24/2026	Online https://www.sandiegocounty.gov/content/sdc/deh/doclibrary/ Public Records Clerk	Records Identified

California DTSC - DTSC records are consistent with those previously referenced in Section 5.2 (HAZ GEN and HAZNET non-ASTM regulatory database listings pertaining to the Site).

County of San Diego DEH – Files maintained at DEH include a percolation test report prepared in 1977 regarding a proposed septic tank at the Site. Additional records pertain to the proposed hotel project at the Site.



6.0 HISTORICAL RESOURCE REVIEW

The objective of consulting historical sources is to develop a history of the previous uses of a property, its adjoining properties and the surrounding area, in order to help identify the likelihood of past uses having led to recognized environmental conditions in connection with a given property. The goal of the historical research is to identify all obvious uses of a subject property from the present, back to the property's first developed use, or back to 1940, whichever is earlier.

It is stated in ASTM E1527-21, the following standard historical resources shall be reviewed if, based on the judgment of the environmental professional, they are reasonably ascertainable, likely to be useful and applicable to the subject property: (1) aerial photographs (2) fire insurance maps (3) local street/city directories and (4) historical topographic maps. There are numerous other potential historical sources one can consider during a historical evaluation including zoning/land use records, property tax files records, building department records, miscellaneous maps, news articles, books about the history of an area being researched, imagery, land title records and a variety of other resources that may provide information about past land uses. These other resources may be found in sources such as prior assessments, newspaper archives, internet sites, community organizations, local libraries, historical societies, government agencies, from current owners or occupants of surrounding properties, or records in the files and/or personal knowledge of owners and/or occupants.

Relative to a final decision on which sources are to be consulted, under ASTM E1527-21, the environmental professional is afforded the ability to exercise professional judgment and consider the possible releases that might have occurred at a property, adjoining properties and surrounding area in light of the historical uses and, in concert with other relevant information gathered as part of the Phase I process, use this information to assist in selecting historical resources that will be beneficial in identifying recognized environmental conditions in connection with a property.

Historical resources reviewed during the completion of this assessment are referenced below. This may include those obtained from prior Phase I ESA reports pertaining to the Site. It is stated in ASTM E1527-21 that environmental professionals may use information in prior environmental reports provided such information was generated as a result of procedures that meet or exceed the requirements of the current practice.

If certain potential sources of information noted above are not referenced in the sections below, they were not deemed necessary by the environmental professional in order to meet the objective of the historical research consultation. Copies of historical resources are included in Appendix C. If any historical resources are not included as appendices, it is due to copyright considerations precluding us from such reproduction.

6.1 Aerial Photographs

We reviewed historical aerial photographs from the years ranging from 1928 to 2024 provided by ERIS and Google Earth. The table below presents the results of the photograph review.

Photograph Year	Site Observations	Adjoining Property Observations
1928-1939	Vacant land.	Northwest, Northeast, Southwest – Vacant land. Southeast – A road (present-day Main Street) followed by vacant land.



Photograph Year	Site Observations	Adjoining Property Observations
1949-1953	No significant changes.	Northwest – A road (present-day Vermont Street) followed by single-family residential, small-scale agriculture, and vacant land. Northeast, Southeast, Southwest – No significant changes.
1963	No significant changes.	Northwest, Northeast, Southeast – No significant changes. Northwest – Single-family residential and several structures. Southwest – At least one building and vacant land.
1971	No significant changes.	Northwest, Southeast, Southwest – No significant changes. Northeast – Two residential or commercial buildings.
1974	Several structures are apparent at the southeastern portion of the Site. The northeastern portion of the Site appears to be disturbed. The remainder of the Site appears to be vacant land.	Northwest, Northeast, Southeast – No significant changes. Southwest – Additional structures and/or equipment are apparent.
1981-1985	Two of the current commercial buildings are apparent at the northwestern and southeastern portions of the Site. Parking areas are also apparent.	Northwest – Additional residential development is apparent. Northeast, Southeast – No significant changes. Southwest – The property appears to be in its current configuration developed with a commercial building and a paved parking/storage area.
1994-1996	The third current commercial building is apparent at the eastern portion of the Site.	Northwest – Additional residential development is apparent. Northeast, Southeast, Southwest – No significant changes.
2002-2004	The central portion of the Site (APN 282-141-33-00) appears to be paved.	Northwest – Additional residential development is apparent. Northeast, Southeast, Southwest – No significant changes.
2005	The northern portion of the Site appears to be used for vehicle/equipment storage.	Northwest – Additional structures are apparent at residential properties. Northeast, Southeast, Southwest – No significant changes.
2009-2016	No significant changes.	Northwest – Additional residential development is apparent. Northeast, Southeast, Southwest – No significant changes.
2018-2020	No significant changes.	Northwest, Northeast, Southwest – No significant changes. Southeast – A southeastern-adjoining property appears to be developed with commercial buildings and paved parking areas in their current configurations.



Photograph Year	Site Observations	Adjoining Property Observations
2022	The southwestern portion of the Site (APN 282-141-32-00) appears to be a gravel lot and used for vehicle/equipment storage. Many of the structures/equipment at the northern portion of the Site appear to have been removed. The Site appears to be in its current configuration.	Northwest – Additional residential development is apparent. Northwestern-adjoining properties appear to be in their current configurations. Northeast, Southeast, Southwest – No significant changes.
2024	No significant changes.	Northwest, Southeast, Southwest – No significant changes. Northeast – Northeastern-adjoining properties appear to be in their current configurations.

6.2 Topographic Maps

We reviewed historical topographic maps from the years ranging from 1942 to 2021 provided by ERIS. The table below presents the results of the topographic map review.

Photograph Year	Site Observations	Adjoining Property Observations
1942-1947	Vacant land.	Northwest, Northeast, Southwest – Vacant land. Southeast – A road (present-day Main Street) followed by vacant land.
1954	No significant changes.	Northwest – A road (present-day Vermont Street) followed by vacant land and a building. Northeast, Southeast, Southwest – No significant changes.
1971	No significant changes.	Northwest, Southeast – No significant changes. Northeast – Two buildings. Southwest – One building.
1982	A building and vacant land.	Northwest – An additional building is depicted. Northeast, Southeast, Southwest – No significant changes.
1988	No significant changes.	Northwest – An additional building is depicted. Northeast, Southwest – No significant changes. Southeast – Main Street followed by vacant land and a building.
1997	Three buildings are depicted at the Site.	Northwest, Northeast, Southeast, Southwest – No significant changes.
2015	No improvements are depicted.	With the exception of adjoining roads, no improvements are depicted.

6.3 Fire Insurance Maps

Fire insurance maps are not published for the Site or surrounding properties.



6.4 City Directories

We reviewed historical city directories from the years ranging from 1970 through 2023 provided by ERIS. The Site is referenced as followed in the directories:

- Not listed in 1970
- Mobile Mart, Inc. in 1975
- Donut Depot, Ramona Auto Service, Ramona Auto Service, and Bill Givens Transmissions in 1980
- Tire Country in 1986
- Alice's Vehicle Registration, B&J Vacuum, Brand's Spas and Pools, Buzz Saw Construction, DMV Service by Alice, Hofmann Fence and Supply, Karen's Kritters, and Country Tire USA in 1991
- Brandon's Spa and Pool, Rick's Video Repair, Country Tire, and Superior Auto in 1996
- A Country Clip Pet Grooming, Rick's Video Repair, and Day Company Millworks in 2001
- Webb Pool and Spa, A Country Clip Pet Grooming, Rick's Video Repair, and Hope Vineyard Christian in 2003
- Linda's Nail Cottage, Webb Pool and Spa, A Country Clip Pet Grooming, Ramona County Crafts, and Hope Vineyard Christian in 2008
- Linda's Nail Cottage, Webb Pool and Spa, A Country Clip Pet Grooming, and Prestige II Auto in 2012
- Webb Pool and Spa, A Country Clip Pet Grooming, and Prestige II Auto in 2016
- Webb Pool and Spa, Finest Blends Barbershop, and Brand X Method Powerlifting in 2020
- Alberto's, Webb Pool and Spa, Finest Blends Barbershop, and Brand X Method Powerlifting in 2023

Adjoining properties identified on reviewed city directories include various commercial and residential listings (personal names) of no obvious environmental concern to the Site.

6.5 Other Historical Sources

Other historical sources are referenced in the ASTM E1527-21 practice as any source or sources other than the standard historical sources referenced in the practice that are credible to a reasonable person and that identify past uses of a subject property. This category includes, but is not limited to miscellaneous maps and directories, newspaper archives, internet sites, community organizations, local libraries, historical societies, current owners or occupants of neighboring properties, or records in the files and/or personal knowledge of the property owner and/or occupants. No historical sources other than the standard sources described above were deemed necessary and useful to assist in identifying recognized environmental conditions.



7.0 SITE RECONNAISSANCE

The objective of the Site reconnaissance is to obtain information indicating the likelihood of identifying recognized environmental conditions in connection with a subject property. The Site visit for our assessment was completed on March 25, 2026 by Milena LaBarbiera who was unaccompanied during the reconnaissance.

7.1 Methodology and Limiting Conditions

The Site reconnaissance consisted of observing the Site on foot walking the periphery of the Site, various transects throughout the Site, and publicly accessible areas surrounding the Site for viewing from accessible adjacent public thoroughfares. If structures are present, the periphery of structures are visually and/or physically observed along with select building interiors. Interiors of the current on-Site buildings were not accessible at the time of the reconnaissance, with the exception of a former office at the warehouse building. Based on our review of current and historical use information and the lack of reported releases at the Site, these limitations are not considered to be ones that would inhibit our ability to identify recognized environmental conditions at the Site. Adjoining properties and the surrounding area were also observed during observation of the periphery of the Site, from public thoroughfares adjacent to or traveled on the way to the Site, and if applicable from buildings and structures otherwise accessed during the inspection. Select photographs of the Site obtained during the Site reconnaissance are included in Appendix D.

7.2 Current General Site and Vicinity Characteristics

The Site and the surrounding vicinity are situated in the community of Ramona that consists primarily of residential and commercial properties, vacant land, and public roadways. The Site is currently developed with a vacant warehouse building, a single-tenant retail building occupied by a dulcería, and a multi-tenant retail building occupied by a barbershop and massage therapist, with one vacant unit. The current use of the Site and adjoining properties are not ones that are indicative of the use, treatment, storage, disposal, or generation of hazardous substances or petroleum products that may have significantly impacted the Site.

7.3 Indications of Past Site and Vicinity Uses

There are no material differences between the current and past uses of the Site, adjoining properties, and the surrounding area that were visually and/or physically observed during the Site reconnaissance that pertain to recognized environmental conditions.

7.4 Site-Specific Observations

We examined the Site for the features and conditions noted in the table below.

Feature or Condition	Details
Drains and Sumps	Typical interior floor drains and exterior area drains are present. No significant staining, odors, or other suspect conditions were noted.



Feature or Condition	Details
Drums, Totes, and Intermediate Bulk Containers	Several drums were observed at the former automobile repair area and at the northern gravel lot. The majority of the drums appeared to be empty. Additionally, one open-top tote containing an unknown oily liquid was observed at the former auto repair area. The tote was stored on a wooden pallet and appeared to be in good condition. No significant staining, odors, or other suspect conditions were noted.
Hazardous Substances and Petroleum Products in Connection with Identified Uses	Retail-sized containers of paints, engine oil, concrete base coat, tractor fluid, and other hazardous substances were observed at the former auto repair area. Staining was observed in the vicinity of two containers of tractor fluid. Please refer to "Stained Soil or Pavement" below for additional information.
Hazardous Substances and Petroleum Products Not in Connection with Identified Uses	None observed.
Heating/Cooling	None observed.
PCB Containing Items	None observed.
Pits, Ponds, or Lagoons	None observed.
Potable Water Supply/Source	Ramona Municipal Water District
Roads	None observed.
Septic Systems or Cesspools.	None observed.
Sewage Disposal System	Ramona Municipal Water District
Solid Waste (including graded areas and non-native fill)	Conventional trash cans and dumpsters are present at the Site. No significant staining, odors, or other suspect conditions were noted. Please refer to any project geotechnical reports for information pertaining to the potential presence of fill material at the Site.
Stained Soil or Pavement	Minor concrete staining was observed in the vicinity of two containers of tractor fluid at the former auto repair area. The concrete appeared to be in good condition with no significant cracks or other pathways to the subsurface noted. This is a de minimis condition that requires no additional evaluation.
Stains or Corrosion on Floors, Walls, or Ceilings (except for staining from water).	None observed.
Standing Surface Water and Pools or Sumps Contain Liquids	None observed.
Storage Tanks	Several air compressors, propane tanks, dissolved acetylene tanks, and one aboveground storage tank (AST) were observed at the former auto repair area. The AST appeared to be empty. No significant staining, odors, or other suspect conditions were noted.
Stressed Vegetation (other than water stress).	None observed.



Feature or Condition	Details
Strong, Pungent, or Noxious Odors and Their Sources	None noted.
Structures and Other Improvements	See Section 2.4.
Water/Wastewater or other liquid (including stormwater)	None observed.
Wells	None observed.



8.0 INTERVIEWS

People interviewed during the completion of this assessment (with the exception of public records clerks at regulatory agencies) are noted in the table below. Such agency contacts are referenced in Section 5.3 of this report. In the event that case workers or other specific staff at regulatory agencies who are currently, historically or will be actively involved in the future with oversight of environmental work at the Site or adjoining properties of interest are interviewed, their contact information is included in the table below.

Name	Title or Role of Contact	Organization or Affiliation	Date of Inquiry or Request	Date Information was Provided
Lauren Welty	Designated Client Representative, Site Owner Representative, and Key Site Manager.	Woodcrest Real Estate Ventures	3/17/2026 (Questionnaire)	3/17/2026

8.1 Site Owner

The Site owner is unaware of environmental concerns in connection with the Site. A copy of the questionnaire completed by the Site owner is included in Appendix E.

8.2 Key Site Manager

The Site owner is also considered to be the Key Site Manager. Please refer to Section 8.1 above.

8.3 Current Occupants

Site occupants were not interviewed during the completion of this report. This is not considered to be a data gap of significance.

8.4 Local Government Official

Public records requests were completed by our firm as described in Section 5.3. No formal interviews with other personnel at agencies were deemed warranted during the preparation of our Phase I ESA.

8.5 Other Parties

Interviews with other people were not conducted during the preparation of this assessment. As stated in the ASTM E1527-21 practice, interviews with past owners, operators and occupants of a subject property who are likely to have material information regarding the potential for contamination at a given property shall be conducted to the extent that they have been identified and that the information likely to be obtained is not duplicative of information already obtained from other sources. Interviews with people with past association with the Site were not deemed warranted during the completion of this assessment. In addition, for abandoned properties where there is evidence of potential unauthorized uses of the abandoned property or evidence of uncontrolled access to the abandoned property, interviews with one or more owners or occupants of neighboring adjoining properties or nearby properties should be conducted. Neither the Site nor its adjoining properties are considered to fall within these criteria.



9.0 ADDITIONAL SERVICES – NON-SCOPE ASTM CONSIDERATIONS

Several non-scope ASTM considerations are referenced in the ASTM E1527-21 practice that a user of a report may wish to evaluate. Listed considerations in the practice include asbestos-containing building materials, biological agents, cultural and historic resources, ecological resources, endangered species, health and safety, indoor air quality (unrelated to releases of hazardous substances or petroleum products into the environment), industrial hygiene, lead-based paint (unrelated to releases into the environment), lead in drinking water, mold or microbial growth conditions, PCB-containing building materials, naturally-occurring radon, regulatory compliance, wetlands and substances not defined as hazardous substances (including some substances sometimes generally referred to as emerging contaminants) unless or until such substances are classified as a CERCLA hazardous substance.

No implication is intended by the practice as to the relative importance of inquiry into such non-scope considerations, and the list of considerations is not intended to be all-inclusive. An evaluation of one or more of the non-scope considerations was not requested of our firm as part of the scope of services for the assessment. Therefore, no findings, opinions and conclusions of this assessment are based on said non-scope ASTM considerations.



10.0 FINDINGS AND OPINIONS

No features, activities, uses and/or conditions that, in our professional judgment, may indicate the presence or likely presence of hazardous substances or petroleum products at the Site were identified during the completion of this assessment with the exception of the following:

- The former use of the Site for automobile repair activities and current storage of associated petroleum-based products at the Site.

Based on visual observations, regulatory research, and other information obtained during the preparation of our Phase I ESA, no releases of hazardous substances or petroleum products to the subsurface have been reported as a result of current or historical Site uses. Therefore, the historical use of the Site and current storage of petroleum-based products are considered to be de minimis conditions.



11.0 CONCLUSIONS AND RECOMMENDATIONS

We have performed a Phase I Environmental Site Assessment in conformance with the scope and limitations of ASTM International Practice E1527-21 of the property identified by County of San Diego APNs 282-141-32-00, -33-00 and -34-00 in the community of Ramona, San Diego County, California. This assessment has revealed no recognized environmental conditions, historical recognized environmental conditions or controlled recognized environmental conditions in connection with the Site. In addition, no significant data gaps were identified during the completion of this assessment. Additional assessment at the Site is not considered to be warranted at this time.



12.0 ENVIRONMENTAL PROFESSIONAL STATEMENT

I declare that, to the best of my professional knowledge and belief, I meet the definition of environmental professional as defined in Section 312.10 of 40 CFR. I have the specific qualifications based on education, training and experience to assess a property of the nature, history and setting of the Site. I have developed and performed the all appropriate inquiries in conformance with the standards and practices set forth in 40 CFR Part 312. Qualifications of personnel involved with the completion of this report are included in Appendix F.

A handwritten signature in black ink, appearing to read "Daniel Weis". The signature is fluid and cursive, with the first name "Daniel" and last name "Weis" clearly distinguishable.

Daniel Weis, R.E.H.S.
Environmental Manager



13.0 ASSUMPTIONS

No Phase I ESA effort can eliminate uncertainty regarding the potential for recognized environmental conditions to exist in connection with a given property. Performance of the ASTM E1527-21 practice may reduce such uncertainty but in no way should the findings and report be misconstrued as insurance or a guarantee regarding the potential for recognized environmental conditions in connection with a given property. The ASTM E1527-21 practice recognizes reasonable limits of time and cost relative to the completion of a Phase I ESA.

During the completion of this ESA, our firm relied on certain information obtained from secondary sources, including but not limited to the user of the report, government agencies, historical research business entities, environmental databases and interviews with one or more persons. The sources obtained and/or consulted are assumed to be reliable. However, our firm cannot warranty or guarantee that the information provided by these other sources is wholly accurate or complete. Our firm is not responsible for any misrepresentations or false statements that may be provided by others or the lack of pertinent/relevant information that should have been provided/disclosed by others, and we assume no responsibility for any consequence as a result of such omissions or withheld information.

Accuracy and completeness of records varies among information sources, including from governmental agencies. As a result, there is a possibility that even with the proper application of the methodologies presented in ASTM E1527-21, conditions may exist that could not be identified within the scope of this assessment, or which were not reasonably identifiable from the available information. In addition, any responses received from Federal, State, Tribal and local regulatory agency secondary sources of information after the issuance of this report may change certain findings and conclusions of this report.

Estimations and opinions regarding the potential for off-site properties to adversely impact a given subject property is one of the key components of a Phase I ESA. In most cases, recent property-specific or adjacent-property specific measured groundwater data or other hydrogeological information is not reasonably ascertainable. In the absence of such data, reasonable assumptions regarding the depth and flow of groundwater are made based on various sources including comparisons to surface elevations, land topography and available hydrogeological on the State of California GeoTracker database. In addition, estimations and opinions regarding potential impacts from off-site locations may be based on certain assumptions that a hazardous substance or petroleum product may not migrate laterally within unsaturated soil for a substantial distance and that contaminants that have reached saturated soil and groundwater may attenuate over time and/or may decrease in concentration relative to distance from its source. While any interpretations presented herein may be effective in reducing uncertainty regarding potential impacts to a subject property from off-site locations, in no way should the findings and report be misconstrued as insurance or a guarantee regarding the potential for such impacts to occur. Greater certainty regarding subsurface conditions at a given property can only be achieved by way of a subsurface sampling effort of one or more media.



14.0 DEFINITIONS

Definitions of key terminology relevant to the ASTM E1527-21 practice are presented below.

Recognized Environmental Condition – (1) the presence of hazardous substances or petroleum products in, on, or at a property due to a release to the environment; (2) the likely presence of hazardous substances or petroleum products in, on, or at a property due to a release or likely release to the environment; or (3) the presence of hazardous substances or petroleum products in, on, or at a subject property under conditions that pose a material threat of a future release to the environment.

Historical Recognized Environmental Condition – A previous release of hazardous substances or petroleum products affecting a property that has been addressed to the satisfaction of the applicable regulatory authority or authorities and meeting unrestricted use criteria established by the applicable regulatory authority or authorities without subjecting a property to any controls (for example, activity and use limitations or other property use limitations).

Controlled Recognized Environmental Condition – A recognized environmental condition affecting a property that has been addressed to the satisfaction of an applicable regulatory authority or authorities with hazardous substances or petroleum products allowed to remain in place subject to implementation of required controls (for example, activity and use limitations or other property use limitations).

All Appropriate Inquiries – That inquiry constituting all appropriate inquiries into the previous ownership and uses of a property consistent with good commercial and customary practice as defined in CERCLA, 42 U.S.C. § 9601(35)(B) and 40 C.F.R. Part 312, that will qualify a party to a commercial real estate transaction for one of the threshold criteria for satisfying the LLPs to CERCLA liability (42 U.S.C. §§ 9601(35)(A) & (B), § 9607(b)(3), § 9607(q), and § 9607(r)), assuming compliance with other elements of the defense.

Data Failure – A failure to achieve the historical research objective as outlined in the ASTM E1527-21 practice even after reviewing the standard historical sources that are reasonably ascertainable and likely to be useful. Data failure is one type of data gap. The research objective is compiling and analyzing historical property information and developing a history of the previous uses of a property, adjoining properties and surrounding area to help identify the likelihood of past uses having led to recognized environmental conditions in connection with a property.

Data Gap – A lack of or inability to obtain information required by the ASTM E1527-21 practice despite good faith efforts by the environmental professional to gather such information. Data gaps may result from incompleteness in any of the activities required by the ASTM E1527-21 practice, including, but not limited to site reconnaissance (for example, an inability to conduct a site visit) and interviews (for example, an inability to interview a key site manager, regulatory officials, etc.). Data gaps are only considered to be significant if they affect the ability of the environmental professional to identify recognized environmental conditions.

De Minimis Condition – A condition related to a release that generally does not present a threat to human health or the environment and that generally would not be the subject of an enforcement action if brought to the attention of appropriate governmental agencies. De minimis conditions are not recognized environmental conditions.

Engineering Controls – Physical modifications to a site or facility (for example, capping, slurry walls, or point of use water treatment) to reduce or eliminate the potential for exposure to hazardous substances or petroleum products in the soil or groundwater on a property. Engineering controls are a type of AUL.



Environment – (A) the navigable waters, the waters of the contiguous zone and the ocean waters of which the natural resources are under the exclusive management authority of the United States under the Magnuson-Stevens Fishery Conservation and Management Act [16 U.S.C. §§ 1801 et seq.], and (B) any other surface water, groundwater, drinking water supply, land surface or subsurface strata, or ambient air within the United States or under the jurisdiction of the United States.

Good Faith – The absence of any intention to seek an unfair advantage or to defraud another party; an honest and sincere intention to fulfill one's obligations in the conduct or transaction concerned.

Hazardous Substance – (A) any substance designated pursuant to section 311(b)(2)(A) of the Federal Water Pollution Control Act [33 U.S.C. 1321(b)(2)(A)], (B) any element, compound, mixture, solution, or substance designated pursuant to section 9602 of this title, (C) any hazardous waste having the characteristics identified under or listed pursuant to section 3001 of the Solid Waste Disposal Act [42 U.S.C. 6921] (but not including any waste the regulation of which under the Solid Waste Disposal Act [42 U.S.C. 6901 et seq.] has been suspended by Act of Congress), (D) any toxic pollutant listed under section 307(a) of the Federal Water Pollution Control Act [33 U.S.C. 1317(a)], (E) any hazardous air pollutant listed under section 112 of the Clean Air Act [42 U.S.C. 7412] and (F) any imminently hazardous chemical substance or mixture with respect to which the administrator has taken action pursuant to section 7 of the Toxic Substances Control Act [15 U.S.C. 2606]. The term does not include petroleum, including crude oil or any fraction thereof which is not otherwise specifically listed or designated as a hazardous substance under subparagraphs (A) through (F) of this paragraph, and the term does not include natural gas, natural gas liquids, liquefied natural gas, or synthetic gas usable for fuel (or mixtures of natural gas and such synthetic gas).

Institutional Controls – A legal or administrative mechanism (for example, deed restrictions, restrictive covenants, easements, or zoning) on the use of, or access to, a site or facility to (1) reduce or eliminate potential exposure to hazardous substances or petroleum products in the soil or groundwater on a property, or (2) to prevent activities that could interfere with the effectiveness of a response action, in order to ensure maintenance of a condition of no significant risk to public health or the environment. An institutional control is a type of AUL.

Petroleum Exclusion – While the definition of a CERCLA hazardous substance specifically excludes petroleum products and crude oil, the EPA has determined that the petroleum exclusion applies to petroleum products such as gasoline and other fuels containing lead, benzene or other hazardous substances that are normally added during the refining process. Notwithstanding the existence of the petroleum exclusion, petroleum products are included within the scope of the ASTM E1527-21 practice for multiple reasons. Petroleum products have historically been widely used at commercial properties. In addition, other federal and state laws may impose liability for releases or spills of petroleum products.

Petroleum Products – Those substances included within the meaning of the petroleum exclusion to CERCLA, 42 U.S.C. § 9601(14), as interpreted by the courts and EPA, that is: petroleum, including crude oil or any fraction thereof which is not otherwise specifically listed or designated as a hazardous substance under Subparagraphs (A) through (F) of 42 U.S.C. § 9601(14), natural gas, natural gas liquids, liquefied natural gas and synthetic gas usable for fuel (or mixtures of natural gas and such synthetic gas). The word fraction refers to certain distillates of crude oil, including gasoline, kerosene, diesel oil, jet fuels and fuel oil.

Reasonably Ascertainable Information – Information that is (1) publicly available, (2) obtainable from its source within reasonable time and cost constraints and (3) practically reviewable.



Release or Threatened Release – Any spilling, leaking, pumping, pouring, emitting, emptying, discharging, injecting, escaping, leaching, dumping or disposing into the environment (including the abandonment or discarding of barrels, containers and other closed receptacles containing any hazardous substance, or pollutant or contaminant).



15.0 REFERENCES

Sources of information consulted during the completion of our Phase I ESA are noted in the sections below.

15.1 Documents, Plans and Reports

- “All Appropriate Inquiry” as necessary to satisfy the defenses available under 42 U.S.C. §§ 9607(b)(3), 9607(r)(1), and 9607(q), relying on definitions provided at 42 U.S.C. §§ 9601(35)(B); and as further explained in 40 CFR §§ 312.1 – 312.31.
- ASTM International, "Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process," ASTM Designation E 1527-21, 2021.
- California Geological Survey, 2002, California Geomorphic Provinces Note 36, Electronic Copy, Revised December.
- California State Water Resources Control Board, Water Quality Control Plan for the San Diego Basin (9), Published 2014.
- ERIS Regulatory Database Report, dated March 10, 2026.
- ERIS City Directory Report.
- ERIS Historical Aerials Report.
- ERIS Topographic Maps Report.
- USGS topographic map, San Pasqual, California Quadrangle.

15.2 Personal Communications

- Designated Client Representative – Ms. Lauren Welty
- Designated Site Owner Representative – Ms. Lauren Welty
- Key Site Manager – Ms. Lauren Welty
- Public Records Clerk – County of San Diego

15.3 Agencies Consulted

- California Department of Conservation, Geologic Energy Management Division (CalGEM)
- California Department of Toxic Substances Control
- California State Water Resources Control Board
- County of San Diego
- United States EPA



FIGURES

FIGURE 1
VICINITY MAP

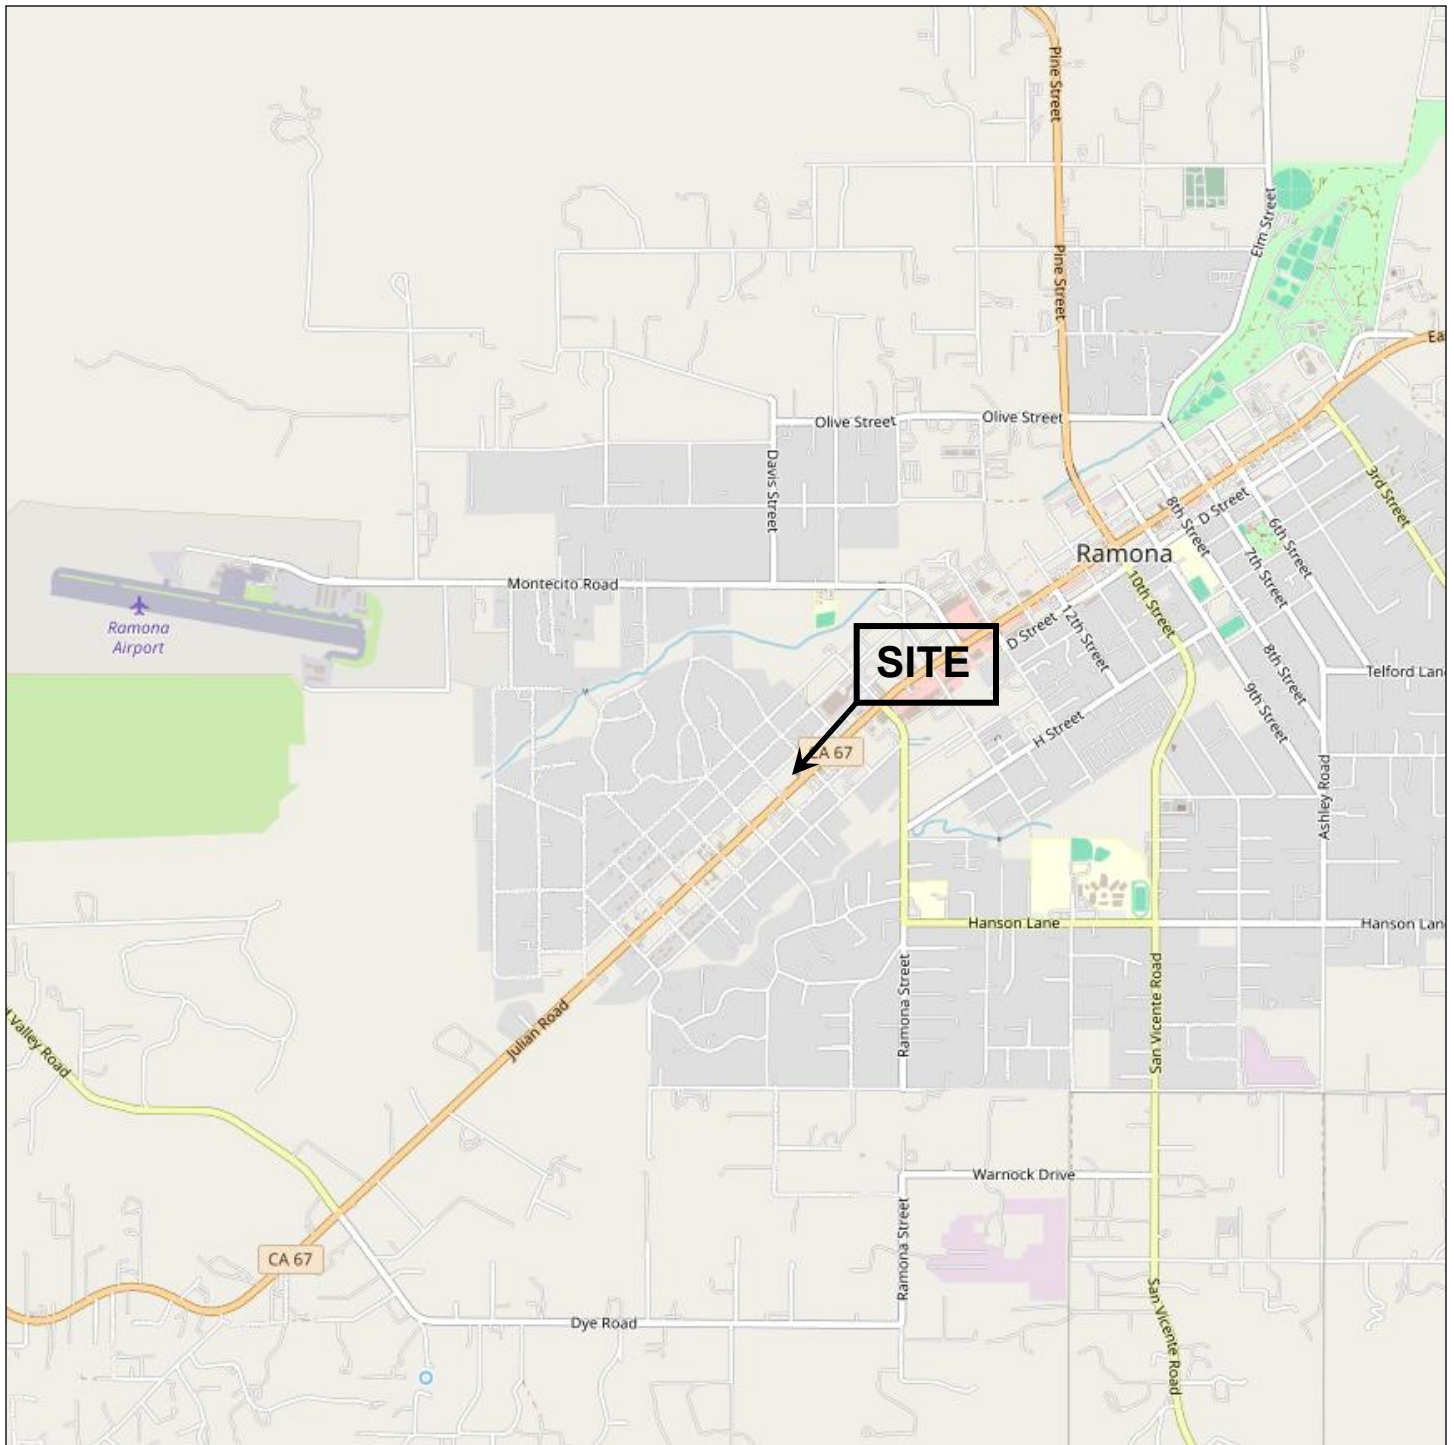


Figure 1 - Vicinity Map



County of San Diego APNs 282-141-32-00, -33-00 and -34-00
Ramona, California

Prepared by:

Weis Environmental
1938 Kellogg Avenue, Suite 116
Carlsbad, CA 92008



FIGURE 2
SITE PLAN



Figure 2 - Site Plan

County of San Diego APNs 282-141-32-00, -33-00 and -34-00
Ramona, California



Prepared by:

Weis Environmental
1938 Kellogg Avenue, Suite 116
Carlsbad, CA 92008



FIGURE 3
TOPOGRAPHIC MAP

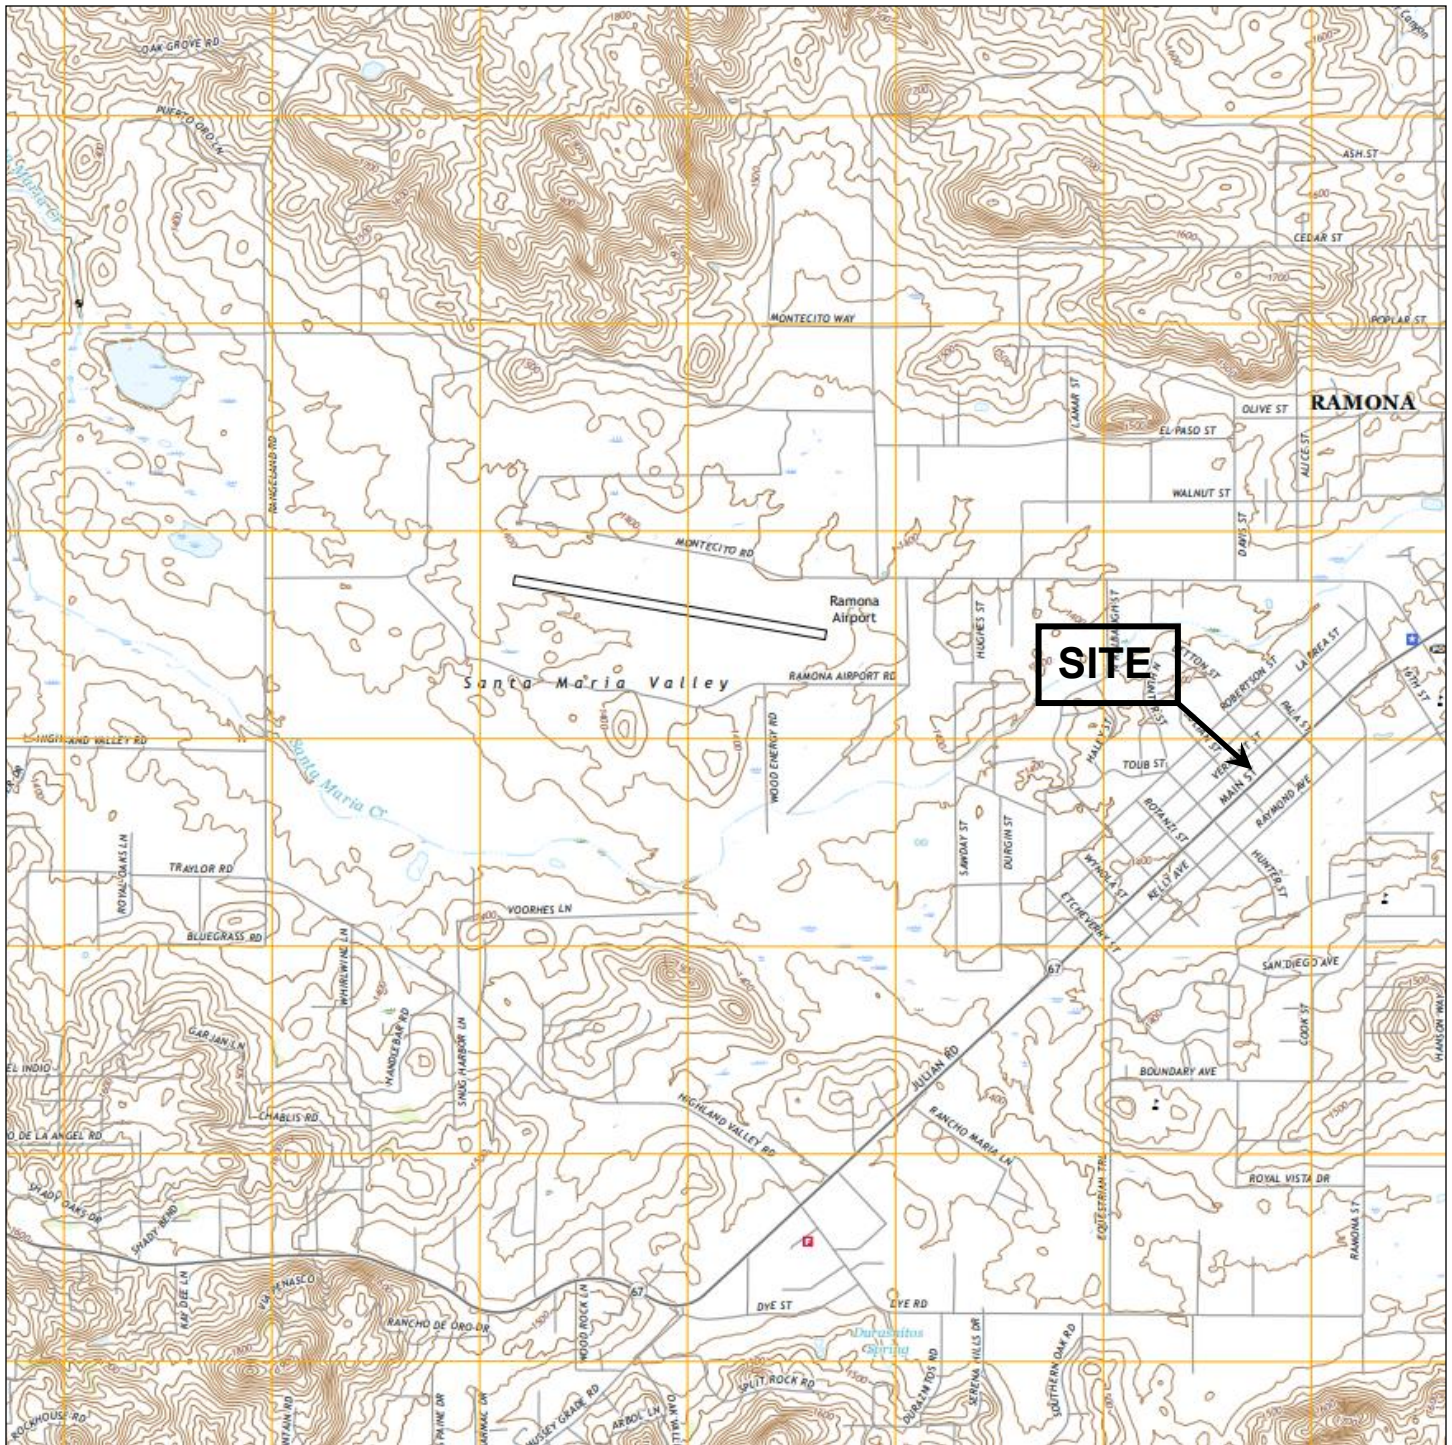


Figure 3 - Topographic Map



County of San Diego APNs 282-141-32-00, -33-00 and -34-00
Ramona, California

Prepared by:

Weis Environmental
1938 Kellogg Avenue, Suite 116
Carlsbad, CA 92008



APPENDICES

APPENDIX A
REGULATORY DATABASE REPORT



DATABASE REPORT

Project Property:	<i>Proposed Ramona Boutique Hotel Proposed Ramona Boutique Hotel Ramona CA</i>
Project No:	
Report Type:	<i>Database Report</i>
Order No:	<i>26030800110</i>
Requested by:	<i>Weis Environmental, LLC</i>
Date Completed:	<i>March 10, 2026</i>

Environmental Risk Information Services

A division of Glacier Media Inc.

1.866.517.5204 | info@erisinfo.com | erisinfo.com

Table of Contents

Table of Contents.....	2
Executive Summary.....	3
Executive Summary: Report Summary.....	4
Executive Summary: Site Report Summary - Project Property.....	9
Executive Summary: Site Report Summary - Surrounding Properties.....	10
Executive Summary: Summary by Data Source.....	19
Map.....	32
Aerial.....	35
Topographic Map.....	36
Detail Report.....	37
Unplottable Summary.....	326
Unplottable Report.....	327
Appendix: Database Descriptions.....	333
Definitions.....	353

Notice: IMPORTANT LIMITATIONS and YOUR LIABILITY

Reliance on information in Report: This report DOES NOT replace a full Phase I Environmental Site Assessment but is solely intended to be used as database review of environmental records.

License for use of information in Report: No page of this report can be used without this cover page, this notice and the project property identifier. The information in Report(s) may not be modified or re-sold.

Your Liability for misuse: Using this Service and/or its reports in a manner contrary to this Notice or your agreement will be in breach of copyright and contract and ERIS may obtain damages for such mis-use, including damages caused to third parties, and gives ERIS the right to terminate your account, rescind your license to any previous reports and to bar you from future use of the Service.

No warranty of Accuracy or Liability for ERIS: The information contained in this report has been produced by ERIS Information Inc. ("ERIS") using various sources of information, including information provided by Federal and State government departments. The report applies only to the address and up to the date specified on the cover of this report, and any alterations or deviation from this description will require a new report. This report and the data contained herein does not purport to be and does not constitute a guarantee of the accuracy of the information contained herein and does not constitute a legal opinion nor medical advice. Although ERIS has endeavored to present you with information that is accurate, ERIS disclaims, any and all liability for any errors, omissions, or inaccuracies in such information and data, whether attributable to inadvertence, negligence or otherwise, and for any consequences arising therefrom. Liability on the part of ERIS is limited to the monetary value paid for this report.

Trademark and Copyright: You may not use the ERIS trademarks or attribute any work to ERIS other than as outlined above. This Service and Report(s) are protected by copyright owned by ERIS Information Inc. Copyright in data used in the Service or Report(s) (the "Data") is owned by ERIS or its licensors. The Service, Report(s) and Data may not be copied or reproduced in whole or in any substantial part without prior written consent of ERIS.

Executive Summary

Property Information:

Project Property: *Proposed Ramona Boutique Hotel
Proposed Ramona Boutique Hotel Ramona CA*

Project No:

Coordinates:

Latitude: 33.0321801
Longitude: -116.88530402
UTM Northing: 3,654,860.29
UTM Easting: 510,710.53
UTM Zone: 11S

Elevation: 1,418 FT

Order Information:

Order No: 26030800110
Date Requested: March 8, 2026
Requested by: Weis Environmental, LLC
Report Type: Database Report

Historicals/Products:

ERIS Xplorer [ERIS Xplorer](#)
Excel Add-On Excel Add-On

Executive Summary: Report Summary

Database	Searched	Search Radius	Project Property	Within 0.12mi	0.125mi to 0.25mi	0.25mi to 0.50mi	0.50mi to 1.00mi	Total
<u>Standard Environmental Records</u>								
Federal								
NPL	Y	1	0	0	0	0	0	0
PROPOSED NPL	Y	1	0	0	0	0	0	0
DELETED NPL	Y	0.5	0	0	0	0	-	0
SEMS	Y	0.5	0	0	0	0	-	0
ODI	Y	0.5	0	0	0	0	-	0
SEMS ARCHIVE	Y	0.5	0	0	0	0	-	0
CERCLIS	Y	0.5	0	0	0	0	-	0
IODI	Y	0.5	0	0	0	0	-	0
CERCLIS NFRAP	Y	0.5	0	0	0	0	-	0
CERCLIS LIENS	Y	PO	0	-	-	-	-	0
RCRA CORRACTS	Y	1	0	0	0	0	0	0
RCRA TSD	Y	0.5	0	0	0	1	-	1
RCRA LQG	Y	0.25	0	0	0	-	-	0
RCRA SQG	Y	0.25	0	0	0	-	-	0
RCRA VSQG	Y	0.25	0	0	1	-	-	1
RCRA NON GEN	Y	0.25	0	13	7	-	-	20
RCRA CONTROLS	Y	0.5	0	0	0	0	-	0
FED ENG	Y	0.5	0	0	0	0	-	0
FED INST	Y	0.5	0	0	0	0	-	0
LUCIS	Y	0.5	0	0	0	0	-	0
NPL IC	Y	0.5	0	0	0	0	-	0
ERNS 1982 TO 1986	Y	PO	0	-	-	-	-	0
ERNS 1987 TO 1989	Y	PO	0	-	-	-	-	0
ERNS	Y	PO	0	-	-	-	-	0
FED BROWNFIELDS	Y	0.5	0	0	0	0	-	0
FEMA UST	Y	0.25	0	0	0	-	-	0
FRP	Y	0.25	0	0	0	-	-	0

Database	Searched	Search Radius	Project Property	Within 0.12mi	0.125mi to 0.25mi	0.25mi to 0.50mi	0.50mi to 1.00mi	Total
DELISTED FRP	Y	0.25	0	0	0	-	-	0
HIST GAS STATIONS	Y	0.25	0	0	0	-	-	0
REFN	Y	0.25	0	0	0	-	-	0
BULK TERMINAL	Y	0.25	0	0	0	-	-	0
SEMS LIEN	Y	PO	0	-	-	-	-	0
SUPERFUND ROD	Y	1	0	0	0	0	0	0
State								
RESPONSE	Y	1	0	0	0	0	0	0
ENVIROSTOR	Y	1	0	0	0	0	0	0
DELISTED ENVS	Y	1	0	0	0	0	0	0
SWF/LF	Y	0.5	0	0	0	0	-	0
SWRCB SWF	Y	0.5	0	0	0	0	-	0
WMUD	Y	0.5	0	0	0	0	-	0
HWP	Y	1	0	0	0	0	0	0
SWAT	Y	0.5	0	0	0	0	-	0
C&D DEBRIS RECY	Y	0.5	0	1	2	2	-	5
RECYCLING	Y	0.5	0	0	0	0	-	0
PROCESSORS	Y	0.5	0	0	0	0	-	0
CONTAINER RECY	Y	0.5	0	0	0	0	-	0
LDS	Y	0.5	0	0	0	1	-	1
LUST	Y	0.5	0	2	0	1	-	3
DELISTED LST	Y	0.5	0	0	0	0	-	0
UST	Y	0.25	0	1	0	-	-	1
UST CLOSURE	Y	0.5	0	0	0	0	-	0
HHSS	Y	0.25	0	1	0	-	-	1
UST SWEEPS	Y	0.25	0	7	0	-	-	7
AST	Y	0.25	0	1	1	-	-	2
AST SWRCB	Y	0.25	0	0	0	-	-	0
TANK OIL GAS	Y	0.25	0	0	0	-	-	0
DELISTED TNK	Y	0.25	0	3	0	-	-	3
CERS TANK	Y	0.25	0	2	2	-	-	4
DELISTED CTNK	Y	0.25	0	0	0	-	-	0
HIST TANK	Y	0.25	0	1	0	-	-	1
LUR	Y	0.5	0	0	0	0	-	0

Database	Searched	Search Radius	Project Property	Within 0.12mi	0.125mi to 0.25mi	0.25mi to 0.50mi	0.50mi to 1.00mi	Total
CALSITES	Y	0.5	0	0	0	0	-	0
HLUR	Y	0.5	0	0	0	0	-	0
DEED	Y	0.5	0	0	0	0	-	0
VCP	Y	0.5	0	0	0	0	-	0
CLEANUP SITES	Y	0.5	0	0	0	1	-	1
DELISTED CLEANUP	Y	0.5	0	0	0	0	-	0
DELISTED COUNTY	Y	0.25	0	0	0	-	-	0
DELISTED COUNTY TANK	Y	0.25	0	0	0	-	-	0
DELISTED COUNTY LTANK	Y	0.5	0	0	0	0	-	0

Tribal

INDIAN LUST	Y	0.5	0	0	0	0	-	0
INDIAN UST	Y	0.25	0	0	0	-	-	0
DELISTED INDIAN LST	Y	0.5	0	0	0	0	-	0
DELISTED INDIAN UST	Y	0.25	0	0	0	-	-	0

County

SWF SANDIEGO	Y	0.5	0	0	0	0	-	0
LOP SANDIEGO	Y	0.5	0	2	0	0	-	2
HAZ SANDIEGO	Y	0.25	2	14	8	-	-	24
UST SANDIEGO	Y	0.25	0	3	0	-	-	3
SAM SANDIEGO	Y	0.5	0	2	0	2	-	4

Additional Environmental Records

Federal

PFAS GHG	Y	0.5	0	0	0	0	-	0
OSC RESPONSE	Y	0.125	0	0	-	-	-	0
FINDS/FRS	Y	PO	0	2	-	-	-	2
TRIS	Y	PO	0	-	-	-	-	0
PFAS NPL	Y	0.5	0	0	0	0	-	0
PFAS FED SITES	Y	0.5	0	0	0	0	-	0
PFAS SSEHRI	Y	0.5	0	0	0	0	-	0
PFAS ERNS	Y	0.5	0	0	0	0	-	0
PFAS NPDES	Y	0.5	0	0	0	0	-	0
PFAS TRI	Y	0.5	0	0	0	0	-	0
PFAS WATER	Y	0.5	0	0	0	0	-	0
PFAS TSCA	Y	0.5	0	0	0	0	-	0

Database	Searched	Search Radius	Project Property	Within 0.12mi	0.125mi to 0.25mi	0.25mi to 0.50mi	0.50mi to 1.00mi	Total
PFAS E-MANIFEST	Y	0.5	0	0	0	0	-	0
PFAS IND	Y	0.5	0	0	0	1	-	1
HMIRS	Y	0.125	0	0	-	-	-	0
NCDL	Y	0.125	0	0	-	-	-	0
TSCA	Y	0.125	0	0	-	-	-	0
HIST TSCA	Y	0.125	0	0	-	-	-	0
FTTS ADMIN	Y	PO	0	-	-	-	-	0
FTTS INSP	Y	PO	0	-	-	-	-	0
PRP	Y	PO	0	-	-	-	-	0
SCRD DRYCLEANER	Y	0.5	0	0	0	0	-	0
ICIS	Y	PO	0	-	-	-	-	0
FED DRYCLEANERS	Y	0.25	0	0	0	-	-	0
DELISTED FED DRY	Y	0.25	0	0	0	-	-	0
FUDS	Y	1	0	0	0	0	1	1
FUDS MRS	Y	1	0	0	0	0	0	0
FORMER NIKE	Y	1	0	0	0	0	0	0
PIPELINE INCIDENT	Y	PO	0	-	-	-	-	0
MLTS	Y	PO	0	-	-	-	-	0
HIST MLTS	Y	PO	0	-	-	-	-	0
MINES	Y	0.25	0	0	0	-	-	0
SMCRA	Y	1	0	0	0	0	0	0
MRDS	Y	1	0	0	0	0	1	1
LM SITES	Y	1	0	0	0	0	0	0
ALT FUELS	Y	0.25	0	0	0	-	-	0
CONSENT DECREES	Y	0.25	0	0	0	-	-	0
AFS	Y	PO	0	-	-	-	-	0
SSTS	Y	0.25	0	0	0	-	-	0
PCBT	Y	0.5	0	0	0	0	-	0
PCB	Y	0.5	0	0	0	0	-	0
POWER PLANTS	Y	0.125	0	0	-	-	-	0
HIST RISK	Y	0.125	0	0	-	-	-	0
NPDES BIOSOLIDS	Y	PO	0	-	-	-	-	0
State								
PFAS SAMPLING	Y	0.5	0	0	0	0	-	0
DRYCLEANERS	Y	0.25	0	0	0	-	-	0

Database	Searched	Search Radius	Project Property	Within 0.12mi	0.125mi to 0.25mi	0.25mi to 0.50mi	0.50mi to 1.00mi	Total
DELISTED DRYCLEANERS	Y	0.25	0	0	0	-	-	0
DRYC GRANT	Y	0.25	0	0	0	-	-	0
PFAS GT CLEANUPS	Y	0.5	0	0	0	0	-	0
PFAS GW	Y	0.5	0	0	0	0	-	0
PFAS INVEST	Y	0.5	0	0	0	0	-	0
HWSS CLEANUP	Y	0.5	0	0	0	0	-	0
TOXIC PITS	Y	1	0	0	0	0	0	0
DTSC HWF	Y	0.5	0	0	0	0	-	0
INSP COMP ENF	Y	1	0	0	0	0	1	1
SCH	Y	1	0	0	0	0	2	2
CHMIRS	Y	PO	0	-	-	-	-	0
HIST CHMIRS	Y	PO	0	-	-	-	-	0
HAZNET	Y	PO	1	2	-	-	-	3
HAZ GEN	Y	PO	1	5	-	-	-	6
HAZ TSD	Y	0.5	0	0	0	0	-	0
HIST MANIFEST	Y	PO	0	1	-	-	-	1
HW TRANSPORT	Y	0.125	0	0	-	-	-	0
WASTE TIRE	Y	PO	0	-	-	-	-	0
MEDICAL WASTE	Y	0.25	0	0	0	-	-	0
HIST CORTESE	Y	0.5	0	0	0	0	-	0
CDO/CAO	Y	0.5	0	0	0	0	-	0
CERS HAZ	Y	0.125	0	5	-	-	-	5
DELISTED HAZ	Y	0.5	0	0	0	0	-	0
GEOTRACKER	Y	0.125	0	0	-	-	-	0
MINE	Y	1	0	0	0	0	0	0
LIEN	Y	PO	0	-	-	-	-	0
WASTE DISCHG	Y	0.25	0	0	0	-	-	0
EMISSIONS	Y	0.25	0	4	0	-	-	4
CDL	Y	0.125	0	0	-	-	-	0

Tribal *No Tribal additional environmental record sources available for this State.*

County

Total: **4** **72** **21** **9** **5** **111**

* PO – Property Only

* 'Property and adjoining properties' database search radii are set at 0.25 miles.

Executive Summary: Site Report Summary - Project Property

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Direction</i>	<i>Distance (mi/ft)</i>	<i>Elev Diff (ft)</i>	<i>Page Number</i>
<u>1</u>	HAZ GEN	PRESTIGE 2 AUTO COLLISION	2037 MAIN ST RAMONA CA 92065	ESE	0.00 / 0.00	1	<u>37</u>
<u>1</u>	HAZ SANDIEGO	PRESTIGE II AUTO COLLISION	2037 MAIN ST RAMONA CA	ESE	0.00 / 0.00	1	<u>37</u>
<u>1</u>	HAZ SANDIEGO	SUPERIOR AUTOMOTIVE	2037 MAIN ST RAMONA CA	ESE	0.00 / 0.00	1	<u>38</u>
<u>1</u>	HAZNET	BORN AGAIN CARS	2037 MAIN RAMONA CA 920650000	ESE	0.00 / 0.00	1	<u>38</u>

Executive Summary: Site Report Summary - Surrounding Properties

Map Key	DB	Company/Site Name	Address	Direction	Distance (mi/ft)	Elev Diff (ft)	Page Number
2	HAZ GEN	JAMES L. HILL, DDS	2005 MAIN ST. RAMONA CA 920650000	ENE	0.01 / 45.54	2	39
2	HAZ SANDIEGO	Malcolm J Boykin, DDS	2005 MAIN ST 2005 MAIN ST RAMONA CA 92065	ENE	0.01 / 45.54	2	39
3	AST	BJ'S RENTALS INC	2055 MAIN STREET, RAMONA, 92065 CA	SSW	0.01 / 50.56	0	40
3	CERS TANK	Sunbelt Rentals PC 1326	2055 MAIN ST RAMONA CA 92065 <i>Site ID: 387922</i>	SSW	0.01 / 50.56	0	40
3	FINDS/FRS	BJ'S RENTALS INC.	2055 MAIN ST RAMONA CA 920652525 <i>Registry ID: 110065601897</i>	SSW	0.01 / 50.56	0	44
3	FINDS/FRS	SUNBELT RENTALS PC 1326	2055 MAIN ST RAMONA CA 92065 <i>Registry ID: 110070800661</i>	SSW	0.01 / 50.56	0	45
3	HAZ GEN	RENTX INDUSTRIES INC	2055 MAIN ST RAMONA CA 920650000	SSW	0.01 / 50.56	0	45
3	HAZ GEN	H S S RENTX	2055 MAIN ST RAMONA CA 920650000	SSW	0.01 / 50.56	0	45
3	HAZ GEN	BJ'S RENTALS INC DBA BJ'S RENTALS	2055 MAIN ST RAMONA CA 92065	SSW	0.01 / 50.56	0	46
3	HAZ GEN	SUNBELT RENTALS PC 1326	2055 MAIN ST RAMONA CA 92065	SSW	0.01 / 50.56	0	46
3	HAZ SANDIEGO	BJS RENTAL STORE	2055 MAIN ST RAMONA CA	SSW	0.01 / 50.56	0	47
3	HAZ SANDIEGO	Sunbelt Rentals PC 1326	2055 MAIN ST RAMONA CA 92065	SSW	0.01 / 50.56	0	48

Map Key	DB	Company/Site Name	Address	Direction	Distance (mi/ft)	Elev Diff (ft)	Page Number
3	HAZ SANDIEGO	HSS RENTX	2055 MAIN ST RAMONA CA	SSW	0.01 / 50.56	0	55
3	HAZNET	BJS RENTAL STORE	2055 MAIN RAMONA CA 920650000	SSW	0.01 / 50.56	0	56
3	HAZNET	1X VJ'S RENTAL STORES	2055 MAIN ST RAMONA CA 920650000	SSW	0.01 / 50.56	0	56
3	HIST MANIFEST		2055 MAIN ST RAMONA CA 920650000	SSW	0.01 / 50.56	0	56
3	LOP SANDIEGO	BJS RENTAL STORE	2055 MAIN ST, RAMONA, CA 92065 RAMONA CA Record ID Record Status: DEH1991-LSAM-H05399-001 Completed	SSW	0.01 / 50.56	0	57
3	LUST	BJS RENTAL STORE	2055 MAIN ST RAMONA CA 920652525 Global ID Status: T0607300711	SSW	0.01 / 50.56	0	57
3	RCRA NON GEN	BJ'S RENTALS INC.	2055 MAIN STREET RAMONA CA 92065 Handler ID Recycler Activity?: CAL000295045 NO	SSW	0.01 / 50.56	0	60
3	RCRA NON GEN	SUNBELT RENTALS PC 1326	2055 MAIN ST RAMONA CA 92065 Handler ID Recycler Activity?: CAL000453957 NO	SSW	0.01 / 50.56	0	62
3	SAM SANDIEGO	BJS RENTAL STORE	2055 MAIN ST RAMONA CA 92065	SSW	0.01 / 50.56	0	64
3	UST SWEEPS	BJS RENTAL STORE	2055 MAIN ST RAMONA CA C C Status: I37-000-5399 INACTIVE Tank ID: 000001	SSW	0.01 / 50.56	0	65
3	UST SWEEPS	BJS RENTAL STORE	2055 MAIN ST RAMONA CA C C Status: A37-000-5399 ACTIVE	SSW	0.01 / 50.56	0	66
4	CERS HAZ	Discount RV INC	1939 MAIN ST RAMONA CA 92065	NE	0.07 / 355.62	4	66
4	DELISTED TNK	SUN VALLEY BODY & PAINT	1939 MAIN ST R RAMONA CA 92065	NE	0.07 / 355.62	4	69
4	EMISSIONS	SUN VALLEY BODY & PAINT	1939 MAIN ST RAMONA CA 92065	NE	0.07 / 355.62	4	69

Map Key	DB	Company/Site Name	Address	Direction	Distance (mi/ft)	Elev Diff (ft)	Page Number
4	HAZ SANDIEGO	TANGUAY'S RAMONA TRUCK & AUTO	1939 MAIN ST A 1939 MAIN ST RAMONA CA 92065	NE	0.07 / 355.62	4	75
4	HAZ SANDIEGO	TANGUAY AUTOMOTIVE INC	1939 MAIN ST RAMONA CA	NE	0.07 / 355.62	4	79
4	HAZ SANDIEGO	RAMONA TRUCK & AUTO	1939 MAIN ST RAMONA CA	NE	0.07 / 355.62	4	80
4	HAZ SANDIEGO	Discount RV INC	1939 MAIN ST R RAMONA CA 92065	NE	0.07 / 355.62	4	81
4	HHSS	JEFF READE CHEVROLET-OLDSMOBIL	1939 MAIN ST. RAMONA CA 92065	NE	0.07 / 355.62	4	84
4	HIST TANK	JEFF READE CHEVROLET-OLDSMOBIL	1939 MAIN ST. RAMONA CA	NE	0.07 / 355.62	4	84
4	RCRA NON GEN	HIGH-COUNTRY CHEV-OLDS INC	1939 MAIN ST\ RAMONA CA 92065	NE	0.07 / 355.62	4	84
		Handler ID Recycler Activity?: CAD981686470 NO					
4	RCRA NON GEN	JEFF READE CHEVROLET OLDSMOBILE	1939 MAIN ST RAMONA CA 92065	NE	0.07 / 355.62	4	86
		Handler ID Recycler Activity?: CAD056297476 NO					
4	RCRA NON GEN	RAMONA RV&AUTO	1939 MAIN ST RAMONA CA 92065	NE	0.07 / 355.62	4	89
		Handler ID Recycler Activity?: CAL000439898 NO					
4	RCRA NON GEN	SUN VALLEY BODY & PAINT	1939 MAIN ST STE R RAMONA CA 92065-0000	NE	0.07 / 355.62	4	91
		Handler ID Recycler Activity?: CAL000209651 NO					
4	RCRA NON GEN	GMBC REAL ESTATE	1939 MAIN STREET RAMONA CA 92065	NE	0.07 / 355.62	4	93
		Handler ID Recycler Activity?: CAC003155771 NO					
4	RCRA NON GEN	DISCOUNT RV INC	1939 MAIN ST RAMONA CA 92065	NE	0.07 / 355.62	4	95
		Handler ID Recycler Activity?: CAL000478193 NO					

Map Key	DB	Company/Site Name	Address	Direction	Distance (mi/ft)	Elev Diff (ft)	Page Number
4	UST SANDIEGO	Discount RV INC	1939 MAIN ST R RAMONA CA 92065	NE	0.07 / 355.62	4	97
Record ID Permit Status: DEH2002-HUPFP-105223 Permit Renewed							
4	UST SWEEPS	RAMONA MOTORS INC	1939 MAIN ST RAMONA CA	NE	0.07 / 355.62	4	98
C C Status: A37-000-5223 ACTIVE							
4	UST SWEEPS	RAMONA MOTORS INC	1939 MAIN ST RAMONA CA	NE	0.07 / 355.62	4	98
C C Status: I37-000-5223 INACTIVE Tank ID: 000001							
5	C&D DEBRIS RECY	O'REILLY AUTO PARTS #2724	1935 MAIN STREET - HWY 67 RAMONA CA 92065	ENE	0.08 / 443.49	5	98
5	CERS HAZ	O'REILLY AUTO PARTS #2724	1935 MAIN ST RAMONA CA 92065	ENE	0.08 / 443.49	5	99
5	HAZ SANDIEGO	O'Reilly Auto Parts #2724	1935 MAIN ST RAMONA CA 92065	ENE	0.08 / 443.49	5	102
5	RCRA NON GEN	O'REILLY AUTO PARTS STORE 2724	1935 MAIN ST RAMONA CA 92065	ENE	0.08 / 443.49	5	109
Handler ID Recycler Activity?: CAL000392583 NO							
6	CERS HAZ	RAMONA AUTOMOTIVE	1936 MAIN ST RAMONA CA 92065	ENE	0.08 / 445.99	1	111
6	DELISTED TNK	RAMONA AUTOMOTIVE	1936 MAIN ST RAMONA CA 92065	ENE	0.08 / 445.99	1	117
6	HAZ SANDIEGO	RAMONA AUTOMOTIVE	1936 MAIN ST RAMONA CA 92065	ENE	0.08 / 445.99	1	118
6	RCRA NON GEN	RAMONA AUTO INC, DBA RAMONA AUTOMOTIVE	1936 MAIN ST RAMONA CA 92065	ENE	0.08 / 445.99	1	122
Handler ID Recycler Activity?: CAL000399681 NO							
6	RCRA NON GEN	RAMONA AUTOMOTIVE INC	1936 MAIN ST RAMONA CA 92065	ENE	0.08 / 445.99	1	124
Handler ID Recycler Activity?: CAL000464077 NO							
6	UST SANDIEGO	RAMONA AUTOMOTIVE	1936 MAIN ST RAMONA CA 92065	ENE	0.08 / 445.99	1	127
Record ID Permit Status: DEH2002-HUPFP-113183 Permit Renewed							

Map Key	DB	Company/Site Name	Address	Direction	Distance (mi/ft)	Elev Diff (ft)	Page Number
6	UST SWEEPS	RAMONA AUTOMOTIVE	1936 MAIN ST RAMONA CA C C Status: I37-000-13183 INACTIVE Tank ID: 000001	ENE	0.08 / 445.99	1	127
6	UST SWEEPS	RAMONA AUTOMOTIVE	1936 MAIN ST RAMONA CA C C Status: A37-000-13183 ACTIVE	ENE	0.08 / 445.99	1	128
7	CERS HAZ	Taco Bell #41609	1925 MAIN ST STE A RAMONA CA 92065	ENE	0.10 / 547.28	4	128
7	HAZ SANDIEGO	Taco Bell #41609	1925 MAIN ST, SUITE# A RAMONA, CA 92065 RAMONA CA 92065	ENE	0.10 / 547.28	4	130
8	RCRA NON GEN	427 JULIAN ST	427 JULIAN ST RAMONA CA 92065 Handler ID Recycler Activity?: CAC003202822 NO	SSE	0.12 / 619.04	-3	131
9	CERS HAZ	Leslie's Swimming Pool Supplies #653	1905 MAIN ST RAMONA CA 92065	ENE	0.12 / 632.95	3	133
9	HAZ SANDIEGO	Leslie's Swimming Pool Supplies #653	1905 MAIN ST 1905 MAIN ST RAMONA CA	ENE	0.12 / 632.95	3	135
10	CERS TANK	STARS PETROLEUM INC	1910 MAIN ST RAMONA CA 92065 Site ID: 156920	ENE	0.12 / 656.72	1	136
10	DELISTED TNK	RAMONA DAY & NITE MOBIL	1910 MAIN ST RAMONA CA 92065	ENE	0.12 / 656.72	1	149
10	EMISSIONS	STARS PETROLEUM INC	1910 MAIN ST RAMONA CA 92065	ENE	0.12 / 656.72	1	149
10	EMISSIONS	GVS SYSTEMSRAMONA DAY N NIT	1910 MAIN ST RAMONA CA 92065	ENE	0.12 / 656.72	1	155
10	EMISSIONS	GVS SYSTEMS / RAMONA DAY N NIT	1910 MAIN ST RAMONA CA 92065	ENE	0.12 / 656.72	1	155
10	HAZ SANDIEGO	RAMONA DAY & NITE MOBIL	1910 MAIN ST RAMONA CA	ENE	0.12 / 656.72	1	157

Map Key	DB	Company/Site Name	Address	Direction	Distance (mi/ft)	Elev Diff (ft)	Page Number
10	HAZ SANDIEGO	STARS PETROLEUM INC	1910 MAIN ST RAMONA CA 92065	ENE	0.12 / 656.72	1	157
10	LOP SANDIEGO	RAMONA DAY & NITE MOBIL	1910 HIGHWAY 67, RAMONA, CA 92065 RAMONA CA Record ID Record Status: DEH2000-LSAM-H29206-001 Completed	ENE	0.12 / 656.72	1	170
10	LUST	STARS PETROLEUM	1910 Main Street RAMONA CA 920652524 Global ID Status: T0607391310	ENE	0.12 / 656.72	1	170
10	RCRA NON GEN	STARS PETROLEUM	1910 MAIN ST RAMONA CA 92065-2524 Handler ID Recycler Activity?: CAL000306036 NO	ENE	0.12 / 656.72	1	224
10	SAM SANDIEGO	RAMONA DAY & NITE MOBIL	1910 HIGHWAY 67 RAMONA CA 92065	ENE	0.12 / 656.72	1	226
10	UST	STARS PETROLEUM INC	1910 MAIN ST RAMONA CA 92065 Facility ID: 37-000-201678 Tank ID No. Tank Status Tank Closure Date: 28266 Confirmed/Updated Information , 28267 Confirmed/Updated Information , 32496 Confirmed/Updated Information , 28268 Confirmed/Updated Information	ENE	0.12 / 656.72	1	227
10	UST SANDIEGO	STARS PETROLEUM INC	1910 MAIN ST RAMONA CA 92065 Record ID Permit Status: DEH2003-HUPFP-201678 Permit Renewed	ENE	0.12 / 656.72	1	229
10	UST SWEEPS	RAMONA DAY & NITE	1910 MAIN ST RAMONA CA C C Status: A37-000-29206 ACTIVE Tank ID: 000001, 000002, 000003	ENE	0.12 / 656.72	1	230
11	C&D DEBRIS RECY	AUTOZONE #2845	370 PALA ST RAMONA CA 92065	ENE	0.18 / 935.37	0	230
11	HAZ SANDIEGO	AutoZone #2845	370 PALA ST RAMONA CA 92065	ENE	0.18 / 935.37	0	231
11	RCRA NON GEN	AUTOZONE #2845	370 PALA ST RAMONA CA 92065-0000 Handler ID Recycler Activity?: CAL000219707 NO	ENE	0.18 / 935.37	0	239
12	HAZ SANDIEGO	Kmart #3678	1855 MAIN ST 1855 MAIN ST RAMONA CA 92065	NE	0.20 / 1,059.08	3	241
12	RCRA NON GEN	KMART #3678	1855 MAIN ST RAMONA CA 92065 Handler ID Recycler Activity?: CAL000231575 NO	NE	0.20 / 1,059.08	3	245

Map Key	DB	Company/Site Name	Address	Direction	Distance (mi/ft)	Elev Diff (ft)	Page Number
12	RCRA NON GEN	KMART #3678	1855 MAIN ST RAMONA CA 92065	NE	0.20 / 1,059.08	3	248
Handler ID Recycler Activity?: CAL000409136 NO							
13	CERS TANK	Jiffy Lube #3777	1850 MAIN ST RAMONA CA 92065	ENE	0.21 / 1,087.89	-1	250
Site ID: 547382							
13	HAZ SANDIEGO	Jiffy Lube #3777	1850 MAIN ST RAMONA CA 92065	ENE	0.21 / 1,087.89	-1	253
13	RCRA NON GEN	TEAM CAR CARE WEST LLC DBA JIFFY LUBE	1850 MAIN ST RAMONA CA 92065	ENE	0.21 / 1,087.89	-1	257
Handler ID Recycler Activity?: CAL000439708 NO							
14	HAZ SANDIEGO	Tractor Supply Company Store #1862- Ramona	203 HUNTER ST RAMONA CA 92065	SW	0.21 / 1,096.15	-7	259
14	RCRA NON GEN	TRACTOR SUPPLY COMPANY #1862	203 HUNTER ST RAMONA CA 92065	SW	0.21 / 1,096.15	-7	270
Handler ID Recycler Activity?: CAL000395864 NO							
15	HAZ SANDIEGO	RAMONA TIRE PROS & SERVICE CENTER	1811 MAIN ST RAMONA CA 92065	NE	0.24 / 1,277.30	4	272
15	RCRA NON GEN	DBA TRACTION TIRE & SERVICE CENTER	1811 MAIN ST RAMONA CA 92065-0000	NE	0.24 / 1,277.30	4	275
Handler ID Recycler Activity?: CAL000219530 NO							
16	HAZ SANDIEGO	Dollar Tree #05003	1853 MAIN ST RAMONA CA 92065-2512	NE	0.24 / 1,280.22	2	277
16	RCRA VSQG	DOLLAR TREE #05003	1853 MAIN ST STE J RAMONA CA 92065	NE	0.24 / 1,280.22	2	286
Handler ID Recycler Activity?: CAL000377750 NO							
17	HAZ SANDIEGO	John R. Harper III, M.D., APC	1834 MAIN ST 1834 MAIN ST RAMONA CA 92065	ENE	0.24 / 1,282.92	0	290
18	AST	OIL CHANGER #619	1809 MAIN ST, RAMONA, 92065- CA	NE	0.25 / 1,302.09	4	291
18	C&D DEBRIS RECY	OIL CHANGER #619	1809 MAIN ST RAMONA CA 92065	NE	0.25 / 1,302.09	4	291

Map Key	DB	Company/Site Name	Address	Direction	Distance (mi/ft)	Elev Diff (ft)	Page Number
18	CERS TANK	OIL CHANGERS #619	1809 MAIN ST RAMONA CA 92065 <i>Site ID:</i> 139740	NE	0.25 / 1,302.09	4	292
18	HAZ SANDIEGO	OIL CHANGERS #619	1809 MAIN ST RAMONA CA 92065	NE	0.25 / 1,302.09	4	296
18	RCRA NON GEN	OIL CHANGERS #619	1809 MAIN STREET RAMONA CA 92065-0000 <i>Handler ID Recycler Activity?:</i> CAL000123149 NO	NE	0.25 / 1,302.09	4	305
19	RCRA TSD	WILLIAM SMITH	2230 TOUB ST RAMONA CA 92065 <i>Handler ID Recycler Activity?:</i> CAC003006712 NO	W	0.28 / 1,500.50	-7	307
20	C&D DEBRIS RECY	MAIN STREET AUTO CARE	2317 MAIN ST STE A RAMONA CA 92065	SW	0.32 / 1,674.75	-15	310
20	C&D DEBRIS RECY	RAMONA MOTOR WORKS, INC.	2317 MAIN ST STE D RAMONA CA 92065	SW	0.32 / 1,674.75	-15	310
21	CLEANUP SITES	BIG BEAR MARKETS	405 RAMONA ST RAMONA CA 92065 <i>Global ID:</i> T0608106941	ENE	0.34 / 1,772.25	1	310
21	SAM SANDIEGO	BIG BEAR MARKETS	405 RAMONA ST RAMONA CA 92065	ENE	0.34 / 1,772.25	1	313
22	PFAS IND	DWZ VENTURES LLC	RAMONA CA	SW	0.36 / 1,918.32	-16	313
23	LDS	Jamal Habib Trust Site Discharge to San Diego Fairy Shrimp Vernal Pools	1703 Main Street Ramona CA 92065	NE	0.40 / 2,100.18	4	314
24	SAM SANDIEGO	JMPCO LAND DEVELOPMENT	CA	ESE	0.43 / 2,288.72	5	316
25	LUST	JMPCO LAND DEVELOPMENT	1839 RAMSEY LN RAMONA CA 92065 <i>Global ID Status:</i> T0607300375	ESE	0.44 / 2,323.60	5	317
26	SCH	OLIVE PIERCE MIDDLE SCHOOL	1521 Hanson Lane Ramona CA 92065 <i>Envirostor ID:</i> 37820022 <i>Cleanup Status:</i> NO ACTION REQUIRED AS OF 8/28/2003	ESE	0.81 / 4,302.67	14	319

Map Key	DB	Company/Site Name	Address	Direction	Distance (mi/ft)	Elev Diff (ft)	Page Number
<u>27</u>	MRDS	HATFIELD CREEK CLAIM	SAN DIEGO COUNTY RAMONA CA 92065 <i>Dep ID: 10214055</i>	NE	0.87 / 4,617.21	-3	<u>321</u>
<u>28</u>	SCH	RAMONA HIGH SCHOOL	1401 Hanson Lane Ramona CA 92065 <i>Envirostor ID: 60000007</i> <i>Cleanup Status: NO ACTION REQUIRED AS OF 12/21/2005</i>	ESE	0.95 / 5,010.71	19	<u>321</u>
<u>29</u>	FUDS	RAMONA BOMBING TARGET/EMERGENY	RAMONA CA <i>FUDS Property No: J09CA1069</i>	WNW	0.95 / 5,019.93	-25	<u>323</u>
<u>30</u>	INSP COMP ENF	COUNTY OF SAN DIEGO RAMONA PHHWCF	324 MAPLE ST RAMONA CA 92065	NE	0.97 / 5,135.25	21	<u>324</u>

Executive Summary: Summary by Data Source

Standard

Federal

RCRA TSD - RCRA non-CORRACTS TSD Facilities

A search of the RCRA TSD database, dated Nov 30, 2025 has found that there are 1 RCRA TSD site(s) within approximately 0.50miles of the project property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
WILLIAM SMITH	2230 TOUB ST RAMONA CA 92065	W	0.28 / 1,500.50	19
<i>Handler ID Recycler Activity?: CAC003006712 NO</i>				

RCRA VSQG - RCRA Very Small Quantity Generators List

A search of the RCRA VSQG database, dated Nov 30, 2025 has found that there are 1 RCRA VSQG site(s) within approximately 0.25 miles of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
DOLLAR TREE #05003	1853 MAIN ST STE J RAMONA CA 92065	NE	0.24 / 1,280.22	16
<i>Handler ID Recycler Activity?: CAL000377750 NO</i>				

RCRA NON GEN - RCRA Non-Generators

A search of the RCRA NON GEN database, dated Nov 30, 2025 has found that there are 20 RCRA NON GEN site(s) within approximately 0.25miles of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
BJ'S RENTALS INC.	2055 MAIN STREET RAMONA CA 92065	SSW	0.01 / 50.56	3
<i>Handler ID Recycler Activity?: CAL000295045 NO</i>				
SUNBELT RENTALS PC 1326	2055 MAIN ST RAMONA CA 92065	SSW	0.01 / 50.56	3
<i>Handler ID Recycler Activity?: CAL000453957 NO</i>				
GMBC REAL ESTATE	1939 MAIN STREET RAMONA CA 92065	NE	0.07 / 355.62	4
<i>Handler ID Recycler Activity?: CAC003155771 NO</i>				
DISCOUNT RV INC	1939 MAIN ST RAMONA CA 92065	NE	0.07 / 355.62	4
<i>Handler ID Recycler Activity?: CAL000478193 NO</i>				
HIGH-COUNTRY CHEV-OLDS INC	1939 MAIN ST\ RAMONA CA 92065	NE	0.07 / 355.62	4

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
Handler ID Recycler Activity?: CAD981686470 NO				
JEFF READE CHEVROLET OLDSMOBILE	1939 MAIN ST RAMONA CA 92065	NE	0.07 / 355.62	<u>4</u>
Handler ID Recycler Activity?: CAD056297476 NO				
RAMONA RV&AUTO	1939 MAIN ST RAMONA CA 92065	NE	0.07 / 355.62	<u>4</u>
Handler ID Recycler Activity?: CAL000439898 NO				
SUN VALLEY BODY & PAINT	1939 MAIN ST STE R RAMONA CA 92065-0000	NE	0.07 / 355.62	<u>4</u>
Handler ID Recycler Activity?: CAL000209651 NO				
O'REILLY AUTO PARTS STORE 2724	1935 MAIN ST RAMONA CA 92065	ENE	0.08 / 443.49	<u>5</u>
Handler ID Recycler Activity?: CAL000392583 NO				
RAMONA AUTO INC, DBA RAMONA AUTOMOTIVE	1936 MAIN ST RAMONA CA 92065	ENE	0.08 / 445.99	<u>6</u>
Handler ID Recycler Activity?: CAL000399681 NO				
RAMONA AUTOMOTIVE INC	1936 MAIN ST RAMONA CA 92065	ENE	0.08 / 445.99	<u>6</u>
Handler ID Recycler Activity?: CAL000464077 NO				
STARS PETROLEUM	1910 MAIN ST RAMONA CA 92065-2524	ENE	0.12 / 656.72	<u>10</u>
Handler ID Recycler Activity?: CAL000306036 NO				
AUTOZONE #2845	370 PALA ST RAMONA CA 92065-0000	ENE	0.18 / 935.37	<u>11</u>
Handler ID Recycler Activity?: CAL000219707 NO				
KMART #3678	1855 MAIN ST RAMONA CA 92065	NE	0.20 / 1,059.08	<u>12</u>
Handler ID Recycler Activity?: CAL000231575 NO				
KMART #3678	1855 MAIN ST RAMONA CA 92065	NE	0.20 / 1,059.08	<u>12</u>
Handler ID Recycler Activity?: CAL000409136 NO				
DBA TRACTION TIRE & SERVICE CENTER	1811 MAIN ST RAMONA CA 92065-0000	NE	0.24 / 1,277.30	<u>15</u>
Handler ID Recycler Activity?: CAL000219530 NO				
OIL CHANGERS #619	1809 MAIN STREET RAMONA CA 92065-0000	NE	0.25 / 1,302.09	<u>18</u>
Handler ID Recycler Activity?: CAL000123149 NO				

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
427 JULIAN ST	427 JULIAN ST RAMONA CA 92065	SSE	0.12 / 619.04	<u>8</u>
<i>Handler ID Recycler Activity?: CAC003202822 NO</i>				
TEAM CAR CARE WEST LLC DBA JIFFY LUBE	1850 MAIN ST RAMONA CA 92065	ENE	0.21 / 1,087.89	<u>13</u>
<i>Handler ID Recycler Activity?: CAL000439708 NO</i>				
TRACTOR SUPPLY COMPANY #1862	203 HUNTER ST RAMONA CA 92065	SW	0.21 / 1,096.15	<u>14</u>
<i>Handler ID Recycler Activity?: CAL000395864 NO</i>				

State

C&D DEBRIS RECY - Construction and Demolition Debris Recyclers

A search of the C&D DEBRIS RECY database, dated Jun 20, 2018 has found that there are 5 C&D DEBRIS RECY site(s) within approximately 0.50miles of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
O'REILLY AUTO PARTS #2724	1935 MAIN STREET - HWY 67 RAMONA CA 92065	ENE	0.08 / 443.49	<u>5</u>
AUTOZONE #2845	370 PALA ST RAMONA CA 92065	ENE	0.18 / 935.37	<u>11</u>
OIL CHANGER #619	1809 MAIN ST RAMONA CA 92065	NE	0.25 / 1,302.09	<u>18</u>

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
RAMONA MOTOR WORKS, INC.	2317 MAIN ST STE D RAMONA CA 92065	SW	0.32 / 1,674.75	<u>20</u>
MAIN STREET AUTO CARE	2317 MAIN ST STE A RAMONA CA 92065	SW	0.32 / 1,674.75	<u>20</u>

LDS - Land Disposal Sites

A search of the LDS database, dated Aug 11, 2025 has found that there are 1 LDS site(s) within approximately 0.50miles of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
Jamal Habib Trust Site Discharge to San Diego Fairy Shrimp Vernal Pools	1703 Main Street Ramona CA 92065	NE	0.40 / 2,100.18	<u>23</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>

LUST - Leaking Underground Fuel Tank Reports

A search of the LUST database, dated Sep 14, 2025 has found that there are 3 LUST site(s) within approximately 0.50miles of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
BJS RENTAL STORE	2055 MAIN ST RAMONA CA 920652525	SSW	0.01 / 50.56	3
	Global ID Status: T0607300711			
STARS PETROLEUM	1910 Main Street RAMONA CA 920652524	ENE	0.12 / 656.72	10
	Global ID Status: T0607391310			
JMPCO LAND DEVELOPMENT	1839 RAMSEY LN RAMONA CA 92065	ESE	0.44 / 2,323.60	25
	Global ID Status: T0607300375			

UST - Permitted Underground Storage Tank (UST) in GeoTracker

A search of the UST database, dated Nov 16, 2025 has found that there are 1 UST site(s) within approximately 0.25miles of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
STARS PETROLEUM INC	1910 MAIN ST RAMONA CA 92065	ENE	0.12 / 656.72	10
	Facility ID: 37-000-201678 Tank ID No. Tank Status Tank Closure Date: 28266 Confirmed/Updated Information , 28267 Confirmed/Updated Information , 32496 Confirmed/Updated Information , 28268 Confirmed/Updated Information			

HHSS - Historical Hazardous Substance Storage Information Database

A search of the HHSS database, dated Aug 27, 2015 has found that there are 1 HHSS site(s) within approximately 0.25miles of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
JEFF READE CHEVROLET-OLDSMOBIL	1939 MAIN ST. RAMONA CA 92065	NE	0.07 / 355.62	4

UST SWEEPS - Statewide Environmental Evaluation and Planning System

A search of the UST SWEEPS database, dated Oct 1, 1994 has found that there are 7 UST SWEEPS site(s) within approximately 0.25 miles of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
BJS RENTAL STORE	2055 MAIN ST RAMONA CA	SSW	0.01 / 50.56	3

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
C C Status: A37-000-5399 <i>ACTIVE</i>				
BJ'S RENTAL STORE	2055 MAIN ST RAMONA CA	SSW	0.01 / 50.56	<u>3</u>
C C Status: I37-000-5399 <i>INACTIVE</i> Tank ID: 000001				
RAMONA MOTORS INC	1939 MAIN ST RAMONA CA	NE	0.07 / 355.62	<u>4</u>
C C Status: I37-000-5223 <i>INACTIVE</i> Tank ID: 000001				
RAMONA MOTORS INC	1939 MAIN ST RAMONA CA	NE	0.07 / 355.62	<u>4</u>
C C Status: A37-000-5223 <i>ACTIVE</i>				
RAMONA AUTOMOTIVE	1936 MAIN ST RAMONA CA	ENE	0.08 / 445.99	<u>6</u>
C C Status: A37-000-13183 <i>ACTIVE</i>				
RAMONA AUTOMOTIVE	1936 MAIN ST RAMONA CA	ENE	0.08 / 445.99	<u>6</u>
C C Status: I37-000-13183 <i>INACTIVE</i> Tank ID: 000001				
RAMONA DAY & NITE	1910 MAIN ST RAMONA CA	ENE	0.12 / 656.72	<u>10</u>
C C Status: A37-000-29206 <i>ACTIVE</i> Tank ID: 000001, 000002, 000003				

AST - Aboveground Storage Tanks

A search of the AST database, dated Aug 31, 2009 has found that there are 2 AST site(s) within approximately 0.25miles of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
BJ'S RENTALS INC	2055 MAIN STREET, RAMONA, 92065 CA	SSW	0.01 / 50.56	<u>3</u>
OIL CHANGER #619	1809 MAIN ST, RAMONA, 92065- CA	NE	0.25 / 1,302.09	<u>18</u>

DELISTED TNK - Delisted Storage Tanks

A search of the DELISTED TNK database, dated Jan 16, 2026 has found that there are 3 DELISTED TNK site(s) within approximately 0.25miles of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
SUN VALLEY BODY & PAINT	1939 MAIN ST R RAMONA CA 92065	NE	0.07 / 355.62	<u>4</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
RAMONA AUTOMOTIVE	1936 MAIN ST RAMONA CA 92065	ENE	0.08 / 445.99	6
RAMONA DAY & NITE MOBIL	1910 MAIN ST RAMONA CA 92065	ENE	0.12 / 656.72	10

CERS TANK - California Environmental Reporting System (CERS) Tanks

A search of the CERS TANK database, dated Jan 12, 2026 has found that there are 4 CERS TANK site(s) within approximately 0.25 miles of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
Sunbelt Rentals PC 1326	2055 MAIN ST RAMONA CA 92065 <i>Site ID: 387922</i>	SSW	0.01 / 50.56	3
STARS PETROLEUM INC	1910 MAIN ST RAMONA CA 92065 <i>Site ID: 156920</i>	ENE	0.12 / 656.72	10
OIL CHANGERS #619	1809 MAIN ST RAMONA CA 92065 <i>Site ID: 139740</i>	NE	0.25 / 1,302.09	18

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
Jiffy Lube #3777	1850 MAIN ST RAMONA CA 92065 <i>Site ID: 547382</i>	ENE	0.21 / 1,087.89	13

HIST TANK - Historical Hazardous Substance Storage Container Information - Facility Summary

A search of the HIST TANK database, dated May 27, 1988 has found that there are 1 HIST TANK site(s) within approximately 0.25 miles of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
JEFF READE CHEVROLET-OLDSMOBIL	1939 MAIN ST. RAMONA CA	NE	0.07 / 355.62	4

CLEANUP SITES - GeoTracker Cleanup Program Sites

A search of the CLEANUP SITES database, dated Aug 11, 2025 has found that there are 1 CLEANUP SITES site(s) within approximately 0.50miles of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
BIG BEAR MARKETS	405 RAMONA ST RAMONA CA 92065	ENE	0.34 / 1,772.25	21

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>

Global ID: T0608106941

County

LOP SANDIEGO - San Diego County - Local Oversight Program List

A search of the LOP SANDIEGO database, dated Jun 15, 2020 has found that there are 2 LOP SANDIEGO site(s) within approximately 0.50miles of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>

BJS RENTAL STORE	2055 MAIN ST, RAMONA, CA 92065 RAMONA CA	SSW	0.01 / 50.56	<u>3</u>

Record ID | Record Status: DEH1991-LSAM-H05399-001 | Completed

RAMONA DAY & NITE MOBIL	1910 HIGHWAY 67, RAMONA, CA 92065 RAMONA CA	ENE	0.12 / 656.72	<u>10</u>

Record ID | Record Status: DEH2000-LSAM-H29206-001 | Completed

HAZ SANDIEGO - San Diego County - Hazardous Materials Management Division Database

A search of the HAZ SANDIEGO database, dated Jul 19, 2024 has found that there are 24 HAZ SANDIEGO site(s) within approximately 0.25miles of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>

PRESTIGE II AUTO COLLISION	2037 MAIN ST RAMONA CA	ESE	0.00 / 0.00	<u>1</u>

SUPERIOR AUTOMOTIVE	2037 MAIN ST RAMONA CA	ESE	0.00 / 0.00	<u>1</u>

Malcolm J Boykin, DDS	2005 MAIN ST 2005 MAIN ST RAMONA CA 92065	ENE	0.01 / 45.54	<u>2</u>

BJS RENTAL STORE	2055 MAIN ST RAMONA CA	SSW	0.01 / 50.56	<u>3</u>

Sunbelt Rentals PC 1326	2055 MAIN ST RAMONA CA 92065	SSW	0.01 / 50.56	<u>3</u>

HSS RENTX	2055 MAIN ST RAMONA CA	SSW	0.01 / 50.56	<u>3</u>

RAMONA TRUCK & AUTO	1939 MAIN ST RAMONA CA	NE	0.07 / 355.62	<u>4</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
TANGUAY AUTOMOTIVE INC	1939 MAIN ST RAMONA CA	NE	0.07 / 355.62	<u>4</u>
TANGUAY'S RAMONA TRUCK & AUTO	1939 MAIN ST A 1939 MAIN ST RAMONA CA 92065	NE	0.07 / 355.62	<u>4</u>
Discount RV INC	1939 MAIN ST R RAMONA CA 92065	NE	0.07 / 355.62	<u>4</u>
O'Reilly Auto Parts #2724	1935 MAIN ST RAMONA CA 92065	ENE	0.08 / 443.49	<u>5</u>
RAMONA AUTOMOTIVE	1936 MAIN ST RAMONA CA 92065	ENE	0.08 / 445.99	<u>6</u>
Taco Bell #41609	1925 MAIN ST, SUITE# A RAMONA, CA 92065 RAMONA CA 92065	ENE	0.10 / 547.28	<u>7</u>
Leslie's Swimming Pool Supplies #653	1905 MAIN ST 1905 MAIN ST RAMONA CA	ENE	0.12 / 632.95	<u>9</u>
STARS PETROLEUM INC	1910 MAIN ST RAMONA CA 92065	ENE	0.12 / 656.72	<u>10</u>
RAMONA DAY & NITE MOBIL	1910 MAIN ST RAMONA CA	ENE	0.12 / 656.72	<u>10</u>
AutoZone #2845	370 PALA ST RAMONA CA 92065	ENE	0.18 / 935.37	<u>11</u>
Kmart #3678	1855 MAIN ST 1855 MAIN ST RAMONA CA 92065	NE	0.20 / 1,059.08	<u>12</u>
RAMONA TIRE PROS & SERVICE CENTER	1811 MAIN ST RAMONA CA 92065	NE	0.24 / 1,277.30	<u>15</u>
Dollar Tree #05003	1853 MAIN ST RAMONA CA 92065-2512	NE	0.24 / 1,280.22	<u>16</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
John R. Harper III, M.D., APC	1834 MAIN ST 1834 MAIN ST RAMONA CA 92065	ENE	0.24 / 1,282.92	17
OIL CHANGERS #619	1809 MAIN ST RAMONA CA 92065	NE	0.25 / 1,302.09	18
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
Jiffy Lube #3777	1850 MAIN ST RAMONA CA 92065	ENE	0.21 / 1,087.89	13
Tractor Supply Company Store #1862- Ramona	203 HUNTER ST RAMONA CA 92065	SW	0.21 / 1,096.15	14

UST SANDIEGO - San Diego County - UST List

A search of the UST SANDIEGO database, dated Nov 27, 2025 has found that there are 3 UST SANDIEGO site(s) within approximately 0.25miles of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
Discount RV INC	1939 MAIN ST R RAMONA CA 92065	NE	0.07 / 355.62	4
<i>Record ID Permit Status: DEH2002-HUPFP-105223 Permit Renewed</i>				
RAMONA AUTOMOTIVE	1936 MAIN ST RAMONA CA 92065	ENE	0.08 / 445.99	6
<i>Record ID Permit Status: DEH2002-HUPFP-113183 Permit Renewed</i>				
STARS PETROLEUM INC	1910 MAIN ST RAMONA CA 92065	ENE	0.12 / 656.72	10
<i>Record ID Permit Status: DEH2003-HUPFP-201678 Permit Renewed</i>				

SAM SANDIEGO - San Diego County - Site Assessment and Mitigation Investigation Sites

A search of the SAM SANDIEGO database, dated Oct 26, 2025 has found that there are 4 SAM SANDIEGO site(s) within approximately 0.50miles of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
BJS RENTAL STORE	2055 MAIN ST RAMONA CA 92065	SSW	0.01 / 50.56	3
RAMONA DAY & NITE MOBIL	1910 HIGHWAY 67 RAMONA CA 92065	ENE	0.12 / 656.72	10

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
BIG BEAR MARKETS	405 RAMONA ST RAMONA CA 92065	ENE	0.34 / 1,772.25	21
JMPCO LAND DEVELOPMENT	CA	ESE	0.43 / 2,288.72	24

Non Standard

Federal

FINDS/FRS - Facility Registry Service/Facility Index

A search of the FINDS/FRS database, dated Jan 1, 2026 has found that there are 2 FINDS/FRS site(s) within approximately 0.02miles of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
BJ'S RENTALS INC.	2055 MAIN ST RAMONA CA 920652525 <i>Registry ID: 110065601897</i>	SSW	0.01 / 50.56	3
SUNBELT RENTALS PC 1326	2055 MAIN ST RAMONA CA 92065 <i>Registry ID: 110070800661</i>	SSW	0.01 / 50.56	3

PFAS IND - PFAS Industry Sectors

A search of the PFAS IND database, dated Feb 16, 2026 has found that there are 1 PFAS IND site(s) within approximately 0.50miles of the project property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
DWZ VENTURES LLC	RAMONA CA	SW	0.36 / 1,918.32	22

FUDS - Formerly Used Defense Sites

A search of the FUDS database, dated May 15, 2023 has found that there are 1 FUDS site(s) within approximately 1.00miles of the project property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
RAMONA BOMBING TARGET/EMERGENY	RAMONA CA <i>FUDS Property No: J09CA1069</i>	WNW	0.95 / 5,019.93	29

MRDS - Mineral Resource Data System

A search of the MRDS database, dated Mar 15, 2016 has found that there are 1 MRDS site(s) within approximately 1.00miles of the project property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
HATFIELD CREEK CLAIM	SAN DIEGO COUNTY RAMONA CA 92065	NE	0.87 / 4,617.21	27
<i>Dep ID: 10214055</i>				

State

INSP COMP ENF - EnviroStor Inspection, Compliance, and Enforcement

A search of the INSP COMP ENF database, dated Feb 9, 2026 has found that there are 1 INSP COMP ENF site(s) within approximately 1.00miles of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
COUNTY OF SAN DIEGO RAMONA PHHWCF	324 MAPLE ST RAMONA CA 92065	NE	0.97 / 5,135.25	30

SCH - School Property Evaluation Program Sites

A search of the SCH database, dated Oct 2, 2025 has found that there are 2 SCH site(s) within approximately 1.00miles of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
OLIVE PIERCE MIDDLE SCHOOL	1521 Hanson Lane Ramona CA 92065	ESE	0.81 / 4,302.67	26
<i>Envirostor ID: 37820022</i> <i>Cleanup Status: NO ACTION REQUIRED AS OF 8/28/2003</i>				
RAMONA HIGH SCHOOL	1401 Hanson Lane Ramona CA 92065	ESE	0.95 / 5,010.71	28
<i>Envirostor ID: 60000007</i> <i>Cleanup Status: NO ACTION REQUIRED AS OF 12/21/2005</i>				

HAZNET - Handlers from Hazardous Waste Manifest Data

A search of the HAZNET database, dated Feb 20, 2025 has found that there are 3 HAZNET site(s) within approximately 0.02miles of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
BORN AGAIN CARS	2037 MAIN RAMONA CA 920650000	ESE	0.00 / 0.00	1
1X VJ'S RENTAL STORES	2055 MAIN ST RAMONA CA 920650000	SSW	0.01 / 50.56	3
BJS RENTAL STORE	2055 MAIN RAMONA CA 920650000	SSW	0.01 / 50.56	3

HAZ GEN - Generators from Hazardous Waste Manifest Data

A search of the HAZ GEN database, dated Feb 20, 2025 has found that there are 6 HAZ GEN site(s) within approximately 0.02miles of

the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
PRESTIGE 2 AUTO COLLISION	2037 MAIN ST RAMONA CA 92065	ESE	0.00 / 0.00	<u>1</u>
JAMES L. HILL, DDS	2005 MAIN ST. RAMONA CA 920650000	ENE	0.01 / 45.54	<u>2</u>
RENTX INDUSTRIES INC	2055 MAIN ST RAMONA CA 920650000	SSW	0.01 / 50.56	<u>3</u>
H S S RENTX	2055 MAIN ST RAMONA CA 920650000	SSW	0.01 / 50.56	<u>3</u>
SUNBELT RENTALS PC 1326	2055 MAIN ST RAMONA CA 92065	SSW	0.01 / 50.56	<u>3</u>
BJ'S RENTALS INC DBA BJ'S RENTALS	2055 MAIN ST RAMONA CA 92065	SSW	0.01 / 50.56	<u>3</u>

HIST MANIFEST - Historical Hazardous Waste Manifest Data

A search of the HIST MANIFEST database, dated Dec 31, 1992 has found that there are 1 HIST MANIFEST site(s) within approximately 0.02miles of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
	2055 MAIN ST RAMONA CA 920650000	SSW	0.01 / 50.56	<u>3</u>

CERS HAZ - California Environmental Reporting System (CERS) Hazardous Waste Sites

A search of the CERS HAZ database, dated Jan 12, 2026 has found that there are 5 CERS HAZ site(s) within approximately 0.12miles of the project property.


<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
Discount RV INC	1939 MAIN ST RAMONA CA 92065	NE	0.07 / 355.62	<u>4</u>
O'REILLY AUTO PARTS #2724	1935 MAIN ST RAMONA CA 92065	ENE	0.08 / 443.49	<u>5</u>
RAMONA AUTOMOTIVE	1936 MAIN ST RAMONA CA 92065	ENE	0.08 / 445.99	<u>6</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
Taco Bell #41609	1925 MAIN ST STE A RAMONA CA 92065	ENE	0.10 / 547.28	<u>7</u>
Leslie's Swimming Pool Supplies #653	1905 MAIN ST RAMONA CA 92065	ENE	0.12 / 632.95	<u>9</u>

EMISSIONS - Toxic Pollutant Emissions Facilities

A search of the EMISSIONS database, dated Dec 31, 2021 has found that there are 4 EMISSIONS site(s) within approximately 0.25 miles of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (mi/ft)</u>	<u>Map Key</u>
SUN VALLEY BODY & PAINT	1939 MAIN ST RAMONA CA 92065	NE	0.07 / 355.62	<u>4</u>
GVS SYSTEMS / RAMONA DAY N NIT	1910 MAIN ST RAMONA CA 92065	ENE	0.12 / 656.72	<u>10</u>
STARS PETROLEUM INC	1910 MAIN ST RAMONA CA 92065	ENE	0.12 / 656.72	<u>10</u>
GVS SYSTEMSRAMONA DAY N NIT	1910 MAIN ST RAMONA CA 92065	ENE	0.12 / 656.72	<u>10</u>

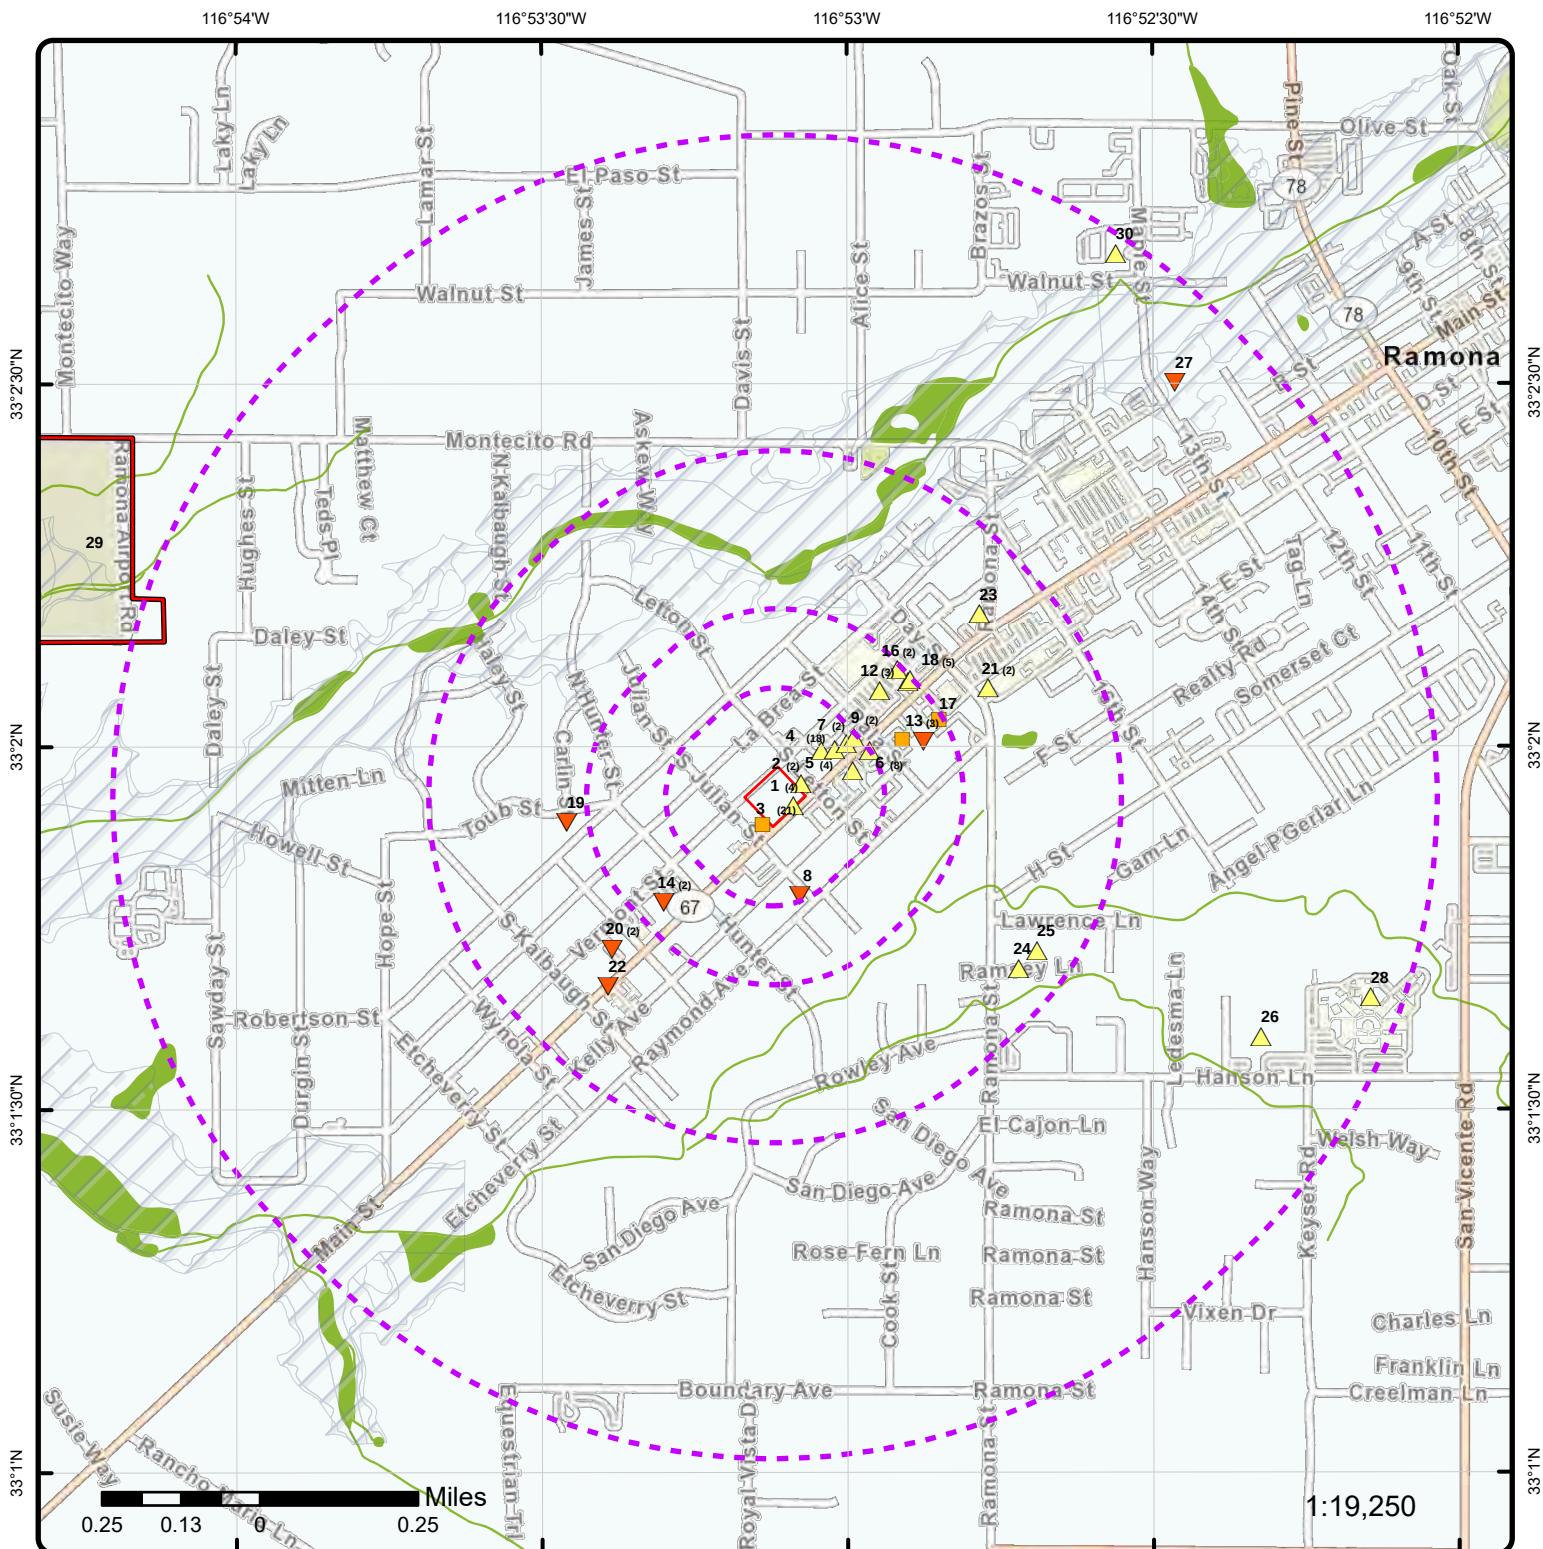

Map: 1.0 Mile Radius

Order Number: 26030800110

Address: Proposed Ramona Boutique Hotel, Ramona, CA



Project Property

Buffer Outline

▲ Sites with Higher Elevation

▲ Sites with Same Elevation

▲ Sites with Lower Elevation

○ Sites with Unknown Elevation

Areas with Higher Elevation

Areas with Same Elevation

Areas with Lower Elevation

Areas with Unknown Elevation

Freeways; Highways

Traffic Circle; Ramp

Major & Minor Arterial

Traffic Circle; Ramp

Local Road

Rail

State

Country

National Wetland


Indian Reserve Land

100 Year Flood Zone

500 Year Flood Zone

FWS Special Designation Areas

National Priorities List (Active, Delisted, Proposed, Institutional Control)

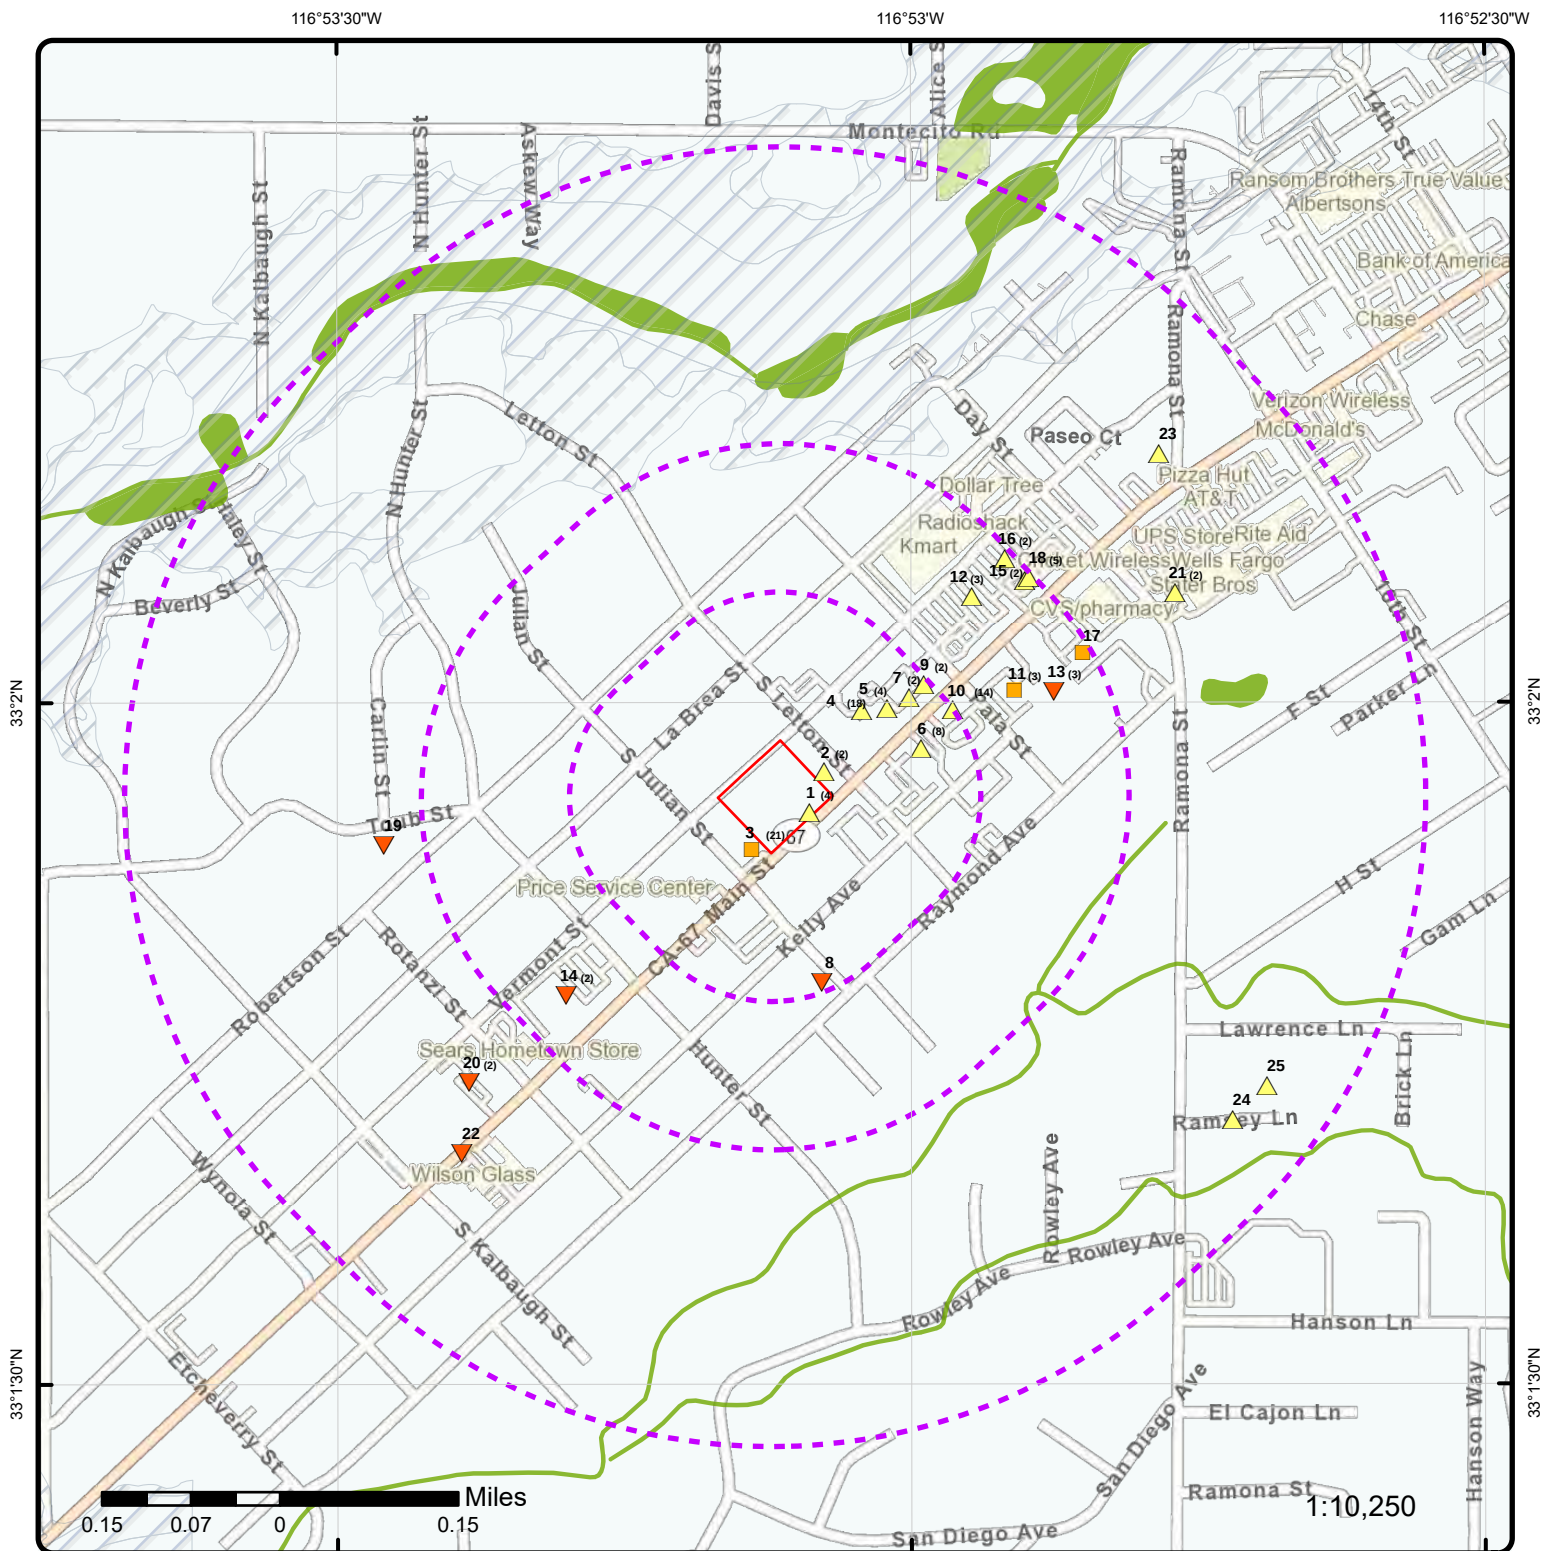

Map: 0.5 Mile Radius

Order Number: 26030800110

Address: Proposed Ramona Boutique Hotel, Ramona, CA



Project Property

Buffer Outline

▲ Sites with Higher Elevation

■ Sites with Same Elevation

▼ Sites with Lower Elevation

○ Sites with Unknown Elevation

Areas with Higher Elevation

Areas with Same Elevation

Areas with Lower Elevation

Areas with Unknown Elevation

Freeways; Highways

Traffic Circle; Ramp

Major & Minor Arterial

Traffic Circle; Ramp

Local Road

Rail

State

Country

National Wetland


Indian Reserve Land

100 Year Flood Zone

500 Year Flood Zone

FWS Special Designation Areas

National Priorities List (Active, Delisted, Proposed, Institutional Control)

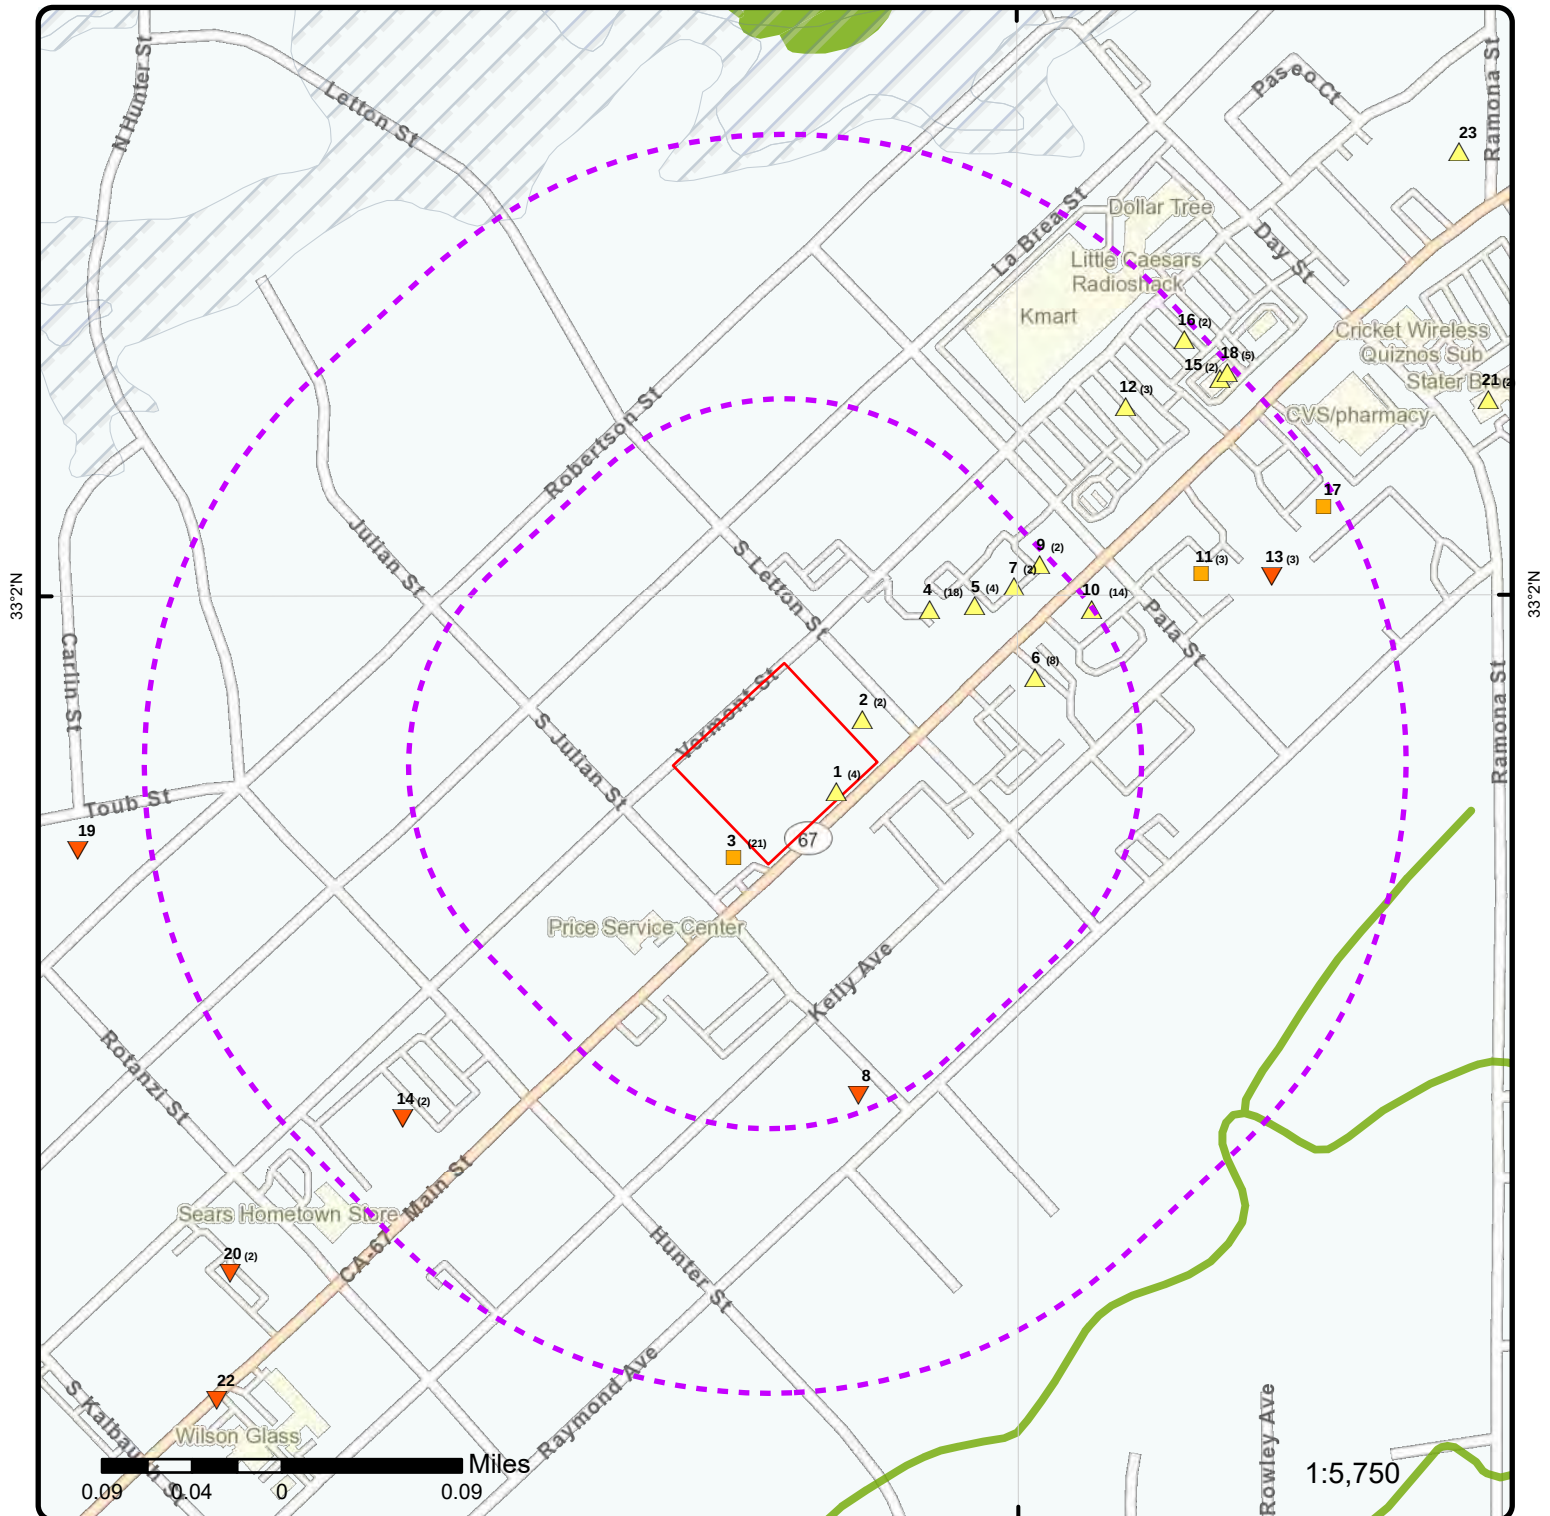

Map: 0.25 Mile Radius

Order Number: 26030800110

Address: Proposed Ramona Boutique Hotel, Ramona, CA



Project Property

Buffer Outline

▲ Sites with Higher Elevation

■ Sites with Same Elevation

▼ Sites with Lower Elevation

Sites with Unknown Elevation

Areas with Higher Elevation

Areas with Same Elevation

Areas with Lower Elevation

Areas with Unknown Elevation

Freeways; Highways

Traffic Circle; Ramp

Major & Minor Arterial

Traffic Circle; Ramp

Local Road

Rail

State

Country

National Wetland

Indian Reserve Land

100 Year Flood Zone

500 Year Flood Zone

FWS Special Designation Areas

National Priorities List (Active, Delisted, Proposed, Institutional Control)

116°53'30"W

116°53'W

116°52'30"W

33°2'30"N

33°2'30"N

33°2'N

33°2'N

33°1'30"N

33°1'30"N



Aerial

Year: 2025


Order Number: 26030800110

Address: Proposed Ramona Boutique Hotel, Ramona, CA



Source: ESRI World Imagery

© ERIS Information Limited Partnership

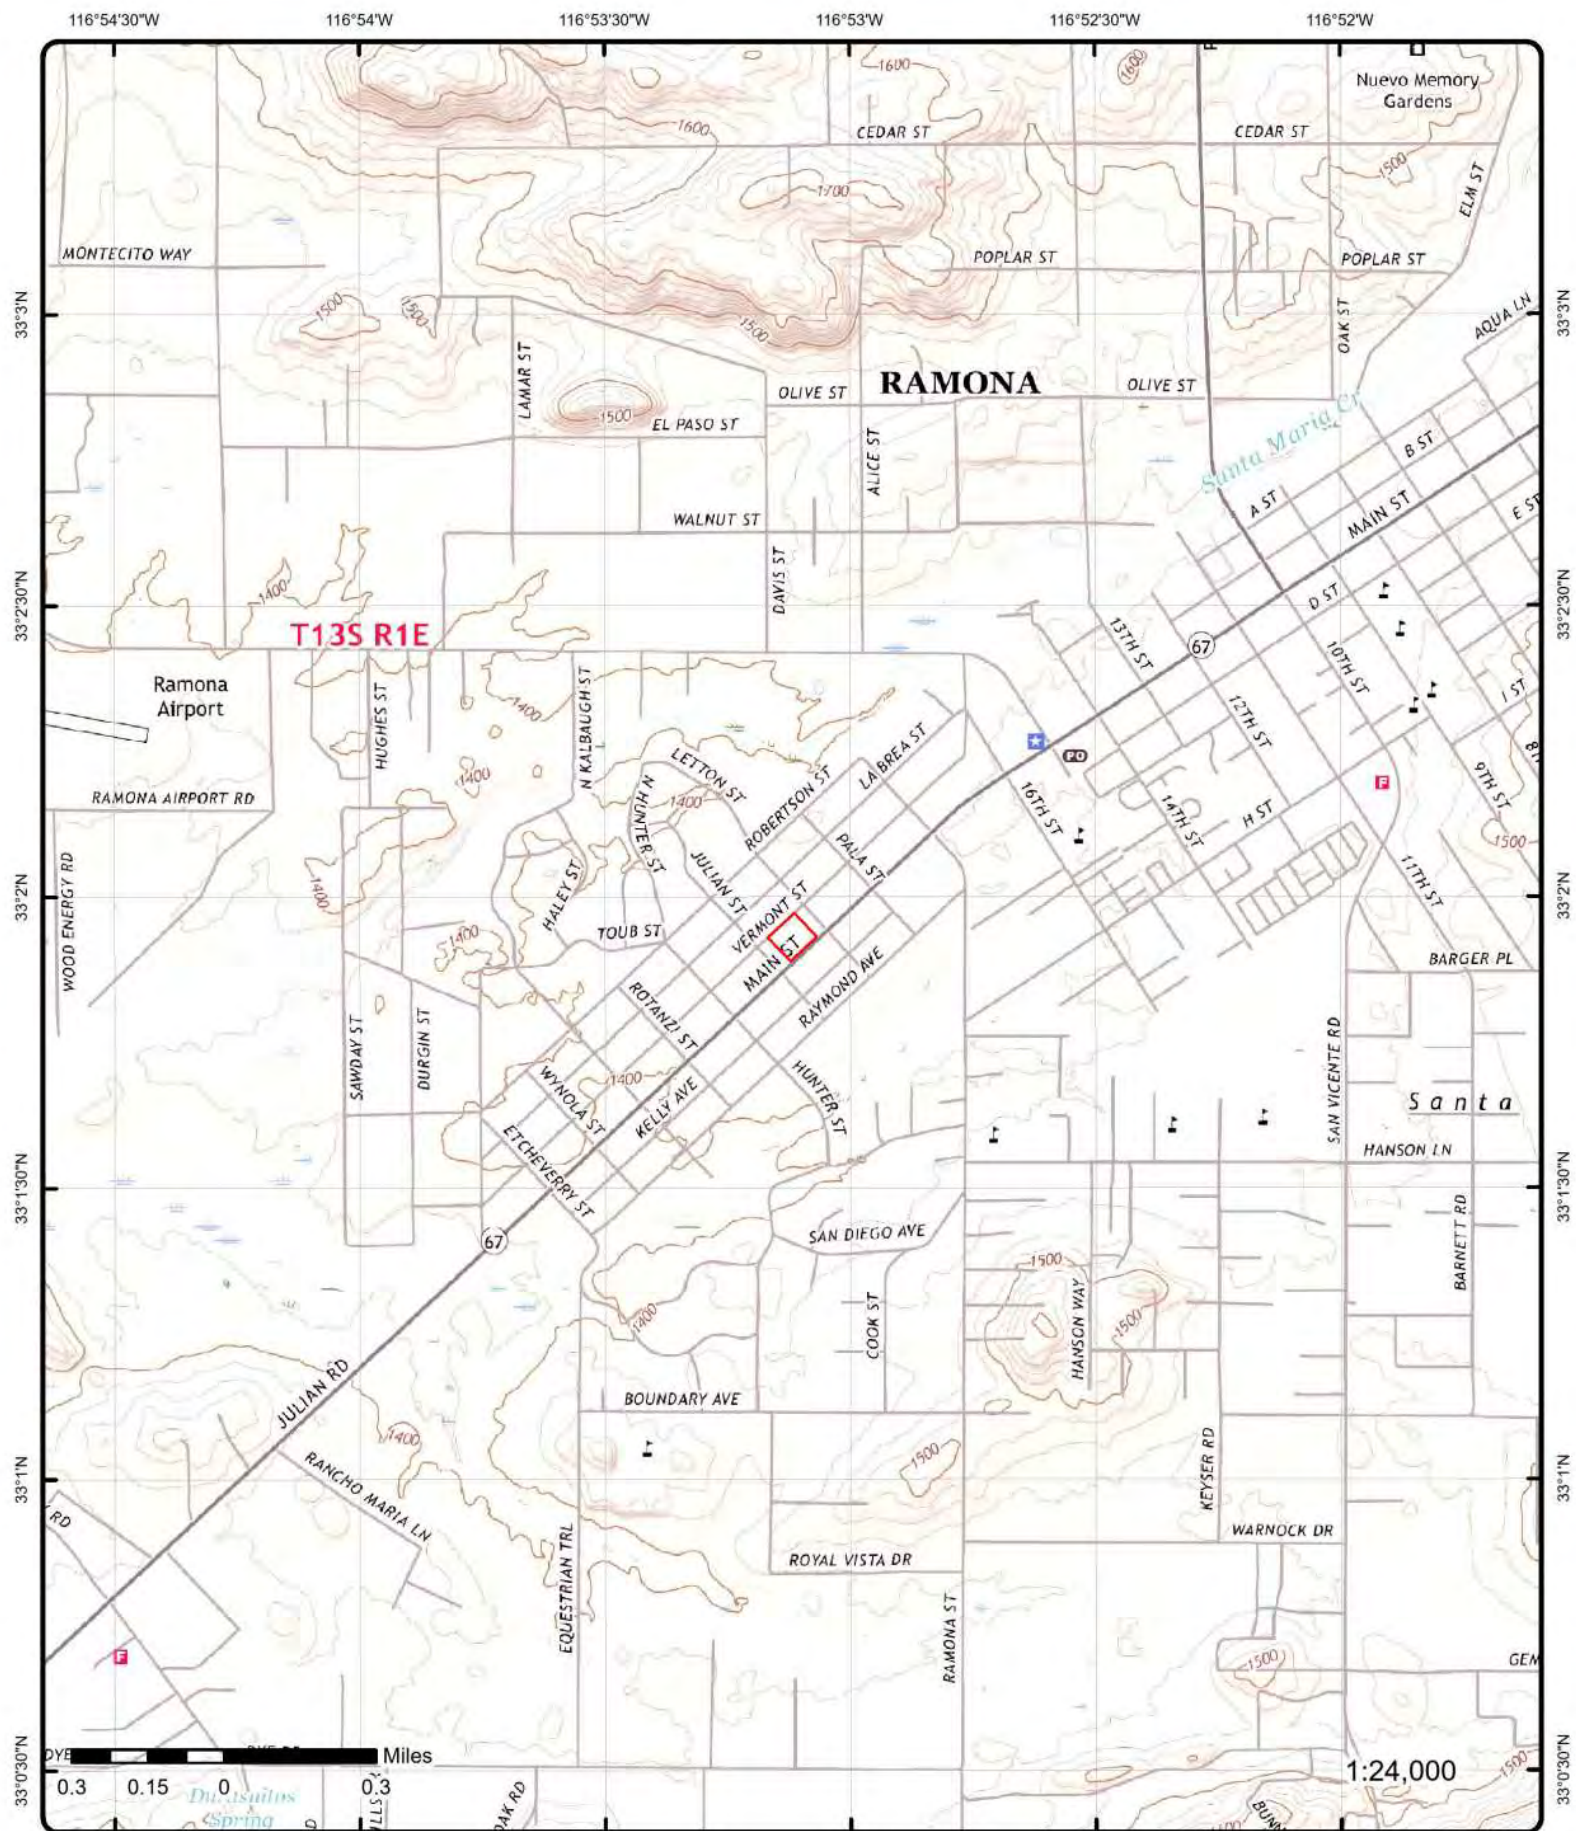

Topographic Map Year: 2021

Address: Proposed Ramona Boutique Hotel, CA

Quadrangle(s): Ramona CA, San Pasqual CA

Source: USGS Topographic Map

Order Number: 26030800110



© ERIS Information Inc.

Detail Report

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
1	1 of 4	ESE	0.00 / 0.00	1,418.96 / 1	PRESTIGE 2 AUTO COLLISION 2037 MAIN ST RAMONA CA 92065	HAZ GEN
EPA ID: CAL000345658 Address 2: Details DTSC HWTS: The Department of Toxic Substances Control (DTSC) makes available a Waste Code Matrix showing each Waste Code, its description, and annual amounts in its Hazardous Waste Tracking System: https://hwts.dtsc.ca.gov/search Handler Profile URL: https://hwts.dtsc.ca.gov/facility/CAL000345658						

1	2 of 4	ESE	0.00 / 0.00	1,418.96 / 1	PRESTIGE II AUTO COLLISION 2037 MAIN ST RAMONA CA	HAZ SANDIEGO
Record ID: DEH2009-HUPFP-211231 Facility Name: PRESTIGE II AUTO COLLISION Facility Address: 2037 MAIN ST, RAMONA, CA 92065 Facility City: RAMONA Facility Zip Code: 0 Facility Latitude: 33.032245232955944 Facility Longitude: -116.88536012791216 GIS Record ID: GIS Facility Name: GIS Facility Address: GIS Facility City: GIS Facility Zip Code: GIS Fac Latitude: GIS Fac Longitude: Tank Owner Name:						

HMD Inactive Permits Map Data

Facilityid:		Latitude WGS84:	0
Cers ID:		Longitude WGS84:	0
Featureid:	2821413300	Ust Facilitytype:	
Site Address:		Agencyname:	COSD
Street String:	2037 MAIN ST	Opened Date Dt:	2009-09-03 00:00:00 UTC
Point X:	6366940.78502	Creator:	
Point Y:	1955952.59989	Created Dt:	1970-01-01 00:00:00 UTC
X Mapcoord:	6366940.785	Editor:	
Y Mapcoord:	1955952.6	Edited Dt:	1970-01-01 00:00:00 UTC
Record Type:	LUEG-DEH/HMD/UPFP/Facility	Parcel No:	282-141-33-00
Record Alias:	Unified Program Facility Permit		
Record Status:	Permit Suspended		
Business Type:	Not Applicable		
Geo Src:	Mapped to record APN/parcel center XY		
Tot Above Ground Petroleum Cap:	0		
Rmp Calarp Level:			
Lrg Qty Mwgenerator:	No		
Own Operate Usts:			
Tot Num Usts:			
Own Operate Apsa Tank:			
Num Tanks 10kgal or Greater:			
Hazwaste Generator:	Yes		
On Site Haz Waste Treatment:			

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Rcra Lrg Qty Generator:						
Kivapertype Pernum:		HK18 211231				

<u>1</u>	3 of 4	ESE	0.00 / 0.00	1,418.96 / 1	SUPERIOR AUTOMOTIVE 2037 MAIN ST RAMONA CA	HAZ SANDIEGO

Record ID: DEH2002-HUPFP-132598
Facility Name: SUPERIOR AUTOMOTIVE
Facility Address: 2037 MAIN ST, RAMONA, CA 92065
Facility City: RAMONA
Facility Zip Code: 92065
Facility Latitude: 33.032245232955944
Facility Longitude: -116.88536012791216
GIS Record ID:
GIS Facility Name:
GIS Facility Address:
GIS Facility City:
GIS Facility Zip Code:
GIS Fac Latitude:
GIS Fac Longitude:
Tank Owner Name:

HMD Inactive Permits Map Data

Facilityid:		Latitude WGS84:	33.0321893
Cers ID:		Longitude WGS84:	-116.885295
Featureid:	2821413300	Ust Facilitytype:	
Site Address:		Agencyname:	COSD
Street String:	2037 MAIN ST	Opened Date Dt:	2002-05-04 00:00:00 UTC
Point X:	6366940.78502	Creator:	
Point Y:	1955952.59989	Created Dt:	1970-01-01 00:00:00 UTC
X Mapcoord:	6366940.785	Editor:	
Y Mapcoord:	1955952.6	Edited Dt:	1970-01-01 00:00:00 UTC
Record Type:	LUEG-DEH/HMD/UPFP/Facility	Parcel No:	282-141-33-00
Record Alias:	Unified Program Facility Permit		
Record Status:	Completed		
Business Type:	Auto Repair, General - Waste USTs Only		
Geo Src:	Mapped to record APN/parcel center XY		
Tot Above Ground Petroleum Cap:	0		
Rmp Calarp Level:			
Lrg Qty Mwgenerator:			
Own Operate Usts:			
Tot Num Usts:			
Own Operate Apsa Tank:	N		
Num Tanks 10kgal or Greater:			
Hazwaste Generator:	Yes		
On Site Haz Waste Treatment:			
Rcra Lrg Qty Generator:			
Kivapertype Pernum:	HK07 132598		

<u>1</u>	4 of 4	ESE	0.00 / 0.00	1,418.96 / 1	BORN AGAIN CARS 2037 MAIN RAMONA CA 920650000	HAZNET

EPA ID:	CAL000048101	Mailing City:	RAMONA
NAICS Code:		Mailing State:	CA
SIC Code:		Mailing Zip:	920650000
Create Date:	6/25/1991	Region Code:	4
Fac Act Ind:	No	Owner Name:	CRAIG GARY
Inact Date:	1/1/1995	Owner Addr 1:	--
County:	37	Owner Addr 2:	--
County Name:	San Diego	Owner City:	--
County:		Owner State:	99
Mail Name:		Owner Zip:	--

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Mailing Addr 1: 2037 MAIN				Owner Phone: 0000000000		
Mailing Addr 2:				Owner Fax:		
2	1 of 2	ENE	0.01 / 45.54	1,419.39 / 2	JAMES L. HILL, DDS 2005 MAIN ST. RAMONA CA 920650000	HAZ GEN
EPA ID: CAL000143103				Facility County: 37		
Address 2:				County: San Diego		
Details DTSC HWTS:		The Department of Toxic Substances Control (DTSC) makes available a Waste Code Matrix showing each Waste Code, its description, and annual amounts in its Hazardous Waste Tracking System: https://hwts.dtsc.ca.gov/search				
Handler Profile URL:		https://hwts.dtsc.ca.gov/facility/CAL000143103				
2	2 of 2	ENE	0.01 / 45.54	1,419.39 / 2	Malcolm J Boykin, DDS 2005 MAIN ST 2005 MAIN ST RAMONA CA 92065	HAZ SANDIEGO
Record ID:		DEH2002-HUPFP-150145				
Facility Name:		Malcolm J Boykin, DDS				
Facility Address:		2005 MAIN ST, RAMONA, CA 92065				
Facility City:		RAMONA				
Facility Zip Code:		92065				
Facility Latitude:		1956037.95200001				
Facility Longitude:		6367202.60000001				
GIS Record ID:						
GIS Facility Name:						
GIS Facility Address:						
GIS Facility City:						
GIS Facility Zip Code:						
GIS Fac Latitude:						
GIS Fac Longitude:						
Tank Owner Name:						
HMD Permits Map Data as of Feb 13, 2023						
GIS Facility ID:		37-000-150145		Parcel No:		282-141-35-00
GIS CERS ID:		10375207		Status:		
GIS Record Type:		LUEG-DEH/HMD/UPFP/Facility		Census Tract:		208.05
Per Type:				Parcel Zip:		92065
Per Sub Type:				Community:		Ramona
Per Cat:				Jurisdiction:		UNINCORPORATED
Record Status:		Permit Renewed		Basin No:		905.41
LRG QTY MW Gener:		No		BOS Dist:		2
EPA ID No:		CAL000143103		Tbpg Grid:		
RMP CAL ARP:		Not Applicable		Insp Dist:		HE017
Tank Owner:				Feature ID:		2821413500
SIC Code:		5172		Kiva Per Typ:		HK10 150145
NAICS Code:				Agency Name:		COSD
Exp Date:				Loc Name:		
Own/Operate USTs :				Score:		
UST Facility:				Side:		
Total No USTs:				User Fld:		
No of Tanks:				Addr Type:		
Own Oper APS:		N		Match Addr:		
Tot AGP Cap:		0		Match Type:		
Capacity LR:				Farm Nursery:		
Hazmat EHS:				Record Alias:		Unified Program Facility Permit
Hazmat Rad:				Hirt Flag:		No
Haz Waste G:		N		Indian or Territry:		
Haz Wst Coll Site:		N		County ID:		
Haz Waste Rad:		N		Zip:		
Haz Waste EHS:		N		X Coord:		6367202.6
Recycle100:		N		Y Coord:		1956037.952
RCRA LRG Qty:		N		X Map Coord:		
Accept Offs:		No		Y Map Coord:		

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Univ Waste Gen Typ:				Point X:	6367202.60000001	
Univ Waste Han:	No			Point Y:	1956037.95200001	
Toxic Gas:	No			Lat GS84:	33.0324842	
Email Perm:				Lon GS84:	-116.8845076	
Phone Perm:	760-789-2330					
Full Name:	Malcolm Boykin					
Site Address:	2005 MAIN ST					
Address:	2005 MAIN ST					
Business Type:	Medical Waste, Small Qty - No Treatment					
HW Tier:	Not Applicable					
Disclose Qty Haz Mat:	Y					
Onsite Haz Waste Tre:	N					
Bill Code:	Small Quantity Medical Waste Generators					
Bill Code 2:	Not Applicable					
Bill Code 3:	Not Applicable					
ER Con Name:	Malcolm Boykin					
ER Contact:	760-583-7696					
ER Con Title:	Owner					
ER Con Work Ph:	760-789-2330					
ARC APN:						
ARC Address:						
ARC City:						
ARC Zipcode:						
ARC State:						
Water Purv:	RAMONA MUNICIPAL WATER DISTRICT					
Fire Agency:	RAMONA MUNI WATER DIST					
Geo SRC:	Mapped to record APN/Parcel XY center					
Frhmbp Report Filename:	HMBP150145.pdf					
Frhmbp Sitemap Filename:						

3	1 of 21	SSW	0.01 / 50.56	1,417.75 / 0	BJ'S RENTALS INC 2055 MAIN STREET, RAMONA, 92065 CA	AST
Total Capacity(Gal):	2500			Owner Name:	BJ'S RENTALS INC	
CUPA:	San Diego			County:	San Diego	
3	2 of 21	SSW	0.01 / 50.56	1,417.75 / 0	Sunbelt Rentals PC 1326 2055 MAIN ST RAMONA CA 92065	CERS TANK
Site ID:	387922					
Latitude:	33.031689					
Longitude:	-116.885925					

Regulated Programs

EI ID:	10375303
EI Description:	Hazardous Waste Generator
EI ID:	10375303
EI Description:	Aboveground Petroleum Storage

Violations

Violation Date:	04/13/2017	Violation Source:	CERS
Violation Program:	HMRRP	Violation Division:	San Diego County Department of Env Health
Citation:	HSC 6.95 25508.1(a)-(f) - California Health and Safety Code, Chapter 6.95, Section(s) 25508.1(a)-(f)		
Violation Notes:			

Returned to compliance on 04/22/2017.

Violation Description:

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Failure to electronically update business plan within 30 days of any one of the following events:
 A 100 percent or more increase in the quantity of a previously disclosed material.
 Any handling of a previously undisclosed hazardous materials at or above reportable quantities.
 A change of business address, business ownership, or business name.
 A substantial change in the handler's operations that requires modification to any portion of the business plan.

Violations

Violation Date:	05/06/2015	Violation Source:	CERS
Violation Program:	HMRRP	Violation Division:	San Diego County Department of Env Health
Citation:	HSC 6.95 25508(a)(1) - California Health and Safety Code, Chapter 6.95, Section(s) 25508(a)(1)		
Violation Notes:			

Returned to compliance on 05/15/2015.

Violation Description:

Failure to complete and electronically submit a site map with all required content.

Violations

Violation Date:	05/06/2015	Violation Source:	CERS
Violation Program:	HMRRP	Violation Division:	San Diego County Department of Env Health
Citation:	HSC 6.95 25508.1(a)-(e) - California Health and Safety Code, Chapter 6.95, Section(s) 25508.1(a)-(e)		
Violation Notes:			

Returned to compliance on 05/15/2015.

Violation Description:

Failure to electronically update business plan within 30 days of any one of the following events:
 A 100 percent or more increase in the quantity of a previously disclosed material.
 Any handling of a previously undisclosed hazardous materials at or above reportable quantities.
 A change of business address, business ownership, or business name.

Violations

Violation Date:	05/06/2015	Violation Source:	CERS
Violation Program:	HW	Violation Division:	San Diego County Department of Env Health
Citation:	22 CCR 16 66266.130 - California Code of Regulations, Title 22, Chapter 16, Section(s) 66266.130		
Violation Notes:			

Returned to compliance on 05/18/2015.

Violation Description:

Failure to properly handle, manage, label, and recycle used oil and fuel filters.

Evaluations

Eval Date:	05/06/2015
Violations Found:	Yes
Eval General Type:	Compliance Evaluation Inspection
Eval Type:	Routine done by local agency
Eval Division:	San Diego County Department of Env Health
Eval Program:	HW
Eval Source:	CERS
Eval Notes:	

Inspector: Fitzmaurice Mark Inspection ID:4350733; Note: data in [EVAL Notes] field for some records is truncated from the source.

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Eval Date:	04/13/2017
Violations Found:	No
Eval General Type:	Compliance Evaluation Inspection
Eval Type:	Routine done by local agency
Eval Division:	San Diego County Department of Env Health
Eval Program:	HW
Eval Source:	CERS
Eval Notes:	

Inspector: Griffin Donelle Inspection ID:5655677; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date:	05/06/2015
Violations Found:	Yes
Eval General Type:	Compliance Evaluation Inspection
Eval Type:	Routine done by local agency
Eval Division:	San Diego County Department of Env Health
Eval Program:	HMRRP
Eval Source:	CERS
Eval Notes:	

Inspector: Fitzmaurice Mark Inspection ID:4350733; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date:	04/13/2017
Violations Found:	Yes
Eval General Type:	Compliance Evaluation Inspection
Eval Type:	Routine done by local agency
Eval Division:	San Diego County Department of Env Health
Eval Program:	HMRRP
Eval Source:	CERS
Eval Notes:	

Inspector: Griffin Donelle Inspection ID:5655677; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date:	07/18/2023
Violations Found:	No
Eval General Type:	Compliance Evaluation Inspection
Eval Type:	Routine done by local agency
Eval Division:	San Diego County Department of Env Health
Eval Program:	HW
Eval Source:	CERS
Eval Notes:	

Inspector: Patel Manan Inspection ID:7249059; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date:	07/18/2023
Violations Found:	No
Eval General Type:	Compliance Evaluation Inspection
Eval Type:	Routine done by local agency
Eval Division:	San Diego County Department of Env Health
Eval Program:	HMRRP
Eval Source:	CERS
Eval Notes:	

Inspector: Patel Manan Inspection ID:7249059; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date:	08/07/2020
Violations Found:	No
Eval General Type:	Compliance Evaluation Inspection
Eval Type:	Routine done by local agency
Eval Division:	San Diego County Department of Env Health
Eval Program:	HMRRP
Eval Source:	CERS
Eval Notes:	

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Inspector: Moreau Marie Inspection ID:6145866; Note: data in [EVAL Notes] field for some records is truncated from the source.

Affiliations

Affil Type Desc:	Operator
Entity Name:	SUNBELT RENTALS, INC.
Entity Title:	
Address:	
City:	
State:	
Country:	
Zip Code:	
Phone:	(760) 789-0931
Affil Type Desc:	CUPA District
Entity Name:	San Diego County Env Health Qlty
Entity Title:	
Address:	PO Box 129261
City:	San Diego
State:	CA
Country:	
Zip Code:	92112-9261
Phone:	(858) 505-6880
Affil Type Desc:	Legal Owner
Entity Name:	SUNBELT RENTALS, INC.
Entity Title:	
Address:	1799 Innovation Point
City:	Fort Mill
State:	SC
Country:	United States
Zip Code:	29715
Phone:	(803) 578-5914
Affil Type Desc:	Document Preparer
Entity Name:	MCox/SMilliken
Entity Title:	
Address:	
City:	
State:	
Country:	
Zip Code:	
Phone:	
Affil Type Desc:	Facility Mailing Address
Entity Name:	Mailing Address
Entity Title:	
Address:	1799 Innovation Point
City:	Fort Mill
State:	SC
Country:	
Zip Code:	29715
Phone:	
Affil Type Desc:	Property Owner
Entity Name:	Bradley J. Thomas
Entity Title:	
Address:	3959 Pacific Hwy
City:	San Diego
State:	CA
Country:	United States
Zip Code:	92110
Phone:	(858) 735-2723
Affil Type Desc:	Identification Signer
Entity Name:	Sean Milliken
Entity Title:	Branch Manager

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Address: City: State: Country: Zip Code: Phone: Affil Type Desc: Entity Name: Entity Title: Address: City: State: Country: Zip Code: Phone: Affil Type Desc: Entity Name: Entity Title: Address: City: State: Country: Zip Code: Phone:						
Environmental Contact Environmental Compliance 1799 Innovation Point Fort Mill SC 29715 Parent Corporation SUNBELT RENTALS, INC.						
Coordinates Env Int Type Code: Program ID: Latitude: Longitude: Coord Name: Ref Point Type Desc:						
HMBP 10375303 33.031690 -116.885930 Center of a facility or station.						
3	3 of21	SSW	0.01 / 50.56	1,417.75 / 0	BJ'S RENTALS INC. 2055 MAIN ST RAMONA CA 920652525	FINDS/FRS
Registry ID: FIPS Code: HUC Code: Site Type Name: Location Description: Supplemental Location: Create Date: Update Date: Interest Types: SIC Codes: SIC Code Descriptions: NAICS Codes: NAICS Code Descriptions: Conveyor: Federal Facility Code: Federal Agency Name: Tribal Land Code: Tribal Land Name: Congressional Dist No: Census Block Code: EPA Region Code: County Name: US/Mexico Border Ind: Latitude: Longitude: Reference Point: Coord Collection Method: Accuracy Value: Datum: Source:						
110065601897 06073 18070304 STATIONARY 13-OCT-15 15-OCT-15 STATE MASTER, UNSPECIFIED UNIVERSE 7359 EQUIPMENT RENTAL AND LEASING, NOT ELSEWHERE CLASSIFIED 532412 CONSTRUCTION, MINING, AND FORESTRY MACHINERY AND EQUIPMENT RENTAL AND LEASING. FRS-GEOCODE 52 060730208052036 09 SAN DIEGO Yes 33.03169 -116.88592 CENTER OF A FACILITY OR STATION ADDRESS MATCHING-HOUSE NUMBER 30 NAD83						

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Frs Facility Detail Report URL: https://ofmpub.epa.gov/frs_public2/fii_query_detail.disp_program_facility?p_registry_id=110065601897 Program Acronyms: CA-ENVIROVIEW:12531, CA-ENVIROVIEW:218083, RCRAINFO:CAL000295045						
3	4 of 21	SSW	0.01 / 50.56	1,417.75 / 0	SUNBELT RENTALS PC 1326 2055 MAIN ST RAMONA CA 92065	FINDS/FRS
Registry ID: 110070800661 FIPS Code: 06073 HUC Code: 18070304 Site Type Name: STATIONARY Location Description: Supplemental Location: Create Date: 10-JUN-20 Update Date: Interest Types: UNSPECIFIED UNIVERSE SIC Codes: SIC Code Descriptions: NAICS Codes: 562991 NAICS Code Descriptions: SEPTIC TANK AND RELATED SERVICES. Conveyor: RCRAINFO Federal Facility Code: Federal Agency Name: Tribal Land Code: Tribal Land Name: Congressional Dist No: 52 Census Block Code: 060730208052036 EPA Region Code: County Name: SAN DIEGO US/Mexico Border Ind: Yes Latitude: 33.031352 Longitude: -116.885476 Reference Point: ENTRANCE POINT OF A FACILITY OR STATION Coord Collection Method: GDT-ADDRESS MATCHING (GEOCODING) Accuracy Value: Datum: NAD83 Source: Frs Facility Detail Report URL: https://ofmpub.epa.gov/frs_public2/fii_query_detail.disp_program_facility?p_registry_id=110070800661 Program Acronyms: RCRAINFO:CAL000453957						
3	5 of 21	SSW	0.01 / 50.56	1,417.75 / 0	RENTX INDUSTRIES INC 2055 MAIN ST RAMONA CA 920650000	HAZ GEN
EPA ID: CAL000208847 Address 2: Details DTSC HWTS: The Department of Toxic Substances Control (DTSC) makes available a Waste Code Matrix showing each Waste Code, its description, and annual amounts in its Hazardous Waste Tracking System: https://hwts.dtsc.ca.gov/search Handler Profile URL: https://hwts.dtsc.ca.gov/facility/CAL000208847						
3	6 of 21	SSW	0.01 / 50.56	1,417.75 / 0	H S S RENTX 2055 MAIN ST RAMONA CA 920650000	HAZ GEN
EPA ID: CAL000272773 Address 2: Details DTSC HWTS: The Department of Toxic Substances Control (DTSC) makes available a Waste Code Matrix showing each Waste Code, its description, and annual amounts in its Hazardous Waste Tracking System:						

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Handler Profile URL:		https://hwts.dtsc.ca.gov/search https://hwts.dtsc.ca.gov/facility/CAL000272773				
3	7 of 21	SSW	0.01 / 50.56	1,417.75 / 0	BJ'S RENTALS INC DBA BJ'S RENTALS 2055 MAIN ST RAMONA CA 92065	HAZ GEN
EPA ID:		CAL000295045		Facility County:		SAN DIEGO
Address 2:		County:				
Details DTSC HWTS:						
Handler Profile URL:		https://hwts.dtsc.ca.gov/facility/CAL000295045				
Tanner Details						
Waste Category Code:		352				
Waste Category:		Other organic solids				
Yearly Totals:						
2020: 0.035						
2019: 0.035						
2018: 0.1875						
Waste Category Code:		343				
Waste Category:		Unspecified organic liquid mixture				
Yearly Totals:						
2020: 0.085						
2019: 0.085						
2018: 0.187						
Contact Details						
Contact Name:		MICHAEL CROUCH				
Mailing Street:		2341 DEERFIELD DRIVE				
Mailing City:		2341 DEERFIELD DRIVE				
Mailing Zip:		297150000				
Contact Phone:		8035785912				
Year:		2018				
Contact Details						
Contact Name:		MICHAEL CROUCH				
Mailing Street:		2341 DEERFIELD DRIVE				
Mailing City:		2341 DEERFIELD DRIVE				
Mailing Zip:		297150000				
Contact Phone:		8035785912				
Year:		2019				
Contact Details						
Contact Name:		MICHAEL CROUCH				
Mailing Street:		2341 DEERFIELD DRIVE				
Mailing City:		2341 DEERFIELD DRIVE				
Mailing Zip:		297150000				
Contact Phone:		8035785912				
Year:		2020				
3	8 of 21	SSW	0.01 / 50.56	1,417.75 / 0	SUNBELT RENTALS PC 1326 2055 MAIN ST RAMONA CA 92065	HAZ GEN

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
EPA ID: Address 2: Details DTSC HWTS: Handler Profile URL: CAL000453957 https://hwts.dtsc.ca.gov/facility/CAL000453957 Facility County: County: SAN DIEGO						
<u>Tanner Details</u>						
Waste Category Code: Waste Category: Yearly Totals: 343 Unspecified organic liquid mixture 2024: 0.14595						
Waste Category Code: Waste Category: Yearly Totals: 352 Other organic solids 2023: 0.1075 2022: 0.04 2021: 0.04						
<u>Contact Details</u>						
Contact Name: Mailing Street: Mailing City: Mailing Zip: Contact Phone: Year: MIKE CROUCH PG PE 1799 INNOVATION POINT 1799 INNOVATION POINT 297158298 7042222484 2022						
<u>Contact Details</u>						
Contact Name: Mailing Street: Mailing City: Mailing Zip: Contact Phone: Year: MIKE CROUCH PG PE 1799 INNOVATION POINT 1799 INNOVATION POINT 297158298 7042222484 2023						
<u>Contact Details</u>						
Contact Name: Mailing Street: Mailing City: Mailing Zip: Contact Phone: Year: MIKE CROUCH PG PE 1799 INNOVATION POINT 1799 INNOVATION POINT 297158298 7042222484 2024						
<u>Contact Details</u>						
Contact Name: Mailing Street: Mailing City: Mailing Zip: Contact Phone: Year: MIKE CROUCH PG PE 1799 INNOVATION POINT 1799 INNOVATION POINT 297158298 7042222484 2021						
3	9 of 21	SSW	0.01 / 50.56	1,417.75 / 0	BJS RENTAL STORE 2055 MAIN ST RAMONA CA	HAZ SANDIEGO

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Record ID: DEH2002-HUPFP-105399
Facility Name: BJS RENTAL STORE
Facility Address: 2055 MAIN ST, RAMONA, CA 92065
Facility City: RAMONA
Facility Zip Code: 92065
Facility Latitude: 33.032245232955944
Facility Longitude: -116.88536012791216
GIS Record ID:
GIS Facility Name:
GIS Facility Address:
GIS Facility City:
GIS Facility Zip Code:
GIS Fac Latitude:
GIS Fac Longitude:
Tank Owner Name:

HMD Inactive Permits Map Data

Facilityid:		Latitude WGS84:	33.0321893
Cers ID:		Longitude WGS84:	-116.885295
Featureid:	2821413300	Ust Facilitytype:	
Site Address:		Agencyname:	COSD
Street String:	2055 MAIN ST	Opened Date Dt:	2002-05-04 00:00:00 UTC
Point X:	6366940.78502	Creator:	
Point Y:	1955952.59989	Created Dt:	1970-01-01 00:00:00 UTC
X Mapcoord:	6366940.785	Editor:	
Y Mapcoord:	1955952.6	Edited Dt:	1970-01-01 00:00:00 UTC
Record Type:	LUEG-DEH/HMD/UPFP/Facility	Parcel No:	282-141-33-00
Record Alias:	Unified Program Facility Permit		
Record Status:	Completed		
Business Type:	Auto Repair, General - Waste USTs Only		
Geo Src:	Mapped to record APN/parcel center XY		
Tot Above Ground Petroleum Cap:	0		
Rmp Calarp Level:			
Lrg Qty Mwgenerator:			
Own Operate Usts:			
Tot Num Usts:			
Own Operate Apsa Tank:	N		
Num Tanks 10kgal or Greater:			
Hazwaste Generator:	Yes		
On Site Haz Waste Treatment:			
Rcra Lrg Qty Generator:			
Kivapertype Pernum:	HK07 105399		

3	10 of21	SSW	0.01 / 50.56	1,417.75 / 0	Sunbelt Rentals PC 1326 2055 MAIN ST RAMONA CA 92065	HAZ SANDIEGO

Record ID: DEH2005-HUPFP-205800
Facility Name: Sunbelt Rentals PC 1326
Facility Address: 2055 MAIN ST RAMONA, CA 92065
Facility City: RAMONA
Facility Zip Code: 92065
Facility Latitude: 33.032245232955745
Facility Longitude: -116.88536012791245
GIS Record ID: DEH2005-HUPFP-205800
GIS Facility Name: Sunbelt Rentals PC 1326
GIS Facility Address: 2055 MAIN ST
GIS Facility City: RAMONA
GIS Facility Zip Code: 92065
GIS Fac Latitude:
GIS Fac Longitude:
Tank Owner Name:

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Hazardous Materials Facility Data

CERS ID:	10375303	Haz Mat on Site:	true
Facility ID No:	37-000-205800	Haz Waste Generatr:	true
EPA ID No:	CAL000453957	Own/Oper Under:	false
Active Permit:	true	Own/Oper Above:	false
Permit Status:	Permit Renewed	Recycle:	false
Bus Phone:	760-789-0931	RCRA Large Qty Gen:	false
Bus Fax:	0	HHW Collection:	false
Last Updated:	07/19/2023 03:03:22 AM		
Mailing Address:	2341 Deerfield Drive, Fort Mill, SC 29715		
Onsite H Waste Treatment:	false		
New Georeferenced Column:			

Hazardous Waste and Materials

ID:	39458	Permit Status:	Permit Renewed
Child Record ID:	DEH2016-HCHEM-0114625	Active Permit:	true
CAS No:	68476-34-6	Haz Material Type:	Pure
Last Updated:	11/29/2016 02:36:53 AM	Trade Secret:	false
Chemical Name:	Diesel Fuel No. 2		
Common Name Inventory:	Diesel Fuel No. 2		
ID:	94733	Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HCHEM-0140917	Active Permit:	true
CAS No:	68476-34-6	Haz Material Type:	Pure
Last Updated:	11/29/2017 02:36:10 AM	Trade Secret:	false
Chemical Name:	Diesel Fuel No. 2		
Common Name Inventory:	Diesel Fuel No. 2		
ID:	182903	Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HCHEM-0191667	Active Permit:	true
CAS No:	68476-34-6	Haz Material Type:	Pure
Last Updated:	12/25/2019 01:30:07 AM	Trade Secret:	false
Chemical Name:	Diesel Fuel No. 2		
Common Name Inventory:	Diesel Fuel No. 2		
ID:	291504	Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HCHEM-0253649	Active Permit:	true
CAS No:	68476-34-6	Haz Material Type:	Pure
Last Updated:	03/18/2020 12:19:24 PM	Trade Secret:	false
Chemical Name:	Diesel Fuel No. 2		
Common Name Inventory:	Diesel Fuel No. 2		
ID:	299780	Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HCHEM-0258033	Active Permit:	true
CAS No:	68476-34-6	Haz Material Type:	Pure
Last Updated:	04/18/2020 02:15:28 AM	Trade Secret:	false
Chemical Name:	Diesel Fuel No. 2		
Common Name Inventory:	Diesel Fuel No. 2		
ID:	410751	Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HCHEM-0292837	Active Permit:	true
CAS No:	68476-34-6	Haz Material Type:	Pure
Last Updated:	11/24/2021 02:33:02 AM	Trade Secret:	false
Chemical Name:	Diesel Fuel No. 2		
Common Name Inventory:	Diesel Fuel No. 2		
ID:	519814	Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HCHEM-0342253	Active Permit:	true
CAS No:	68476-34-6	Haz Material Type:	Pure
Last Updated:	12/30/2022 02:31:26 AM	Trade Secret:	false
Chemical Name:	Diesel Fuel No. 2		
Common Name Inventory:	Diesel Fuel No. 2		
ID:	567177	Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HCHEM-0363670	Active Permit:	true

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
CAS No:	68476-34-6				Haz Material Type:	Pure
Last Updated:	07/19/2023 03:03:22 AM				Trade Secret:	false
Chemical Name:	Diesel Fuel No. 2					
Common Name Inventory:	Diesel Fuel No. 2					
ID:	39456				Permit Status:	Permit Renewed
Child Record ID:	DEH2016-HCHEM-0114623				Active Permit:	true
CAS No:	8006-61-9				Haz Material Type:	Pure
Last Updated:	11/29/2016 02:36:53 AM				Trade Secret:	false
Chemical Name:	GASOLINE					
Common Name Inventory:	REGULAR UNLEADED					
ID:	94731				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HCHEM-0140915				Active Permit:	true
CAS No:	8006-61-9				Haz Material Type:	Pure
Last Updated:	11/29/2017 02:36:10 AM				Trade Secret:	false
Chemical Name:	GASOLINE					
Common Name Inventory:	REGULAR UNLEADED					
ID:	182901				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HCHEM-0191665				Active Permit:	true
CAS No:	8006-61-9				Haz Material Type:	Pure
Last Updated:	12/25/2019 01:30:07 AM				Trade Secret:	false
Chemical Name:	GASOLINE					
Common Name Inventory:	REGULAR UNLEADED					
ID:	291502				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HCHEM-0253647				Active Permit:	true
CAS No:	8006-61-9				Haz Material Type:	Pure
Last Updated:	03/18/2020 12:19:24 PM				Trade Secret:	false
Chemical Name:	GASOLINE					
Common Name Inventory:	REGULAR UNLEADED					
ID:	299778				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HCHEM-0258031				Active Permit:	true
CAS No:	8006-61-9				Haz Material Type:	Pure
Last Updated:	04/18/2020 02:15:28 AM				Trade Secret:	false
Chemical Name:	GASOLINE					
Common Name Inventory:	REGULAR UNLEADED					
ID:	410753				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HCHEM-0292839				Active Permit:	true
CAS No:	8006-61-9				Haz Material Type:	Pure
Last Updated:	11/24/2021 02:33:02 AM				Trade Secret:	false
Chemical Name:	GASOLINE					
Common Name Inventory:	REGULAR UNLEADED					
ID:	519812				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HCHEM-0342251				Active Permit:	true
CAS No:	8006-61-9				Haz Material Type:	Pure
Last Updated:	12/30/2022 02:31:26 AM				Trade Secret:	false
Chemical Name:	GASOLINE					
Common Name Inventory:	REGULAR UNLEADED					
ID:	567175				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HCHEM-0363668				Active Permit:	true
CAS No:	8006-61-9				Haz Material Type:	Pure
Last Updated:	07/19/2023 03:03:22 AM				Trade Secret:	false
Chemical Name:	GASOLINE					
Common Name Inventory:	REGULAR UNLEADED					
ID:	39457				Permit Status:	Permit Renewed
Child Record ID:	DEH2016-HCHEM-0114624				Active Permit:	true
CAS No:					Haz Material Type:	Pure
Last Updated:	11/29/2016 02:36:53 AM				Trade Secret:	false
Chemical Name:	HYDRAULIC OILS / MOTOR OIL					
Common Name Inventory:	HYDRAULIC OILS / MOTOR OIL					
ID:	94732				Permit Status:	Permit Renewed

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Child Record ID:	DEH2017-HCHEM-0140916				Active Permit:	true
CAS No:					Haz Material Type:	Pure
Last Updated:	11/29/2017 02:36:10 AM				Trade Secret:	false
Chemical Name:	HYDRAULIC OILS / MOTOR OIL					
Common Name Inventory:	HYDRAULIC OILS / MOTOR OIL					
ID:	182902				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HCHEM-0191666				Active Permit:	true
CAS No:					Haz Material Type:	Pure
Last Updated:	12/25/2019 01:30:07 AM				Trade Secret:	false
Chemical Name:	HYDRAULIC OILS / MOTOR OIL					
Common Name Inventory:	HYDRAULIC OILS / MOTOR OIL					
ID:	291503				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HCHEM-0253648				Active Permit:	true
CAS No:					Haz Material Type:	Pure
Last Updated:	03/18/2020 12:19:24 PM				Trade Secret:	false
Chemical Name:	HYDRAULIC OILS / MOTOR OIL					
Common Name Inventory:	HYDRAULIC OILS / MOTOR OIL					
ID:	299779				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HCHEM-0258032				Active Permit:	true
CAS No:					Haz Material Type:	Pure
Last Updated:	04/18/2020 02:15:28 AM				Trade Secret:	false
Chemical Name:	HYDRAULIC OILS / MOTOR OIL					
Common Name Inventory:	HYDRAULIC OILS / MOTOR OIL					
ID:	410752				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HCHEM-0292838				Active Permit:	true
CAS No:					Haz Material Type:	Pure
Last Updated:	11/24/2021 02:33:02 AM				Trade Secret:	false
Chemical Name:	HYDRAULIC OILS / MOTOR OIL					
Common Name Inventory:	HYDRAULIC OILS / MOTOR OIL					
ID:	519813				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HCHEM-0342252				Active Permit:	true
CAS No:					Haz Material Type:	Pure
Last Updated:	12/30/2022 02:31:26 AM				Trade Secret:	false
Chemical Name:	HYDRAULIC OILS / MOTOR OIL					
Common Name Inventory:	HYDRAULIC OILS / MOTOR OIL					
ID:	567176				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HCHEM-0363669				Active Permit:	true
CAS No:					Haz Material Type:	Pure
Last Updated:	07/19/2023 03:03:22 AM				Trade Secret:	false
Chemical Name:	HYDRAULIC OILS / MOTOR OIL					
Common Name Inventory:	HYDRAULIC OILS / MOTOR OIL					
ID:	39455				Permit Status:	Permit Renewed
Child Record ID:	DEH2016-HCHEM-0114622				Active Permit:	true
CAS No:	68476-85-7				Haz Material Type:	Pure
Last Updated:	11/29/2016 02:36:53 AM				Trade Secret:	false
Chemical Name:	PROPANE					
Common Name Inventory:	PROPANE					
ID:	94730				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HCHEM-0140914				Active Permit:	true
CAS No:	68476-85-7				Haz Material Type:	Pure
Last Updated:	11/29/2017 02:36:10 AM				Trade Secret:	false
Chemical Name:	PROPANE					
Common Name Inventory:	PROPANE					
ID:	182900				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HCHEM-0191664				Active Permit:	true
CAS No:	68476-85-7				Haz Material Type:	Pure
Last Updated:	12/25/2019 01:30:07 AM				Trade Secret:	false
Chemical Name:	PROPANE					
Common Name Inventory:	PROPANE					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
ID:	291501				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HCHEM-0253646				Active Permit:	true
CAS No:	68476-85-7				Haz Material Type:	Pure
Last Updated:	03/18/2020 12:19:24 PM				Trade Secret:	false
Chemical Name:	PROPANE					
Common Name Inventory:	PROPANE					
ID:	299777				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HCHEM-0258030				Active Permit:	true
CAS No:	68476-85-7				Haz Material Type:	Pure
Last Updated:	04/18/2020 02:15:28 AM				Trade Secret:	false
Chemical Name:	PROPANE					
Common Name Inventory:	PROPANE					
ID:	410754				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HCHEM-0292840				Active Permit:	true
CAS No:	68476-85-7				Haz Material Type:	Pure
Last Updated:	11/24/2021 02:33:02 AM				Trade Secret:	false
Chemical Name:	PROPANE					
Common Name Inventory:	PROPANE					
ID:	519811				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HCHEM-0342250				Active Permit:	true
CAS No:	68476-85-7				Haz Material Type:	Pure
Last Updated:	12/30/2022 02:31:26 AM				Trade Secret:	false
Chemical Name:	PROPANE					
Common Name Inventory:	PROPANE					
ID:	567174				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HCHEM-0363667				Active Permit:	true
CAS No:	68476-85-7				Haz Material Type:	Pure
Last Updated:	07/19/2023 03:03:22 AM				Trade Secret:	false
Chemical Name:	PROPANE					
Common Name Inventory:	PROPANE					
ID:	39460				Permit Status:	Permit Renewed
Child Record ID:	DEH2016-HWAST-0095958				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	11/29/2016 02:36:53 AM				Trade Secret:	false
Chemical Name:	WASTE 221 WASTE OIL & MIXED OIL					
Common Name Inventory:	WASTE OIL					
ID:	94735				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0119494				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	11/29/2017 02:36:10 AM				Trade Secret:	false
Chemical Name:	WASTE 221 WASTE OIL & MIXED OIL					
Common Name Inventory:	WASTE OIL					
ID:	182905				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0165843				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	12/25/2019 01:30:08 AM				Trade Secret:	false
Chemical Name:	WASTE 221 WASTE OIL & MIXED OIL					
Common Name Inventory:	WASTE OIL					
ID:	291506				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0223198				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	03/18/2020 12:19:25 PM				Trade Secret:	false
Chemical Name:	WASTE 221 WASTE OIL & MIXED OIL					
Common Name Inventory:	WASTE OIL					
ID:	299782				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0228973				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	04/18/2020 02:15:29 AM				Trade Secret:	false
Chemical Name:	WASTE 221 WASTE OIL & MIXED OIL					
Common Name Inventory:	WASTE OIL					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
ID:	410755				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0261902				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	11/24/2021 02:33:02 AM				Trade Secret:	false
Chemical Name:	WASTE 221 WASTE OIL & MIXED OIL					
Common Name Inventory:	WASTE OIL					
ID:	519816				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HWAST-0309644				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	12/30/2022 02:31:26 AM				Trade Secret:	false
Chemical Name:	WASTE 221 WASTE OIL & MIXED OIL					
Common Name Inventory:	WASTE OIL					
ID:	567179				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0332697				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	07/19/2023 03:03:22 AM				Trade Secret:	false
Chemical Name:	WASTE 221 WASTE OIL & MIXED OIL					
Common Name Inventory:	WASTE OIL					
ID:	39459				Permit Status:	Permit Renewed
Child Record ID:	DEH2016-HWAST-0095957				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	11/29/2016 02:36:53 AM				Trade Secret:	false
Chemical Name:	WASTE 352 ORGANIC SOLIDS (OTHER)					
Common Name Inventory:	WASTE OILY ABSORBENT					
ID:	94734				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0119493				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	11/29/2017 02:36:10 AM				Trade Secret:	false
Chemical Name:	WASTE 352 ORGANIC SOLIDS (OTHER)					
Common Name Inventory:	WASTE OILY ABSORBENT					
ID:	182904				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0165842				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	12/25/2019 01:30:08 AM				Trade Secret:	false
Chemical Name:	WASTE 352 ORGANIC SOLIDS (OTHER)					
Common Name Inventory:	WASTE OILY ABSORBENT					
ID:	291505				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0223197				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	03/18/2020 12:19:25 PM				Trade Secret:	false
Chemical Name:	WASTE 352 ORGANIC SOLIDS (OTHER)					
Common Name Inventory:	WASTE OILY ABSORBENT					
ID:	299781				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0228972				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	04/18/2020 02:15:29 AM				Trade Secret:	false
Chemical Name:	WASTE 352 ORGANIC SOLIDS (OTHER)					
Common Name Inventory:	WASTE OILY ABSORBENT					
ID:	410756				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0261903				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	11/24/2021 02:33:02 AM				Trade Secret:	false
Chemical Name:	WASTE 352 ORGANIC SOLIDS (OTHER)					
Common Name Inventory:	WASTE OILY ABSORBENT					
ID:	519815				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HWAST-0309643				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	12/30/2022 02:31:26 AM				Trade Secret:	false
Chemical Name:	WASTE 352 ORGANIC SOLIDS (OTHER)					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Common Name Inventory:		WASTE OILY ABSORBENT				
ID:	567178			Permit Status:	Permit Renewed	
Child Record ID:	DEH2023-HWAST-0332696			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	07/19/2023 03:03:22 AM			Trade Secret:	false	
Chemical Name:	WASTE 352 ORGANIC SOLIDS (OTHER)					
Common Name Inventory:	WASTE OILY ABSORBENT					
<u>Hazardous Materials Inspection Violations</u>						
Container Tank ID:	37-000-205800			Inspection No:	4350733	
Facility ID No:	20492			Inspection Type:	Routine	
ID:	05/06/2015 12:00:00 AM			Inspection Date:		
UST ID:				Compliance Date:	05/13/2015 12:00:00 AM	
Permit Status:	Permit Renewed			Last Updated:	07/19/2023 03:03:22 AM	
Active Permit:	true			NOV:	false	
Program Element:	Hazardous Waste Generator					
Violation Code:	3020001 Failure to ensure employees are familiar with the handling and compliance of hazardous waste regulations and emergency response. 22 CCR 12 66262.34(d)(2); 40 CFR 1 262.34(d)(5)(iii)					
Violation Classification:	Minor					
Container Tank ID:	37-000-205800			Inspection No:	4350733	
Facility ID No:	20494			Inspection Type:	Routine	
ID:	05/06/2015 12:00:00 AM			Inspection Date:		
UST ID:				Compliance Date:	05/15/2015 12:00:00 AM	
Permit Status:	Permit Renewed			Last Updated:	07/19/2023 03:03:22 AM	
Active Permit:	true			NOV:	false	
Program Element:	Hazardous Materials Release Response Plans					
Violation Code:	1010006 Failure to update hazardous material inventory within 30 days when one of the following occurs: A 100 percent or more increase in the quantity of a previously disclosed material; Any handling of a previously undisclosed hazardous materials; A change of business address, business ownership, or business name; HSC 6.95 25508.1(a)/(b)/(c)/(d)/(e).					
Violation Classification:	Minor					
Container Tank ID:	37-000-205800			Inspection No:	4350733	
Facility ID No:	20493			Inspection Type:	Routine	
ID:	05/06/2015 12:00:00 AM			Inspection Date:		
UST ID:				Compliance Date:	05/15/2015 12:00:00 AM	
Permit Status:	Permit Renewed			Last Updated:	07/19/2023 03:03:22 AM	
Active Permit:	true			NOV:	false	
Program Element:	Hazardous Materials Release Response Plans					
Violation Code:	1010005 Failure to complete and/or submit an annotated site map if required by CUPA; HSC 6.95 25505(a)2.					
Violation Classification:	Minor					
Container Tank ID:	37-000-205800			Inspection No:	4350733	
Facility ID No:	20491			Inspection Type:	Routine	
ID:	05/06/2015 12:00:00 AM			Inspection Date:		
UST ID:				Compliance Date:	05/18/2015 12:00:00 AM	
Permit Status:	Permit Renewed			Last Updated:	07/19/2023 03:03:22 AM	
Active Permit:	true			NOV:	false	
Program Element:	Hazardous Waste Generator					
Violation Code:	3030004 Failure to properly handle, manage, label, and recycle used oil and fuel filters.; 22 CCR 16 66266.130.					
Violation Classification:	Minor					
Container Tank ID:	37-000-205800			Inspection No:	5655677	
Facility ID No:	20495			Inspection Type:	Routine	
ID:	04/13/2017 01:51:00 PM			Inspection Date:		
UST ID:				Compliance Date:	04/22/2017 12:00:00 AM	
Permit Status:	Permit Renewed			Last Updated:	07/19/2023 03:03:22 AM	
Active Permit:	true			NOV:	false	
Program Element:	Hazardous Materials Release Response Plans					
Violation Code:	1010006 HMBP not updated to reflect inventory changes or facility information. HSC 25508.1(a-e)					
Violation Classification:	Minor					

HMD Permits Map Data

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Epa ID: CAL000453957 Cers ID: 10375303 Sitemap: Record Status: Permit Renewed Er Contact1: Sean Milliken Er Title1: Branch Manager Er Phone1: 610-200-9679 Er Altphone: 760-789-0931 Er Contact2: Lauri Bender Er Title2: Safety Coordinator Er Phone2: 619-921-7862 Er Altphone2: 619-921-7862 Biz Apn: 282-141-33-00 Biz Phone: 704-222-2484 Biz Email: enviro@sunbeltrentals.com Biz Owner: Sunbelt Rentals, Inc. Biz Type: Auto Repair, General - Waste USTs Only Facility Subject To Calarp: Plating Shop Metal Finishing: Chemical Supplier Wholesale: Pesticide Applicator Fumigatio: Chem Gas Paint Manufacture: Resin Site With 6 Items: Petroleum Propane Fuel Supp: Site With Gt20 Inventory Items: Apsa Stor Tank Gt10000 Gal: Apsa Stor Tank Chem Gt999ga: Ust Stor Tank Fuel Gt30k Ga: Cryogas Gt20kcft200gal1200lb: Gases Gt20kCft 208 Gal 1666 L: Prop Gt185kCft5k Gal 2100: Extreme Haz Gt20 Cft 54 Gal 5: Opened Dt: 2005-09-09T00:00:00 Expiration Dt: 2024-12-31T00:00:00 Rpt Name: HMBP205800.pdf Hirt Flag: N Billing Code1: Base + CUPA St No: 2055 St No End: St Name: MAIN St Dir: St Type: ST St Unit: Insp Dist Geoinfo: HE020						
<u>3</u>	11 of 21	SSW	0.01 / 50.56	1,417.75 / 0	HSS RENTX 2055 MAIN ST RAMONA CA	HAZ SANDIEGO
Record ID: DEH2003-HUPFP-202824 Facility Name: HSS RENTX Facility Address: 2055 MAIN ST, RAMONA, CA 92065 Facility City: RAMONA Facility Zip Code: 92065 Facility Latitude: 33.032245232955944 Facility Longitude: -116.88536012791216 GIS Record ID: GIS Facility Name: GIS Facility Address: GIS Facility City: GIS Facility Zip Code: GIS Fac Latitude: GIS Fac Longitude: Tank Owner Name:						
HMD Inactive Permits Map Data						
Facilityid: Cers ID: Featureid: 2821413300 Site Address: Street String: 2055 MAIN ST Point X: 6366940.78502 Point Y: 1955952.59989 X Mapcoord: 6366940.785 Y Mapcoord: 1955952.6 Record Type: LUEG-DEH/HMD/UPFP/Facility Record Alias: Unified Program Facility Permit Record Status: Completed Latitude WGS84: 33.0321893 Longitude WGS84: -116.885295 Ust Facilitytype: Agencyname: COSD Opened Date Dt: 2003-12-08 00:00:00 UTC Creator: Created Dt: 1970-01-01 00:00:00 UTC Editor: Edited Dt: 1970-01-01 00:00:00 UTC Parcel No: 282-141-33-00						

Tanner Information

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
State Waste Code:	213				Generator County:	San Diego
Year:	1991				Tsd Epa ID:	CAT080013352
Tons:	0.04				Tsd County:	Los Angeles
Method Code:	R01					
State Waste Code Desc:	Hydrocarbon solvents (benzene, hexane, Stoddard, Etc.)					
Method Description:						

<u>3</u>	15 of 21	SSW	0.01 / 50.56	1,417.75 / 0	BJS RENTAL STORE 2055 MAIN ST, RAMONA, CA 92065 RAMONA CA	LOP SANDIEGO
SWRCB Global ID:	T0607300711			Parcel No:	282-141-33-00	
Record ID:	DEH1991-LSAM-H05399-001			Census Tract:	208.05	
Record Status:	Completed			Zip Code 2:	92065	
Opened Date:	2/22/1991			Community:	Ramona	
Case Type:	LOP - Local Oversight Program			Jurisdiction:	UNINCORPORATED	
Historical Name:	BJ'S RENTALS			Watershed Basin No:	905.41	
Lead Agency:	DEH/SAM			Latitude GS 84:	33.0321893	
Lead Agency Date:	3/22/1991			Longitude GS 84:	-116.8852950	
Funding:	F - LOP Federal Fund			X Map Coord:	6366940.785	
Fire Agency:	RAMONA MUNI WATER DIST			Y Map Coord:	1955952.600	
Water Purveyor:	RAMONA MUNICIPAL WATER DISTRICT					
File Case Type:	CLOSED OR TRANSFERRED LOP CASES					

<u>3</u>	16 of 21	SSW	0.01 / 50.56	1,417.75 / 0	BJS RENTAL STORE 2055 MAIN ST RAMONA CA 920652525	LUST
Global ID:	T0607300711			Case Type (DL):	LUST Cleanup Site	
Site Facility Type:	LUST CLEANUP SITE			Oil Field (SRCH):		
Site Fac Type (SRCH):	LUST CLEANUP SITE			Oil Field Oper (SRCH):		
Status:				Census Tract (SRCH):	6073020805	
Status (SRCH):	COMPLETED - CASE CLOSED			Latitude (DL):	33.031688	
Status (DL):	Completed - Case Closed			Longitude (DL):	-116.885925	
Status Date (DL):	4/1/1992			RWQCB Region (DL):	SAN DIEGO RWQCB (REGION 9)	
Cleanup Status:	COMPLETED - CASE CLOSED					
Site Facility Name (SRCH):	BJS RENTAL STORE					
Address (SRCH):	2055 MAIN ST					
City (SRCH):	RAMONA					
Zip (SRCH):	920652525					
County (SRCH):	SAN DIEGO					
Street No (DL):	2055					
Street Name (DL):	MAIN ST					
City (DL):	RAMONA					
Zip (DL):	920652525					
County (DL):	San Diego					
State (DL):	CA					
Business Name (DL):	BJS RENTAL STORE					
Site Facility Name:	BJS RENTAL STORE					
Address :	2055 MAIN ST					
City :	RAMONA					
Zip :	920652525					
County :	SAN DIEGO					
Report Source:	LUST Cleanup Sites & Military UST Site from GeoTracker Project Search Results Export; LUST Cleanup Sites & Military UST Site from GeoTracker Cleanup Sites Data Download; LUST Cleanup Sites from GeoTracker Search					

GeoTracker Sites Data Download - Site Details

CUF Case:
Lead Agency: SAN DIEGO COUNTY
Case Worker:
Local Agency:
RB Case No: 9UT1932

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Local Case No:		H05399-001				
File Location:		Local Agency				
Potential COC:		Gasoline				
Potential Media of Concern:		Soil				
Begin Date:		2/22/1991				
How Discovered:						
How Discovered Description:						
Stop Method:						
Stop Description:						
Calwater Watershed Name:		San Dieguito - Santa Maria Valley - Ramona (905.41)				
DWR GW Subbasin Name:		Santa Maria Valley (9-011)				
Disadvantaged Community:						
CalEnvScreen Score:						
Coordinate Source:		Google Geocode				
Discharge Cause:						
Discharge Source:						
EPA Region:		9				
Leak Reported Dt:		1991-02-22 00:00:00				
Military DoD Site:		No				
No Further Action Dt:		1992-04-01 00:00:00				
Qty Rlsd Gallons:						
Facility Project Sub Type:						
Calenviroscreen 3 Score:		21-25%				
Calenviroscreen 4 Score:		15-20%				
Claim No:						
Claim Status:						
A2022 Assembly District:		75				
A2022 Congressional District:		48				
A2022 Senate District:		40				
Site History:						

GeoTracker Sites Data Download - Status History

Status: Completed - Case Closed
Status Date: 4/1/1992

Status: Open - Case Begin Date
Status Date: 2/22/1991

GeoTracker Search - Regulatory Profile

Site Facility Name: BJS RENTAL STORE
Site Facility Type: LUST CLEANUP SITE
Cleanup Status: COMPLETED - CASE CLOSED
Address: 2055 MAIN ST
City: RAMONA
Zip: 920652525
County: SAN DIEGO
Report Link: https://geotracker.waterboards.ca.gov/profile_report?global_id=T0607300711
Cleanup Status Detail: COMPLETED - CASE CLOSED AS OF 4/1/1992
Project Status:
Cleanup History Link: https://geotracker.waterboards.ca.gov/profile_report_include?global_id=T0607300711&tabname=regulatoryhistory
Potential COC: GASOLINE
Potential Media of Concern: SOIL
File Location: LOCAL AGENCY
User Defined Beneficial Use:
Designated Beneficial Use: MUN, AGR, IND, PROC
DWR GW Sub Basin: Santa Maria Valley (9-011)
Calwater Watershed Name: San Dieguito - Santa Maria Valley - Ramona (905.41)
Post Closure Site Management:
Future Land Use:
Cleanup Oversight Agencies: SAN DIEGO COUNTY (LEAD) - CASE #: H05399-001
SAN DIEGO RWQCB (REGION 9) - CASE #: 9UT1932
CUF Claim No:
CUF Priority Assig:
CUF Amount Paid:

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

WDR Place Type:

WDR File No:

WDR Order No:

Project Oversight Agencies:

Facility Type:

Composting Method:

Grndwtr Monitoring Frequency:

Designated Beneficial Use Desc: Municipal and Domestic Supply, Agricultural Supply, Industrial Service Supply, Industrial Process Supply

Site History:

No site history available

GeoTracker Search - Cleanup Status History

Status: Completed - Case Closed

Date : 4/1/1992

Status: Open - Case Begin Date

Date : 2/22/1991

GeoTracker Search - Regulatory Activities

Action Type: Other Regulatory Actions

Action: Closure/No Further Action Letter

Action Date: 4/1/1992

Received Issue Date: 4/1/1992

Doc Link: https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607300711&enforcement_id=6377408&temptable=ENFORCEMENT

Title Description Comments:

H05399-001 Closure Documents

Action Type: Other Regulatory Actions

Action: File review

Action Date: 2/26/1991

Received Issue Date: 2/26/1991

Doc Link: https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607300711&enforcement_id=6619543&temptable=ENFORCEMENT

Title Description Comments:

Historical Document

Action Type: Leak Action

Action: Leak Reported

Action Date: 2/22/1991

Received Issue Date:

Doc Link:

Title Description Comments:

Action Type: Leak Action

Action: Leak Stopped

Action Date: 2/22/1991

Received Issue Date:

Doc Link:

Title Description Comments:

Action Type: Leak Action

Action: Leak Discovery

Action Date: 2/22/1991

Received Issue Date:

Doc Link:

Title Description Comments:

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Action Type: Leak Action
Action: Leak Began
Action Date: 2/22/1991
Received Issue Date:
Doc Link:
Title Description Comments:

GeoTracker Search - Documents

Document Type:	Site Documents	Document Date:	4/1/1992
Type:	CLOSURE/NO FURTHER ACTION LETTER	Submitted:	
Submitted By:	DIANNE PELLEY (REGULATOR)		
Title:	H05399-001 CLOSURE DOCUMENTS		
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607300711&enforcement_id=6377408		

Document Type:	Site Documents	Document Date:	2/26/1991
Type:	FILE REVIEW	Submitted:	
Submitted By:	THANH DO (REGULATOR)		
Title:	HISTORICAL DOCUMENT		
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607300711&enforcement_id=6619543		

<u>3</u>	17 of 21	SSW	0.01 / 50.56	1,417.75 / 0	BJ'S RENTALS INC. 2055 MAIN STREET RAMONA CA 92065	RCRA NON GEN

Handler ID: CAL000295045
Generator Status: N
Recycler Activity?: NO
Recycler Activity Note: This facility has not been identified as a Recycler Facility from both the RCRA Handler and Biennial Report Modules.

Violation/Evaluation Summary

Note: NO RECORDS: As of Nov 2025, there are no Compliance Monitoring and Enforcement (violation) records associated with this facility (EPA ID).

Handler Summary

Importer:	No	Used Oil Transpor:	No
Mixed Waste Gen:	No	Used Oil Trans Fac:	No
Transporter:	No	Used Oil Processor:	No
Transfer Facility:	No	Used Oil Refiner:	No
Recycler:	No	Used Oil Burner:	No
Onsite Burner Exem:	No	Commercial TSD:	No
Furnace Exemption:	No	Recycl Nonstorage:	No
Underground Injec:	No		
Used Oil Market Burner:	No		
Used Oil Spec Marketer:	No		

Additional Handler Summary Details

Source Type:	N	NAIC 1:	532412
Seq No:	1	NAIC 2:	
Non Notifier:		NAIC 3:	
Receive Date:	20180827	NAIC 4:	
Active Site:	-----	State:	CA
Land Type:	P	Location Latitude:	33.031352
In Handler Univ:	N	Location Longitude:	-116.885476
In A Universe:	N	Loc GIS Primary:	N
Gen Status:	N	Loc GIS Origin:	AG
Report Cycle:		State District Owner:	

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Accessibility:			State District:			
Region:	09					
Fed Waste Gen Owner:		HQ				
State Waste Generator Owner:		CA				
State Waste Generator:		N				
Short Term Generator:		N				
Uni Waste:		N				
Universal Waste Dest Facility:		N				
Federal Universal Waste:		N				
As Federally Regulated Tsdf:		-----				
As Converter Tsdf:		-----				
As State Regulated Tsdf:		-----				
As State Regulated Handler:		---				
Federal Indicator:		---				
Hsm:		N				
Subpart K:		----				
GPRA Permit:		N				
GPRA Renewal:		N				
Permit Renewal Wrkld:		-----				
Permwrk ID:		-----				
Perm Prog:		-----				
Pcwrkld:		-----				
Closwrkld:		-----				
GPRA Ca:		N				
Cawrkld:		N				
Subjca Tsd Discretion:		N				
NCAPS:		N				
EC Indicator:		N				
Ca725 Indicator:		N				
Ca750 Indicator:		N				
Operating Tsdf:		-----				
Full Enforcement:		-----				
Snc:		N				
Unaddressed Snc:		N				
Addressed Snc:		N				
Snc With Comp Sched:		N				
Fa Required:		-----				
Hhandler Last Change:		20180827				
Recognized Trader Importer:		N				
Recognized Trader Exporter:		N				
Slab Importer:		N				
Slab Exporter:		N				
Manifest Broker:		N				
Subpart P:		N				
Contact Language:		EN				
Handler Name:		BJ'S RENTALS INC.				
Location Street No:		2055				
Location Street1:		MAIN STREET				
Location Street2:						
Location City:		RAMONA				
Location State:		CA				
Location Zip:		92065				
Location County Code:		CA073				
Location County Name:		SAN DIEGO				
Location Country:		US				
Contact Name:		SEAN MILLIKEN				
Contact Street No:		2055				
Contact Street1:		MAIN STREET				
Contact Street2:						
Contact City:		RAMONA				
Contact State:		CA				
Contact Zip:		92065				
Contact Country:		US				
Contact Phone & Ext:		760-789-0931				
Contact Fax:						
Contact Email Address:		SEAN.MILLIKEN@BJSRENTALS.COM				
Contact Title:		BRANCH MANAGER				
Owner Name:		BJ'S RENTALS INC.				
Owner Type:		P				

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Owner Seq:	1
Operator Name:	BJ'S RENTALS INC.
Operator Type:	P
Operator Seq:	2
Public Notes:	

Hazardous Waste Handler Details

Seq No:	1
Receive Date:	20180827
Handler Name:	BJ'S RENTALS INC.
Fed Waste Generator:	N
Generator Code Description:	Not a Generator, Verified
Source Type:	Notification
TSD Activity:	N

Waste Code Details

Waste Code:	221
Waste Code Desc:	Waste oil and mixed oil
Waste Code:	352
Waste Code Desc:	Other organic solids

Owner/Operator Details

Owner/Operator Ind:	Current Operator	Street No:	1800
Type:	Private	Street1:	MCKINLEY AVENUE
Name:	BJ'S RENTALS INC.	Street2:	
Dt Became Current:		City:	NATIONAL CITY
Dt Ended Current:		State:	CA
Phone:		Country:	US
Source Type:	Notification	Zip:	91950
Owner/Operator Ind:	Current Owner	Street No:	1800
Type:	Private	Street1:	MCKINLEY AVENUE
Name:	BJ'S RENTALS INC.	Street2:	
Dt Became Current:		City:	NATIONAL CITY
Dt Ended Current:		State:	CA
Phone:		Country:	US
Source Type:	Notification	Zip:	91950

3	18 of21	SSW	0.01 / 50.56	1,417.75 / 0	SUNBELT RENTALS PC 1326 2055 MAIN ST RAMONA CA 92065	RCRA NON GEN

Handler ID:	CAL000453957
Generator Status:	N
Recycler Activity?:	NO
Recycler Activity Note:	This facility has not been identified as a Recycler Facility from both the RCRA Handler and Biennial Report Modules.

Violation/Evaluation Summary

Note:	NO RECORDS: As of Nov 2025, there are no Compliance Monitoring and Enforcement (violation) records associated with this facility (EPA ID).

Handler Summary

Importer:	No	Used Oil Transpor:	No
Mixed Waste Gen:	No	Used Oil Trans Fac:	No

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Transporter:	No				Used Oil Processor:	No
Transfer Facility:	No				Used Oil Refiner:	No
Recycler:	No				Used Oil Burner:	No
Onsite Burner Exem:	No				Commercial TSD:	No
Furnace Exemption:	No				Recycl Nonstorage:	No
Underground Injec:	No					
Used Oil Market Burner:		No				
Used Oil Spec Marketer:		No				

Additional Handler Summary Details

Source Type:	I			NAIC 1:	562991
Seq No:	1			NAIC 2:	
Non Notifier:				NAIC 3:	
Receive Date:	20200330			NAIC 4:	
Active Site:	----			State:	CA
Land Type:				Location Latitude:	33.031352
In Handler Univ:	N			Location Longitude:	-116.885476
In A Universe:	N			Loc GIS Primary:	N
Gen Status:	N			Loc GIS Origin:	AG
Report Cycle:				State District Owner:	
Accessibility:				State District:	
Region:	09				
Fed Waste Gen Owner:	HQ				
State Waste Generator Owner:	CA				
State Waste Generator:	2				
Short Term Generator:	N				
Uni Waste:	N				
Universal Waste Dest Facility:	N				
Federal Universal Waste:	N				
As Federally Regulated Tsdf:	-----				
As Converter Tsdf:	-----				
As State Regulated Tsdf:	-----				
As State Regulated Handler:	---				
Federal Indicator:	---				
Hsm:	N				
Subpart K:	----				
GPRA Permit:	N				
GPRA Renewal:	N				
Permit Renewal Wrkld:	-----				
Permwrk ID:	-----				
Perm Prog:	-----				
Pcwrkld:	-----				
Closwrkld:	-----				
GPRA Ca:	N				
Cawrkld:	N				
Subjca Tsd Discretion:	N				
NCAPS:	N				
EC Indicator:	N				
Ca725 Indicator:	N				
Ca750 Indicator:	N				
Operating Tsdf:	-----				
Full Enforcement:	-----				
Snc:	N				
Unaddressed Snc:	N				
Addressed Snc:	N				
Snc With Comp Sched:	N				
Fa Required:	-----				
Hhandler Last Change:	20200408				
Recognized Trader Importer:	N				
Recognized Trader Exporter:	N				
Slab Importer:	N				
Slab Exporter:	N				
Manifest Broker:	N				
Subpart P:	N				
Contact Language:	EN				
Handler Name:	SUNBELT RENTALS PC 1326				
Location Street No:					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Location Street1:		2055 MAIN ST				
Location Street2:						
Location City:		RAMONA				
Location State:		CA				
Location Zip:		92065				
Location County Code:		CA073				
Location County Name:		SAN DIEGO				
Location Country:		US				
Contact Name:		SEAN MILLIKEN				
Contact Street No:						
Contact Street1:		2055 MAIN ST				
Contact Street2:						
Contact City:		RAMONA				
Contact State:		CA				
Contact Zip:		92065				
Contact Country:						
Contact Phone & Ext:		760-789-0931				
Contact Fax:						
Contact Email Address:		ENVIRO@SUNBELTRENTALS.COM				
Contact Title:						
Owner Name:		SUNBELT RENTALS INC C/O MICHAEL CROUCH				
Owner Type:		O				
Owner Seq:		1				
Operator Name:		SEAN MILLIKEN				
Operator Type:		O				
Operator Seq:		2				
Public Notes:						

Contact DTSC for information.

Hazardous Waste Handler Details

Seq No: 1
Receive Date: 20200330
Handler Name: SUNBELT RENTALS PC 1326
Fed Waste Generator: N
Generator Code Description: Not a Generator, Verified
Source Type: Implementer
TSD Activity: N

Owner/Operator Details

Owner/Operator Ind:	Current Operator	Street No:	
Type:	Other	Street1:	2055 MAIN ST
Name:	SEAN MILLIKEN	Street2:	
Dt Became Current:		City:	RAMONA
Dt Ended Current:		State:	CA
Phone:	760-789-0931	Country:	
Source Type:	Implementer	Zip:	92065

Owner/Operator Ind:	Current Owner	Street No:	
Type:	Other	Street1:	2341 DEERFIELD DR
Name:	SUNBELT RENTALS INC C/O MICHAEL CROUCH	Street2:	
Dt Became Current:		City:	FORT MILL
Dt Ended Current:		State:	SC
Phone:	803-578-5912	Country:	
Source Type:	Implementer	Zip:	29715

3	19 of 21	SSW	0.01 / 50.56	1,417.75 / 0	BJS RENTAL STORE 2055 MAIN ST RAMONA CA 92065	SAM SANDIEGO
Record ID:	DEH1991-LSAM-H05399-001	Agency Name:	COSD			
Record ID (Map):	DEH1991-LSAM-H05399-001	Lead Agency:	DEH/SAM			

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Record Type (Map):	LUEG-DEH/LWQD/SAM Investigation/NA			Lead Agcy Date:	3/21/1991, 7:00 PM	
ID:	2290			Object ID:	2288	
ThomasBros Map Gd:	1152 E 7			SWRCB Global ID:	T0607300711	
Jurisdiction:	UNINCORPORATED			Feature ID:	2821413300	
Census Tract:	208.05			Parcel No:	282-141-33-00	
Watershed Basin:	905.41			Case No:	H05399-001	
GT Global ID:	T0607300711			H No:	H05399	
GT RB Case No:	9UT1932			KIVA per Tp per No:	6SAM H05399	
GT Status Date:	3/31/1992, 7:00 PM			Status:	Completed	
GT Case Type:	LUST Cleanup Site			Record Status:	Completed	
GT CUF Case:	NO			Record Type:	SAM Investigation	
GT County:	San Diego			Record Alias:	SAM Investigation	
GT Latitude:	33.031688			Date:	02/22/1991	
GT Longitude:	-116.885925			Per Type:	LWQD	
Latitude GS84:	33.0321893			Primary Parcel:	Yes	
Longitude GS84:	-116.885295			Primary Address:	Yes	
Point X:	-116.88513877634006			Address Type:	ALIAS	
Point Y:	33.03191389018864			Community:	Ramona	
X:	6366940.785			Zip Code:	92065	
Y:	1955952.6			Zip Community:	92065	
BOS District:	2			Gt Stat Dt:	1992-04-01 00:00:00 UTC	
Lead Agc Dt:	1991-03-22 00:00:00 UTC			Opened Dt:	1991-02-22 00:00:00 UTC	
Edited Dt:						
Project Name:	BJS RENTAL STORE					
Address:	2055 MAIN ST, RAMONA CA 92065					
Street String:	2055 MAIN ST					
City:	RAMONA					
Record Name (Map):	BJS RENTAL STORE					
Address (Map):	2055 MAIN ST, RAMONA, CA 92065					
GT Lead Agency:	SAN DIEGO COUNTY LOP					
GT Status:	Completed - Case Closed					
DEH Permit Owner:						
Water Purveyor:	RAMONA MUNICIPAL WATER DISTRICT					
Case Type:	LOP - Local Oversight Program					
Geo SRC:	Mapped to XY from previous SAM Layer					
Historical Name:	BJ'S RENTALS					
Fire Agency:	RAMONA MUNI WATER DIST					
Funding:	F - LOP Federal Fund					
Short Notes:						
Source File:	Citizen Access DEH Site Assessment and Mitigation Investigation Sites (as of 26 Oct 2025); San Diego Site Assessment and Mitigation Investigation Sites (Map) (as of 1 Nov 2016)					

3	20 of 21	SSW	0.01 / 50.56	1,417.75 / 0	BJS RENTAL STORE 2055 MAIN ST RAMONA CA	UST SWEEPS
C C:	137-000-5399			D Filename:	NSITE1	
BOE:	44-022220			Page No:	364	
Comp:	5399			County:	SAN DIEGO	
Status:	INACTIVE			State :	CA	
No of Tanks:	1			Zip:	92065	
Jurisdic:	SAN DIEGO COUNTY			Latitude:	33.041619	
Agency:	SAN DIEGO COUNTY - U.S.T.			Longitude:	-116.86922	
Phone:	() 789-0931			Georesult:	S5HPNTSCZA	

Tank Details

Tank ID:	000001	S Contain:	SINGLE & LINER
O Tank ID:		Stg:	
SWRCB No:	37-000-005399-000001	Storage :	PRODUCT
Removed:		Storag Type:	PRODUCT
Installed:	UNKNOWN	P Contain:	OTHER
A Date:		Content:	LEADED
Capac:	500	ONA:	
Tank Use:	M.V. FUEL	D File Name:	NTANK1

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
3	21 of 21	SSW	0.01 / 50.56	1,417.75 / 0	BJS RENTAL STORE 2055 MAIN ST RAMONA CA	UST SWEEPS

C C:	A37-000-5399	D Filename:	SITE02A
BOE:	44-022220	Page No:	207
Comp:	5399	County:	SAN DIEGO
Status:	ACTIVE	State :	CA
No of Tanks:		Zip:	92065
Jurisdic:	SAN DIEGO COUNTY	Latitude:	33.041619
Agency:	SAN DIEGO COUNTY - U.S.T.	Longitude:	-116.86922
Phone:		Georesult:	S5HPNTSCZA

4	1 of 18	NE	0.07 / 355.62	1,422.11 / 4	Discount RV INC 1939 MAIN ST RAMONA CA 92065	CERS HAZ

Latitude: 33.033020
Longitude: -116.884230

Regulated Programs

EI ID:	10375060	EI Description:	Hazardous Waste Generator
EI ID:	10375060	EI Description:	Chemical Storage Facilities

Violations

Violation Date:	04/05/2023	Violation Source:	CERS
Violation Program:	HW	Violation Division:	San Diego County Department of Env Health
Citation:	HSC 6.5 Multiple - California Health and Safety Code, Chapter 6.5, Section(s) Multiple		
Violation Notes:			

Returned to compliance on 04/05/2023. Inspection Sequence ID:6923983;Violation:HMD0152 Failed to report &/or update the required inventory information for hazardous waste(s) generated at the facility in CERS. SDCC 68.904(a)(2)

Violation Description:

Hazardous Waste Generator Program - Operations/Maintenance - General

Violations

Violation Date:	03/16/2015	Violation Source:	CERS
Violation Program:	HW	Violation Division:	San Diego County Department of Env Health
Citation:	22 CCR 12 66262.40(c) - California Code of Regulations, Title 22, Chapter 12, Section(s) 66262.40(c)		
Violation Notes:			

Returned to compliance on 03/16/2015.

Violation Description:

Failure to determine if the waste generated is a hazardous waste and to maintain analysis results for three years.

Violations

Violation Date:	04/05/2023	Violation Source:	CERS
Violation Program:	HW	Violation Division:	San Diego County Department of Env Health
Citation:	HSC 6.5 25163(a) - California Health and Safety Code, Chapter 6.5, Section(s) 25163(a)		
Violation Notes:			

Returned to compliance on 08/17/2023. Inspection Sequence ID:6923983

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Violation Description:

Failure to use a DTSC registered hazardous waste transporter to transport hazardous waste.

Violations

Violation Date:	04/05/2023	Violation Source:	CERS
Violation Program:	HW	Violation Division:	San Diego County Department of Env Health
Citation:	22 CCR 12 66262.34(f) - California Code of Regulations, Title 22, Chapter 12, Section(s) 66262.34(f)		
Violation Notes:			

Returned to compliance on 10/15/2024. Inspection Sequence ID:6923983

Violation Description:

Failure to properly label hazardous waste accumulation containers and portable tanks with the following requirements: "Hazardous Waste", name and address of the generator, physical and chemical characteristics of the Hazardous Waste, and starting accumulation date.

Violations

Violation Date:	03/16/2015	Violation Source:	CERS
Violation Program:	HW	Violation Division:	San Diego County Department of Env Health
Citation:	22 CCR 12 66262.34(f) - California Code of Regulations, Title 22, Chapter 12, Section(s) 66262.34(f)		
Violation Notes:			

Returned to compliance on 03/16/2015.

Violation Description:

Failure to properly label hazardous waste accumulation containers with the following requirements: "Hazardous Waste", name and address of the generator, physical and chemical characteristics of the Hazardous Waste, and starting accumulation date.

Evaluations

Eval Date:	03/01/2017
Violations Found:	No
Eval General Type:	Compliance Evaluation Inspection
Eval Type:	Routine done by local agency
Eval Division:	San Diego County Department of Env Health
Eval Program:	HW
Eval Source:	CERS
Eval Notes:	

Inspector: Griffin Donelle Inspection ID:5646192; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date:	04/05/2023
Violations Found:	Yes
Eval General Type:	Compliance Evaluation Inspection
Eval Type:	Routine done by local agency
Eval Division:	San Diego County Department of Env Health
Eval Program:	HW
Eval Source:	CERS
Eval Notes:	

Inspector: LeClair Richard Inspection ID:6923983; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date:	03/16/2015
Violations Found:	Yes
Eval General Type:	Compliance Evaluation Inspection
Eval Type:	Routine done by local agency
Eval Division:	San Diego County Department of Env Health
Eval Program:	HW

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Eval Source:	CERS
Eval Notes:	

Inspector: Jaramillo Marcie Inspection ID:4111382; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date:	08/02/2019
Violations Found:	No
Eval General Type:	Compliance Evaluation Inspection
Eval Type:	Routine done by local agency
Eval Division:	San Diego County Department of Env Health
Eval Program:	HW
Eval Source:	CERS
Eval Notes:	

Inspector: Moreau Marie Inspection ID:6120128; Note: data in [EVAL Notes] field for some records is truncated from the source.

Affiliations

Affil Type Desc:	Legal Owner
Entity Name:	Torean Kelley
Entity Title:	
Address:	8039 Rancho Fanita Dr
City:	Santee
State:	CA
Country:	United States
Zip Code:	92071
Phone:	(619) 448-6242

Affil Type Desc:	Parent Corporation
Entity Name:	Discount RV INC
Entity Title:	
Address:	
City:	
State:	
Country:	
Zip Code:	
Phone:	

Affil Type Desc:	Document Preparer
Entity Name:	Andrew Deremer
Entity Title:	
Address:	
City:	
State:	
Country:	
Zip Code:	
Phone:	

Affil Type Desc:	Facility Mailing Address
Entity Name:	Mailing Address
Entity Title:	
Address:	1939 Main St
City:	Ramona
State:	CA
Country:	
Zip Code:	92065
Phone:	

Affil Type Desc:	CUPA District
Entity Name:	San Diego County Env Health Qlty
Entity Title:	
Address:	PO Box 129261
City:	San Diego
State:	CA
Country:	
Zip Code:	92112-9261

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Phone:		(858) 505-6880				
Affil Type Desc:		Operator				
Entity Name:		Torean Kelly				
Entity Title:						
Address:						
City:						
State:						
Country:						
Zip Code:						
Phone:		(619) 448-6242				
Affil Type Desc:		Identification Signer				
Entity Name:		Andrew Deremer				
Entity Title:						
Address:						
City:						
State:						
Country:						
Zip Code:						
Phone:						
Affil Type Desc:		Environmental Contact				
Entity Name:		Torean Kelley				
Entity Title:						
Address:		1939 Main St				
City:		Ramona				
State:		CA				
Country:						
Zip Code:		92065				
Phone:						
 <u>Coordinates</u>						
Env Int Type Code:	HWG			Longitude:	-116.883270	
Program ID:	10375060			Coord Name:		
Latitude:	33.033130			Ref Point Type Desc:	Center of a facility or station.	

4	2 of 18	NE	0.07 / 355.62	1,422.11 / 4	SUN VALLEY BODY & PAINT 1939 MAIN ST R RAMONA CA 92065	DELISTED TNK

Delisted San Diego County - UST List

Record ID:	DEH2002-HUPFP-105223	Haz. Waste Gen:	true
CERS ID:	10375060	Recycle:	false
Permit Status:	Permit Renewed	Onsite Haz Wt Trt:	false
Active Permit:	true	RCRA Large Qty Gen:	false
Facility Type UST:		HHW Collection:	false
Business Phone:	760-788-4449	Last Updated:	2021 Oct 28 02:35:13 AM
Business Fax:	0	Atoms:	
Facility ID:	37-000-105223	ZIP Codes:	
EPA ID No:	CAL000209651	Latitude:	
Haz. Mat. On-Site:	true	Longitude:	
Own or Operate UG:	false	Original Source:	USSD
Own or Operate AG:	false	Record Date:	13-JAN-2022
Mailing Address:	1743 Main St, Ste D, RAMONA, CA 92065-2523		
New Georeferenced:			

4	3 of 18	NE	0.07 / 355.62	1,422.11 / 4	SUN VALLEY BODY & PAINT 1939 MAIN ST RAMONA CA 92065	EMISSIONS

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
<u>2005 Criteria Data</u>						
Facility ID:	7986				CERR Code:	
Facility SIC Code:	7532				TOGT:	.31
CO:	37				ROGT:	.29
Air Basin:	SD				COT:	
District:	SD				NOXT:	
COID:	SD				SOXT:	
DISN:	SAN DIEGO COUNTY APCD				PMT:	
CHAPIS:					PM10T:	
<u>2005 Toxic Data</u>						
Facility ID:	7986				COID:	SD
Facility SIC Code:	7532				DISN:	SAN DIEGO COUNTY APCD
CO:	37				CHAPIS:	
Air Basin:	SD				CERR Code:	
District:	SD					
TS:						
Health Risk Asmt:						
Non-Cancer Chronic Haz Ind:						
Non-Cancer Acute Haz Ind:						
<u>2006 Criteria Data</u>						
Facility ID:	7986				CERR Code:	
Facility SIC Code:	7532				TOGT:	.31
CO:	37				ROGT:	.29
Air Basin:	SD				COT:	
District:	SD				NOXT:	
COID:	SD				SOXT:	
DISN:	SAN DIEGO COUNTY APCD				PMT:	
CHAPIS:					PM10T:	
<u>2006 Toxic Data</u>						
Facility ID:	7986				COID:	SD
Facility SIC Code:	7532				DISN:	SAN DIEGO COUNTY APCD
CO:	37				CHAPIS:	
Air Basin:	SD				CERR Code:	
District:	SD					
TS:						
Health Risk Asmt:						
Non-Cancer Chronic Haz Ind:						
Non-Cancer Acute Haz Ind:						
<u>2007 Criteria Data</u>						
Facility ID:	7986				CERR Code:	
Facility SIC Code:	7532				TOGT:	.31
CO:	37				ROGT:	.29
Air Basin:	SD				COT:	
District:	SD				NOXT:	
COID:	SD				SOXT:	
DISN:	SAN DIEGO COUNTY APCD				PMT:	
CHAPIS:					PM10T:	
<u>2007 Toxic Data</u>						
Facility ID:	7986				COID:	SD
Facility SIC Code:	7532				DISN:	SAN DIEGO COUNTY APCD
CO:	37				CHAPIS:	

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Air Basin:	SD				CERR Code:	
District:	SD					
TS:						
Health Risk Asmt:						
Non-Cancer Chronic Haz Ind:						
Non-Cancer Acute Haz Ind:						
<u>2008 Criteria Data</u>						
Facility ID:	7986				CERR Code:	
Facility SIC Code:	7532				TOGT:	.31
CO:	37				ROGT:	.29
Air Basin:	SD				COT:	
District:	SD				NOXT:	
COID:	SD				SOXT:	
DISN:	SAN DIEGO COUNTY APCD				PMT:	
CHAPIS:					PM10T:	
<u>2008 Toxic Data</u>						
Facility ID:	7986				COID:	SD
Facility SIC Code:	7532				DISN:	SAN DIEGO COUNTY APCD
CO:	37				CHAPIS:	
Air Basin:	SD				CERR Code:	
District:	SD					
TS:						
Health Risk Asmt:						
Non-Cancer Chronic Haz Ind:						
Non-Cancer Acute Haz Ind:						
<u>2009 Criteria Data</u>						
Facility ID:	7986				CERR Code:	
Facility SIC Code:	7532				TOGT:	.31
CO:	37				ROGT:	.29
Air Basin:	SD				COT:	
District:	SD				NOXT:	
COID:	SD				SOXT:	
DISN:	SAN DIEGO COUNTY APCD				PMT:	
CHAPIS:					PM10T:	
<u>2009 Toxic Data</u>						
Facility ID:	7986				COID:	SD
Facility SIC Code:	7532				DISN:	SAN DIEGO COUNTY APCD
CO:	37				CHAPIS:	
Air Basin:	SD				CERR Code:	
District:	SD					
TS:						
Health Risk Asmt:						
Non-Cancer Chronic Haz Ind:						
Non-Cancer Acute Haz Ind:						
<u>2010 Toxic Data</u>						
Facility ID:	7986				COID:	SD
Facility SIC Code:	7532				DISN:	SAN DIEGO COUNTY APCD
CO:	37				CHAPIS:	
Air Basin:	SD				CERR Code:	
District:	SD					
TS:						
Health Risk Asmt:						
Non-Cancer Chronic Haz Ind:						

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Non-Cancer Acute Haz Ind:

2011 Criteria Data

Facility ID:	7986	CERR Code:	
Facility SIC Code:	7532	TOGT:	.31
CO:	37	ROGT:	.29
Air Basin:	SD	COT:	
District:	SD	NOXT:	
COID:	SD	SOXT:	
DISN:	SAN DIEGO COUNTY APCD	PMT:	
CHAPIS:		PM10T:	

2011 Toxic Data

Facility ID:	7986	COID:	SD
Facility SIC Code:	7532	DISN:	SAN DIEGO COUNTY APCD
CO:	37	CHAPIS:	
Air Basin:	SD	CERR Code:	
District:	SD		
TS:			
Health Risk Asmt:			
Non-Cancer Chronic Haz Ind:			
Non-Cancer Acute Haz Ind:			

2012 Criteria Data

Facility ID:	7986	CERR Code:	
Facility SIC Code:	7532	TOGT:	.31
CO:	37	ROGT:	.29
Air Basin:	SD	COT:	
District:	SD	NOXT:	
COID:	SD	SOXT:	
DISN:	SAN DIEGO COUNTY APCD	PMT:	
CHAPIS:		PM10T:	

2012 Toxic Data

Facility ID:	7986	COID:	SD
Facility SIC Code:	7532	DISN:	SAN DIEGO COUNTY APCD
CO:	37	CHAPIS:	
Air Basin:	SD	CERR Code:	
District:	SD		
TS:			
Health Risk Asmt:			
Non-Cancer Chronic Haz Ind:			
Non-Cancer Acute Haz Ind:			

2013 Criteria Data

Facility ID:	7986	CERR Code:	
Facility SIC Code:	7532	TOGT:	.31
CO:	37	ROGT:	.29
Air Basin:	SD	COT:	
District:	SD	NOXT:	
COID:	SD	SOXT:	
DISN:	SAN DIEGO COUNTY APCD	PMT:	
CHAPIS:		PM10T:	

2013 Toxic Data

Facility ID:	7986	COID:	SD

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Facility SIC Code:	7532			DISN:	SAN DIEGO COUNTY APCD	
CO:	37			CHAPIS:		
Air Basin:	SD			CERR Code:		
District:	SD					
TS:						
Health Risk Asmt:						
Non-Cancer Chronic Haz Ind:						
Non-Cancer Acute Haz Ind:						
<u>2014 Criteria Data</u>						
Facility ID:	7986			CERR Code:		
Facility SIC Code:	7532			TOGT:	.31	
CO:	37			ROGT:	.29	
Air Basin:	SD			COT:		
District:	SD			NOXT:		
COID:	SD			SOXT:		
DISN:	SAN DIEGO COUNTY APCD			PMT:		
CHAPIS:				PM10T:		
<u>2014 Toxic Data</u>						
Facility ID:	7986			COID:	SD	
Facility SIC Code:	7532			DISN:	SAN DIEGO COUNTY APCD	
CO:	37			CHAPIS:		
Air Basin:	SD			CERR Code:		
District:	SD					
TS:						
Health Risk Asmt:						
Non-Cancer Chronic Haz Ind:						
Non-Cancer Acute Haz Ind:						
<u>2015 Criteria Data</u>						
Facility ID:	7986			CERR Code:		
Facility SIC Code:	7532			TOGT:	.31	
CO:	37			ROGT:	.29	
Air Basin:	SD			COT:		
District:	SD			NOXT:		
COID:	SD			SOXT:		
DISN:	SAN DIEGO COUNTY APCD			PMT:		
CHAPIS:				PM10T:		
<u>2015 Toxic Data</u>						
Facility ID:	7986			COID:	SD	
Facility SIC Code:	7532			DISN:	SAN DIEGO COUNTY APCD	
CO:	37			CHAPIS:		
Air Basin:	SD			CERR Code:		
District:	SD					
TS:						
Health Risk Asmt:						
Non-Cancer Chronic Haz Ind:						
Non-Cancer Acute Haz Ind:						
<u>2016 Criteria Data</u>						
Facility ID:	7986			CERR CODE:		
Facility SIC Code:	7532			TOGT:	.31	
CO:	37			ROGT:	.29	
Air Basin:	SD			COT:		
District:	SD			NOXT:		
COID:	SD			SOXT:		

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
DISN:		SAN DIEGO COUNTY APCD		PMT:		
CHAPIS:				PM10T:		
<u>2016 Toxic Data</u>						
Facility ID:	7986			TS:		
Facility SIC Code:	7532			HRA:		
CERR CODE:				CH Index:		
COID:	SD			AH Index:		
CO:	37			Air Basin:	SD	
DISN:	SAN DIEGO COUNTY APCD			District:	SD	
CHAPIS:						
<u>2017 Criteria Data</u>						
Facility ID:	7986			CERR Code:		
Facility SIC Code:	7532			TOGT:	.31	
CO:	37			ROGT:	.29	
Air Basin:	SD			COT:		
District:	SD			NOXT:		
COID:	SD			SOXT:		
DISN:	SAN DIEGO COUNTY APCD			PMT:		
CHAPIS:				PM10T:		
<u>2017 Toxic Data</u>						
Facility ID:	7986			COID:	SD	
Facility SIC Code:	7532			DISN:	SAN DIEGO COUNTY APCD	
CO:	37			CHAPIS:		
Air Basin:	SD			CERR Code:		
District:	SD					
TS:						
Health Risk Asmt:						
Non-Cancer Chronic Haz Ind:						
Non-Cancer Acute Haz Ind:						
<u>2018 Criteria Data</u>						
Facility ID:	7986			CERR Code:		
Facility SIC Code:	7532			TOGT:	.31	
CO:	37			ROGT:	.29	
Air Basin:	SD			COT:		
District:	SD			NOXT:		
COID:	SD			SOXT:		
DISN:	SAN DIEGO COUNTY APCD			PMT:		
CHAPIS:				PM10T:		
<u>2018 Toxic Data</u>						
Facility ID:	7986			COID:	SD	
Facility SIC Code:	7532			DISN:	SAN DIEGO COUNTY APCD	
CO:	37			CHAPIS:		
Air Basin:	SD			CERR Code:		
District:	SD					
TS:						
Health Risk Asmt:						
Non-Cancer Chronic Haz Ind:						
Non-Cancer Acute Haz Ind:						
<u>2019 Criteria Data</u>						
CO:	37			CHAPIS:		

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Air Basin: SD Facility ID: 7986 District: SD Facility SIC Code: 7532 CO ID: SD DISN: SAN DIEGO COUNTY APCD PM10T: TOGT: .31 PMT: CERR Code: ROGT: .29 COT: NOXT: SOXT:						
<u>2019 Toxic Data</u>						
CO: 37 Air Basin: SD Facility ID: 7986 District: SD Facility SIC Code: 7532 COID: SD Non-Cancer Chronic Haz Ind: Non-Cancer Acute Haz Ind: DISN: SAN DIEGO COUNTY APCD CHAPIS: CERR Code: TS: Health Risk Asmt:						
4	4 of 18	NE	0.07 / 355.62	1,422.11 / 4	TANGUAY'S RAMONA TRUCK & AUTO 1939 MAIN ST A 1939 MAIN ST RAMONA CA 92065	HAZ SANDIEGO
Record ID: DEH2006-HUPFP-206749 Facility Name: TANGUAY'S RAMONA TRUCK & AUTO Facility Address: 1939 MAIN ST A, RAMONA, CA 92065 Facility City: RAMONA Facility Zip Code: 92065 Facility Latitude: 1956235.618 Facility Longitude: 6367286.848 GIS Record ID: GIS Facility Name: GIS Facility Address: GIS Facility City: GIS Facility Zip Code: GIS Fac Latitude: GIS Fac Longitude: Tank Owner Name:						
<u>Hazardous Materials Inspection Violations</u>						
Container Tank ID: Facility ID No: 37-000-206749 ID: 21434 UST ID: Permit Status: Permit Suspended Active Permit: false Program Element: Hazardous Materials Release Response Plans Violation Code: 1020001 Failure to include an adequate training program in the business plan, which is reasonable and appropriate for the size of the business and the nature of the hazardous material handled; HSC 6.95 25505(a)4 Violation Classification: Minor Inspection No: 4085723 Inspection Type: Routine Inspection Date: 03/10/2015 12:00:00 AM Compliance Date: 12/28/2016 12:00:00 AM Last Updated: 03/01/2022 12:00:00 AM NOV: false						
Container Tank ID: Facility ID No: 37-000-206749 ID: 21436 UST ID: Permit Status: Permit Suspended Active Permit: false Program Element: Hazardous Materials Release Response Plans Violation Code: 1010006 Failure to update hazardous material inventory within 30 days when one of the following occurs: A 100 percent or more increase in the quantity of a previously disclosed material; Any handling of a previously undisclosed hazardous materials; A change of business address, business ownership, or business name; HSC 6.95 25508.1(a)/(b)/(c)/(d)/(e). Inspection No: 4085723 Inspection Type: Routine Inspection Date: 03/10/2015 12:00:00 AM Compliance Date: 12/28/2016 12:00:00 AM Last Updated: 03/01/2022 12:00:00 AM NOV: false						

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Violation Classification:		Class II				
Container Tank ID:					Inspection No:	4085723
Facility ID No:	37-000-206749				Inspection Type:	Routine
ID:	21432				Inspection Date:	03/10/2015 12:00:00 AM
UST ID:					Compliance Date:	12/28/2016 12:00:00 AM
Permit Status:	Permit Suspended				Last Updated:	03/01/2022 12:00:00 AM
Active Permit:	false				NOV:	true
Program Element:	Hazardous Materials Release Response Plans					
Violation Code:	HMD1001 Unified Program Facility (UPF) permit was not obtained for the handling of hazardous materials; SDCC 68.905.					
Violation Classification:		Class I				
Container Tank ID:					Inspection No:	4085723
Facility ID No:	37-000-206749				Inspection Type:	Routine
ID:	21428				Inspection Date:	03/10/2015 12:00:00 AM
UST ID:					Compliance Date:	12/28/2016 12:00:00 AM
Permit Status:	Permit Suspended				Last Updated:	03/01/2022 12:00:00 AM
Active Permit:	false				NOV:	false
Program Element:	Hazardous Waste Generator					
Violation Code:	3020001 Failure to ensure employees are familiar with the handling and compliance of hazardous waste regulations and emergency response. 22 CCR 12 66262.34(d)(2); 40 CFR 1 262.34(d)(5)(iii)					
Violation Classification:		Minor				
Container Tank ID:					Inspection No:	4085723
Facility ID No:	37-000-206749				Inspection Type:	Routine
ID:	21433				Inspection Date:	03/10/2015 12:00:00 AM
UST ID:					Compliance Date:	12/28/2016 12:00:00 AM
Permit Status:	Permit Suspended				Last Updated:	03/01/2022 12:00:00 AM
Active Permit:	false				NOV:	false
Program Element:	Hazardous Materials Release Response Plans					
Violation Code:	1010003 Owner/Operator failed to complete and/or submit the Business Activities Page and/or Business Owner Operator Identification Page; 19 CCR 4 2729.2(a)(1).					
Violation Classification:		Minor				
Container Tank ID:					Inspection No:	4085723
Facility ID No:	37-000-206749				Inspection Type:	Routine
ID:	21435				Inspection Date:	03/10/2015 12:00:00 AM
UST ID:					Compliance Date:	12/28/2016 12:00:00 AM
Permit Status:	Permit Suspended				Last Updated:	03/01/2022 12:00:00 AM
Active Permit:	false				NOV:	false
Program Element:	Hazardous Materials Release Response Plans					
Violation Code:	1010008 Failure to annually review and electronically certify that the business plan is complete, accurate, and up-to-date. For facilities with invenntory that exceed EPCRA thresholds; failure to submit inventory reports (Activities, Owner/Operator, Hazardous Materials Descriptions and Map pages HSC 6.95 25508.2 / 19 CCR 4 2729.5(c)					
Violation Classification:		Minor				
Container Tank ID:					Inspection No:	4085723
Facility ID No:	37-000-206749				Inspection Type:	Routine
ID:	21427				Inspection Date:	03/10/2015 12:00:00 AM
UST ID:					Compliance Date:	12/28/2016 12:00:00 AM
Permit Status:	Permit Suspended				Last Updated:	03/01/2022 12:00:00 AM
Active Permit:	false				NOV:	true
Program Element:	Hazardous Waste Generator					
Violation Code:	HMD0131 No Unified Program Facility (UPF) permit not obtained for the generation of hazardous waste. SDCC 68.905.					
Violation Classification:		Class I				
Container Tank ID:					Inspection No:	4085723
Facility ID No:	37-000-206749				Inspection Type:	Routine
ID:	21426				Inspection Date:	03/10/2015 12:00:00 AM
UST ID:					Compliance Date:	01/03/2017 12:00:00 AM
Permit Status:	Permit Suspended				Last Updated:	03/01/2022 12:00:00 AM
Active Permit:	false				NOV:	false
Program Element:	Hazardous Waste Generator					
Violation Code:	3010002 Failure to obtain and/or maintain an Active EPA ID.; 22 CCR 12 66262.12.					
Violation Classification:		Minor				
Container Tank ID:					Inspection No:	5537238

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Facility ID No:	37-000-206749			Inspection Type:	Re-inspection	
ID:	21437			Inspection Date:	07/29/2016 10:39:00 AM	
UST ID:				Compliance Date:	12/28/2016 12:00:00 AM	
Permit Status:	Permit Suspended			Last Updated:	03/01/2022 12:00:00 AM	
Active Permit:	false			NOV:	true	
Program Element:	Hazardous Materials Release Response Plans					
Violation Code:	1010008 HMBP not certified annually as complete and accurate in CERS. HSC 25508.2					
Violation Classification:	Class II					
Container Tank ID:				Inspection No:	5537238	
Facility ID No:	37-000-206749			Inspection Type:	Re-inspection	
ID:	21438			Inspection Date:	07/29/2016 10:39:00 AM	
UST ID:				Compliance Date:	12/28/2016 12:00:00 AM	
Permit Status:	Permit Suspended			Last Updated:	03/01/2022 12:00:00 AM	
Active Permit:	false			NOV:	true	
Program Element:	Hazardous Materials Release Response Plans					
Violation Code:	1010006 HMBP not updated to reflect inventory changes or facility information. HSC 25508.1(a-e)					
Violation Classification:	Class II					
Container Tank ID:				Inspection No:	5537238	
Facility ID No:	37-000-206749			Inspection Type:	Re-inspection	
ID:	21439			Inspection Date:	07/29/2016 10:39:00 AM	
UST ID:				Compliance Date:	12/28/2016 12:00:00 AM	
Permit Status:	Permit Suspended			Last Updated:	03/01/2022 12:00:00 AM	
Active Permit:	false			NOV:	true	
Program Element:	Hazardous Materials Release Response Plans					
Violation Code:	1010003 Business Activities and/or Business Owner/Operator Identification not completed in CERS. 19 CCR 2729.2(a)(1); HSC 25404(e)(4)					
Violation Classification:	Class II					
Container Tank ID:				Inspection No:	5632971	
Facility ID No:	37-000-206749			Inspection Type:	Routine	
ID:	21441			Inspection Date:	12/28/2016 07:18:00 AM	
UST ID:				Compliance Date:	12/28/2016 12:00:00 AM	
Permit Status:	Permit Suspended			Last Updated:	03/01/2022 12:00:00 AM	
Active Permit:	false			NOV:	false	
Program Element:	Hazardous Materials Release Response Plans					
Violation Code:	1010002 HMBP not submitted to the CUPA in CERS. HSC 25508(a)(1)(A); HSC 25404(e)(4); 27 CCR 15188(a), (d)					
Violation Classification:	Class II					
Container Tank ID:				Inspection No:	5632971	
Facility ID No:	37-000-206749			Inspection Type:	Routine	
ID:	21429			Inspection Date:	12/28/2016 07:18:00 AM	
UST ID:				Compliance Date:	01/03/2017 12:00:00 AM	
Permit Status:	Permit Suspended			Last Updated:	03/01/2022 12:00:00 AM	
Active Permit:	false			NOV:	false	
Program Element:	Hazardous Waste Generator					
Violation Code:	3010002 Failed to obtain and/or maintain an active EPA ID. 22 CCR 66262.12					
Violation Classification:	Class II					
Container Tank ID:				Inspection No:	5632971	
Facility ID No:	37-000-206749			Inspection Type:	Routine	
ID:	21430			Inspection Date:	12/28/2016 07:18:00 AM	
UST ID:				Compliance Date:	05/25/2018 12:00:00 AM	
Permit Status:	Permit Suspended			Last Updated:	03/01/2022 12:00:00 AM	
Active Permit:	false			NOV:	true	
Program Element:	Hazardous Waste Generator					
Violation Code:	HMD0131 Unified Program Facility Permit not obtained &/or maintained for the generation of hazardous waste. HSC 25404.1; SDCC 68.905; 68.906, 68.907					
Violation Classification:	Class I					
Container Tank ID:				Inspection No:	5632971	
Facility ID No:	37-000-206749			Inspection Type:	Routine	
ID:	21440			Inspection Date:	12/28/2016 07:18:00 AM	
UST ID:				Compliance Date:	05/25/2018 12:00:00 AM	
Permit Status:	Permit Suspended			Last Updated:	03/01/2022 12:00:00 AM	
Active Permit:	false			NOV:	true	
Program Element:	Hazardous Materials Release Response Plans					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB		
Violation Code:		HMD1001 Unified Program Facility permit not obtained for hazardous materials. SDCC 68.905						
Violation Classification:		Class I						
Container Tank ID:				Inspection No:	5632971			
Facility ID No:	37-000-206749			Inspection Type:	Routine			
ID:	21442			Inspection Date:	12/28/2016 07:18:00 AM			
UST ID:				Compliance Date:	05/25/2018 12:00:00 AM			
Permit Status:	Permit Suspended			Last Updated:	03/01/2022 12:00:00 AM			
Active Permit:	false			NOV:	false			
Program Element:	Hazardous Materials Release Response Plans							
Violation Code:	1020002 Initial and/or annual employee training not conducted for hazardous materials management and/or employee training records not available or not maintained for 3 years. HSC 25505(a)(4)							
Violation Classification:		Class II						
Container Tank ID:				Inspection No:	5977409			
Facility ID No:	37-000-206749			Inspection Type:	Re-inspection			
ID:	21444			Inspection Date:	05/25/2018 02:08:00 PM			
UST ID:				Compliance Date:	05/25/2018 12:00:00 AM			
Permit Status:	Permit Suspended			Last Updated:	03/01/2022 12:00:00 AM			
Active Permit:	false			NOV:	false			
Program Element:	Hazardous Materials Release Response Plans							
Violation Code:	1010004 Chemical inventory incomplete or not submitted in CERS. HSC 25505(a)(1); 25507(a); 25508.1(a-b); 19 CCR 2654 (a) or (d)							
Violation Classification:		Class II						
Container Tank ID:				Inspection No:	5977409			
Facility ID No:	37-000-206749			Inspection Type:	Re-inspection			
ID:	21431			Inspection Date:	05/25/2018 02:08:00 PM			
UST ID:				Compliance Date:	01/22/2019 12:00:00 AM			
Permit Status:	Permit Suspended			Last Updated:	03/01/2022 12:00:00 AM			
Active Permit:	false			NOV:	true			
Program Element:	Hazardous Waste Generator							
Violation Code:	HMD0131 Unified Program Facility Permit not obtained &/or maintained for the generation of hazardous waste. SDCC 68.905							
Violation Classification:		Class I						
Container Tank ID:				Inspection No:	5977409			
Facility ID No:	37-000-206749			Inspection Type:	Re-inspection			
ID:	21443			Inspection Date:	05/25/2018 02:08:00 PM			
UST ID:				Compliance Date:	01/22/2019 12:00:00 AM			
Permit Status:	Permit Suspended			Last Updated:	03/01/2022 12:00:00 AM			
Active Permit:	false			NOV:	true			
Program Element:	Hazardous Materials Release Response Plans							
Violation Code:	HMD1001 Unified Program Facility permit not obtained for hazardous materials. SDCC 68.905; 68.906, 68.907							
Violation Classification:		Class I						
Container Tank ID:				Inspection No:	6076076			
Facility ID No:	37-000-206749			Inspection Type:	Routine			
ID:	47474			Inspection Date:	07/16/2019 12:00:00 AM			
UST ID:				Compliance Date:	07/16/2019 12:00:00 AM			
Permit Status:	Permit Suspended			Last Updated:	03/01/2022 12:00:00 AM			
Active Permit:	false			NOV:	false			
Program Element:	Hazardous Materials Release Response Plans							
Violation Code:	1010008 HMBP not certified annually as complete and accurate in CERS. HSC 25508(a)(1)(A), 25508.2, 19 CCR 2654(b)							
Violation Classification:		Class II						
Container Tank ID:				Inspection No:	6076076			
Facility ID No:	37-000-206749			Inspection Type:	Routine			
ID:	47473			Inspection Date:	07/16/2019 12:00:00 AM			
UST ID:				Compliance Date:	07/26/2019 12:00:00 AM			
Permit Status:	Permit Suspended			Last Updated:	03/01/2022 12:00:00 AM			
Active Permit:	false			NOV:	false			
Program Element:	Hazardous Waste Generator							
Violation Code:	3030010 Accumulated waste too long (>180 or 270 days) or (>90 days). HSC 25201(a), 25123.3(h)(1); 22 CCR 66262.34(d); 40 CFR 262.34(e) and/or (f)							
Violation Classification:		Class II						

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

HMD Permits Map Data as of Feb 13, 2023

GIS Facility ID:	37-000-206749	Parcel No:	282-141-59-00
GIS CERS ID:	10375324	Status:	
GIS Record Type:	LUEG-DEH/HMD/UPFP/Facility	Census Tract:	208.05
Per Type:		Parcel Zip:	92065
Per Sub Type:		Community:	Ramona
Per Cat:		Jurisdiction:	UNINCORPORATED
Record Status:	Permit Renewed	Basin No:	905.41
LRG QTY MW Gener:	No	BOS Dist:	2
EPA ID No:	cal000303455	Tbpg Grid:	
RMP CAL ARP:	Not Applicable	Insp Dist:	HE017
Tank Owner:		Feature ID:	2821415900
SIC Code:	0000	Kiva Per Typ:	HK07 206749
NAICS Code:		Agency Name:	COSD
Exp Date:		Loc Name:	
Own/Operate USTs :		Score:	
UST Facility:		Side:	
Total No USTs:		User Fld:	
No of Tanks:		Addr Type:	
Own Oper APS:	N	Match Addr:	
Tot AGP Cap:	0	Match Type:	
Capacity LR:		Farm Nursery:	
Hazmat EHS:	N	Record Alias:	Unified Program Facility Permit
Hazmat Rad:	No	Hirt Flag:	No
Haz Waste G:	Y	Indian or Territry:	
Haz Wst Coll Site:	N	County ID:	
Haz Waste Rad:	N	Zip:	
Haz Waste EHS:	N	X Coord:	6367286.848
Recycle100:	N	Y Coord:	1956235.618
RCRA LRG Qty:	N	X Map Coord:	
Accept Offs:		Y Map Coord:	
Univ Waste Gen Typ:		Point X:	6367286.848
Universl Waste Han:		Point Y:	1956235.618
Toxic Gas:	No	Lat GS84:	33.0330289
Email Perm:		Lon GS84:	-116.8842366
Phone Perm:	858-531-0310		
Full Name:	michele tanguay		
Site Address:	1939 MAIN ST		
Address:	1939 MAIN ST A		
Business Type:	Auto Repair, General - Waste USTs Only		
HW Tier:	Not Applicable		
Disclose Qty Haz Mat:	Y		
Onsite Haz Waste Tre:	N		
Bill Code:	Not Applicable		
Bill Code 2:	Not Applicable		
Bill Code 3:	Not Applicable		
ER Con Name:	DAVID TANGUAY		
ER Contact:	760-703-8446		
ER Con Title:	MANAGE-SHOP		
ER Con Work Ph:	7607886961		
ARC APN:			
ARC Address:			
ARC City:			
ARC Zipcode:			
ARC State:			
Water Purv:	RAMONA MUNICIPAL WATER DISTRICT		
Fire Agency:	RAMONA MUNI WATER DIST		
Geo SRC:	Mapped to record APN/Parcel XY center		
Frhmbp Report Filename:	HMBP206749.pdf		
Frhmbp Sitemap Filename:	MAP_206749.pdf		

4	5 of 18	NE	0.07 / 355.62	1,422.11 / 4	TANGUAY AUTOMOTIVE INC 1939 MAIN ST RAMONA CA	HAZ SANDIEGO

Record ID: DEH2002-HUPFP-130544
Facility Name: TANGUAY AUTOMOTIVE INC

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Facility Address:		1939 MAIN ST, RAMONA, CA 92065				
Facility City:		RAMONA				
Facility Zip Code:		92065				
Facility Latitude:		33.03302885363707				
Facility Longitude:		-116.88423662357552				
GIS Record ID:						
GIS Facility Name:						
GIS Facility Address:						
GIS Facility City:						
GIS Facility Zip Code:						
GIS Fac Latitude:						
GIS Fac Longitude:						
Tank Owner Name:						

HMD Inactive Permits Map Data

Facilityid:		Latitude WGS84:	33.0330289
Cers ID:		Longitude WGS84:	-116.8842366
Featureid:	2821415900	Ust Facilitytype:	
Site Address:		Agencyname:	COSD
Street String:	1939 MAIN ST	Opened Date Dt:	2002-05-04 00:00:00 UTC
Point X:	6367286.84798	Creator:	
Point Y:	1956235.61802	Created Dt:	1970-01-01 00:00:00 UTC
X Mapcoord:	6367286.848	Editor:	
Y Mapcoord:	1956235.618	Edited Dt:	1970-01-01 00:00:00 UTC
Record Type:	LUEG-DEH/HMD/UPFP/Facility	Parcel No:	282-141-59-00
Record Alias:	Unified Program Facility Permit		
Record Status:	Completed		
Business Type:	Auto Repair, General - Waste USTs Only		
Geo Src:	Mapped to record APN/parcel center XY		
Tot Above Ground Petroleum Cap:	0		
Rmp Calarp Level:			
Lrg Qty Mwgenerator:			
Own Operate Usts:			
Tot Num Usts:			
Own Operate Apsa Tank:	N		
Num Tanks 10kgal or Greater:			
Hazwaste Generator:	Yes		
On Site Haz Waste Treatment:			
Rcra Lrg Qty Generator:			
Kivapertype Pernum:	HK07 130544		

<u>4</u>	6 of 18	NE	0.07 / 355.62	1,422.11 / 4	RAMONA TRUCK & AUTO 1939 MAIN ST RAMONA CA	HAZ SANDIEGO

Record ID:	DEH2002-HUPFP-200921
Facility Name:	RAMONA TRUCK & AUTO
Facility Address:	1939 MAIN ST, RAMONA, CA 92065
Facility City:	RAMONA
Facility Zip Code:	92065
Facility Latitude:	33.03302885363707
Facility Longitude:	-116.88423662357552
GIS Record ID:	
GIS Facility Name:	
GIS Facility Address:	
GIS Facility City:	
GIS Facility Zip Code:	
GIS Fac Latitude:	
GIS Fac Longitude:	
Tank Owner Name:	

HMD Inactive Permits Map Data

Facilityid:	Latitude WGS84:	33.0330289

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Cers ID: Featureid: 2821415900 Site Address: Street String: 1939 MAIN ST Point X: 6367286.84798 Point Y: 1956235.61802 X Mapcoord: 6367286.848 Y Mapcoord: 1956235.618 Record Type: LUEG-DEH/HMD/UPFP/Facility Record Alias: Unified Program Facility Permit Record Status: Completed Business Type: Auto Repair, General - Waste USTs Only Geo Src: Mapped to record APN/parcel center XY Tot Above Ground Petroleum Cap: 0 Rmp Calarp Level: Lrg Qty Mwgenerator: Own Operate Usts: Tot Num Usts: Own Operate Apsa Tank: N Num Tanks 10kgal or Greater: Hazwaste Generator: Yes On Site Haz Waste Treatment: Rcra Lrg Qty Generator: Kivapertype Pernum: HK07 200921 Longitude WGS84: -116.8842366 Ust Facilitytype: Agencyname: COSD Opened Date Dt: 2002-10-29 00:00:00 UTC Creator: Created Dt: 1970-01-01 00:00:00 UTC Editor: Edited Dt: 1970-01-01 00:00:00 UTC Parcel No: 282-141-59-00						
4	7 of 18	NE	0.07 / 355.62	1,422.11 / 4	Discount RV INC 1939 MAIN ST R RAMONA CA 92065	HAZ SANDIEGO
Record ID: DEH2002-HUPFP-105223 Facility Name: Discount RV INC Facility Address: 1939 MAIN ST R RAMONA, CA 92065 Facility City: RAMONA Facility Zip Code: 92065 Facility Latitude: 33.03302885363692 Facility Longitude: -116.88423662357584 GIS Record ID: DEH2002-HUPFP-105223 GIS Facility Name: Discount RV INC GIS Facility Address: 1939 MAIN ST R GIS Facility City: RAMONA GIS Facility Zip Code: 92065 GIS Fac Latitude: GIS Fac Longitude: Tank Owner Name:						
<u>Hazardous Materials Facility Data</u>						
CERS ID: 10375060 Facility ID No: 37-000-105223 EPA ID No: CAL000105507 Active Permit: true Permit Status: Permit Renewed Bus Phone: 6194486242 Bus Fax: 0 Last Updated: 06/23/2023 02:32:03 AM Mailing Address: 1939 Main St, Ramona, CA 92065 Onsite H Waste Treatment: false New Georeferenced Column: Haz Mat on Site: true Haz Waste Generatr: true Own/Oper Under: false Own/Oper Above: false Recycle: false RCRA Large Qty Gen: false HHW Collection: false						
<u>Hazardous Waste and Materials</u>						
ID: 582942 Child Record ID: DEH2023-HWAST-0340547 CAS No: Last Updated: 06/23/2023 02:32:03 AM Permit Status: Permit Renewed Active Permit: true Haz Material Type: Trade Secret: false						

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Chemical Name:
Common Name Inventory: Waste Paint Thinner

Hazardous Materials Inspection Violations

Container Tank ID:	37-000-105223	Inspection No:	4111382
Facility ID No:	2961	Inspection Type:	Routine
ID:	03/16/2015 12:00:00 AM	Inspection Date:	
UST ID:		Compliance Date:	03/16/2015 12:00:00 AM
Permit Status:	Permit Renewed	Last Updated:	06/23/2023 12:00:00 AM
Active Permit:	true	NOV:	false
Program Element:	Hazardous Materials Release Response Plans		
Violation Code:	1010003 Owner/Operator failed to complete and/or submit the Business Activities Page and/or Business Owner Operator Identification Page; 19 CCR 4 2729.2(a)(1).		
Violation Classification:	Class II		
Container Tank ID:	37-000-105223	Inspection No:	4111382
Facility ID No:	2959	Inspection Type:	Routine
ID:	03/16/2015 12:00:00 AM	Inspection Date:	
UST ID:		Compliance Date:	03/16/2015 12:00:00 AM
Permit Status:	Permit Renewed	Last Updated:	06/23/2023 12:00:00 AM
Active Permit:	true	NOV:	false
Program Element:	Hazardous Waste Generator		
Violation Code:	3030005 Failure to determine if the waste generated is a hazardous waste and to maintain analysis results for three years 22 CCR 12 66262.11, 66262.40(c).		
Violation Classification:	Class II		
Container Tank ID:	37-000-105223	Inspection No:	4111382
Facility ID No:	2960	Inspection Type:	Routine
ID:	03/16/2015 12:00:00 AM	Inspection Date:	
UST ID:		Compliance Date:	03/16/2015 12:00:00 AM
Permit Status:	Permit Renewed	Last Updated:	06/23/2023 12:00:00 AM
Active Permit:	true	NOV:	false
Program Element:	Hazardous Waste Generator		
Violation Code:	3030007 Failure to properly label hazardous waste accumulation containers with the following requirements: "Hazardous Waste", name and address of the generator, physical and chemical characteristics of the Hazardous Waste, and starting accumulation date.; 22 CCR 12 66262.34(f).		
Violation Classification:	Class II		
Container Tank ID:	37-000-105223	Inspection No:	6923983
Facility ID No:	77222	Inspection Type:	Initial Inspection
ID:	04/05/2023 12:00:00 AM	Inspection Date:	
UST ID:		Compliance Date:	04/05/2023 12:00:00 AM
Permit Status:	Permit Renewed	Last Updated:	06/23/2023 12:00:00 AM
Active Permit:	true	NOV:	false
Program Element:	Hazardous Waste Generator		
Violation Code:	HMD0152 Failed to report &/or update the required inventory information for hazardous waste(s) generated at the facility in CERS. SDCC 68.904(a)(2)		
Violation Classification:	Class II		
Container Tank ID:	37-000-105223	Inspection No:	6923983
Facility ID No:	77217	Inspection Type:	Initial Inspection
ID:	04/05/2023 12:00:00 AM	Inspection Date:	
UST ID:		Compliance Date:	
Permit Status:	Permit Renewed	Last Updated:	06/23/2023 12:00:00 AM
Active Permit:	true	NOV:	
Program Element:	Hazardous Waste Generator		
Violation Code:	HMD0001 RECORD KEEPING/OPERATIONAL REQUIREMENTS		
Violation Classification:			
Container Tank ID:	37-000-105223	Inspection No:	6923983
Facility ID No:	77221	Inspection Type:	Initial Inspection
ID:	04/05/2023 12:00:00 AM	Inspection Date:	
UST ID:		Compliance Date:	
Permit Status:	Permit Renewed	Last Updated:	06/23/2023 12:00:00 AM
Active Permit:	true	NOV:	false
Program Element:	Hazardous Waste Generator		
Violation Code:	3050001 Failed to use a DTSC registered hazardous waste transporter to transport hazardous waste. HSC 25163		

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Violation Classification:		(a) Class II				
Container Tank ID:	37-000-105223			Inspection No:	6923983	
Facility ID No:	77220			Inspection Type:	Initial Inspection	
ID:	04/05/2023 12:00:00 AM			Inspection Date:		
UST ID:				Compliance Date:		
Permit Status:	Permit Renewed			Last Updated:	06/23/2023 12:00:00 AM	
Active Permit:	true			NOV:	false	
Program Element:	Hazardous Waste Generator					
Violation Code:	3030007 Failed to properly label/date hazardous waste container &/or tank. 22 CCR 66262.34(f)					
Violation Classification:	Minor					
Container Tank ID:	37-000-105223			Inspection No:	6923983	
Facility ID No:	77219			Inspection Type:	Initial Inspection	
ID:	04/05/2023 12:00:00 AM			Inspection Date:		
UST ID:				Compliance Date:		
Permit Status:	Permit Renewed			Last Updated:	06/23/2023 12:00:00 AM	
Active Permit:	true			NOV:		
Program Element:	Hazardous Waste Generator					
Violation Code:	HMD0000 HAZARDOUS WASTE REQUIREMENTS FOR SQGS AND LQGS					
Violation Classification:						
Container Tank ID:	37-000-105223			Inspection No:	6923983	
Facility ID No:	77216			Inspection Type:	Initial Inspection	
ID:	04/05/2023 12:00:00 AM			Inspection Date:		
UST ID:				Compliance Date:		
Permit Status:	Permit Renewed			Last Updated:	06/23/2023 12:00:00 AM	
Active Permit:	true			NOV:		
Program Element:	Hazardous Waste Generator					
Violation Code:	HMD0001 DISPOSAL AND TRANSPORTATION					
Violation Classification:						
Container Tank ID:	37-000-105223			Inspection No:	6923983	
Facility ID No:	77218			Inspection Type:	Initial Inspection	
ID:	04/05/2023 12:00:00 AM			Inspection Date:		
UST ID:				Compliance Date:		
Permit Status:	Permit Renewed			Last Updated:	06/23/2023 12:00:00 AM	
Active Permit:	true			NOV:		
Program Element:	Hazardous Waste Generator					
Violation Code:	HMD0000 HAZARDOUS WASTE REQUIREMENTS FOR SQGS ONLY					
Violation Classification:						
<u>HMD Permits Map Data</u>						
Epa ID:	CAL000105507			Opened Dt:	2002-05-04T00:00:00	
Cers ID:	10375060			Expiration Dt:	2024-07-31T00:00:00	
Sitemap:	MAP_105223.pdf			Rpt Name:	HMBP105223.pdf	
Record Status:	Permit Renewed			Hirt Flag:	N	
Er Contact1:	Torean Kelley			Billing Code1:	Base + CUPA	
Er Title1:	Owner			St No:	1939	
Er Phone1:	6194486242			St No End:		
Er Altphone:	6194486242			St Name:	MAIN	
Er Contact2:	Barney Kelley			St Dir:		
Er Title2:	Owner			St Type:	ST	
Er Phone2:	6193227728			St Unit:	R	
Er Altphone2:	6193227728			Insp Dist Geoinfo:	HP064	
Biz Apn:	282-141-59-00					
Biz Phone:	6194486242					
Biz Email:	Tori@discountrvinc.com					
Biz Owner:	Torean Kelley					
Biz Type:	Auto/Truck Body Repair					
Facility Subject To Calarp:						
Plating Shop Metal Finishing:						
Chemical Supplier Wholesale:						
Pesticide Applicator Fumigatio:						
Chem Gas Paint Manufacture:						
Resin Site With 6 Items:						

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Petroleum Propane Fuel Supp:
 Site With Gt20 Inventory Items:
 Apsa Stor Tank Gt10000 Gal:
 Apsa Stor Tank Chem Gt999ga:
 Ust Stor Tank Fuel Gt30k Ga:
 Cryogas Gt20kcft200gal1200lb:
 Gases Gt20kCft 208 Gal 1666 L:
 Prop Gt185kCft5k Gal 2100:
 Extreme Haz Gt20 Cft 54 Gal 5:

HMD Facility Data

ID:	37317	Tank Status:	Removed
Facility ID No:	37-000-105223	Tank Cap in Galons:	500
Tank ID No:	19180	Tank Contents:	
Permit Status:	Permit Renewed	Tank Use:	04
Active Permit:	true	Type of Tank:	95
Dt UST Perm Closed:	11/08/1986 12:00:00 AM	Last Updated:	06/23/2023 02:32:03 AM
Piping System Type:			
Tank Owner Name:	Torean Kelly		
Facility Type UST Facility:			

4	8 of18	NE	0.07 / 355.62	1,422.11 / 4	JEFF READE CHEVROLET- OLDSMOBIL 1939 MAIN ST. RAMONA CA 92065	 HHSS
County:		San Diego				
Tank Details Microfiche:		http://geotracker.waterboards.ca.gov/ustpdfs/pdf/0002b581.pdf				

4	9 of18	NE	0.07 / 355.62	1,422.11 / 4	JEFF READE CHEVROLET- OLDSMOBIL 1939 MAIN ST. RAMONA CA	HIST TANK
Owner Name:		JOHN R. SINGER		No of Containers:		1
Owner Street:		2401 DURAZNITOS RD.		County:		SAN DIEGO
Owner City:		RAMONA		Facility State:		CA
Owner State:		CA		Facility Zip:		92065
Owner Zip:		92065				

4	10 of18	NE	0.07 / 355.62	1,422.11 / 4	HIGH-COUNTRY CHEV-OLDS INC 1939 MAIN ST RAMONA CA 92065	RCRA NON GEN
Handler ID:		CAD981686470				
Generator Status:		N				
Recycler Activity?:		NO				
Recycler Activity Note:		This facility has not been identified as a Recycler Facility from both the RCRA Handler and Biennial Report Modules.				

Violation/Evaluation Summary

Note: NO RECORDS: As of Nov 2025, there are no Compliance Monitoring and Enforcement (violation) records associated with this facility (EPA ID).

Handler Summary

Importer:	No	Used Oil Transpor:	No
Mixed Waste Gen:	No	Used Oil Trans Fac:	No
Transporter:	No	Used Oil Processor:	No

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Transfer Facility:	No				Used Oil Refiner:	No
Recycler:	No				Used Oil Burner:	No
Onsite Burner Exem:	No				Commercial TSD:	No
Furnace Exemption:	No				Recycl Nonstorage:	No
Underground Injec:	No					
Used Oil Market Burner:		No				
Used Oil Spec Marketer:		No				

Additional Handler Summary Details

Source Type:	N			NAIC 1:	
Seq No:	1			NAIC 2:	
Non Notifier:				NAIC 3:	
Receive Date:	19861024			NAIC 4:	
Active Site:	-----			State:	CA
Land Type:	O			Location Latitude:	33.03253
In Handler Univ:	N			Location Longitude:	-116.883965
In A Universe:	N			Loc GIS Primary:	N
Gen Status:	N			Loc GIS Origin:	AG
Report Cycle:				State District Owner:	CA
Accessibility:				State District:	4
Region:	09				
Fed Waste Gen Owner:	HQ				
State Waste Generator Owner:	HQ				
State Waste Generator:	N				
Short Term Generator:	N				
Uni Waste:	N				
Universal Waste Dest Facility:	N				
Federal Universal Waste:	N				
As Federally Regulated Tsdf:	-----				
As Converter Tsdf:	-----				
As State Regulated Tsdf:	-----				
As State Regulated Handler:	---				
Federal Indicator:	---				
Hsm:	N				
Subpart K:	----				
GPRA Permit:	N				
GPRA Renewal:	N				
Permit Renewal Wrkld:	-----				
Permwrk ID:	-----				
Perm Prog:	-----				
Pcwrkld:	-----				
Closwrkld:	-----				
GPRA Ca:	N				
Cawrkld:	N				
Subjca Tsd Discretion:	N				
NCAPS:	N				
EC Indicator:	N				
Ca725 Indicator:	N				
Ca750 Indicator:	N				
Operating Tsdf:	-----				
Full Enforcement:	-----				
Snc:	N				
Unaddressed Snc:	N				
Addressed Snc:	N				
Snc With Comp Sched:	N				
Fa Required:	-----				
Hhandler Last Change:	20020627				
Recognized Trader Importer:	N				
Recognized Trader Exporter:	N				
Slab Importer:	N				
Slab Exporter:	N				
Manifest Broker:	N				
Subpart P:	N				
Contact Language:	EN				
Handler Name:	HIGH-COUNTRY CHEV-OLDS INC				
Location Street No:					
Location Street1:	1939 MAIN ST\				

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Location Street2:						
Location City:		RAMONA				
Location State:		CA				
Location Zip:		92065				
Location County Code:		CA073				
Location County Name:		SAN DIEGO				
Location Country:		US				
Contact Name:		ENVIRONMENTAL MANAGER				
Contact Street No:						
Contact Street1:		1939 MAIN ST\				
Contact Street2:						
Contact City:		RAMONA				
Contact State:		CA				
Contact Zip:		92065				
Contact Country:		US				
Contact Phone & Ext:		619-789-2201				
Contact Fax:						
Contact Email Address:						
Contact Title:						
Owner Name:		JIM WILLIAMS				
Owner Type:		P				
Owner Seq:		1				
Operator Name:		NOT REQUIRED				
Operator Type:		P				
Operator Seq:		2				
Public Notes:						
<u>Hazardous Waste Handler Details</u>						
Seq No:		1				
Receive Date:		19861024				
Handler Name:		HIGH-COUNTRY CHEV-OLDS INC				
Fed Waste Generator:		N				
Generator Code Description:		Not a Generator, Verified				
Source Type:		Notification				
TSD Activity:		N				
<u>Owner/Operator Details</u>						
Owner/Operator Ind:		Current Operator			Street No:	
Type:		Private			Street1:	
Name:		NOT REQUIRED			NOT REQUIRED	
Dt Became Current:					Street2:	
Dt Ended Current:					City:	
Phone:		415-555-1212			NOT REQUIRED	
Source Type:		Notification			State:	
					ME	
					Country:	
					Zip:	
					99999	
Owner/Operator Ind:		Current Owner			Street No:	
Type:		Private			Street1:	
Name:		JIM WILLIAMS			NOT REQUIRED	
Dt Became Current:					Street2:	
Dt Ended Current:					City:	
Phone:		415-555-1212			NOT REQUIRED	
Source Type:		Notification			State:	
					ME	
					Country:	
					Zip:	
					99999	

4	11 of 18	NE	0.07 / 355.62	1,422.11 / 4	JEFF READE CHEVROLET OLDSMOBILE 1939 MAIN ST RAMONA CA 92065	RCRA NON GEN
Handler ID:		CAD056297476				
Generator Status:		N				
Recycler Activity?:		NO				
Recycler Activity Note:		This facility has not been identified as a Recycler Facility from both the RCRA Handler and Biennial Report Modules.				

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Violation/Evaluation Summary

Note: NO RECORDS: As of Nov 2025, there are no Compliance Monitoring and Enforcement (violation) records associated with this facility (EPA ID).

Handler Summary

Importer:	No	Used Oil Transpor:	No
Mixed Waste Gen:	No	Used Oil Trans Fac:	No
Transporter:	No	Used Oil Processor:	No
Transfer Facility:	No	Used Oil Refiner:	No
Recycler:	No	Used Oil Burner:	No
Onsite Burner Exem:	No	Commercial TSD:	No
Furnace Exemption:	No	Recycl Nonstorage:	No
Underground Injec:	No		
Used Oil Market Burner:	No		
Used Oil Spec Marketer:	No		

Additional Handler Summary Details

Source Type:	N	NAIC 1:	
Seq No:	1	NAIC 2:	
Non Notifier:		NAIC 3:	
Receive Date:	19860731	NAIC 4:	
Active Site:	----	State:	CA
Land Type:	O	Location Latitude:	33.03253
In Handler Univ:	N	Location Longitude:	-116.883965
In A Universe:	N	Loc GIS Primary:	N
Gen Status:	N	Loc GIS Origin:	AG
Report Cycle:		State District Owner:	CA
Accessibility:		State District:	4
Region:	09		
Fed Waste Gen Owner:	HQ		
State Waste Generator Owner:	HQ		
State Waste Generator:	N		
Short Term Generator:	N		
Uni Waste:	N		
Universal Waste Dest Facility:	N		
Federal Universal Waste:	N		
As Federally Regulated Tsdf:	-----		
As Converter Tsdf:	-----		
As State Regulated Tsdf:	-----		
As State Regulated Handler:	---		
Federal Indicator:	---		
Hsm:	N		
Subpart K:	----		
GPRA Permit:	N		
GPRA Renewal:	N		
Permit Renewal Wrkld:	-----		
Permwrk ID:	-----		
Perm Prog:	-----		
Pcwrkld:	-----		
Closwrkld:	-----		
GPRA Ca:	N		
Cawrkld:	N		
Subjca Tsd Discretion:	N		
NCAPS:	N		
EC Indicator:	N		
Ca725 Indicator:	N		
Ca750 Indicator:	N		
Operating Tsdf:	-----		
Full Enforcement:	-----		
Snc:	N		
Unaddressed Snc:	N		
Addressed Snc:	N		

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Snc With Comp Sched:		N				
Fa Required:		-----				
Hhandler Last Change:		20020627				
Recognized Trader Importer:		N				
Recognized Trader Exporter:		N				
Slab Importer:		N				
Slab Exporter:		N				
Manifest Broker:		N				
Subpart P:		N				
Contact Language:		EN				
Handler Name:		JEFF READE CHEVROLET OLDSMOBILE				
Location Street No:						
Location Street1:		1939 MAIN ST				
Location Street2:						
Location City:		RAMONA				
Location State:		CA				
Location Zip:		92065				
Location County Code:		CA073				
Location County Name:		SAN DIEGO				
Location Country:		US				
Contact Name:		ENVIRONMENTAL MANAGER				
Contact Street No:						
Contact Street1:		1939 MAIN ST				
Contact Street2:						
Contact City:		RAMONA				
Contact State:		CA				
Contact Zip:		92065				
Contact Country:		US				
Contact Phone & Ext:		619-789-2201				
Contact Fax:						
Contact Email Address:						
Contact Title:						
Owner Name:		JEFF READE CHEV OLDS				
Owner Type:		P				
Owner Seq:		1				
Operator Name:		NOT REQUIRED				
Operator Type:		P				
Operator Seq:		2				
Public Notes:						

Hazardous Waste Handler Details

Seq No: 1
 Receive Date: 19860731
 Handler Name: JEFF READE CHEVROLET OLDSMOBILE
 Fed Waste Generator: N
 Generator Code Description: Not a Generator, Verified
 Source Type: Notification
 TSD Activity: N

Owner/Operator Details

Owner/Operator Ind:	Current Operator	Street No:	
Type:	Private	Street1:	NOT REQUIRED
Name:	NOT REQUIRED	Street2:	
Dt Became Current:		City:	NOT REQUIRED
Dt Ended Current:		State:	ME
Phone:	415-555-1212	Country:	
Source Type:	Notification	Zip:	99999

Owner/Operator Ind:	Current Owner	Street No:	
Type:	Private	Street1:	NOT REQUIRED
Name:	JEFF READE CHEV OLDS	Street2:	
Dt Became Current:		City:	NOT REQUIRED
Dt Ended Current:		State:	ME
Phone:	415-555-1212	Country:	

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Source Type:	Notification			Zip:	99999	

<u>4</u>	12 of 18	NE	0.07 / 355.62	1,422.11 / 4	RAMONA RV&AUTO 1939 MAIN ST RAMONA CA 92065	RCRA NON GEN

Handler ID: CAL000439898
Generator Status: N
Recycler Activity?: NO
Recycler Activity Note: This facility has not been identified as a Recycler Facility from both the RCRA Handler and Biennial Report Modules.

Violation/Evaluation Summary

Note: NO RECORDS: As of Nov 2025, there are no Compliance Monitoring and Enforcement (violation) records associated with this facility (EPA ID).

Handler Summary

Importer:	No	Used Oil Transpor:	No
Mixed Waste Gen:	No	Used Oil Trans Fac:	No
Transporter:	No	Used Oil Processor:	No
Transfer Facility:	No	Used Oil Refiner:	No
Recycler:	No	Used Oil Burner:	No
Onsite Burner Exem:	No	Commercial TSD:	No
Furnace Exemption:	No	Recycl Nonstorage:	No
Underground Injec:	No		
Used Oil Market Burner:	No		
Used Oil Spec Marketer:	No		

Additional Handler Summary Details

Source Type:	I	NAIC 1:	811111
Seq No:	1	NAIC 2:	
Non Notifier:		NAIC 3:	
Receive Date:	20181016	NAIC 4:	
Active Site:	H----	State:	CA
Land Type:		Location Latitude:	33.033105
In Handler Univ:	Y	Location Longitude:	-116.884314
In A Universe:	Y	Loc GIS Primary:	N
Gen Status:	N	Loc GIS Origin:	AG
Report Cycle:		State District Owner:	
Accessibility:		State District:	
Region:	09		
Fed Waste Gen Owner:	HQ		
State Waste Generator Owner:	CA		
State Waste Generator:	2		
Short Term Generator:	N		
Uni Waste:	Y		
Universal Waste Dest Facility:	Y		
Federal Universal Waste:	N		
As Federally Regulated Tsdf:	-----		
As Converter Tsdf:	-----		
As State Regulated Tsdf:	-----		
As State Regulated Handler:	---		
Federal Indicator:	---		
Hsm:	N		
Subpart K:	----		
GPRA Permit:	N		
GPRA Renewal:	N		
Permit Renewal Wrkld:	-----		
Permwrk ID:	-----		
Perm Prog:	-----		
Pcwrkld:	-----		
Closwrkld:	-----		

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
GPRA Ca:		N				
Cawrkld:		N				
Subjca Tsd Discretion:		N				
NCAPS:		N				
EC Indicator:		N				
Ca725 Indicator:		N				
Ca750 Indicator:		N				
Operating Tsdf:		-----				
Full Enforcement:		-----				
Snc:		N				
Unaddressed Snc:		N				
Addressed Snc:		N				
Snc With Comp Sched:		N				
Fa Required:		-----				
Hhandler Last Change:		20181120				
Recognized Trader Importer:		N				
Recognized Trader Exporter:		N				
Slab Importer:		N				
Slab Exporter:		N				
Manifest Broker:		N				
Subpart P:		N				
Contact Language:		EN				
Handler Name:		RAMONA RV&AUTO				
Location Street No:						
Location Street1:		1939 MAIN ST				
Location Street2:						
Location City:		RAMONA				
Location State:		CA				
Location Zip:		92065				
Location County Code:		CA073				
Location County Name:		SAN DIEGO				
Location Country:		US				
Contact Name:		JAMES SPENCER				
Contact Street No:						
Contact Street1:		1939 MAIN ST				
Contact Street2:						
Contact City:		RAMONA				
Contact State:		CA				
Contact Zip:		92065				
Contact Country:						
Contact Phone & Ext:		760-788-6961				
Contact Fax:		760-788-6546				
Contact Email Address:						
Contact Title:						
Owner Name:		JAMES SPENCER				
Owner Type:		O				
Owner Seq:		1				
Operator Name:		JAMES SPENCER				
Operator Type:		O				
Operator Seq:		2				
Public Notes:						

Contact DTSC for information.

Hazardous Waste Handler Details

Seq No: 1
Receive Date: 20181016
Handler Name: RAMONA RV&AUTO
Fed Waste Generator: N
Generator Code Description: Not a Generator, Verified
Source Type: Implementer
TSD Activity: N

Owner/Operator Details

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Owner/Operator Ind: Current Operator Type: Other Name: JAMES SPENCER Dt Became Current: Dt Ended Current: Phone: 760-788-6961 Source Type: Implementer Street No: Street1: 1939 MAIN ST Street2: City: RAMONA State: CA Country: Zip: 92065						
Owner/Operator Ind: Current Owner Type: Other Name: JAMES SPENCER Dt Became Current: Dt Ended Current: Phone: 760-788-6961 Source Type: Implementer Street No: Street1: 1939 MAIN ST Street2: City: RAMONA State: CA Country: Zip: 92065						

<u>4</u>	13 of 18	NE	0.07 / 355.62	1,422.11 / 4	SUN VALLEY BODY & PAINT 1939 MAIN ST STE R RAMONA CA 92065-0000	RCRA NON GEN

Handler ID: CAL000209651
Generator Status: N
Recycler Activity?: NO
Recycler Activity Note: This facility has not been identified as a Recycler Facility from both the RCRA Handler and Biennial Report Modules.

Violation/Evaluation Summary

Note: NO RECORDS: As of Nov 2025, there are no Compliance Monitoring and Enforcement (violation) records associated with this facility (EPA ID).

Handler Summary

Importer:	No	Used Oil Transpor:	No
Mixed Waste Gen:	No	Used Oil Trans Fac:	No
Transporter:	No	Used Oil Processor:	No
Transfer Facility:	No	Used Oil Refiner:	No
Recycler:	No	Used Oil Burner:	No
Onsite Burner Exem:	No	Commercial TSD:	No
Furnace Exemption:	No	Recycl Nonstorage:	No
Underground Injec:	No		
Used Oil Market Burner:	No		
Used Oil Spec Marketer:	No		

Additional Handler Summary Details

Source Type:	I	NAIC 1:	811121
Seq No:	1	NAIC 2:	
Non Notifier:		NAIC 3:	
Receive Date:	20000229	NAIC 4:	
Active Site:	H----	State:	CA
Land Type:		Location Latitude:	33.033105
In Handler Univ:	Y	Location Longitude:	-116.884314
In A Universe:	Y	Loc GIS Primary:	N
Gen Status:	N	Loc GIS Origin:	AG
Report Cycle:		State District Owner:	
Accessibility:		State District:	
Region:	09		
Fed Waste Gen Owner:	HQ		
State Waste Generator Owner:	CA		
State Waste Generator:	2		
Short Term Generator:	N		
Uni Waste:	Y		
Universal Waste Dest Facility:	Y		
Federal Universal Waste:	N		

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
As Federally Regulated Tsdf:	-----					
As Converter Tsdf:	-----					
As State Regulated Tsdf:	-----					
As State Regulated Handler:	---					
Federal Indicator:	---					
Hsm:	N					
Subpart K:	----					
GPRA Permit:	N					
GPRA Renewal:	N					
Permit Renewal Wrkld:	-----					
Permwrk ID:	-----					
Perm Prog:	-----					
Pcwrkld:	-----					
Closwrkld:	-----					
GPRA Ca:	N					
Cawrkld:	N					
Subjca Tsd Discretion:	N					
NCAPS:	N					
EC Indicator:	N					
Ca725 Indicator:	N					
Ca750 Indicator:	N					
Operating Tsdf:	-----					
Full Enforcement:	-----					
Snc:	N					
Unaddressed Snc:	N					
Addressed Snc:	N					
Snc With Comp Sched:	N					
Fa Required:	-----					
Hhandler Last Change:	20180905					
Recognized Trader Importer:	N					
Recognized Trader Exporter:	N					
Slab Importer:	N					
Slab Exporter:	N					
Manifest Broker:	N					
Subpart P:	N					
Contact Language:	EN					
Handler Name:	SUN VALLEY BODY & PAINT					
Location Street No:						
Location Street1:	1939 MAIN ST STE R					
Location Street2:						
Location City:	RAMONA					
Location State:	CA					
Location Zip:	92065-0000					
Location County Code:	CA073					
Location County Name:	SAN DIEGO					
Location Country:	US					
Contact Name:	JOHN FARDOS					
Contact Street No:						
Contact Street1:	1939 MAIN ST STE R					
Contact Street2:						
Contact City:	RAMONA					
Contact State:	CA					
Contact Zip:	92065-0000					
Contact Country:						
Contact Phone & Ext:	760-788-4449					
Contact Fax:	000-000-0000					
Contact Email Address:	SUNVALLEYBODYANDPAINT@AOL.COM					
Contact Title:						
Owner Name:	JOHN FARDOS					
Owner Type:	O					
Owner Seq:	1					
Operator Name:	JOHN FARDOS					
Operator Type:	O					
Operator Seq:	2					
Public Notes:						

Contact DTSC for information.

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Hazardous Waste Handler Details

Seq No: 1
 Receive Date: 20000229
 Handler Name: SUN VALLEY BODY & PAINT
 Fed Waste Generator: N
 Generator Code Description: Not a Generator, Verified
 Source Type: Implementer
 TSD Activity: N

Owner/Operator Details

Owner/Operator Ind:	Current Owner	Street No:	
Type:	Other	Street1:	1939 MAIN ST
Name:	JOHN FARDOS	Street2:	
Dt Became Current:		City:	RAMONA
Dt Ended Current:		State:	CA
Phone:	760-788-4449	Country:	
Source Type:	Implementer	Zip:	92065-0000
Owner/Operator Ind:	Current Operator	Street No:	
Type:	Other	Street1:	1939 MAIN ST STE R
Name:	JOHN FARDOS	Street2:	
Dt Became Current:		City:	RAMONA
Dt Ended Current:		State:	CA
Phone:	760-788-4449	Country:	
Source Type:	Implementer	Zip:	92065-0000

4	14 of 18	NE	0.07 / 355.62	1,422.11 / 4	GMBC REAL ESTATE 1939 MAIN STREET RAMONA CA 92065	RCRA NON GEN
Handler ID:	CAC003155771					
Generator Status:	N					
Recycler Activity?:	NO					
Recycler Activity Note:	This facility has not been identified as a Recycler Facility from both the RCRA Handler and Biennial Report Modules.					

Violation/Evaluation Summary

Note: NO RECORDS: As of Nov 2025, there are no Compliance Monitoring and Enforcement (violation) records associated with this facility (EPA ID).

Handler Summary

Importer:	No	Used Oil Transpor:	No
Mixed Waste Gen:	No	Used Oil Trans Fac:	No
Transporter:	No	Used Oil Processor:	No
Transfer Facility:	No	Used Oil Refiner:	No
Recycler:	No	Used Oil Burner:	No
Onsite Burner Exem:	No	Commercial TSD:	No
Furnace Exemption:	No	Recycl Nonstorage:	No
Underground Injec:	No		
Used Oil Market Burner:	No		
Used Oil Spec Marketer:	No		

Additional Handler Summary Details

Source Type:	I	NAIC 1:	236118
Seq No:	1	NAIC 2:	
Non Notifier:		NAIC 3:	
Receive Date:	20220106	NAIC 4:	

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Active Site:	----				State:	CA
Land Type:					Location Latitude:	33.03253
In Handler Univ:	N				Location Longitude:	-116.883965
In A Universe:	N				Loc GIS Primary:	N
Gen Status:	N				Loc GIS Origin:	AG
Report Cycle:					State District Owner:	
Accessibility:					State District:	
Region:	09					
Fed Waste Gen Owner:		HQ				
State Waste Generator Owner:		CA				
State Waste Generator:		2				
Short Term Generator:		N				
Uni Waste:		N				
Universal Waste Dest Facility:		N				
Federal Universal Waste:		N				
As Federally Regulated Tsdf:		-----				
As Converter Tsdf:		-----				
As State Regulated Tsdf:		-----				
As State Regulated Handler:		---				
Federal Indicator:		---				
Hsm:		N				
Subpart K:		----				
GPRA Permit:		N				
GPRA Renewal:		N				
Permit Renewal Wrkld:		-----				
Permwrk ID:		-----				
Perm Prog:		-----				
Pcwrkld:		-----				
Closwrkld:		-----				
GPRA Ca:		N				
Cawrkld:		N				
Subjca Tsd Discretion:		N				
NCAPS:		N				
EC Indicator:		N				
Ca725 Indicator:		N				
Ca750 Indicator:		N				
Operating Tsdf:		-----				
Full Enforcement:		-----				
Snc:		N				
Unaddressed Snc:		N				
Addressed Snc:		N				
Snc With Comp Sched:		N				
Fa Required:		----				
Hhandler Last Change:		20220106				
Recognized Trader Importer:		N				
Recognized Trader Exporter:		N				
Slab Importer:		N				
Slab Exporter:		N				
Manifest Broker:		N				
Subpart P:		N				
Contact Language:		EN				
Handler Name:		GMBC REAL ESTATE				
Location Street No:						
Location Street1:		1939 MAIN STREET				
Location Street2:						
Location City:		RAMONA				
Location State:		CA				
Location Zip:		92065				
Location County Code:		CA073				
Location County Name:		SAN DIEGO				
Location Country:		US				
Contact Name:		TIM MONETTA				
Contact Street No:						
Contact Street1:		406 16TH STREET 104A				
Contact Street2:						
Contact City:		RAMONA				
Contact State:		CA				
Contact Zip:		92065				
Contact Country:						

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Contact Phone & Ext:	619-840-4916
Contact Fax:	
Contact Email Address:	TIM@GMBCREALESTATE.COM
Contact Title:	
Owner Name:	SINGER FAMILY TRUST
Owner Type:	O
Owner Seq:	1
Operator Name:	TIM MONETTA
Operator Type:	O
Operator Seq:	2
Public Notes:	

Contact DTSC for information.

Hazardous Waste Handler Details

Seq No:	1
Receive Date:	20220106
Handler Name:	GMBC REAL ESTATE
Fed Waste Generator:	N
Generator Code Description:	Not a Generator, Verified
Source Type:	Implementer
TSD Activity:	N

Owner/Operator Details

Owner/Operator Ind:	Current Operator	Street No:	
Type:	Other	Street1:	406 16TH STREET 104A
Name:	TIM MONETTA	Street2:	
Dt Became Current:		City:	RAMONA
Dt Ended Current:		State:	CA
Phone:	619-840-4916	Country:	
Source Type:	Implementer	Zip:	92065
Owner/Operator Ind:	Current Owner	Street No:	
Type:	Other	Street1:	406 16TH STREET 104A
Name:	SINGER FAMILY TRUST	Street2:	
Dt Became Current:		City:	RAMONA
Dt Ended Current:		State:	CA
Phone:	619-840-4916	Country:	
Source Type:	Implementer	Zip:	92065

4	15 of 18	NE	0.07 / 355.62	1,422.11 / 4	DISCOUNT RV INC 1939 MAIN ST RAMONA CA 92065	RCRA NON GEN

Handler ID:	CAL000478193
Generator Status:	N
Recycler Activity?:	NO
Recycler Activity Note:	This facility has not been identified as a Recycler Facility from both the RCRA Handler and Biennial Report Modules.

Violation/Evaluation Summary

Note:	NO RECORDS: As of Nov 2025, there are no Compliance Monitoring and Enforcement (violation) records associated with this facility (EPA ID).

Handler Summary

Importer:	No	Used Oil Transpor:	No
Mixed Waste Gen:	No	Used Oil Trans Fac:	No
Transporter:	No	Used Oil Processor:	No
Transfer Facility:	No	Used Oil Refiner:	No

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Recycler:	No				Used Oil Burner:	No
Onsite Burner Exem:	No				Commercial TSD:	No
Furnace Exemption:	No				Recycl Nonstorage:	No
Underground Injec:	No					
Used Oil Market Burner:	No	No				
Used Oil Spec Marketer:	No	No				

Additional Handler Summary Details

Source Type:	I			NAIC 1:	811111
Seq No:	1			NAIC 2:	
Non Notifier:				NAIC 3:	
Receive Date:	20230525			NAIC 4:	
Active Site:	----			State:	CA
Land Type:				Location Latitude:	33.03253
In Handler Univ:	N			Location Longitude:	-116.883965
In A Universe:	N			Loc GIS Primary:	N
Gen Status:	N			Loc GIS Origin:	AG
Report Cycle:				State District Owner:	
Accessibility:				State District:	
Region:	09				
Fed Waste Gen Owner:	HQ				
State Waste Generator Owner:	CA				
State Waste Generator:	2				
Short Term Generator:	N				
Uni Waste:	N				
Universal Waste Dest Facility:	N				
Federal Universal Waste:	N				
As Federally Regulated Tsdf:	-----				
As Converter Tsdf:	-----				
As State Regulated Tsdf:	-----				
As State Regulated Handler:	---				
Federal Indicator:	---				
Hsm:	N				
Subpart K:	----				
GPRA Permit:	N				
GPRA Renewal:	N				
Permit Renewal Wrkld:	-----				
Permwrk ID:	-----				
Perm Prog:	-----				
Pcwrkld:	-----				
Closwrkld:	-----				
GPRA Ca:	N				
Cawrkld:	N				
Subjca Tsd Discretion:	N				
NCAPS:	N				
EC Indicator:	N				
Ca725 Indicator:	N				
Ca750 Indicator:	N				
Operating Tsdf:	-----				
Full Enforcement:	-----				
Snc:	N				
Unaddressed Snc:	N				
Addressed Snc:	N				
Snc With Comp Sched:	N				
Fa Required:	-----				
Hhandler Last Change:	20230612				
Recognized Trader Importer:	N				
Recognized Trader Exporter:	N				
Slab Importer:	N				
Slab Exporter:	N				
Manifest Broker:	N				
Subpart P:	N				
Contact Language:	EN				
Handler Name:	DISCOUNT RV INC				
Location Street No:					
Location Street1:	1939 MAIN ST				
Location Street2:					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Location City:	RAMONA
Location State:	CA
Location Zip:	92065
Location County Code:	CA073
Location County Name:	SAN DIEGO
Location Country:	US
Contact Name:	TOREAN KELLEY
Contact Street No:	
Contact Street1:	1939 MAIN ST
Contact Street2:	
Contact City:	RAMONA
Contact State:	CA
Contact Zip:	92065
Contact Country:	
Contact Phone & Ext:	619-448-6242
Contact Fax:	619-448-6253
Contact Email Address:	TORI@DISCOUNTRVINC.COM
Contact Title:	
Owner Name:	DISCOUNT RV INC
Owner Type:	O
Owner Seq:	1
Operator Name:	TOREAN KELLEY
Operator Type:	O
Operator Seq:	2
Public Notes:	

Contact DTSC for information.

Hazardous Waste Handler Details

Seq No:	1
Receive Date:	20230525
Handler Name:	DISCOUNT RV INC
Fed Waste Generator:	N
Generator Code Description:	Not a Generator, Verified
Source Type:	Implementer
TSD Activity:	N

Owner/Operator Details

Owner/Operator Ind:	Current Operator	Street No:	
Type:	Other	Street1:	1939 MAIN ST
Name:	TOREAN KELLEY	Street2:	
Dt Became Current:		City:	RAMONA
Dt Ended Current:		State:	CA
Phone:	619-448-6242	Country:	
Source Type:	Implementer	Zip:	92065
Owner/Operator Ind:	Current Owner	Street No:	
Type:	Other	Street1:	1939 MAIN ST
Name:	DISCOUNT RV INC	Street2:	
Dt Became Current:		City:	RAMONA
Dt Ended Current:		State:	CA
Phone:	619-448-6242	Country:	
Source Type:	Implementer	Zip:	92065

4	16 of 18	NE	0.07 / 355.62	1,422.11 / 4	Discount RV INC 1939 MAIN ST R RAMONA CA 92065	UST SANDIEGO
Facility ID:	37-000-105223	RCRA Large Qty. Gen:	false			
Record ID:	DEH2002-HUPFP-105223	HHW Collection:	false			
CERS ID:	10,375,060	Recycle:	false			
EPA ID No:	CAL000105507	Own or Operate UG:	false			
Permit Status:	Permit Renewed	Own or Operate AG:	false			

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Active Permit: true Haz. Mat. On-Site: true Haz. Waste Gen: true Onsite Haz Wt Trt: false Mailing Address: 1939 Main St, Ramona, CA 92065 Business Phone: 6194486242 Business Fax: 0 Last Updated: 2023 Jun 23 02:32:03 AM						
Tank Information						
Tank ID: 19180 Tank Status: Removed Permit Status: Permit Renewed Active Permit: true Dt UST Perm Closed: 1986 Nov 08 12:00:00 AM Type of Tank: 95 Tank Owner Name: Torean Kelly Tank Capacity in Gal: 500 Tank Contents: Tank Use: 04 Piping Sys Type: Fac Type (UST Fac): Last Updated: 2025 Aug 02 02:30:47 AM						
4	17 of 18	NE	0.07 / 355.62	1,422.11 / 4	RAMONA MOTORS INC 1939 MAIN ST RAMONA CA	UST SWEEPS
C C: A37-000-5223 BOE: Comp: 5223 Status: ACTIVE No of Tanks: Jurisdic: SAN DIEGO COUNTY Agency: SAN DIEGO COUNTY - U.S.T. Phone: D Filename: SITE02A Page No: 207 County: SAN DIEGO State : CA Zip: 92065 Latitude: 33.040704 Longitude: -116.870838 Georesult: S5HPNTSCZA						
4	18 of 18	NE	0.07 / 355.62	1,422.11 / 4	RAMONA MOTORS INC 1939 MAIN ST RAMONA CA	UST SWEEPS
C C: I37-000-5223 BOE: Comp: 5223 Status: INACTIVE No of Tanks: 1 Jurisdic: SAN DIEGO COUNTY Agency: SAN DIEGO COUNTY - U.S.T. Phone: (619) 789-2201 D Filename: NSITE1 Page No: 364 County: SAN DIEGO State : CA Zip: 92065 Latitude: 33.040704 Longitude: -116.870838 Georesult: S5HPNTSCZA						
Tank Details						
Tank ID: 000001 O Tank ID: SWRCB No: 37-000-005223-000001 Removed: Installed: 01-74-01 A Date: Capac: 500 Tank Use: PETROLEUM S Contain: NONE Stg: Storage : WASTE Storag Type: WASTE P Contain: OTHER Content: ONA: D File Name: NTANK1						
5	1 of 4	ENE	0.08 / 443.49	1,422.28 / 5	O'REILLY AUTO PARTS #2724 1935 MAIN STREET - HWY 67 RAMONA CA 92065	C&D DEBRIS RECY
County: SAN DIEGO Activity Type: USED OIL COLLECTION Phone No:						

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
5	2 of 4	ENE	0.08 / 443.49	1,422.28 / 5	O'REILLY AUTO PARTS #2724 1935 MAIN ST RAMONA CA 92065	CERS HAZ

Latitude: 33.033260
Longitude: -116.883682

Regulated Programs

EI ID: 10375087 **EI Description:** Hazardous Waste Generator
EI ID: 10375087 **EI Description:** Chemical Storage Facilities

Violations

Violation Date: 01/24/2024 **Violation Source:** CERS
Violation Program: HW **Violation Division:** San Diego County Department of Env Health
Citation: 22 CCR 12 66262.40(a) - California Code of Regulations, Title 22, Chapter 12, Section(s) 66262.40(a)
Violation Notes:

Returned to compliance on 02/20/2024. Inspection Sequence ID:7316909

Violation Description:

Failure to keep a copy of each properly signed manifest for at least three years from the date the waste was accepted by the initial transporter. The manifest signed at the time the waste was accepted for transport shall be kept until receiving a signed copy from the designated facility which received the waste.

Evaluations

Eval Date: 01/30/2018
Violations Found: No
Eval General Type: Compliance Evaluation Inspection
Eval Type: Routine done by local agency
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS
Eval Notes:

Inspector: Griffin Donelle Inspection ID:5883011; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date: 02/26/2021
Violations Found: No
Eval General Type: Compliance Evaluation Inspection
Eval Type: Routine done by local agency
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS
Eval Notes:

Inspector: Villalvazo Olivia Inspection ID:6371807; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date: 01/24/2024
Violations Found: Yes
Eval General Type: Compliance Evaluation Inspection
Eval Type: Routine done by local agency
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS
Eval Notes:

Inspector: Murphy Sky Inspection ID:7316909; Note: data in [EVAL Notes] field for some records is truncated from the source.

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Eval Date:	01/24/2024
Violations Found:	No
Eval General Type:	Compliance Evaluation Inspection
Eval Type:	Routine done by local agency
Eval Division:	San Diego County Department of Env Health
Eval Program:	HMRRP
Eval Source:	CERS
Eval Notes:	

Inspector: Murphy Sky Inspection ID:7316909; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date:	04/11/2016
Violations Found:	No
Eval General Type:	Compliance Evaluation Inspection
Eval Type:	Routine done by local agency
Eval Division:	San Diego County Department of Env Health
Eval Program:	HW
Eval Source:	CERS
Eval Notes:	

Inspector: Walsh Todd Inspection ID:5397999; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date:	01/30/2018
Violations Found:	No
Eval General Type:	Compliance Evaluation Inspection
Eval Type:	Routine done by local agency
Eval Division:	San Diego County Department of Env Health
Eval Program:	HW
Eval Source:	CERS
Eval Notes:	

Inspector: Griffin Donelle Inspection ID:5883011; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date:	04/11/2016
Violations Found:	No
Eval General Type:	Compliance Evaluation Inspection
Eval Type:	Routine done by local agency
Eval Division:	San Diego County Department of Env Health
Eval Program:	HMRRP
Eval Source:	CERS
Eval Notes:	

Inspector: Walsh Todd Inspection ID:5397999; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date:	02/26/2021
Violations Found:	No
Eval General Type:	Compliance Evaluation Inspection
Eval Type:	Routine done by local agency
Eval Division:	San Diego County Department of Env Health
Eval Program:	HMRRP
Eval Source:	CERS
Eval Notes:	

Inspector: Villalvazo Olivia Inspection ID:6371807; Note: data in [EVAL Notes] field for some records is truncated from the source.

Affiliations

Affil Type Desc:	Environmental Contact
Entity Name:	3E, Regulatory Department/O'Reilly Auto Parts
Entity Title:	
Address:	3207 Grey Hawk Court, Suite 200
City:	Carlsbad
State:	CA
Country:	

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Zip Code: Phone:		92010				
Affil Type Desc: Entity Name: Entity Title: Address: City: State: Country: Zip Code: Phone:		CUPA District San Diego County Env Health Qlty PO Box 129261 San Diego CA 92112-9261 (858) 505-6880				
Affil Type Desc: Entity Name: Entity Title: Address: City: State: Country: Zip Code: Phone:		Facility Mailing Address Mailing Address 3E,Reg Dept/O'Reilly Auto Parts, 3207 Grey Hawk Court, Suite 200 Carlsbad CA 92010				
Affil Type Desc: Entity Name: Entity Title: Address: City: State: Country: Zip Code: Phone:		Parent Corporation O'Reilly Auto Parts 				
Affil Type Desc: Entity Name: Entity Title: Address: City: State: Country: Zip Code: Phone:		Operator O'Reilly Auto Enterprises, L.L.C. 				
Affil Type Desc: Entity Name: Entity Title: Address: City: State: Country: Zip Code: Phone:		Document Preparer Merlando Contreras, Agent for O'Reilly Auto Enterprises, L.L.C. 				
Affil Type Desc: Entity Name: Entity Title: Address: City: State: Country: Zip Code: Phone:		Legal Owner O'Reilly Auto Enterprises, L.L.C. 233 S Patterson Ave Springfield MO United States 65802 (417) 862-3333				
Affil Type Desc: Entity Name: Entity Title: Address: City: State:		Identification Signer Hector Vasquez, Agent for O'Reilly Auto Enterprises, L.L.C. Regulatory Compliance Specialist II, 3E 				

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Country: Zip Code: Phone:						
<u>Coordinates</u>						
Env Int Type Code:	HWG			Longitude:	-116.883680	
Program ID:	10375087			Coord Name:		
Latitude:	33.033260			Ref Point Type Desc:	Center of a facility or station.	

<u>5</u>	3 of 4	ENE	0.08 / 443.49	1,422.28 / 5	O'Reilly Auto Parts #2724 1935 MAIN ST RAMONA CA 92065	HAZ SANDIEGO

Record ID: DEH2002-HUPFP-134974
Facility Name: O'Reilly Auto Parts #2724
Facility Address: 1935 MAIN ST RAMONA, CA 92065
Facility City: RAMONA
Facility Zip Code: 92065
Facility Latitude: 33.033258937965115
Facility Longitude: -116.88368252123982
GIS Record ID: DEH2002-HUPFP-134974
GIS Facility Name: O'Reilly Auto Parts #2724
GIS Facility Address: 1935 MAIN ST
GIS Facility City: RAMONA
GIS Facility Zip Code: 92065
GIS Fac Latitude: -117.14618435643081
GIS Fac Longitude: 32.69865621635764
Tank Owner Name:

Hazardous Materials Facility Data

CERS ID:	10375087	Haz Mat on Site:	true
Facility ID No:	37-000-134974	Haz Waste Generatr:	true
EPA ID No:	CAL000392583	Own/Oper Under:	false
Active Permit:	true	Own/Oper Above:	false
Permit Status:	Permit Renewed	Recycle:	false
Bus Phone:	(760) 789-7109	RCRA Large Qty Gen:	false
Bus Fax:	0	HHW Collection:	false
Last Updated:	07/28/2023 12:37:34 AM		
Mailing Address:	3207 Grey Hawk Court, Suite 200, Carlsbad, CA 92010		
Onsite H Waste Treatment:	false		
New Georeferenced Column:	(32.69865621635764, -117.14618435643081)		

Hazardous Waste and Materials

ID:	21515	Permit Status:	Permit Renewed
Child Record ID:	DEH2016-HWAST-0084713	Active Permit:	true
CAS No:		Haz Material Type:	
Last Updated:	05/28/2016 02:32:38 AM	Trade Secret:	false
Chemical Name:			
Common Name Inventory:	Used Motor Oil		
ID:	21518	Permit Status:	Permit Renewed
Child Record ID:	DEH2016-HWAST-0084716	Active Permit:	true
CAS No:		Haz Material Type:	
Last Updated:	05/28/2016 02:32:38 AM	Trade Secret:	false
Chemical Name:			
Common Name Inventory:	Waste aerosols (each not exceeding 1 L capacity)		
ID:	21520	Permit Status:	Permit Renewed
Child Record ID:	DEH2016-HWAST-0084718	Active Permit:	true
CAS No:		Haz Material Type:	
Last Updated:	05/28/2016 02:32:38 AM	Trade Secret:	false
Chemical Name:			

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Common Name Inventory:		Waste organic peroxide type D, liquid				
ID:	21514			Permit Status:	Permit Renewed	
Child Record ID:	DEH2016-HWAST-0084712			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	05/28/2016 02:32:38 AM			Trade Secret:	false	
Chemical Name:		Used Absorbent Containing Oil				
ID:	21517			Permit Status:	Permit Renewed	
Child Record ID:	DEH2016-HWAST-0084715			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	05/28/2016 02:32:38 AM			Trade Secret:	false	
Chemical Name:		Waste caustic alkali liquids, n.o.s.				
ID:	21516			Permit Status:	Permit Renewed	
Child Record ID:	DEH2016-HWAST-0084714			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	05/28/2016 02:32:38 AM			Trade Secret:	false	
Chemical Name:		Waste corrosive liquids, n.o.s.				
ID:	21519			Permit Status:	Permit Renewed	
Child Record ID:	DEH2016-HWAST-0084717			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	05/28/2016 02:32:38 AM			Trade Secret:	false	
Chemical Name:		Waste flammable liquids, toxic, n.o.s.				
ID:	21521			Permit Status:	Permit Renewed	
Child Record ID:	DEH2016-HWAST-0084719			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	05/28/2016 02:32:38 AM			Trade Secret:	false	
Chemical Name:		Lead Acid Battery Spill Clean Up (Neutralized w/ Soda Ash)				
ID:	86043			Permit Status:	Permit Renewed	
Child Record ID:	DEH2017-HWAST-0119509			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	05/16/2018 12:41:54 AM			Trade Secret:	false	
Chemical Name:		Waste Lead Acid Battery Spill Clean Up (Neutralized w/ Soda Ash)				
ID:	86036			Permit Status:	Permit Renewed	
Child Record ID:	DEH2017-HWAST-0119502			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	05/16/2018 12:41:54 AM			Trade Secret:	false	
Chemical Name:		Used Absorbent Containing Oil				
ID:	86040			Permit Status:	Permit Renewed	
Child Record ID:	DEH2017-HWAST-0119506			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	05/16/2018 12:41:54 AM			Trade Secret:	false	
Chemical Name:		Waste Corrosive Liquids, N.O.S.				
ID:	86038			Permit Status:	Permit Renewed	
Child Record ID:	DEH2017-HWAST-0119504			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	05/16/2018 12:41:54 AM			Trade Secret:	false	
Chemical Name:		Waste Aerosols (each not exceeding 1 L capacity)				
ID:	86042			Permit Status:	Permit Renewed	
Child Record ID:	DEH2017-HWAST-0119508			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	05/16/2018 12:41:54 AM			Trade Secret:	false	

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Chemical Name:						
Common Name Inventory:		Waste Organic Peroxide Type D, Liquid				
ID:	86037			Permit Status:	Permit Renewed	
Child Record ID:	DEH2017-HWAST-0119503			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	05/16/2018 12:41:54 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Used Motor Oil				
ID:	86039			Permit Status:	Permit Renewed	
Child Record ID:	DEH2017-HWAST-0119505			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	05/16/2018 12:41:54 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Waste Caustic Alkali Liquids, N.O.S.				
ID:	86041			Permit Status:	Permit Renewed	
Child Record ID:	DEH2017-HWAST-0119507			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	05/16/2018 12:41:54 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Waste Flammable Liquids, Toxic , N.O.S.				
ID:	167031			Permit Status:	Permit Renewed	
Child Record ID:	DEH2018-HWAST-0160366			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	08/10/2019 01:16:15 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Waste Flammable Liquids, Toxic , N.O.S.				
ID:	167027			Permit Status:	Permit Renewed	
Child Record ID:	DEH2018-HWAST-0160362			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	08/10/2019 01:16:15 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Used Motor Oil				
ID:	167029			Permit Status:	Permit Renewed	
Child Record ID:	DEH2018-HWAST-0160364			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	08/10/2019 01:16:15 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Waste Caustic Alkali Liquids, N.O.S.				
ID:	167030			Permit Status:	Permit Renewed	
Child Record ID:	DEH2018-HWAST-0160365			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	08/10/2019 01:16:15 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Waste Corrosive Liquids, N.O.S.				
ID:	167028			Permit Status:	Permit Renewed	
Child Record ID:	DEH2018-HWAST-0160363			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	08/10/2019 01:16:15 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Waste Aerosols (each not exceeding 1 L capacity)				
ID:	167033			Permit Status:	Permit Renewed	
Child Record ID:	DEH2018-HWAST-0160368			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	08/10/2019 01:16:15 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Waste Lead Acid Battery Spill Clean Up (Neutralized w/ Soda Ash)				
ID:	167026			Permit Status:	Permit Renewed	
Child Record ID:	DEH2018-HWAST-0160361			Active Permit:	true	
CAS No:				Haz Material Type:		

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Last Updated:	08/10/2019 01:16:15 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Used Absorbent Containing Oil					
ID:	167032				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0160367				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	08/10/2019 01:16:15 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Waste Organic Peroxide Type D, Liquid					
ID:	269489				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0210354				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/19/2020 02:31:00 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Waste Organic Peroxide Type D, Liquid					
ID:	269485				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0210350				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/19/2020 02:31:00 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Waste Aerosols (each not exceeding 1 L capacity)					
ID:	269484				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0210349				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/19/2020 02:31:00 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Used Motor Oil					
ID:	269486				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0210351				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/19/2020 02:31:00 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Waste Caustic Alkali Liquids, N.O.S.					
ID:	269483				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0210348				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/19/2020 02:31:00 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Used Absorbent Containing Oil					
ID:	269490				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0210355				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/19/2020 02:31:00 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Waste Lead Acid Battery Spill Clean Up (Neutralized w/ Soda Ash)					
ID:	269487				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0210352				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/19/2020 02:31:00 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Waste Corrosive Liquids, N.O.S.					
ID:	269488				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0210353				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/19/2020 02:31:00 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Waste Flammable Liquids, Toxic , N.O.S.					
ID:	314459				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0236145				Active Permit:	true

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
CAS No:					Haz Material Type:	
Last Updated:	05/18/2021 02:52:55 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Used Motor Oil					
ID:	314458				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0236144				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/18/2021 02:52:55 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Used Absorbent Containing Oil					
ID:	314465				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0236151				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/18/2021 02:52:55 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Waste Lead Acid Battery Spill Clean Up (Neutralized w/ Soda Ash)					
ID:	314461				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0236147				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/18/2021 02:52:55 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Waste Caustic Alkali Liquids, N.O.S.					
ID:	314464				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0236150				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/18/2021 02:52:55 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Waste Organic Peroxide Type D, Liquid					
ID:	314463				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0236149				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/18/2021 02:52:55 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Waste Flammable Liquids, Toxic , N.O.S.					
ID:	314462				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0236148				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/18/2021 02:52:55 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Waste Corrosive Liquids, N.O.S.					
ID:	314460				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0236146				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/18/2021 02:52:55 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Waste Aerosols (each not exceeding 1 L capacity)					
ID:	421909				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0268181				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/03/2022 02:31:39 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Used Absorbent Containing Oil					
ID:	421915				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0268187				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/03/2022 02:31:39 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Waste Organic Peroxide Type D, Liquid					
ID:	421910				Permit Status:	Permit Renewed

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Child Record ID:	DEH2021-HWAST-0268182				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/03/2022 02:31:39 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Used Motor Oil					
ID:	421917				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0268189				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/03/2022 02:31:39 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Waste Flammable Liquids					
ID:	421916				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0268188				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/03/2022 02:31:39 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Waste Lead Acid Battery Spill Clean Up (Neutralized w/ Soda Ash)					
ID:	421914				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0268186				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/03/2022 02:31:39 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Waste Flammable Liquids, Toxic , N.O.S.					
ID:	421911				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0268183				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/03/2022 02:31:39 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Waste Aerosols (each not exceeding 1 L capacity)					
ID:	421912				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0268184				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/03/2022 02:31:39 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Waste Caustic Alkali Liquids, N.O.S.					
ID:	421913				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0268185				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/03/2022 02:31:39 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Waste Corrosive Liquids, N.O.S.					
ID:	518542				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HWAST-0310321				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/09/2023 02:31:33 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Used Motor Oil Filters					
ID:	518540				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HWAST-0310319				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/09/2023 02:31:33 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Used Motor Oil					
ID:	518539				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HWAST-0310318				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/09/2023 02:31:33 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Used Absorbent Containing Oil					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
ID:	518541				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HWAST-0310320				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/09/2023 02:31:33 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Waste Lead Acid Battery Spill Clean Up (Neutralized w/ Soda Ash)					
ID:	588128				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0342841				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	06/22/2023 01:36:55 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Used Absorbent Containing Oil					
ID:	588130				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0342843				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	06/22/2023 01:36:55 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Waste Lead Acid Battery Spill Clean Up (Neutralized w/ Soda Ash)					
ID:	588131				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0342844				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	06/22/2023 01:36:55 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Used Motor Oil Filters					
ID:	588129				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0342842				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	06/22/2023 01:36:55 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Used Motor Oil					
ID:	595055				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0345925				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	07/28/2023 12:37:35 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Waste Lead Acid Battery Spill Clean Up (Neutralized w/ Soda Ash)					
ID:	595054				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0345924				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	07/28/2023 12:37:35 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Used Motor Oil					
ID:	595056				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0345926				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	07/28/2023 12:37:35 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Used Motor Oil Filters					
ID:	595053				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0345923				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	07/28/2023 12:37:35 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Used Absorbent Containing Oil					

HMD Permits Map Data

Epa ID:	CAL000392583	Opened Dt:	2002-05-04T00:00:00
Cers ID:	10375087	Expiration Dt:	2025-05-31T00:00:00
Sitemap:	MAP_134974.pdf	Rpt Name:	HMBP134974.pdf

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Record Status: Permit Renewed Er Contact1: 3E, 24 Hour Emergency Call Center Er Title1: District Manager Er Phone1: (800) 451-8346 Er Altphone: (800) 451-8346 Er Contact2: O'Reilly Alarm Service Er Title2: Store Manager Er Phone2: 417-829-5855 Er Altphone2: 800-288-6661 x 3206 Biz Apn: 282-141-55-00 Biz Phone: (417) 862-3333 Biz Email: Regulatory@3eco.com Biz Owner: O'Reilly Auto Enterprises, L.L.C. Biz Type: Retail Stores Facility Subject To Calarp: Plating Shop Metal Finishing: Chemical Supplier Wholesale: Pesticide Applicator Fumigatio: Chem Gas Paint Manufacture: Resin Site With 6 Items: Petroleum Propane Fuel Supp: Site With Gt20 Inventory Items: Apsa Stor Tank Gt10000 Gal: Apsa Stor Tank Chem Gt999ga: Ust Stor Tank Fuel Gt30k Ga: Cryogas Gt20kcft200gal1200lb: Gases Gt20kCft 208 Gal 1666 L: Prop Gt185kCft5k Gal 2100: Extreme Haz Gt20 Cft 54 Gal 5: Hirt Flag: N Billing Code1: Base + CUPA St No: 1935 St No End: St Name: MAIN St Dir: St Type: ST St Unit: Insp Dist Geoinfo: HE020						
5	4 of 4	ENE	0.08 / 443.49	1,422.28 / 5	O'REILLY AUTO PARTS STORE 2724 1935 MAIN ST RAMONA CA 92065	RCRA NON GEN
Handler ID:		CAL000392583				
Generator Status:		N				
Recycler Activity?:		NO				
Recycler Activity Note:		This facility has not been identified as a Recycler Facility from both the RCRA Handler and Biennial Report Modules.				
<u>Violation/Evaluation Summary</u>						
Note:		NO RECORDS: As of Nov 2025, there are no Compliance Monitoring and Enforcement (violation) records associated with this facility (EPA ID).				
<u>Handler Summary</u>						
Importer:		No		Used Oil Transpor:		No
Mixed Waste Gen:		No		Used Oil Trans Fac:		No
Transporter:		No		Used Oil Processor:		No
Transfer Facility:		No		Used Oil Refiner:		No
Recycler:		No		Used Oil Burner:		No
Onsite Burner Exem:		No		Commercial TSD:		No
Furnace Exemption:		No		Recycl Nonstorage:		No
Underground Injec:		No				
Used Oil Market Burner:		No				
Used Oil Spec Marketer:		No				
<u>Additional Handler Summary Details</u>						
Source Type:		I		NAIC 1:		44131
Seq No:		1		NAIC 2:		
Non Notifier:				NAIC 3:		
Receive Date:		20140109		NAIC 4:		

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Active Site:	H----				State:	CA
Land Type:					Location Latitude:	33.032928
In Handler Univ:	Y				Location Longitude:	-116.883491
In A Universe:	Y				Loc GIS Primary:	N
Gen Status:	N				Loc GIS Origin:	AG
Report Cycle:					State District Owner:	
Accessibility:					State District:	
Region:	09					
Fed Waste Gen Owner:		HQ				
State Waste Generator Owner:		CA				
State Waste Generator:		2				
Short Term Generator:		N				
Uni Waste:		Y				
Universal Waste Dest Facility:		Y				
Federal Universal Waste:		N				
As Federally Regulated Tsdf:		-----				
As Converter Tsdf:		-----				
As State Regulated Tsdf:		-----				
As State Regulated Handler:		---				
Federal Indicator:		---				
Hsm:		N				
Subpart K:		----				
GPRA Permit:		N				
GPRA Renewal:		N				
Permit Renewal Wrkld:		-----				
Permwrk ID:		-----				
Perm Prog:		-----				
Pcwrkld:		-----				
Closwrkld:		-----				
GPRA Ca:		N				
Cawrkld:		N				
Subjca Tsd Discretion:		N				
NCAPS:		N				
EC Indicator:		N				
Ca725 Indicator:		N				
Ca750 Indicator:		N				
Operating Tsdf:		-----				
Full Enforcement:		-----				
Snc:		N				
Unaddressed Snc:		N				
Addressed Snc:		N				
Snc With Comp Sched:		N				
Fa Required:		----				
Hhandler Last Change:		20180906				
Recognized Trader Importer:		N				
Recognized Trader Exporter:		N				
Slab Importer:		N				
Slab Exporter:		N				
Manifest Broker:		N				
Subpart P:		N				
Contact Language:		EN				
Handler Name:		O'REILLY AUTO PARTS STORE 2724				
Location Street No:						
Location Street1:		1935 MAIN ST				
Location Street2:						
Location City:		RAMONA				
Location State:		CA				
Location Zip:		92065				
Location County Code:		CA073				
Location County Name:		SAN DIEGO				
Location Country:		US				
Contact Name:		JOHN BOUNDS				
Contact Street No:						
Contact Street1:		233 S. PATTERSON AVE.				
Contact Street2:						
Contact City:		SPRINGFIELD				
Contact State:		MO				
Contact Zip:		65802				
Contact Country:						

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Contact Phone & Ext:		417-520-4589				
Contact Fax:		417-874-7102				
Contact Email Address:		JBOUNDS2@OREILLYAUTO.COM				
Contact Title:						
Owner Name:		O'REILLY AUTO PARTS				
Owner Type:		O				
Owner Seq:		1				
Operator Name:		JOHN BOUNDS				
Operator Type:		O				
Operator Seq:		2				
Public Notes:						

Contact DTSC for information.

Hazardous Waste Handler Details

Seq No: 1
Receive Date: 20140109
Handler Name: O'REILLY AUTO PARTS STORE 2724
Fed Waste Generator: N
Generator Code Description: Not a Generator, Verified
Source Type: Implementer
TSD Activity: N

Owner/Operator Details

Owner/Operator Ind:	Current Operator	Street No:	
Type:	Other	Street1:	233 S. PATTERSON AVE.
Name:	JOHN BOUNDS	Street2:	
Dt Became Current:		City:	SPRINGFIELD
Dt Ended Current:		State:	MO
Phone:	417-520-4589	Country:	
Source Type:	Implementer	Zip:	65802

Owner/Operator Ind:	Current Owner	Street No:	
Type:	Other	Street1:	233 S PATTERSON
Name:	O'REILLY AUTO PARTS	Street2:	
Dt Became Current:		City:	SPRINGFIELD
Dt Ended Current:		State:	MO
Phone:	417-862-3333	Country:	
Source Type:	Implementer	Zip:	65802-0000

6	1 of 8	ENE	0.08 / 445.99	1,418.80 / 1	RAMONA AUTOMOTIVE 1936 MAIN ST RAMONA CA 92065	CERS HAZ

Latitude: 33.006500
Longitude: -116.808800

Regulated Programs

EI ID:	10375084	EI Description:	Chemical Storage Facilities
EI ID:	10375084	EI Description:	Hazardous Waste Generator

Violations

Violation Date:	08/24/2021	Violation Source:	CERS
Violation Program:	HW	Violation Division:	San Diego County Department of Env Health
Citation:	HSC 6.5 25123.3(h)(1) - California Health and Safety Code, Chapter 6.5, Section(s) 25123.3(h)(1)		
Violation Notes:			

Returned to compliance on 10/20/2021. Inspection Sequence ID:6797570

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Violation Description:

- Failure to send hazardous waste offsite for treatment, storage, or disposal within 180 days (or 270 days if waste is transported over 200 miles) for a generator who generates less than 1000 kilogram per month if all of the following conditions are met:
- (1) The quantity of hazardous waste accumulated onsite never exceeds 6,000 kilograms.
 - (2) The generator complies with the requirements of 40 Code of Federal Regulations section 262.34(d), (e) and (f).
 - (3) The generator does not hold acutely hazardous waste or extremely hazardous waste in an amount greater than one kilogram for more than 90 days.

Violations

Violation Date: 09/19/2016
Violation Program: HW
Citation: HSC 6.5 Multiple - California Health and Safety Code, Chapter 6.5, Section(s) Multiple
Violation Source: CERS
Violation Division: San Diego County Department of Env Health
Violation Notes:

Returned to compliance on 12/08/2016. Inspection Sequence ID:5569692; Violation: HMD0226 Did not accumulate waste in a container or tank. (40 CFR 262.34(d)(2).) 22 CCR 66262.34(d)(2)

Violation Description:

Hazardous Waste Generator Program - Operations/Maintenance - General

Violations

Violation Date: 08/24/2021
Violation Program: HMRRP
Citation: HSC 6.95 25508(a)(3) - California Health and Safety Code, Chapter 6.95, Section(s) 25508(a)(3)
Violation Source: CERS
Violation Division: San Diego County Department of Env Health
Violation Notes:

Returned to compliance on 10/20/2021. Inspection Sequence ID:6797570

Violation Description:

Failure to complete and electronically submit a site map with all required content.

Violations

Violation Date: 09/19/2016
Violation Program: HW
Citation: 40 CFR 1 265.171 - U.S. Code of Federal Regulations, Title 40, Chapter 1, Section(s) 265.171
Violation Source: CERS
Violation Division: San Diego County Department of Env Health
Violation Notes:

Returned to compliance on 12/08/2016. Inspection Sequence ID:5569692

Violation Description:

Failure to accumulate hazardous waste in a container that is in good condition.

Violations

Violation Date: 09/19/2016
Violation Program: HMRRP
Citation: HSC 6.95 25505(a)(4) - California Health and Safety Code, Chapter 6.95, Section(s) 25505(a)(4)
Violation Source: CERS
Violation Division: San Diego County Department of Env Health
Violation Notes:

Returned to compliance on 12/08/2016. Inspection Sequence ID:5569692

Violation Description:

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Failure to provide initial and annual training to all employees in safety procedures in the event of a release or threatened release of a hazardous material or failure to document and maintain training records for a minimum of three years.

Violations

Violation Date: 08/24/2021
Violation Program: HW
Citation: 22 CCR 12 66262.34(f) - California Code of Regulations, Title 22, Chapter 12, Section(s) 66262.34(f)
Violation Notes:

Returned to compliance on 10/20/2021. Inspection Sequence ID:6797570

Violation Description:

Failure to properly label hazardous waste accumulation containers and portable tanks with the following requirements: "Hazardous Waste", name and address of the generator, physical and chemical characteristics of the Hazardous Waste, and starting accumulation date.

Violations

Violation Date: 10/02/2023
Violation Program: HW
Citation: HSC 6.5 Multiple - California Health and Safety Code, Chapter 6.5, Section(s) Multiple
Violation Notes:

Returned to compliance on 10/19/2023. Inspection Sequence ID:7301536; Violation: HMD0131 Unified Program Facility Permit not obtained &/or maintained for the generation of hazardous waste. SDCC 68.904; 68.905; 68.907.1

Violation Description:

Hazardous Waste Generator Program - Administration/Documentation - General

Violations

Violation Date: 09/19/2016
Violation Program: HW
Citation: 40 CFR 1 265.173 - U.S. Code of Federal Regulations, Title 40, Chapter 1, Section(s) 265.173
Violation Notes:

Returned to compliance on 12/08/2016. Inspection Sequence ID:5569692

Violation Description:

Failure to meet the following container management requirements:
 (a) A container holding hazardous waste must always be closed during storage, except when it is necessary to add or remove waste.
 (b) A container holding hazardous waste must not be opened, handled, or stored in a manner which may rupture the container or cause it to leak.

Violations

Violation Date: 08/24/2021
Violation Program: HMRRP
Citation: HSC 6.95 25508.2 - California Health and Safety Code, Chapter 6.95, Section(s) 25508.2
Violation Notes:

Returned to compliance on 10/20/2021. Inspection Sequence ID:6797570

Violation Description:

Failure to annually review and electronically certify that the business plan is complete and accurate on or before the annual due date.

Violations

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Violation Date: 10/02/2023
Violation Program: HMRRP
Citation: HSC 6.95 Multiple - California Health and Safety Code, Chapter 6.95, Section(s) Multiple
Violation Notes:

Returned to compliance on 10/19/2023. Inspection Sequence ID:7301536; Violation: HMD1001 Unified Program Facility permit not obtained for hazardous materials. SDCC 68.904; 68.905; 68.906, 68.907; 68.907.1

Violation Description:

Business Plan Program - Administration/Documentation - General

Violations

Violation Date: 09/19/2016
Violation Program: HW
Citation: 22 CCR 12 66262.34(f) - California Code of Regulations, Title 22, Chapter 12, Section(s) 66262.34(f)
Violation Notes:

Returned to compliance on 12/08/2016. Inspection Sequence ID:5569692

Violation Description:

Failure to properly label hazardous waste accumulation containers and portable tanks with the following requirements: "Hazardous Waste", name and address of the generator, physical and chemical characteristics of the Hazardous Waste, and starting accumulation date.

Violations

Violation Date: 08/24/2021
Violation Program: HMRRP
Citation: HSC 6.95 25505(a)(4) - California Health and Safety Code, Chapter 6.95, Section(s) 25505(a)(4)
Violation Notes:

Returned to compliance on 10/20/2021. Inspection Sequence ID:6797570

Violation Description:

Failure to provide initial and annual training to all employees in safety procedures in the event of a release or threatened release of a hazardous material or failure to document and maintain training records for a minimum of three years.

Violations

Violation Date: 09/19/2016
Violation Program: HW
Citation: 22 CCR 12 66262.12 - California Code of Regulations, Title 22, Chapter 12, Section(s) 66262.12
Violation Notes:

Returned to compliance on 05/02/2017. Inspection Sequence ID:5569692

Violation Description:

Failure to obtain an Identification Number prior to treating, storing, disposing of, transporting or offering for transportation any hazardous waste.

Evaluations

Eval Date: 08/24/2021
Violations Found: Yes
Eval General Type: Compliance Evaluation Inspection
Eval Type: Routine done by local agency
Eval Division: San Diego County Department of Env Health
Eval Program: HW

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Eval Source:	CERS
Eval Notes:	

Inspector: Valdez Kevin Inspection ID:6797570; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date:	10/02/2023
Violations Found:	Yes
Eval General Type:	Compliance Evaluation Inspection
Eval Type:	Routine done by local agency
Eval Division:	San Diego County Department of Env Health
Eval Program:	HMRRP
Eval Source:	CERS
Eval Notes:	

Inspector: Murphy Sky Inspection ID:7301536; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date:	10/02/2023
Violations Found:	Yes
Eval General Type:	Compliance Evaluation Inspection
Eval Type:	Routine done by local agency
Eval Division:	San Diego County Department of Env Health
Eval Program:	HW
Eval Source:	CERS
Eval Notes:	

Inspector: Murphy Sky Inspection ID:7301536; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date:	09/19/2016
Violations Found:	Yes
Eval General Type:	Compliance Evaluation Inspection
Eval Type:	Routine done by local agency
Eval Division:	San Diego County Department of Env Health
Eval Program:	HW
Eval Source:	CERS
Eval Notes:	

Inspector: Walsh Todd Inspection ID:5569692; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date:	08/24/2021
Violations Found:	Yes
Eval General Type:	Compliance Evaluation Inspection
Eval Type:	Routine done by local agency
Eval Division:	San Diego County Department of Env Health
Eval Program:	HMRRP
Eval Source:	CERS
Eval Notes:	

Inspector: Valdez Kevin Inspection ID:6797570; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date:	09/11/2018
Violations Found:	No
Eval General Type:	Compliance Evaluation Inspection
Eval Type:	Routine done by local agency
Eval Division:	San Diego County Department of Env Health
Eval Program:	HW
Eval Source:	CERS
Eval Notes:	

Inspector: Griffin Donelle Inspection ID:6001980; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date:	09/11/2018
Violations Found:	No
Eval General Type:	Compliance Evaluation Inspection
Eval Type:	Routine done by local agency

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Eval Division:	San Diego County Department of Env Health
Eval Program:	HMRRP
Eval Source:	CERS
Eval Notes:	

Inspector: Griffin Donelle Inspection ID:6001980; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date:	09/19/2016
Violations Found:	Yes
Eval General Type:	Compliance Evaluation Inspection
Eval Type:	Routine done by local agency
Eval Division:	San Diego County Department of Env Health
Eval Program:	HMRRP
Eval Source:	CERS
Eval Notes:	

Inspector: Walsh Todd Inspection ID:5569692; Note: data in [EVAL Notes] field for some records is truncated from the source.

Affiliations

Affil Type Desc:	Facility Mailing Address
Entity Name:	Mailing Address
Entity Title:	
Address:	1936 MAIN ST
City:	RAMONA
State:	CA
Country:	
Zip Code:	92065
Phone:	

Affil Type Desc:	Operator
Entity Name:	Eric Lehmann
Entity Title:	
Address:	
City:	
State:	
Country:	
Zip Code:	
Phone:	(760) 522-2964

Affil Type Desc:	Environmental Contact
Entity Name:	Eric Lehmann
Entity Title:	
Address:	1936 MAIN ST
City:	RAMONA
State:	CA
Country:	
Zip Code:	92065
Phone:	

Affil Type Desc:	Identification Signer
Entity Name:	Eric Lehmann
Entity Title:	Owner
Address:	
City:	
State:	
Country:	
Zip Code:	
Phone:	

Affil Type Desc:	Legal Owner
Entity Name:	RAMONA AUTOMOTIVE INC
Entity Title:	
Address:	1810 El Cajon Ln
City:	Ramona
State:	CA

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Country:		United States				
Zip Code:		92065				
Phone:		(760) 789-2621				
Affil Type Desc:		Property Owner				
Entity Name:		Stephen Norman				
Entity Title:						
Address:		PO BOX 1233				
City:		Ramona				
State:		CA				
Country:		United States				
Zip Code:		92065				
Phone:		(760) 994-8342				
Affil Type Desc:		CUPA District				
Entity Name:		San Diego County Env Health Qlty				
Entity Title:						
Address:		PO Box 129261				
City:		San Diego				
State:		CA				
Country:						
Zip Code:		92112-9261				
Phone:		(858) 505-6880				
Affil Type Desc:		Document Preparer				
Entity Name:		Andrew Deremer				
Entity Title:						
Address:						
City:						
State:						
Country:						
Zip Code:						
Phone:						
Affil Type Desc:		Parent Corporation				
Entity Name:		Ramona Automotive				
Entity Title:						
Address:						
City:						
State:						
Country:						
Zip Code:						
Phone:						
 <u>Coordinates</u>						
Env Int Type Code:	HWG			Longitude:	-116.883148	
Program ID:	10375084			Coord Name:		
Latitude:	33.032764			Ref Point Type Desc:	Unknown	

<u>6</u>	2 of 8	ENE	0.08 / 445.99	1,418.80 / 1	RAMONA AUTOMOTIVE 1936 MAIN ST RAMONA CA 92065	DELISTED TNK

Delisted San Diego County - UST List

Record ID:	DEH2002-HUPFP-113183	Haz. Waste Gen:	true
CERS ID:	10375084	Recycle:	false
Permit Status:	Permit Renewed	Onsite Haz Wt Trt:	false
Active Permit:	true	RCRA Large Qty Gen:	false
Facility Type UST:		HHW Collection:	false
Business Phone:	760-789-2621	Last Updated:	2020 Nov 05 02:32:07 AM
Business Fax:	7607895376	Atoms:	
Facility ID:	37-000-113183	ZIP Codes:	
EPA ID No:	CAL000399681	Latitude:	

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Haz. Mat. On-Site: true Own or Operate UG: false Own or Operate AG: false Mailing Address: 1936 Main Street, Ramona , CA 92065 New Georeferenced: (32.69872166580155, -117.14607398007146) Longitude: Original Source: USSD Record Date: 18-JUN-2021						
6	3 of 8	ENE	0.08 / 445.99	1,418.80 / 1	RAMONA AUTOMOTIVE 1936 MAIN ST RAMONA CA 92065	HAZ SANDIEGO
Record ID: DEH2002-HUPFP-113183 Facility Name: RAMONA AUTOMOTIVE Facility Address: 1936 MAIN ST RAMONA, CA 92065 Facility City: RAMONA Facility Zip Code: 92065 Facility Latitude: 33.03279179292595 Facility Longitude: -116.88318053965452 GIS Record ID: DEH2002-HUPFP-113183 GIS Facility Name: RAMONA AUTOMOTIVE GIS Facility Address: 1936 MAIN ST GIS Facility City: RAMONA GIS Facility Zip Code: 92065 GIS Fac Latitude: GIS Fac Longitude: Tank Owner Name:						
<u>Hazardous Materials Facility Data</u>						
CERS ID: 10375084 Facility ID No: 37-000-113183 EPA ID No: CAL000464077 Active Permit: true Permit Status: Permit Renewed Bus Phone: 7607892621 Bus Fax: 7607895376 Last Updated: 10/20/2023 02:31:15 AM Mailing Address: 1936 MAIN ST, RAMONA, CA 92065 Onsite H Waste Treatment: false New Georeferenced Column:						
Haz Mat on Site: true Haz Waste Generatr: true Own/Oper Under: false Own/Oper Above: false Recycle: false RCRA Large Qty Gen: false HHW Collection: false						
<u>Hazardous Waste and Materials</u>						
ID: 9794 Child Record ID: DEH2016-HWAST-0095671 CAS No: Last Updated: 01/17/2018 09:48:29 AM Chemical Name: Used Motor oil Common Name Inventory: Used Motor Oil						
Permit Status: Permit Renewed Active Permit: true Haz Material Type: Trade Secret: false						
ID: 9795 Child Record ID: DEH2016-HWAST-0095672 CAS No: Last Updated: 01/17/2018 09:48:29 AM Chemical Name: Waste Antifreeze Common Name Inventory: Waste Antifreeze						
Permit Status: Permit Renewed Active Permit: true Haz Material Type: Trade Secret: false						
ID: 607137 Child Record ID: DEH2023-HWAST-0351315 CAS No: Last Updated: 10/20/2023 02:31:15 AM Chemical Name: Waste coolant Common Name Inventory: waste coolant						
Permit Status: Permit Renewed Active Permit: true Haz Material Type: Trade Secret: false						
ID: 607136 Child Record ID: DEH2023-HWAST-0351314 CAS No:						
Permit Status: Permit Renewed Active Permit: true Haz Material Type:						

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Last Updated:	10/20/2023 02:31:15 AM				Trade Secret:	false
Chemical Name:	Waste filters					
Common Name Inventory:	waste filters					
ID:	607138				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0351316				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/20/2023 02:31:15 AM				Trade Secret:	false
Chemical Name:	Waste oil					
Common Name Inventory:	waste oil					
<u>Hazardous Materials Inspection Violations</u>						
Container Tank ID:	37-000-113183				Inspection No:	5569692
Facility ID No:	4939				Inspection Type:	Routine
ID:	09/19/2016 04:49:00 PM				Inspection Date:	
UST ID:					Compliance Date:	12/08/2016 12:00:00 AM
Permit Status:	Permit Renewed				Last Updated:	10/20/2023 02:31:15 AM
Active Permit:	true				NOV:	false
Program Element:	Hazardous Waste Generator					
Violation Code:	3030013 Failed to accumulate hazardous waste in a container that is in good condition. (40 CFR 262.34(d)(2); 265.171.) 22 CCR 66262.34(d)(2)					
Violation Classification:	Class II					
Container Tank ID:	37-000-113183				Inspection No:	5569692
Facility ID No:	4937				Inspection Type:	Routine
ID:	09/19/2016 04:49:00 PM				Inspection Date:	
UST ID:					Compliance Date:	12/08/2016 12:00:00 AM
Permit Status:	Permit Renewed				Last Updated:	10/20/2023 02:31:15 AM
Active Permit:	true				NOV:	false
Program Element:	Hazardous Waste Generator					
Violation Code:	HMD0226 Did not accumulate waste in a container or tank. (40 CFR 262.34(d)(2).) 22 CCR 66262.34(d)(2)					
Violation Classification:	Class II					
Container Tank ID:	37-000-113183				Inspection No:	5569692
Facility ID No:	4936				Inspection Type:	Routine
ID:	09/19/2016 04:49:00 PM				Inspection Date:	
UST ID:					Compliance Date:	12/08/2016 12:00:00 AM
Permit Status:	Permit Renewed				Last Updated:	10/20/2023 02:31:15 AM
Active Permit:	true				NOV:	false
Program Element:	Hazardous Waste Generator					
Violation Code:	3030007 Failed to properly label/date hazardous waste container and/or tank. 22 CCR 66262.34(f)					
Violation Classification:	Minor					
Container Tank ID:	37-000-113183				Inspection No:	5569692
Facility ID No:	4938				Inspection Type:	Routine
ID:	09/19/2016 04:49:00 PM				Inspection Date:	
UST ID:					Compliance Date:	12/08/2016 12:00:00 AM
Permit Status:	Permit Renewed				Last Updated:	10/20/2023 02:31:15 AM
Active Permit:	true				NOV:	false
Program Element:	Hazardous Waste Generator					
Violation Code:	3030017 Failed to properly close hazardous waste container(s). (40 CFR 262.34(d)(2); 265.173.) 22 CCR 66262.34(d)(2)					
Violation Classification:	Minor					
Container Tank ID:	37-000-113183				Inspection No:	5569692
Facility ID No:	4940				Inspection Type:	Routine
ID:	09/19/2016 04:49:00 PM				Inspection Date:	
UST ID:					Compliance Date:	12/08/2016 12:00:00 AM
Permit Status:	Permit Renewed				Last Updated:	10/20/2023 02:31:15 AM
Active Permit:	true				NOV:	false
Program Element:	Hazardous Materials Release Response Plans					
Violation Code:	1020002 Initial and/or annual employee training not conducted for hazardous materials management and/or employee training records not available or not maintained for 3 years. HSC 25505(a)(4)					
Violation Classification:	Class II					
Container Tank ID:	37-000-113183				Inspection No:	5569692
Facility ID No:	4935				Inspection Type:	Routine

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
ID:	09/19/2016 04:49:00 PM				Inspection Date:	
UST ID:					Compliance Date:	05/02/2017 12:00:00 AM
Permit Status:	Permit Renewed				Last Updated:	10/20/2023 02:31:15 AM
Active Permit:	true				NOV:	false
Program Element:	Hazardous Waste Generator					
Violation Code:	3010002 Failed to obtain and/or maintain an active EPA ID. 22 CCR 66262.12					
Violation Classification:	Minor					
Container Tank ID:	37-000-113183				Inspection No:	6797570
Facility ID No:	56476				Inspection Type:	Routine
ID:	08/24/2021 12:00:00 AM				Inspection Date:	
UST ID:					Compliance Date:	10/20/2021 12:00:00 AM
Permit Status:	Permit Renewed				Last Updated:	10/20/2023 02:31:15 AM
Active Permit:	true				NOV:	false
Program Element:	Hazardous Waste Generator					
Violation Code:	3030010 Failed to properly dispose of hazardous waste within 180 days (or 270 days if waste is transported over 200 miles). 3030010 Failed to properly dispose of hazardous waste within 180 days (or 270 days if waste is transported over 200 miles). 22 CCR 66262.34(d); HSC 6.5 25123.3(h)(1)					
Violation Classification:	Class II					
Container Tank ID:	37-000-113183				Inspection No:	6797570
Facility ID No:	56478				Inspection Type:	Routine
ID:	08/24/2021 12:00:00 AM				Inspection Date:	
UST ID:					Compliance Date:	10/20/2021 12:00:00 AM
Permit Status:	Permit Renewed				Last Updated:	10/20/2023 02:31:15 AM
Active Permit:	true				NOV:	false
Program Element:	Hazardous Materials Release Response Plans					
Violation Code:	1010008 HMBP not certified as complete and accurate in CERS by the required due date. HSC 25508.2, 19 CCR 2654(b)					
Violation Classification:	Class II					
Container Tank ID:	37-000-113183				Inspection No:	6797570
Facility ID No:	56479				Inspection Type:	Routine
ID:	08/24/2021 12:00:00 AM				Inspection Date:	
UST ID:					Compliance Date:	10/20/2021 12:00:00 AM
Permit Status:	Permit Renewed				Last Updated:	10/20/2023 02:31:15 AM
Active Permit:	true				NOV:	false
Program Element:	Hazardous Materials Release Response Plans					
Violation Code:	1020002 Initial &/or annual employee training not conducted in safety procedures for a hazardous material release or threatened release &/or employee training records not available or not maintained for 3 years. HSC 25505(a)(4); 19 CCR 2659(b)					
Violation Classification:	Class II					
Container Tank ID:	37-000-113183				Inspection No:	6797570
Facility ID No:	56477				Inspection Type:	Routine
ID:	08/24/2021 12:00:00 AM				Inspection Date:	
UST ID:					Compliance Date:	10/20/2021 12:00:00 AM
Permit Status:	Permit Renewed				Last Updated:	10/20/2023 02:31:15 AM
Active Permit:	true				NOV:	false
Program Element:	Hazardous Materials Release Response Plans					
Violation Code:	1010005 Site map not submitted in CERS or not sufficient. HSC 25505(a)(2); 25508.1(f); 19 CCR 2652(a)(3)					
Violation Classification:	Minor					
Container Tank ID:	37-000-113183				Inspection No:	6797570
Facility ID No:	56475				Inspection Type:	Routine
ID:	08/24/2021 12:00:00 AM				Inspection Date:	
UST ID:					Compliance Date:	10/20/2021 12:00:00 AM
Permit Status:	Permit Renewed				Last Updated:	10/20/2023 02:31:15 AM
Active Permit:	true				NOV:	false
Program Element:	Hazardous Waste Generator					
Violation Code:	3030007 Failed to properly label/date hazardous waste container &/or tank. 22 CCR 66262.34(f)					
Violation Classification:	Minor					
Container Tank ID:	37-000-113183				Inspection No:	7301536
Facility ID No:	82807				Inspection Type:	Initial Inspection
ID:	10/02/2023 12:00:00 AM				Inspection Date:	
UST ID:					Compliance Date:	10/19/2023 12:00:00 AM
Permit Status:	Permit Renewed				Last Updated:	10/20/2023 02:31:15 AM
Active Permit:	true				NOV:	false

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Program Element:		Hazardous Materials Release Response Plans				
Violation Code:		HMD1001 Unified Program Facility permit not obtained for hazardous materials. SDCC 68.904; 68.905; 68.906, 68.907; 68.907.1				
Violation Classification:		Class II				
Container Tank ID:	37-000-113183			Inspection No:	7301536	
Facility ID No:	82805			Inspection Type:	Initial Inspection	
ID:	10/02/2023 12:00:00 AM			Inspection Date:		
UST ID:				Compliance Date:	10/19/2023 12:00:00 AM	
Permit Status:	Permit Renewed			Last Updated:	10/20/2023 02:31:15 AM	
Active Permit:	true			NOV:	false	
Program Element:		Hazardous Waste Generator				
Violation Code:		HMD0131 Unified Program Facility Permit not obtained &/or maintained for the generation of hazardous waste. SDCC 68.904; 68.905; 68.907.1				
Violation Classification:		Class II				
Container Tank ID:	37-000-113183			Inspection No:	7301536	
Facility ID No:	82803			Inspection Type:	Initial Inspection	
ID:	10/02/2023 12:00:00 AM			Inspection Date:		
UST ID:				Compliance Date:		
Permit Status:	Permit Renewed			Last Updated:	10/20/2023 02:31:15 AM	
Active Permit:	true			NOV:		
Program Element:		Hazardous Waste Generator				
Violation Code:		HMD0001 RECORD KEEPING/OPERATIONAL REQUIREMENTS				
Violation Classification:						
Container Tank ID:	37-000-113183			Inspection No:	7301536	
Facility ID No:	82804			Inspection Type:	Initial Inspection	
ID:	10/02/2023 12:00:00 AM			Inspection Date:		
UST ID:				Compliance Date:		
Permit Status:	Permit Renewed			Last Updated:	10/20/2023 02:31:15 AM	
Active Permit:	true			NOV:		
Program Element:		Hazardous Waste Generator				
Violation Code:		HMD0000 HAZARDOUS WASTE REQUIREMENTS FOR SQGS AND LQGS				
Violation Classification:						
Container Tank ID:	37-000-113183			Inspection No:	7301536	
Facility ID No:	82806			Inspection Type:	Initial Inspection	
ID:	10/02/2023 12:00:00 AM			Inspection Date:		
UST ID:				Compliance Date:		
Permit Status:	Permit Renewed			Last Updated:	10/20/2023 02:31:15 AM	
Active Permit:	true			NOV:		
Program Element:		Hazardous Materials Release Response Plans				
Violation Code:		HMD0000 HAZARDOUS MATERIALS REQUIREMENTS				
Violation Classification:						
<u>HMD Permits Map Data</u>						
Epa ID:	CAL000464077			Opened Dt:	2002-05-04T00:00:00	
Cers ID:	10375084			Expiration Dt:	2024-11-30T00:00:00	
Sitemap:	MAP_113183.pdf			Rpt Name:	HMBP113183.pdf	
Record Status:	Permit Renewed			Hirt Flag:	N	
Er Contact1:	Eric Lehmann			Billing Code1:	Base + CUPA	
Er Title1:	CO			St No:	1936	
Er Phone1:	7605222964			St No End:		
Er Altphone:	7607892621			St Name:	MAIN	
Er Contact2:	Logan Lehmann			St Dir:		
Er Title2:	Daily Operations Manager			St Type:	ST	
Er Phone2:	7604193188			St Unit:		
Er Altphone2:	7607892621			Insp Dist Geoinfo:	HE020	
Biz Apn:	282-222-09-00					
Biz Phone:	7607892621					
Biz Email:	RAMONAAUTOMOTIVE@AOL.COM					
Biz Owner:	RAMONA AUTOMOTIVE INC					
Biz Type:	Auto Repair, General - Waste USTs Only					
Facility Subject To Calarp:						
Plating Shop Metal Finishing:						
Chemical Supplier Wholesale:						

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Pesticide Applicator Fumigatio:
 Chem Gas Paint Manufacture:
 Resin Site With 6 Items:
 Petroleum Propane Fuel Supp:
 Site With Gt20 Inventory Items:
 Apsa Stor Tank Gt10000 Gal:
 Apsa Stor Tank Chem Gt999ga:
 Ust Stor Tank Fuel Gt30k Ga:
 Cryogas Gt20kcft200gal1200lb:
 Gases Gt20kCft 208 Gal 1666 L:
 Prop Gt185kCft5k Gal 2100:
 Extreme Haz Gt20 Cft 54 Gal 5:

HMD Facility Data

ID:	38030	Tank Status:	Removed
Facility ID No:	37-000-113183	Tank Cap in Galons:	550
Tank ID No:	22659	Tank Contents:	
Permit Status:	Permit Renewed	Tank Use:	04
Active Permit:	true	Type of Tank:	01
Dt UST Perm Closed:	01/12/1987 12:00:00 AM	Last Updated:	10/20/2023 02:31:15 AM
Piping System Type:			
Tank Owner Name:	Eric Lehmann		
Facility Type UST Facility:			

6	4 of8	ENE	0.08 / 445.99	1,418.80 / 1	RAMONA AUTO INC, DBA RAMONA AUTOMOTIVE 1936 MAIN ST RAMONA CA 92065	RCRA NON GEN

Handler ID:	CAL000399681
Generator Status:	N
Recycler Activity?:	NO
Recycler Activity Note:	This facility has not been identified as a Recycler Facility from both the RCRA Handler and Biennial Report Modules.

Violation/Evaluation Summary

Note:	NO RECORDS: As of Nov 2025, there are no Compliance Monitoring and Enforcement (violation) records associated with this facility (EPA ID).

Handler Summary

Importer:	No	Used Oil Transpor:	No
Mixed Waste Gen:	No	Used Oil Trans Fac:	No
Transporter:	No	Used Oil Processor:	No
Transfer Facility:	No	Used Oil Refiner:	No
Recycler:	No	Used Oil Burner:	No
Onsite Burner Exem:	No	Commercial TSD:	No
Furnace Exemption:	No	Recycl Nonstorage:	No
Underground Injec:	No		
Used Oil Market Burner:	No		
Used Oil Spec Marketer:	No		

Additional Handler Summary Details

Source Type:	I	NAIC 1:	811198
Seq No:	1	NAIC 2:	
Non Notifier:		NAIC 3:	
Receive Date:	20140814	NAIC 4:	
Active Site:	H----	State:	CA
Land Type:		Location Latitude:	33.032966
In Handler Univ:	Y	Location Longitude:	-116.883355
In A Universe:	Y	Loc GIS Primary:	N

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Gen Status:	N				Loc GIS Origin:	AG
Report Cycle:					State District Owner:	
Accessibility:					State District:	
Region:	09					
Fed Waste Gen Owner:	HQ					
State Waste Generator Owner:	CA					
State Waste Generator:	2					
Short Term Generator:	N					
Uni Waste:	Y					
Universal Waste Dest Facility:	Y					
Federal Universal Waste:	N					
As Federally Regulated Tsdf:	-----					
As Converter Tsdf:	-----					
As State Regulated Tsdf:	-----					
As State Regulated Handler:	---					
Federal Indicator:	---					
Hsm:	N					
Subpart K:	----					
GPRA Permit:	N					
GPRA Renewal:	N					
Permit Renewal Wrkld:	-----					
Permwrk ID:	-----					
Perm Prog:	-----					
Pcwrkld:	-----					
Closwrkld:	-----					
GPRA Ca:	N					
Cawrkld:	N					
Subjca Tsd Discretion:	N					
NCAPS:	N					
EC Indicator:	N					
Ca725 Indicator:	N					
Ca750 Indicator:	N					
Operating Tsdf:	-----					
Full Enforcement:	-----					
Snc:	N					
Unaddressed Snc:	N					
Addressed Snc:	N					
Snc With Comp Sched:	N					
Fa Required:	-----					
Hhandler Last Change:	20180906					
Recognized Trader Importer:	N					
Recognized Trader Exporter:	N					
Slab Importer:	N					
Slab Exporter:	N					
Manifest Broker:	N					
Subpart P:	N					
Contact Language:	EN					
Handler Name:	RAMONA AUTO INC, DBA RAMONA AUTOMOTIVE					
Location Street No:						
Location Street1:	1936 MAIN ST					
Location Street2:						
Location City:	RAMONA					
Location State:	CA					
Location Zip:	92065					
Location County Code:	CA073					
Location County Name:	SAN DIEGO					
Location Country:	US					
Contact Name:	CHRIS CARTIER PRESIDENT					
Contact Street No:						
Contact Street1:	1936 MAIN ST					
Contact Street2:						
Contact City:	RAMONA					
Contact State:	CA					
Contact Zip:	92065					
Contact Country:						
Contact Phone & Ext:	760-789-2621					
Contact Fax:	760-789-2786					
Contact Email Address:	CHRIS@RAMONAAUTOMOTIVE.COM					
Contact Title:						

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Owner Name:	RAMONA AUTO INC
Owner Type:	O
Owner Seq:	1
Operator Name:	CHRIS CARTIER PRESIDENT
Operator Type:	O
Operator Seq:	2
Public Notes:	

Contact DTSC for information.

Hazardous Waste Handler Details

Seq No:	1
Receive Date:	20140814
Handler Name:	RAMONA AUTO INC, DBA RAMONA AUTOMOTIVE
Fed Waste Generator:	N
Generator Code Description:	Not a Generator, Verified
Source Type:	Implementer
TSD Activity:	N

Owner/Operator Details

Owner/Operator Ind:	Current Owner	Street No:	
Type:	Other	Street1:	1936 MAIN ST
Name:	RAMONA AUTO INC	Street2:	
Dt Became Current:		City:	RAMONA
Dt Ended Current:		State:	CA
Phone:	760-789-2621	Country:	
Source Type:	Implementer	Zip:	92065
Owner/Operator Ind:	Current Operator	Street No:	
Type:	Other	Street1:	1936 MAIN ST
Name:	CHRIS CARTIER PRESIDENT	Street2:	
Dt Became Current:		City:	RAMONA
Dt Ended Current:		State:	CA
Phone:	760-789-2621	Country:	
Source Type:	Implementer	Zip:	92065

6	5 of 8	ENE	0.08 / 445.99	1,418.80 / 1	RAMONA AUTOMOTIVE INC 1936 MAIN ST RAMONA CA 92065	RCRA NON GEN

Handler ID:	CAL000464077
Generator Status:	N
Recycler Activity?:	NO
Recycler Activity Note:	This facility has not been identified as a Recycler Facility from both the RCRA Handler and Biennial Report Modules.

Violation/Evaluation Summary

Note:	NO RECORDS: As of Nov 2025, there are no Compliance Monitoring and Enforcement (violation) records associated with this facility (EPA ID).

Handler Summary

Importer:	No	Used Oil Transpor:	No
Mixed Waste Gen:	No	Used Oil Trans Fac:	No
Transporter:	No	Used Oil Processor:	No
Transfer Facility:	No	Used Oil Refiner:	No
Recycler:	No	Used Oil Burner:	No
Onsite Burner Exem:	No	Commercial TSD:	No
Furnace Exemption:	No	Recycl Nonstorage:	No
Underground Injec:	No		

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Used Oil Market Burner:		No				
Used Oil Spec Marketer:		No				

Additional Handler Summary Details

Source Type:	1		NAIC 1:	811111
Seq No:	2		NAIC 2:	
Non Notifier:			NAIC 3:	
Receive Date:	20250305		NAIC 4:	
Active Site:	----		State:	CA
Land Type:			Location Latitude:	33.032961
In Handler Univ:	N		Location Longitude:	-116.883347
In A Universe:	N		Loc GIS Primary:	N
Gen Status:	N		Loc GIS Origin:	AG
Report Cycle:			State District Owner:	
Accessibility:			State District:	
Region:	09			
Fed Waste Gen Owner:	HQ			
State Waste Generator Owner:	CA			
State Waste Generator:	2			
Short Term Generator:	N			
Uni Waste:	N			
Universal Waste Dest Facility:	N			
Federal Universal Waste:	N			
As Federally Regulated Tsdf:	-----			
As Converter Tsdf:	-----			
As State Regulated Tsdf:	-----			
As State Regulated Handler:	---			
Federal Indicator:	---			
Hsm:	N			
Subpart K:	----			
GPRA Permit:	N			
GPRA Renewal:	N			
Permit Renewal Wrkld:	-----			
Permwrk ID:	-----			
Perm Prog:	-----			
Pcwrkld:	-----			
Closwrkld:	-----			
GPRA Ca:	N			
Cawrkld:	N			
Subjca Tsd Discretion:	N			
NCAPS:	N			
EC Indicator:	N			
Ca725 Indicator:	N			
Ca750 Indicator:	N			
Operating Tsdf:	-----			
Full Enforcement:	-----			
Snc:	N			
Unaddressed Snc:	N			
Addressed Snc:	N			
Snc With Comp Sched:	N			
Fa Required:	-----			
Hhandler Last Change:	20250313			
Recognized Trader Importer:	N			
Recognized Trader Exporter:	N			
Slab Importer:	N			
Slab Exporter:	N			
Manifest Broker:	N			
Subpart P:	N			
Contact Language:	EN			
Handler Name:	RAMONA AUTOMOTIVE INC			
Location Street No:				
Location Street1:	1936 MAIN ST			
Location Street2:				
Location City:	RAMONA			
Location State:	CA			
Location Zip:	92065			
Location County Code:	CA073			

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Location County Name:		SAN DIEGO				
Location Country:		US				
Contact Name:		ERIC LEHMANN				
Contact Street No:						
Contact Street1:		1810 EL CAJON LN				
Contact Street2:						
Contact City:		RAMONA				
Contact State:		CA				
Contact Zip:		92065				
Contact Country:		US				
Contact Phone & Ext:		760-789-2691				
Contact Fax:						
Contact Email Address:		RAMONA.AUTOMOTIVE@AOL.COM				
Contact Title:						
Owner Name:		RAMONA AUTOMOTIVE INC				
Owner Type:		O				
Owner Seq:		1				
Operator Name:		RAMONA AUTOMOTIVE INC				
Operator Type:		O				
Operator Seq:		2				
Public Notes:						

Contact DTSC for information.

Hazardous Waste Handler Details

Seq No: 1
Receive Date: 20210716
Handler Name: RAMONA AUTOMOTIVE
Fed Waste Generator: N
Generator Code Description: Not a Generator, Verified
Source Type: Implementer
TSD Activity: N

Hazardous Waste Handler Details

Seq No: 2
Receive Date: 20250305
Handler Name: RAMONA AUTOMOTIVE INC
Fed Waste Generator: N
Generator Code Description: Not a Generator, Verified
Source Type: Implementer
TSD Activity: N

Owner/Operator Details

Owner/Operator Ind:	Current Owner	Street No:	
Type:	Other	Street1:	1810 EL CAJON LN
Name:	ERIC LEHMANN	Street2:	
Dt Became Current:		City:	RAMONA
Dt Ended Current:		State:	CA
Phone:	760-522-2964	Country:	
Source Type:	Implementer	Zip:	92065
Owner/Operator Ind:	Current Owner	Street No:	
Type:	Other	Street1:	1936 MAIN ST
Name:	RAMONA AUTOMOTIVE INC	Street2:	
Dt Became Current:		City:	RAMONA
Dt Ended Current:		State:	CA
Phone:	760-789-2691	Country:	US
Source Type:	Implementer	Zip:	92065
Owner/Operator Ind:	Current Operator	Street No:	
Type:	Other	Street1:	1810 EL CAJON LN
Name:	ERIC LEHMANN	Street2:	

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Dt Became Current:				City:	RAMONA
Dt Ended Current:				State:	CA
Phone:	760-522-2964			Country:	
Source Type:	Implementer			Zip:	92065
Owner/Operator Ind:	Current Operator			Street No:	
Type:	Other			Street1:	1936 MAIN ST
Name:	RAMONA AUTOMOTIVE INC			Street2:	
Dt Became Current:				City:	RAMONA
Dt Ended Current:				State:	CA
Phone:	760-789-2691			Country:	US
Source Type:	Implementer			Zip:	92065

Historical Handler Details

Receive Dt:	20210716
Generator Code Description:	Not a Generator, Verified
Handler Name:	RAMONA AUTOMOTIVE

6	6 of8	ENE	0.08 / 445.99	1,418.80 / 1	RAMONA AUTOMOTIVE 1936 MAIN ST RAMONA CA 92065	UST SANDIEGO

Facility ID:	37-000-113183	RCRA Large Qty. Gen:	false
Record ID:	DEH2002-HUPFP-113183	HHW Collection:	false
CERS ID:	10,375,084	Recycle:	false
EPA ID No:	CAL000464077	Own or Operate UG:	false
Permit Status:	Permit Renewed	Own or Operate AG:	false
Active Permit:	true	Business Phone:	7607892621
Haz. Mat. On-Site:	true	Business Fax:	7607895376
Haz. Waste Gen:	true	Last Updated:	2023 Oct 20 02:31:15 AM
Onsite Haz Wt Trt:	false		
Mailing Address:	1936 MAIN ST, RAMONA, CA 92065		

Tank Information

Tank ID:	22659	Tank Capacity in Gal:	550
Tank Status:	Removed	Tank Contents:	
Permit Status:	Permit Renewed	Tank Use:	04
Active Permit:	true	Piping Sys Type:	
Dt UST Perm Closed:	1987 Jan 12 12:00:00 AM	Fac Type (UST Fac):	
Type of Tank:	01	Last Updated:	2025 Nov 15 12:58:15 AM
Tank Owner Name:	Eric Lehmann		

6	7 of8	ENE	0.08 / 445.99	1,418.80 / 1	RAMONA AUTOMOTIVE 1936 MAIN ST RAMONA CA	UST SWEEPS

C C:	137-000-13183	D Filename:	NSITE1
BOE:		Page No:	364
Comp:	13183	County:	SAN DIEGO
Status:	INACTIVE	State :	CA
No of Tanks:	1	Zip:	92065
Jurisdict:	SAN DIEGO COUNTY	Latitude:	33.040786
Agency:	SAN DIEGO COUNTY - U.S.T.	Longitude:	-116.870926
Phone:	() 789-2621	Georesult:	S5HPNTSCZA

Tank Details

Tank ID:	000001	S Contain:	SINGLE & LINER
O Tank ID:		Stg:	
SWRCB No:	37-000-013183-000001	Storage :	WASTE
Removed:		Storag Type:	WASTE
Installed:	UNKNOWN	P Contain:	OTHER

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
A Date:		550		Content:		
Capac:		PETROLEUM		ONA:		
Tank Use:				D File Name:		NTANK1
6	8 of 8	ENE	0.08 / 445.99	1,418.80 / 1	RAMONA AUTOMOTIVE 1936 MAIN ST RAMONA CA	UST SWEEPS
C C:		A37-000-13183		D Filename:		SITE02A
BOE:				Page No:		207
Comp:		13183		County:		SAN DIEGO
Status:		ACTIVE		State :		CA
No of Tanks:				Zip:		92065
Jurisdict:		SAN DIEGO COUNTY		Latitude:		33.040786
Agency:		SAN DIEGO COUNTY - U.S.T.		Longitude:		-116.870926
Phone:				Georesult:		S5HPNTSCZA
7	1 of 2	ENE	0.10 / 547.28	1,421.76 / 4	Taco Bell #41609 1925 MAIN ST STE A RAMONA CA 92065	CERS HAZ
Latitude:		33.033500				
Longitude:		-116.883460				
<u>Regulated Programs</u>						
EI ID:		10941688		EI Description:		Chemical Storage Facilities
<u>Violations</u>						
Violation Date:		12/06/2023		Violation Source:		CERS
Violation Program:		HMRRP		Violation Division:		San Diego County Department of Env Health
Citation:		HSC 6.95 25508(a)(3) - California Health and Safety Code, Chapter 6.95, Section(s) 25508(a)(3)				
Violation Notes:						
Returned to compliance on 02/20/2024. Inspection Sequence ID:7374464						
<u>Violation Description:</u>						
Failure to establish and/or electronically submit an adequate training program in safety procedures in the event of a release or threatened release of a hazardous material. *Verify agricultural handler exemption HSC 25507.1						
<u>Violations</u>						
Violation Date:		12/06/2023		Violation Source:		CERS
Violation Program:		HMRRP		Violation Division:		San Diego County Department of Env Health
Citation:		HSC 6.95 Multiple - California Health and Safety Code, Chapter 6.95, Section(s) Multiple				
Violation Notes:						
Returned to compliance on 02/21/2024. Inspection Sequence ID:7374464;Violation:HMD1001 Unified Program Facility permit not obtained for hazardous materials. SDCC 68.904; 68.905; 68.906, 68.907; 68.907.1						
<u>Violation Description:</u>						
Business Plan Program - Administration/Documentation - General						
<u>Evaluations</u>						
Eval Date:		12/06/2023				
Violations Found:		Yes				
Eval General Type:		Compliance Evaluation Inspection				

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Eval Type:	Routine done by local agency
Eval Division:	San Diego County Department of Env Health
Eval Program:	HMRRP
Eval Source:	CERS
Eval Notes:	

Inspector: Murphy Sky Inspection ID:7374464; Note: data in [EVAL Notes] field for some records is truncated from the source.

Affiliations

Affil Type Desc:	Legal Owner
Entity Name:	Angel City Bell, LLC
Entity Title:	
Address:	3120 S Durango Dr, #305
City:	Las Vegas
State:	NV
Country:	United States
Zip Code:	89117
Phone:	(702) 880-5818

Affil Type Desc:	Facility Mailing Address
Entity Name:	Mailing Address
Entity Title:	
Address:	3120 S Durango Dr, #305
City:	Las Vegas
State:	NV
Country:	
Zip Code:	89117
Phone:	

Affil Type Desc:	Document Preparer
Entity Name:	Laury Ketcham
Entity Title:	
Address:	
City:	
State:	
Country:	
Zip Code:	
Phone:	

Affil Type Desc:	Identification Signer
Entity Name:	Laury Ketcham
Entity Title:	Mgr of Vendor Relations
Address:	
City:	
State:	
Country:	
Zip Code:	
Phone:	

Affil Type Desc:	CUPA District
Entity Name:	San Diego County Env Health Qlty
Entity Title:	
Address:	PO Box 129261
City:	San Diego
State:	CA
Country:	
Zip Code:	92112-9261
Phone:	(858) 505-6880

Affil Type Desc:	Environmental Contact
Entity Name:	Justin Hvidsten
Entity Title:	
Address:	8141 E Kaiser Blvd #312
City:	Anaheim
State:	CA
Country:	

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Zip Code: 92808 Phone: Affil Type Desc: Operator Entity Name: Angel City Bell, LLC Entity Title: Address: City: State: Country: Zip Code: Phone: (702) 880-5818 Affil Type Desc: Parent Corporation Entity Name: Angel City Bell, LLC Entity Title: Address: City: State: Country: Zip Code: Phone:						
7	2 of 2	ENE	0.10 / 547.28	1,421.76 / 4	Taco Bell #41609 1925 MAIN ST, SUITE# A RAMONA, CA 92065 RAMONA CA 92065	HAZ SANDIEGO
Record ID: DEH2023-HUPFP-008311 Facility Name: Taco Bell #41609 Facility Address: 1925 MAIN ST, SUITE# A RAMONA, CA 92065 Facility City: RAMONA Facility Zip Code: 92065 Facility Latitude: 33.033404734458344 Facility Longitude: -116.8833742937518 GIS Record ID: GIS Facility Name: GIS Facility Address: GIS Facility City: GIS Facility Zip Code: GIS Fac Latitude: GIS Fac Longitude: Tank Owner Name:						
HMD Permits Map Data						
Epa ID: Cers ID: 10941688 Sitemap: MAP_008311.pdf Record Status: Permit Renewed Er Contact1: Alma Morales Er Title1: Area Coach Er Phone1: 619-917-1663 Er Altphone: 619-917-1663 Er Contact2: Shane Grant Er Title2: Director of Operations Er Phone2: 714-470-4800 Er Altphone2: 714-470-4800 Biz Apn: 282-141-56-00 Biz Phone: 702-880-5818 Biz Email: shernandez@drqfood.com Biz Owner: Angel City Bell, LLC Biz Type: Beverage Carbonation Only Facility Subject To Calarp: Plating Shop Metal Finishing: Chemical Supplier Wholesale: Pesticide Applicator Fumigatio: Opened Dt: 2023-11-22T00:00:00 Expiration Dt: 2025-01-31T00:00:00 Rpt Name: HMBP008311.pdf Hirt Flag: N Billing Code1: MIVLR St No: 1925 St No End: St Name: MAIN St Dir: St Type: ST St Unit: A Insp Dist Geoinfo: HE020						

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Chem Gas Paint Manufacture:
 Resin Site With 6 Items:
 Petroleum Propane Fuel Supp:
 Site With Gt20 Inventory Items:
 Apsa Stor Tank Gt10000 Gal:
 Apsa Stor Tank Chem Gt999ga:
 Ust Stor Tank Fuel Gt30k Ga:
 Cryogas Gt20kcft200gal1200lb:
 Gases Gt20kCft 208 Gal 1666 L:
 Prop Gt185kCft5k Gal 2100:
 Extreme Haz Gt20 Cft 54 Gal 5:

8	1 of1	SSE	0.12 / 619.04	1,414.17 / -3	427 JULIAN ST 427 JULIAN ST RAMONA CA 92065	RCRA NON GEN

Handler ID:	CAC003202822
Generator Status:	N
Recycler Activity?:	NO
Recycler Activity Note:	This facility has not been identified as a Recycler Facility from both the RCRA Handler and Biennial Report Modules.

Violation/Evaluation Summary

Note:	NO RECORDS: As of Nov 2025, there are no Compliance Monitoring and Enforcement (violation) records associated with this facility (EPA ID).

Handler Summary

Importer:	No	Used Oil Transpor:	No
Mixed Waste Gen:	No	Used Oil Trans Fac:	No
Transporter:	No	Used Oil Processor:	No
Transfer Facility:	No	Used Oil Refiner:	No
Recycler:	No	Used Oil Burner:	No
Onsite Burner Exem:	No	Commercial TSD:	No
Furnace Exemption:	No	Recycl Nonstorage:	No
Underground Injec:	No		
Used Oil Market Burner:	No		
Used Oil Spec Marketer:	No		

Additional Handler Summary Details

Source Type:	I	NAIC 1:	56299
Seq No:	1	NAIC 2:	
Non Notifier:		NAIC 3:	
Receive Date:	20221104	NAIC 4:	
Active Site:	----	State:	CA
Land Type:		Location Latitude:	33.030034
In Handler Univ:	N	Location Longitude:	-116.884525
In A Universe:	N	Loc GIS Primary:	N
Gen Status:	N	Loc GIS Origin:	AG
Report Cycle:		State District Owner:	
Accessibility:		State District:	
Region:	09		
Fed Waste Gen Owner:	HQ		
State Waste Generator Owner:	CA		
State Waste Generator:	2		
Short Term Generator:	N		
Uni Waste:	N		
Universal Waste Dest Facility:	N		
Federal Universal Waste:	N		
As Federally Regulated Tsdf:	-----		
As Converter Tsdf:	-----		
As State Regulated Tsdf:	-----		
As State Regulated Handler:	---		

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Federal Indicator:		---				
Hsm:		N				
Subpart K:		----				
GPRA Permit:		N				
GPRA Renewal:		N				
Permit Renewal Wrkld:		-----				
Permwrk ID:		-----				
Perm Prog:		-----				
Pcwrkld:		-----				
Closwrkld:		-----				
GPRA Ca:		N				
Cawrkld:		N				
Subjca Tsd Discretion:		N				
NCAPS:		N				
EC Indicator:		N				
Ca725 Indicator:		N				
Ca750 Indicator:		N				
Operating Tsdf:		-----				
Full Enforcement:		-----				
Snc:		N				
Unaddressed Snc:		N				
Addressed Snc:		N				
Snc With Comp Sched:		N				
Fa Required:		-----				
Hhandler Last Change:		20241212				
Recognized Trader Importer:		N				
Recognized Trader Exporter:		N				
Slab Importer:		N				
Slab Exporter:		N				
Manifest Broker:		N				
Subpart P:		N				
Contact Language:		EN				
Handler Name:		427 JULIAN ST				
Location Street No:						
Location Street1:		427 JULIAN ST				
Location Street2:						
Location City:		RAMONA				
Location State:		CA				
Location Zip:		92065				
Location County Code:		CA073				
Location County Name:		SAN DIEGO				
Location Country:		US				
Contact Name:		VICTORIA BOOKHAMMER				
Contact Street No:						
Contact Street1:		427 JULIAN ST				
Contact Street2:						
Contact City:		RAMONA				
Contact State:		CA				
Contact Zip:		92065				
Contact Country:						
Contact Phone & Ext:		760-520-5733				
Contact Fax:						
Contact Email Address:		SEWITT@PWSEI.COM				
Contact Title:						
Owner Name:		VICTORIA BOOKHAMMER				
Owner Type:		O				
Owner Seq:		1				
Operator Name:		VICTORIA BOOKHAMMER				
Operator Type:		O				
Operator Seq:		2				
Public Notes:						

Contact DTSC for information.

Hazardous Waste Handler Details

Seq No: 1

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Receive Date:		20221104				
Handler Name:		427 JULIAN ST				
Fed Waste Generator:		N				
Generator Code Description:		Not a Generator, Verified				
Source Type:		Implementer				
TSD Activity:		N				
<u>Owner/Operator Details</u>						
Owner/Operator Ind:		Current Operator		Street No:		
Type:		Other		Street1:		427 JULIAN ST
Name:		VICTORIA BOOKHAMMER		Street2:		
Dt Became Current:				City:		RAMONA
Dt Ended Current:				State:		CA
Phone:		760-520-5733		Country:		
Source Type:		Implementer		Zip:		92065
Owner/Operator Ind:		Current Owner		Street No:		
Type:		Other		Street1:		427 JULIAN ST
Name:		VICTORIA BOOKHAMMER		Street2:		
Dt Became Current:				City:		RAMONA
Dt Ended Current:				State:		CA
Phone:		760-520-5733		Country:		
Source Type:		Implementer		Zip:		92065

9	1 of 2	ENE	0.12 / 632.95	1,421.10 / 3	Leslie's Swimming Pool Supplies #653 1905 MAIN ST RAMONA CA 92065	CERS HAZ

Latitude: 33.033623
Longitude: -116.883072

Regulated Programs

EI ID:	10157107	EI Description:	Chemical Storage Facilities

Violations

Violation Date:	08/21/2013	Violation Source:	CERS
Violation Program:	HMRP	Violation Division:	San Diego County Department of Env Health
Citation:	HSC 6.95 25503.5(a) - California Health and Safety Code, Chapter 6.95, Section(s) 25503.5(a)		
Violation Notes:			

Returned to compliance on 09/18/2013.

Violation Description:

Owner/Operator failed to establish and implement a Hazardous Materials Business Plan when storing hazardous materials at or above the thresholds quantities of 55 gallons/500 lbs/200 cubic feet.

Violations

Violation Date:	08/21/2013	Violation Source:	CERS
Violation Program:	HMRP	Violation Division:	San Diego County Department of Env Health
Citation:	HSC 6.95 25503.5(a) - California Health and Safety Code, Chapter 6.95, Section(s) 25503.5(a)		
Violation Notes:			

Returned to compliance on 07/07/2015.

Violation Description:

Owner/Operator failed to establish and implement a Hazardous Materials Business Plan when storing hazardous materials at or above the thresholds

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

quantities of 55 gallons/500 lbs/200 cubic feet.

Evaluations

Eval Date: 09/11/2024
Violations Found: No
Eval General Type: Compliance Evaluation Inspection
Eval Type: Routine done by local agency
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS
Eval Notes:

Inspector: Peguero Esequiel Inspection ID:7567276; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date: 08/21/2013
Violations Found: Yes
Eval General Type: Other/Unknown
Eval Type: Other, not routine, done by local agency
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS
Eval Notes:

Inspector: Kieu Bridget Inspection ID:4908591; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date: 08/21/2013
Violations Found: Yes
Eval General Type: Compliance Evaluation Inspection
Eval Type: Routine done by local agency
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS
Eval Notes:

Inspector: Kieu Bridget Inspection ID:4090886; Note: data in [EVAL Notes] field for some records is truncated from the source.

Affiliations

Affil Type Desc: CUPA District
Entity Name: San Diego County Env Health Qlty
Entity Title:
Address: PO Box 129261
City: San Diego
State: CA
Country:
Zip Code: 92112-9261
Phone: (858) 505-6880

Affil Type Desc: Parent Corporation
Entity Name: Leslie's Poolmart, Inc
Entity Title:
Address:
City:
State:
Country:
Zip Code:
Phone:

Affil Type Desc: Environmental Contact
Entity Name: Gina Stoner
Entity Title:
Address: 2005 E Indian School Road, ATTN: Regulatory Affairs

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
City: State: Country: Zip Code: Phone:		Phoenix AZ 85016				
Affil Type Desc: Entity Name: Entity Title: Address: City: State: Country: Zip Code: Phone:		Legal Owner Leslie's Poolmart, Inc. 2005 E Indian School Road, ATTN: Regulatory Affairs Phoenix AZ United States 85016 (602) 366-3946				
Affil Type Desc: Entity Name: Entity Title: Address: City: State: Country: Zip Code: Phone:		Operator Leslie's Poolmart, Inc. (602) 366-3999				
Affil Type Desc: Entity Name: Entity Title: Address: City: State: Country: Zip Code: Phone:		Facility Mailing Address Mailing Address 2005 E Indian School Road, ATTN: Regulatory Affairs Phoenix AZ 85016				
Affil Type Desc: Entity Name: Entity Title: Address: City: State: Country: Zip Code: Phone:		Identification Signer Steven Oseseck Consultant 				
Affil Type Desc: Entity Name: Entity Title: Address: City: State: Country: Zip Code: Phone:		Document Preparer Steven Oseseck 				
<u>Coordinates</u>						
Env Int Type Code: Program ID: Latitude:	HMBP 10157107 33.033620			Longitude: Coord Name: Ref Point Type Desc:	-116.883070 Center of a facility or station.	
<u>9</u>	2 of2	ENE	0.12 / 632.95	1,421.10 / 3	Leslie's Swimming Pool Supplies #653 1905 MAIN ST 1905 MAIN ST RAMONA CA	HAZ SANDIEGO

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Record ID:		DEH2008-HUPFP-209067				
Facility Name:		Leslie's Swimming Pool Supplies #653				
Facility Address:		1905 MAIN ST, RAMONA, CA 92065				
Facility City:		RAMONA				
Facility Zip Code:		0				
Facility Latitude:		33.033621141099026				
Facility Longitude:		-116.8830697483031				
GIS Record ID:						
GIS Facility Name:						
GIS Facility Address:						
GIS Facility City:						
GIS Facility Zip Code:						
GIS Fac Latitude:						
GIS Fac Longitude:						
Tank Owner Name:						

HMD Inactive Permits Map Data

Facilityid:		Latitude WGS84:	0
Cers ID:	10157107	Longitude WGS84:	0
Featureid:	2821415700	Ust Facilitytype:	
Site Address:	1905 MAIN ST	Agencyname:	COSD
Street String:	1905 MAIN ST	Opened Date Dt:	2008-02-25 00:00:00 UTC
Point X:	6367645.7741	Creator:	
Point Y:	1956448.94404	Created Dt:	1970-01-01 00:00:00 UTC
X Mapcoord:	6367645.774	Editor:	
Y Mapcoord:	1956448.944	Edited Dt:	1970-01-01 00:00:00 UTC
Record Type:	LUEG-DEH/HMD/UPFP/Facility	Parcel No:	282-141-57-00
Record Alias:	Unified Program Facility Permit		
Record Status:	Permit Suspended		
Business Type:	Swimming Pool Chemical Supply & Pool Maint.		
Geo Src:	Mapped to record APN/parcel center XY		
Tot Above Ground Petroleum Cap:	0		
Rmp Calarp Level:			
Lrg Qty Mwgenerator:	No		
Own Operate Usts:			
Tot Num Usts:			
Own Operate Apsa Tank:			
Num Tanks 10kgal or Greater:			
Hazwaste Generator:	N		
On Site Haz Waste Treatment:	N		
Rcra Lrg Qty Generator:	N		
Kivapertype Pernum:	HK07 209067		

Hazardous Materials Inspection Violations

Container Tank ID:		Inspection No:	4090886
Facility ID No:	25001	Inspection Type:	Routine
ID:	08/21/2013 01:53:00 PM	Inspection Date:	
UST ID:		Compliance Date:	07/07/2015 12:00:00 AM
Permit Status:	Permit Suspended	Last Updated:	04/07/2017 10:38:09 AM
Active Permit:	false	NOV:	false
Program Element:	Hazardous Materials Release Response Plans		
Violation Code:	1010001 Owner/Operator failed to establish and implement a Hazardous Materials Business Plan when storing hazardous materials at or above the thresholds quantities of 55 gallons/500 lbs/200 cubic feet; 19 CCR 4 2729.1 (a); HSC 6.95 25503.5(a).		
Violation Classification:	Class II		

10	1 of 14	ENE	0.12 / 656.72	1,418.40 / 1	STARS PETROLEUM INC 1910 MAIN ST RAMONA CA 92065	CERS TANK
Site ID:	156920					
Latitude:	33.033390					
Longitude:	-116.882880					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Regulated Programs

EI ID: 10375228
EI Description: Underground Storage Tank

EI ID: 10375228
EI Description: Hazardous Waste Generator

Violations

Violation Date: 06/30/2021
Violation Program: UST
Citation: HSC 6.7 25284.2 - California Health and Safety Code, Chapter 6.7, Section(s) 25284.2
Violation Notes:

Returned to compliance on 06/30/2021. Inspection Sequence ID:6667849;Tank ID:28267,28268;Violation Description:(TCR 9a) Failure to meet one or more of the following requirements: Install or maintain a liquid-tight spill container. Have a minimum capacity of 5 gallons. Have a functional drain valve or other method for the removal of liquid from the spill container. Be resistant to galvanic corrosion. Perform a tightness test at installation, every 12 months thereafter, or within 30 days after a repair to the spill container, tested using applicable manufacturer guidelines, industry codes, engineering standards, or a method approved by a professional engineer. Tested by a certified UST service technician. Maintain records of spill containment testing for 36 months. 23 CCR 2635(b), 2637.1(a-c), 2665(a-b), 2712(b)(1)(F); HSC 25284.2

Violation Description:

"Failure to meet one or more of the following requirements:

Install or maintain a liquid-tight spill container.

Have a minimum capacity of five gallons.

Have a functional drain valve or other method for the removal of liquid from the spill container.

Be resistant to galvanic corrosion.

Perform a tightness test at installation, every 12 months thereafter, or within 30 days after a repair to the spill container.

Tested using applicable manufacturer guidelines, industry codes, engineering standards, or a method approved by a professional engineer.

Tested by a certified UST service technician.

Maintain records of spill containment testing for 36 months.

"

Violations

Violation Date: 06/21/2018
Violation Program: UST
Citation: 23 CCR 16 2636(f)(2) - California Code of Regulations, Title 23, Chapter 16, Section(s) 2636(f)(2)
Violation Notes:

Returned to compliance on 06/21/2018.

Violation Description:

Failure of the functional line leak detector (LLD) monitoring pressurized piping to meet one or more of the following requirements: Monitored at least hourly with the capability of detecting a release of 3.0 gallons per hour leak at 10 p.s.i.g. and restrict or shut off the flow of product through the piping when a leak is detected.

Violations

Violation Date: 06/28/2016
Violation Program: UST
Violation Source: CERS
Violation Division: San Diego County Department of Env Health

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Citation: 23 CCR 16 2636(f)(2) - California Code of Regulations, Title 23, Chapter 16, Section(s) 2636(f)(2)

Violation Notes:

Returned to compliance on 06/28/2016.

Violation Description:

Failure of the line leak detector (LLD) monitoring pressurized piping to meet one or more of the following requirements: Monitor at least hourly. Be capable of detecting a release of 3.0 gallons per hour at 10 p.s.i.g.
Restrict or shut off the flow of product through the piping when a leak is detected.

Violations

Violation Date:	07/08/2014	Violation Source:	CERS
Violation Program:	UST	Violation Division:	San Diego County Department of Env Health
Citation:	23 CCR 16 2632, 2634, 2636, 2666 - California Code of Regulations, Title 23, Chapter 16, Section(s) 2632, 2634, 2636, 2666		

Violation Notes:

Returned to compliance on 07/08/2014. Inspection Sequence ID:4977868; Tank ID:87,91,89,03; Violation Description: Failure of the leak detection equipment to be properly programmed or properly operated. 23 CCR 16 2632, 2634, 2636, 2666

Violation Description:

Failure of the leak detection equipment to be properly programmed or properly operated.

Violations

Violation Date:	06/29/2015	Violation Source:	CERS
Violation Program:	UST	Violation Division:	San Diego County Department of Env Health
Citation:	23 CCR 16 2632, 2634, 2636, 2666 - California Code of Regulations, Title 23, Chapter 16, Section(s) 2632, 2634, 2636, 2666		

Violation Notes:

Returned to compliance on 06/29/2015. Inspection Sequence ID:5161628; Tank ID:28267,28268,28266,34296; Violation Description: (RD) Failure of the leak detection equipment to have an audible and visual alarm as required. 23 CCR 2632, 2634, 2636, 2666

Violation Description:

Failure of the leak detection equipment to have an audible and visual alarm as required.

Violations

Violation Date:	06/02/2022	Violation Source:	CERS
Violation Program:	HW	Violation Division:	San Diego County Department of Env Health
Citation:	HSC 6.5 25123.3(h)(1) - California Health and Safety Code, Chapter 6.5, Section(s) 25123.3(h)(1)		

Violation Notes:

Returned to compliance on 06/16/2022. Inspection Sequence ID:6944856

Violation Description:

- Failure to send hazardous waste offsite for treatment, storage, or disposal within 180 days (or 270 days if waste is transported over 200 miles) for a generator who generates less than 1000 kilogram per month if all of the following conditions are met:
- (1) The quantity of hazardous waste accumulated onsite never exceeds 6,000 kilograms.
 - (2) The generator complies with the requirements of 40 Code of Federal Regulations section 262.34(d), (e) and (f).
 - (3) The generator does not hold acutely hazardous waste or extremely hazardous waste in an amount greater than one kilogram for more than 90 days.

Violations

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Violation Date: 06/28/2017
Violation Program: UST
Citation: 23 CCR 16 2636(f)(2) - California Code of Regulations, Title 23, Chapter 16, Section(s) 2636(f)(2)
Violation Notes:

Returned to compliance on 06/28/2017. Inspection Sequence ID:5668063;Tank ID:32496,28268,28267;Violation Description:(RD) Failure of the pressurized piping to meet one or more of the following requirements: monitored at least hourly with the capability of detecting a release of 3.0 gallons per hour, and will restrict the flow or product through the piping or trigger an alarm when a release occurs. 23 CCR 2636(f)(2)

Violation Description:

Failure of the line leak detector (LLD) monitoring pressurized piping to meet one or more of the following requirements:Monitor at least hourly.Be capable of detecting a release of 3.0 gallons per hour at 10 p.s.i.g. Restrict or shut off the flow of product through the piping when a leak is detected.

Violations

Violation Date: 06/24/2025
Violation Program: UST
Citation: HSC 6.7 25284.2 - California Health and Safety Code, Chapter 6.7, Section(s) 25284.2
Violation Notes:

Returned to compliance on 06/24/2025. Inspection Sequence ID:7668521;Tank ID:28266;Violation Description:(TCR 9a) Failure to meet one or more of the following requirements: 1) Install or maintain a liquid-tight spill container. 2) Have a minimum capacity of 5 gallons. 3) Have a functional drain valve or other method for the removal of liquid from the spill container. 4) Be resistant to galvanic corrosion. 5) Perform a tightness test at installation, every 12 months thereafter, or within 30 days after a repair to the spill container. 6) Tested using applicable manufacturer guidelines, industry codes, engineering standards, or a method approved by a professional engineer. 7) Tested by a certified UST service technician. 8) Maintain records of spill containment testing for 36 months. 23 CCR 2635(b), 2637.1(a-c), 2665(a-b), 2712(b)(1)(F); HSC 25284.2

Violation Description:

"Failure to meet one or more of the following requirements:

Install or maintain a liquid-tight spill container.

Have a minimum capacity of five gallons.

Have a functional drain valve or other method for the removal of liquid from the spill container.

Be resistant to galvanic corrosion.

Perform a tightness test at installation, every 12 months thereafter, or within 30 days after a repair to the spill container.

Tested using applicable manufacturer guidelines, industry codes, engineering standards, or a method approved by a professional engineer.

Tested by a certified UST service technician.

Maintain records of spill containment testing for 36 months.

"

Violations

Violation Date: 06/14/2019
Violation Program: UST
Citation: HSC 6.7 25292.1(a) - California Health and Safety Code, Chapter 6.7, Section(s) 25292.1(a)
Violation Notes:

Returned to compliance on 06/14/2019. Inspection Sequence ID:6178535;Tank ID:32496;Violation Description:Failure to operate the UST system to prevent unauthorized releases including leaks, spills, and/or overfills. HSC 25292.1(a)

Violation Description:

Failure to operate the UST system to prevent unauthorized releases including leaks, spills, and/or overfills.

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Violations

Violation Date:	06/29/2015	Violation Source:	CERS
Violation Program:	UST	Violation Division:	San Diego County Department of Env Health
Citation:	23 CCR 16 2636(f) - California Code of Regulations, Title 23, Chapter 16, Section(s) 2636(f)		
Violation Notes:			

Returned to compliance on 06/29/2015. Inspection Sequence ID:5161628;Tank ID:28267;Violation Description:Failure to continuously monitor the interstitial space of the tank, piping and/or sumps sump such that the leak detection activates an audible/visual alarm when a leak is detected. 23 CCR 16 2631(g), 2632(c)(2)(A)&(B), 2633(c), 2636(f).

Violation Description:

Failure to continuously monitor the interstitial space of the tank, piping and/or sumps sump such that the leak detection activates an audible/visual alarm when a leak is detected.

Violations

Violation Date:	06/02/2022	Violation Source:	CERS
Violation Program:	HW	Violation Division:	San Diego County Department of Env Health
Citation:	22 CCR 12 66262.34(f) - California Code of Regulations, Title 22, Chapter 12, Section(s) 66262.34(f)		
Violation Notes:			

Returned to compliance on 06/16/2022. Inspection Sequence ID:6944856

Violation Description:

Failure to properly label hazardous waste accumulation containers and portable tanks with the following requirements: "Hazardous Waste", name and address of the generator, physical and chemical characteristics of the Hazardous Waste, and starting accumulation date.

Violations

Violation Date:	06/14/2019	Violation Source:	CERS
Violation Program:	HMRRP	Violation Division:	San Diego County Department of Env Health
Citation:	HSC 6.95 25508(a)(1) - California Health and Safety Code, Chapter 6.95, Section(s) 25508(a)(1)		
Violation Notes:			

Returned to compliance on 06/19/2019. Inspection Sequence ID:6178535

Violation Description:

Failure to annually review and electronically certify that the business plan is complete and accurate on or before the annual due date.

Violations

Violation Date:	06/02/2022	Violation Source:	CERS
Violation Program:	HMRRP	Violation Division:	San Diego County Department of Env Health
Citation:	HSC 6.95 25508(a)(3) - California Health and Safety Code, Chapter 6.95, Section(s) 25508(a)(3)		
Violation Notes:			

Returned to compliance on 08/17/2022. Inspection Sequence ID:6944856

Violation Description:

Failure to complete and electronically submit hazardous material inventory information for all reportable hazardous materials on site at or above reportable quantities.

Violations

Violation Date:	06/29/2015	Violation Source:	CERS
Violation Program:	HW	Violation Division:	San Diego County Department of Env Health
Citation:	22 CCR 12 66262.34(d) - California Code of Regulations, Title 22, Chapter 12, Section(s) 66262.34(d)		

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Violation Notes:

Returned to compliance on 07/14/2015. Inspection Sequence ID:5161628

Violation Description:

Failure to dispose of hazardous waste within 180 days (or 270 if waste is transported over 200 miles) for the generator who generates less than 1000 kilogram per month, but more than 100 kilograms per month.

Violations

Violation Date:	07/08/2014	Violation Source:	CERS
Violation Program:	UST	Violation Division:	San Diego County Department of Env Health
Citation:	23 CCR 16 2636(f)(2) - California Code of Regulations, Title 23, Chapter 16, Section(s) 2636(f)(2)		
Violation Notes:			

Returned to compliance on 07/08/2014. Inspection Sequence ID:4977868;Tank ID:91,03;Violation Description:Failure of the pressurized piping to meet one or more of the following requirements: monitored at least hourly with the capability of detecting a release of 3.0 gallons per hour, and will restrict the flow of product through the piping or trigger an alarm when a release occurs. 23 CCR 16 2636(f)(2).

Violation Description:

Failure of the pressurized piping to meet one or more of the following requirements: monitored at least hourly with the capability of detecting a release of 3.0 gallons per hour, and will restrict the flow of product through the piping or trigger an alarm when a release occurs.

Violations

Violation Date:	06/14/2019	Violation Source:	CERS
Violation Program:	UST	Violation Division:	San Diego County Department of Env Health
Citation:	23 CCR 16 2636(f)(1) - California Code of Regulations, Title 23, Chapter 16, Section(s) 2636(f)(1)		
Violation Notes:			

Returned to compliance on 06/14/2019. Inspection Sequence ID:6178535;Tank ID:28266;Violation Description:(TCR 9d) Failure of the double-walled pressurized piping to be continuously monitored with a system that activates an audible and visual alarm or stops flow at dispenser when a leak is detected. 23 CCR 2636(f)(1)

Violation Description:

Failure of the double-walled pressurized piping to be continuously monitored with a system that activates an audible and visual alarm or stops flow at the dispenser when a leak is detected.

Violations

Violation Date:	06/29/2015	Violation Source:	CERS
Violation Program:	UST	Violation Division:	San Diego County Department of Env Health
Citation:	23 CCR 16 2666(c) - California Code of Regulations, Title 23, Chapter 16, Section(s) 2666(c)		
Violation Notes:			

Returned to compliance on 06/29/2015. Inspection Sequence ID:5161628;Tank ID:28267;Violation Description:Failure of line leak detector to detect a leak and/or failure of audible and visual alarm. 23 CCR 16 2636(f)(2), 2666.

Violation Description:

Failure of line leak detector to detect a leak and/or failure of audible and visual alarm.

Evaluations

Eval Date:	06/28/2016
Violations Found:	No
Eval General Type:	Compliance Evaluation Inspection
Eval Type:	Routine done by local agency
Eval Division:	San Diego County Department of Env Health

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Eval Program:		HMRRP				
Eval Source:		CERS				
Eval Notes:						
Inspector: Beacon Ellen Inspection ID:5444891; Note: data in [EVAL Notes] field for some records is truncated from the source.						
Eval Date:		06/14/2019				
Violations Found:		No				
Eval General Type:		Compliance Evaluation Inspection				
Eval Type:		Routine done by local agency				
Eval Division:		San Diego County Department of Env Health				
Eval Program:		HW				
Eval Source:		CERS				
Eval Notes:						
Inspector: Fernandez Juan Inspection ID:6178535; Note: data in [EVAL Notes] field for some records is truncated from the source.						
Eval Date:		06/24/2025				
Violations Found:		No				
Eval General Type:		Compliance Evaluation Inspection				
Eval Type:		Routine done by local agency				
Eval Division:		San Diego County Department of Env Health				
Eval Program:		HMRRP				
Eval Source:		CERS				
Eval Notes:						
Inspector: Donoso Nereyda Inspection ID:7668521; Note: data in [EVAL Notes] field for some records is truncated from the source.						
Eval Date:		07/08/2014				
Violations Found:		Yes				
Eval General Type:		Compliance Evaluation Inspection				
Eval Type:		Routine done by local agency				
Eval Division:		San Diego County Department of Env Health				
Eval Program:		UST				
Eval Source:		CERS				
Eval Notes:						
Inspector: Tank HT202 Inspection ID:4977868; Note: data in [EVAL Notes] field for some records is truncated from the source.						
Eval Date:		06/14/2019				
Violations Found:		Yes				
Eval General Type:		Compliance Evaluation Inspection				
Eval Type:		Routine done by local agency				
Eval Division:		San Diego County Department of Env Health				
Eval Program:		UST				
Eval Source:		CERS				
Eval Notes:						
Inspector: Fernandez Juan Inspection ID:6178535; Note: data in [EVAL Notes] field for some records is truncated from the source.						
Eval Date:		06/28/2016				
Violations Found:		Yes				
Eval General Type:		Compliance Evaluation Inspection				
Eval Type:		Routine done by local agency				
Eval Division:		San Diego County Department of Env Health				
Eval Program:		UST				
Eval Source:		CERS				
Eval Notes:						
Inspector: Beacon Ellen Inspection ID:5444891; Note: data in [EVAL Notes] field for some records is truncated from the source.						
Eval Date:		06/29/2015				
Violations Found:		Yes				
Eval General Type:		Compliance Evaluation Inspection				

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Eval Type: Routine done by local agency Eval Division: San Diego County Department of Env Health Eval Program: UST Eval Source: CERS Eval Notes:						
Inspector: Beacon Ellen Inspection ID:5161628; Note: data in [EVAL Notes] field for some records is truncated from the source.						
Eval Date: 06/29/2015 Violations Found: Yes Eval General Type: Compliance Evaluation Inspection Eval Type: Routine done by local agency Eval Division: San Diego County Department of Env Health Eval Program: HW Eval Source: CERS Eval Notes:						
Inspector: Beacon Ellen Inspection ID:5161628; Note: data in [EVAL Notes] field for some records is truncated from the source.						
Eval Date: 06/02/2022 Violations Found: Yes Eval General Type: Compliance Evaluation Inspection Eval Type: Routine done by local agency Eval Division: San Diego County Department of Env Health Eval Program: HW Eval Source: CERS Eval Notes:						
Inspector: Halsey Christopher Inspection ID:6944856; Note: data in [EVAL Notes] field for some records is truncated from the source.						
Eval Date: 06/14/2019 Violations Found: Yes Eval General Type: Compliance Evaluation Inspection Eval Type: Routine done by local agency Eval Division: San Diego County Department of Env Health Eval Program: HMRRP Eval Source: CERS Eval Notes:						
Inspector: Fernandez Juan Inspection ID:6178535; Note: data in [EVAL Notes] field for some records is truncated from the source.						
Eval Date: 06/21/2018 Violations Found: Yes Eval General Type: Compliance Evaluation Inspection Eval Type: Routine done by local agency Eval Division: San Diego County Department of Env Health Eval Program: UST Eval Source: CERS Eval Notes:						
Inspector: Fernandez Juan Inspection ID:5914775; Note: data in [EVAL Notes] field for some records is truncated from the source.						
Eval Date: 06/28/2017 Violations Found: Yes Eval General Type: Compliance Evaluation Inspection Eval Type: Routine done by local agency Eval Division: San Diego County Department of Env Health Eval Program: UST Eval Source: CERS Eval Notes:						
Inspector: Beacon Ellen Inspection ID:5668063; Note: data in [EVAL Notes] field for some records is truncated from the source.						
Eval Date: 06/29/2015						

<i>Map Key</i>	<i>Number of Records</i>	<i>Direction</i>	<i>Distance (mi/ft)</i>	<i>Elev/Diff (ft)</i>	<i>Site</i>	<i>DB</i>
Violations Found:		No				
Eval General Type:		Compliance Evaluation Inspection				
Eval Type:		Routine done by local agency				
Eval Division:		San Diego County Department of Env Health				
Eval Program:		HMRRP				
Eval Source:		CERS				
Eval Notes:						
Inspector: Beacon Ellen Inspection ID:5161628; Note: data in [EVAL Notes] field for some records is truncated from the source.						
Eval Date:		06/28/2016				
Violations Found:		No				
Eval General Type:		Compliance Evaluation Inspection				
Eval Type:		Routine done by local agency				
Eval Division:		San Diego County Department of Env Health				
Eval Program:		HW				
Eval Source:		CERS				
Eval Notes:						
Inspector: Beacon Ellen Inspection ID:5444891; Note: data in [EVAL Notes] field for some records is truncated from the source.						
Eval Date:		06/28/2017				
Violations Found:		No				
Eval General Type:		Compliance Evaluation Inspection				
Eval Type:		Routine done by local agency				
Eval Division:		San Diego County Department of Env Health				
Eval Program:		HW				
Eval Source:		CERS				
Eval Notes:						
Inspector: Beacon Ellen Inspection ID:5668063; Note: data in [EVAL Notes] field for some records is truncated from the source.						
Eval Date:		07/08/2014				
Violations Found:		No				
Eval General Type:		Compliance Evaluation Inspection				
Eval Type:		Routine done by local agency				
Eval Division:		San Diego County Department of Env Health				
Eval Program:		HMRRP				
Eval Source:		CERS				
Eval Notes:						
Inspector: Tank HT202 Inspection ID:4977868; Note: data in [EVAL Notes] field for some records is truncated from the source.						
Eval Date:		06/13/2024				
Violations Found:		No				
Eval General Type:		Compliance Evaluation Inspection				
Eval Type:		Routine done by local agency				
Eval Division:		San Diego County Department of Env Health				
Eval Program:		UST				
Eval Source:		CERS				
Eval Notes:						
Inspector: Halsey Christopher Inspection ID:7397863; Note: data in [EVAL Notes] field for some records is truncated from the source.						
Eval Date:		06/24/2025				
Violations Found:		Yes				
Eval General Type:		Compliance Evaluation Inspection				
Eval Type:		Routine done by local agency				
Eval Division:		San Diego County Department of Env Health				
Eval Program:		UST				
Eval Source:		CERS				
Eval Notes:						
Inspector: Donoso Nereyda Inspection ID:7668521; Note: data in [EVAL Notes] field for some records is truncated from the source.						

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Eval Date:	06/30/2021
Violations Found:	Yes
Eval General Type:	Compliance Evaluation Inspection
Eval Type:	Routine done by local agency
Eval Division:	San Diego County Department of Env Health
Eval Program:	UST
Eval Source:	CERS
Eval Notes:	

Inspector: Fernandez Juan Inspection ID:6667849; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date:	06/21/2023
Violations Found:	No
Eval General Type:	Compliance Evaluation Inspection
Eval Type:	Routine done by local agency
Eval Division:	San Diego County Department of Env Health
Eval Program:	UST
Eval Source:	CERS
Eval Notes:	

Inspector: Halsey Christopher Inspection ID:7202785; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date:	06/24/2025
Violations Found:	No
Eval General Type:	Compliance Evaluation Inspection
Eval Type:	Routine done by local agency
Eval Division:	San Diego County Department of Env Health
Eval Program:	HW
Eval Source:	CERS
Eval Notes:	

Inspector: Donoso Nereyda Inspection ID:7668521; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date:	06/28/2017
Violations Found:	No
Eval General Type:	Compliance Evaluation Inspection
Eval Type:	Routine done by local agency
Eval Division:	San Diego County Department of Env Health
Eval Program:	HMRRP
Eval Source:	CERS
Eval Notes:	

Inspector: Beacon Ellen Inspection ID:5668063; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date:	06/02/2022
Violations Found:	Yes
Eval General Type:	Compliance Evaluation Inspection
Eval Type:	Routine done by local agency
Eval Division:	San Diego County Department of Env Health
Eval Program:	HMRRP
Eval Source:	CERS
Eval Notes:	

Inspector: Halsey Christopher Inspection ID:6944856; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date:	06/11/2020
Violations Found:	No
Eval General Type:	Other/Unknown
Eval Type:	Other, not routine, done by local agency
Eval Division:	San Diego County Department of Env Health
Eval Program:	UST
Eval Source:	CERS
Eval Notes:	

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

"No On-site Inspection" Inspector: Fernandez Juan Inspection ID:6443608; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date: 06/21/2018
Violations Found: No
Eval General Type: Compliance Evaluation Inspection
Eval Type: Routine done by local agency
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS
Eval Notes:

Inspector: Fernandez Juan Inspection ID:5914775; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date: 06/21/2018
Violations Found: No
Eval General Type: Compliance Evaluation Inspection
Eval Type: Routine done by local agency
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS
Eval Notes:

Inspector: Fernandez Juan Inspection ID:5914775; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date: 06/02/2022
Violations Found: No
Eval General Type: Compliance Evaluation Inspection
Eval Type: Routine done by local agency
Eval Division: San Diego County Department of Env Health
Eval Program: UST
Eval Source: CERS
Eval Notes:

Inspector: Halsey Christopher Inspection ID:6944856; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date: 07/08/2014
Violations Found: No
Eval General Type: Compliance Evaluation Inspection
Eval Type: Routine done by local agency
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS
Eval Notes:

Inspector: Tank HT202 Inspection ID:4977868; Note: data in [EVAL Notes] field for some records is truncated from the source.

Affiliations

Affil Type Desc: Identification Signer
Entity Name: Tim Kjonggaard
Entity Title: President
Address:
City:
State:
Country:
Zip Code:
Phone:

Affil Type Desc: UST Tank Operator
Entity Name: Stars Petroleum Inc.
Entity Title:
Address: 1910 Main St.
City: Ramona

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
State:		CA				
Country:		United States				
Zip Code:		92065				
Phone:		(760) 788-7800				
Affil Type Desc:		Property Owner				
Entity Name:		STARS PETRO				
Entity Title:						
Address:		1910 MAIN ST				
City:		RAMONA				
State:						
Country:						
Zip Code:						
Phone:						
Affil Type Desc:		UST PO Name				
Entity Name:		STARS PETRO				
Entity Title:						
Address:		1910 MAIN ST				
City:		RAMONA				
State:						
Country:						
Zip Code:						
Phone:						
Affil Type Desc:		CUPA District				
Entity Name:		San Diego County Env Health Qlty				
Entity Title:						
Address:		PO Box 129261				
City:		San Diego				
State:		CA				
Country:						
Zip Code:		92112-9261				
Phone:		(858) 505-6880				
Affil Type Desc:		Environmental Contact				
Entity Name:		Tim Kjonegaard				
Entity Title:						
Address:		1910 MAIN ST				
City:		RAMONA				
State:		CA				
Country:						
Zip Code:		92065				
Phone:						
Affil Type Desc:		UST Property Owner Name				
Entity Name:		Stars Petroleum Inc.				
Entity Title:						
Address:		1910 Main St.				
City:		Ramona				
State:		CA				
Country:		United States				
Zip Code:		92065				
Phone:		(760) 788-7800				
Affil Type Desc:		UST Permit Applicant				
Entity Name:		TIM KJONEGAARD				
Entity Title:		President				
Address:						
City:						
State:						
Country:						
Zip Code:						
Phone:		(760) 788-7800				
Affil Type Desc:		UST Tank Owner				
Entity Name:		Stars Petroleum Inc.				
Entity Title:						
Address:		1910 Main St.				

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
City: State: Country: Zip Code: Phone:					Ramona CA United States 92065 (760) 788-7800	
Affil Type Desc: Entity Name: Entity Title: Address: City: State: Country: Zip Code: Phone:					Environmental Contact TIM KJONEGAARD 1910 MAIN ST RAMONA	
Affil Type Desc: Entity Name: Entity Title: Address: City: State: Country: Zip Code: Phone:					Property Owner STARS PETROLEUM INC 1910 MAIN ST RAMONA CA United States 92065 (760) 788-7800	
Affil Type Desc: Entity Name: Entity Title: Address: City: State: Country: Zip Code: Phone:					Facility Mailing Address Mailing Address 1910 MAIN ST RAMONA CA 92065	
Affil Type Desc: Entity Name: Entity Title: Address: City: State: Country: Zip Code: Phone:					Legal Owner Tim Kjonegaard 1910 Main Street Ramona CA United States 92065 (760) 788-7800	
Affil Type Desc: Entity Name: Entity Title: Address: City: State: Country: Zip Code: Phone:					Operator Tim Kjonegaard (760) 788-7800	
Affil Type Desc: Entity Name: Entity Title: Address: City: State: Country: Zip Code: Phone:					Parent Corporation STARS PETROLEUM INC 	

Coordinates

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Env Int Type Code:		HWG			Longitude:	-116.882830
Program ID:		10375228			Coord Name:	
Latitude:		33.033370			Ref Point Type Desc:	Center of a facility or station.
10	2 of14	ENE	0.12 / 656.72	1,418.40 / 1	RAMONA DAY & NITE MOBIL 1910 MAIN ST RAMONA CA 92065	DELISTED TNK
<u>Delisted Storage Tanks</u>						
Facility ID:		H29206			County:	San Diego
Latitude:		33.03337			Original Source:	UST
Longitude:		-116.88282			Record Date:	30-JAN-2017
Permitting Agency:		SAN DIEGO COUNTY				
10	3 of14	ENE	0.12 / 656.72	1,418.40 / 1	STARS PETROLEUM INC 1910 MAIN ST RAMONA CA 92065	EMISSIONS
<u>2004 Criteria Data</u>						
Facility ID:		88156			CERR Code:	
Facility SIC Code:		5541			TOGT:	3.64
CO:		37			ROGT:	3.64
Air Basin:		SD			COT:	
District:		SD			NOXT:	
COID:		SD			SOXT:	
DISN:		SAN DIEGO COUNTY APCD			PMT:	
CHAPIS:					PM10T:	
<u>2004 Toxic Data</u>						
Facility ID:		88156			COID:	SD
Facility SIC Code:		5541			DISN:	SAN DIEGO COUNTY APCD
CO:		37			CHAPIS:	
Air Basin:		SD			CERR Code:	
District:		SD				
TS:						
Health Risk Asmt:						
Non-Cancer Chronic Haz Ind:						
Non-Cancer Acute Haz Ind:						
<u>2005 Criteria Data</u>						
Facility ID:		88156			CERR Code:	
Facility SIC Code:		5541			TOGT:	3.64
CO:		37			ROGT:	3.64
Air Basin:		SD			COT:	
District:		SD			NOXT:	
COID:		SD			SOXT:	
DISN:		SAN DIEGO COUNTY APCD			PMT:	
CHAPIS:					PM10T:	
<u>2005 Toxic Data</u>						
Facility ID:		88156			COID:	SD
Facility SIC Code:		5541			DISN:	SAN DIEGO COUNTY APCD
CO:		37			CHAPIS:	
Air Basin:		SD			CERR Code:	

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
District:	SD					
TS:						
Health Risk Asmt:						
Non-Cancer Chronic Haz Ind:						
Non-Cancer Acute Haz Ind:						
<u>2006 Criteria Data</u>						
Facility ID:	88156				CERR Code:	
Facility SIC Code:	5541				TOGT:	3.64
CO:	37				ROGT:	3.64
Air Basin:	SD				COT:	
District:	SD				NOXT:	
COID:	SD				SOXT:	
DISN:	SAN DIEGO COUNTY APCD				PMT:	
CHAPIS:					PM10T:	
<u>2006 Toxic Data</u>						
Facility ID:	88156				COID:	SD
Facility SIC Code:	5541				DISN:	SAN DIEGO COUNTY APCD
CO:	37				CHAPIS:	
Air Basin:	SD				CERR Code:	
District:	SD					
TS:						
Health Risk Asmt:						
Non-Cancer Chronic Haz Ind:						
Non-Cancer Acute Haz Ind:						
<u>2007 Criteria Data</u>						
Facility ID:	88156				CERR Code:	
Facility SIC Code:	5541				TOGT:	3.64
CO:	37				ROGT:	3.64
Air Basin:	SD				COT:	
District:	SD				NOXT:	
COID:	SD				SOXT:	
DISN:	SAN DIEGO COUNTY APCD				PMT:	
CHAPIS:					PM10T:	
<u>2007 Toxic Data</u>						
Facility ID:	88156				COID:	SD
Facility SIC Code:	5541				DISN:	SAN DIEGO COUNTY APCD
CO:	37				CHAPIS:	
Air Basin:	SD				CERR Code:	
District:	SD					
TS:						
Health Risk Asmt:						
Non-Cancer Chronic Haz Ind:						
Non-Cancer Acute Haz Ind:						
<u>2008 Criteria Data</u>						
Facility ID:	88156				CERR Code:	
Facility SIC Code:	5541				TOGT:	3.64
CO:	37				ROGT:	3.64
Air Basin:	SD				COT:	
District:	SD				NOXT:	
COID:	SD				SOXT:	
DISN:	SAN DIEGO COUNTY APCD				PMT:	
CHAPIS:					PM10T:	

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
<u>2008 Toxic Data</u>						
Facility ID:	88156			COID:	SD	
Facility SIC Code:	5541			DISN:	SAN DIEGO COUNTY APCD	
CO:	37			CHAPIS:		
Air Basin:	SD			CERR Code:		
District:	SD					
TS:						
Health Risk Asmt:						
Non-Cancer Chronic Haz Ind:						
Non-Cancer Acute Haz Ind:						
<u>2009 Criteria Data</u>						
Facility ID:	88156			CERR Code:		
Facility SIC Code:	5541			TOGT:	3.64	
CO:	37			ROGT:	3.64	
Air Basin:	SD			COT:		
District:	SD			NOXT:		
COID:	SD			SOXT:		
DISN:	SAN DIEGO COUNTY APCD			PMT:		
CHAPIS:				PM10T:		
<u>2009 Toxic Data</u>						
Facility ID:	88156			COID:	SD	
Facility SIC Code:	5541			DISN:	SAN DIEGO COUNTY APCD	
CO:	37			CHAPIS:		
Air Basin:	SD			CERR Code:		
District:	SD					
TS:						
Health Risk Asmt:						
Non-Cancer Chronic Haz Ind:						
Non-Cancer Acute Haz Ind:						
<u>2010 Toxic Data</u>						
Facility ID:	88156			COID:	SD	
Facility SIC Code:	5541			DISN:	SAN DIEGO COUNTY APCD	
CO:	37			CHAPIS:		
Air Basin:	SD			CERR Code:		
District:	SD					
TS:						
Health Risk Asmt:						
Non-Cancer Chronic Haz Ind:						
Non-Cancer Acute Haz Ind:						
<u>2011 Criteria Data</u>						
Facility ID:	88156			CERR Code:		
Facility SIC Code:	5541			TOGT:	3.64	
CO:	37			ROGT:	3.64	
Air Basin:	SD			COT:		
District:	SD			NOXT:		
COID:	SD			SOXT:		
DISN:	SAN DIEGO COUNTY APCD			PMT:		
CHAPIS:				PM10T:		
<u>2011 Toxic Data</u>						
Facility ID:	88156			COID:	SD	
Facility SIC Code:	5541			DISN:	SAN DIEGO COUNTY APCD	

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
CO:	37				CHAPIS:	
Air Basin:	SD				CERR Code:	
District:	SD					
TS:						
Health Risk Asmt:						
Non-Cancer Chronic Haz Ind:						
Non-Cancer Acute Haz Ind:						
<u>2012 Criteria Data</u>						
Facility ID:	88156				CERR Code:	
Facility SIC Code:	5541				TOGT:	3.64
CO:	37				ROGT:	3.64
Air Basin:	SD				COT:	
District:	SD				NOXT:	
COID:	SD				SOXT:	
DISN:	SAN DIEGO COUNTY APCD				PMT:	
CHAPIS:					PM10T:	
<u>2012 Toxic Data</u>						
Facility ID:	88156				COID:	SD
Facility SIC Code:	5541				DISN:	SAN DIEGO COUNTY APCD
CO:	37				CHAPIS:	
Air Basin:	SD				CERR Code:	
District:	SD					
TS:						
Health Risk Asmt:						
Non-Cancer Chronic Haz Ind:						
Non-Cancer Acute Haz Ind:						
<u>2013 Criteria Data</u>						
Facility ID:	88156				CERR Code:	
Facility SIC Code:	5541				TOGT:	3.64
CO:	37				ROGT:	3.64
Air Basin:	SD				COT:	
District:	SD				NOXT:	
COID:	SD				SOXT:	
DISN:	SAN DIEGO COUNTY APCD				PMT:	
CHAPIS:					PM10T:	
<u>2013 Toxic Data</u>						
Facility ID:	88156				COID:	SD
Facility SIC Code:	5541				DISN:	SAN DIEGO COUNTY APCD
CO:	37				CHAPIS:	
Air Basin:	SD				CERR Code:	
District:	SD					
TS:						
Health Risk Asmt:						
Non-Cancer Chronic Haz Ind:						
Non-Cancer Acute Haz Ind:						
<u>2014 Criteria Data</u>						
Facility ID:	88156				CERR Code:	
Facility SIC Code:	5541				TOGT:	3.64
CO:	37				ROGT:	3.64
Air Basin:	SD				COT:	
District:	SD				NOXT:	
COID:	SD				SOXT:	
DISN:	SAN DIEGO COUNTY APCD				PMT:	

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
CHAPIS:				PM10T:		
<u>2014 Toxic Data</u>						
Facility ID:	88156			COID:	SD	
Facility SIC Code:	5541			DISN:	SAN DIEGO COUNTY APCD	
CO:	37			CHAPIS:		
Air Basin:	SD			CERR Code:		
District:	SD					
TS:						
Health Risk Asmt:						
Non-Cancer Chronic Haz Ind:						
Non-Cancer Acute Haz Ind:						
<u>2015 Criteria Data</u>						
Facility ID:	88156			CERR Code:		
Facility SIC Code:	5541			TOGT:	3.64	
CO:	37			ROGT:	3.64	
Air Basin:	SD			COT:		
District:	SD			NOXT:		
COID:	SD			SOXT:		
DISN:	SAN DIEGO COUNTY APCD			PMT:		
CHAPIS:				PM10T:		
<u>2015 Toxic Data</u>						
Facility ID:	88156			COID:	SD	
Facility SIC Code:	5541			DISN:	SAN DIEGO COUNTY APCD	
CO:	37			CHAPIS:		
Air Basin:	SD			CERR Code:		
District:	SD					
TS:						
Health Risk Asmt:						
Non-Cancer Chronic Haz Ind:						
Non-Cancer Acute Haz Ind:						
<u>2016 Criteria Data</u>						
Facility ID:	88156			CERR CODE:		
Facility SIC Code:	5541			TOGT:	3.64	
CO:	37			ROGT:	3.64	
Air Basin:	SD			COT:		
District:	SD			NOXT:		
COID:	SD			SOXT:		
DISN:	SAN DIEGO COUNTY APCD			PMT:		
CHAPIS:				PM10T:		
<u>2016 Toxic Data</u>						
Facility ID:	88156			TS:		
Facility SIC Code:	5541			HRA:		
CERR CODE:				CH Index:		
COID:	SD			AH Index:		
CO:	37			Air Basin:	SD	
DISN:	SAN DIEGO COUNTY APCD			District:	SD	
CHAPIS:						
<u>2017 Criteria Data</u>						
Facility ID:	88156			CERR Code:		
Facility SIC Code:	5541			TOGT:	3.64	

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
CO:	37				ROGT:	3.64
Air Basin:	SD				COT:	
District:	SD				NOXT:	
COID:	SD				SOXT:	
DISN:	SAN DIEGO COUNTY APCD				PMT:	
CHAPIS:					PM10T:	
<u>2017 Toxic Data</u>						
Facility ID:	88156				COID:	SD
Facility SIC Code:	5541				DISN:	SAN DIEGO COUNTY APCD
CO:	37				CHAPIS:	
Air Basin:	SD				CERR Code:	
District:	SD					
TS:						
Health Risk Asmt:						
Non-Cancer Chronic Haz Ind:						
Non-Cancer Acute Haz Ind:						
<u>2018 Criteria Data</u>						
Facility ID:	88156				CERR Code:	
Facility SIC Code:	5541				TOGT:	3.64
CO:	37				ROGT:	3.64
Air Basin:	SD				COT:	
District:	SD				NOXT:	
COID:	SD				SOXT:	
DISN:	SAN DIEGO COUNTY APCD				PMT:	
CHAPIS:					PM10T:	
<u>2018 Toxic Data</u>						
Facility ID:	88156				COID:	SD
Facility SIC Code:	5541				DISN:	SAN DIEGO COUNTY APCD
CO:	37				CHAPIS:	
Air Basin:	SD				CERR Code:	
District:	SD					
TS:						
Health Risk Asmt:						
Non-Cancer Chronic Haz Ind:						
Non-Cancer Acute Haz Ind:						
<u>2019 Criteria Data</u>						
CO:	37				CHAPIS:	
Air Basin:	SD				CERR Code:	
Facility ID:	88156				ROGT:	3.64
District:	SD				COT:	
Facility SIC Code:	5541				NOXT:	
CO ID:	SD				SOXT:	
DISN:	SAN DIEGO COUNTY APCD					
PM10T:						
TOGT:		3.64				
PMT:						
<u>2019 Toxic Data</u>						
CO:	37				DISN:	SAN DIEGO COUNTY APCD
Air Basin:	SD				CHAPIS:	
Facility ID:	88156				CERR Code:	
District:	SD				TS:	
Facility SIC Code:	5541				Health Risk Asmt:	
COID:	SD					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Non-Cancer Chronic Haz Ind:						
Non-Cancer Acute Haz Ind:						

10	4 of 14	ENE	0.12 / 656.72	1,418.40 / 1	GVS SYSTEMSRAMONA DAY N NIT 1910 MAIN ST RAMONA CA 92065	EMISSIONS

2003 Criteria Data

Facility ID:	88156	CERR Code:	
Facility SIC Code:	5541	TOGT:	3.4491898
CO:	37	ROGT:	3.4491898
Air Basin:	SD	COT:	
District:	SD	NOXT:	
COID:	SD	SOXT:	
DISN:	SAN DIEGO COUNTY APCD	PMT:	
CHAPIS:		PM10T:	

2003 Toxic Data

Facility ID:	88156	COID:	SD
Facility SIC Code:	5541	DISN:	SAN DIEGO COUNTY APCD
CO:	37	CHAPIS:	
Air Basin:	SD	CERR Code:	
District:	SD		
TS:			
Health Risk Asmt:			
Non-Cancer Chronic Haz Ind:			
Non-Cancer Acute Haz Ind:			

10	5 of 14	ENE	0.12 / 656.72	1,418.40 / 1	GVS SYSTEMS / RAMONA DAY N NIT 1910 MAIN ST RAMONA CA 92065	EMISSIONS

1999 Criteria Data

Facility ID:	88156	CERR Code:	
Facility SIC Code:	5541	TOGT:	3.3480804
CO:	37	ROGT:	3.3480804
Air Basin:	SD	COT:	
District:	SD	NOXT:	
COID:	SD	SOXT:	
DISN:	SAN DIEGO COUNTY APCD	PMT:	
CHAPIS:		PM10T:	

1999 Toxic Data

Facility ID:	88156	COID:	SD
Facility SIC Code:	5541	DISN:	SAN DIEGO COUNTY APCD
CO:	37	CHAPIS:	
Air Basin:	SD	CERR Code:	
District:	SD		
TS:			
Health Risk Asmt:			
Non-Cancer Chronic Haz Ind:			
Non-Cancer Acute Haz Ind:			

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

2000 Criteria Data

Facility ID:	88156				CERR Code:	
Facility SIC Code:	5541				TOGT:	3.4491898
CO:	37				ROGT:	3.4491898
Air Basin:	SD				COT:	
District:	SD				NOXT:	
COID:	SD				SOXT:	
DISN:	SAN DIEGO COUNTY APCD				PMT:	
CHAPIS:					PM10T:	

2000 Toxic Data

Facility ID:	88156				COID:	SD
Facility SIC Code:	5541				DISN:	SAN DIEGO COUNTY APCD
CO:	37				CHAPIS:	
Air Basin:	SD				CERR Code:	
District:	SD					
TS:						
Health Risk Asmt:						
Non-Cancer Chronic Haz Ind:						
Non-Cancer Acute Haz Ind:						

2001 Criteria Data

Facility ID:	88156				CERR Code:	
Facility SIC Code:	5541				TOGT:	3.45
CO:	37				ROGT:	3.45
Air Basin:	SD				COT:	
District:	SD				NOXT:	
COID:	SD				SOXT:	
DISN:	SAN DIEGO COUNTY APCD				PMT:	
CHAPIS:					PM10T:	

2001 Toxic Data

Facility ID:	88156				COID:	SD
Facility SIC Code:	5541				DISN:	SAN DIEGO COUNTY APCD
CO:	37				CHAPIS:	
Air Basin:	SD				CERR Code:	
District:	SD					
TS:						
Health Risk Asmt:						
Non-Cancer Chronic Haz Ind:						
Non-Cancer Acute Haz Ind:						

2002 Criteria Data

Facility ID:	88156				CERR Code:	
Facility SIC Code:	5541				TOGT:	3.4491898
CO:	37				ROGT:	3.4491898
Air Basin:	SD				COT:	
District:	SD				NOXT:	
COID:	SD				SOXT:	
DISN:	SAN DIEGO COUNTY APCD				PMT:	
CHAPIS:					PM10T:	

2002 Toxic Data

Facility ID:	88156				COID:	SD
Facility SIC Code:	5541				DISN:	SAN DIEGO COUNTY APCD
CO:	37				CHAPIS:	
Air Basin:	SD				CERR Code:	

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
District: SD TS: Health Risk Asmt: Non-Cancer Chronic Haz Ind: Non-Cancer Acute Haz Ind:						
10	6 of 14	ENE	0.12 / 656.72	1,418.40 / 1	RAMONA DAY & NITE MOBIL 1910 MAIN ST RAMONA CA	HAZ SANDIEGO
Record ID: DEH2002-HUPFP-129206 Facility Name: RAMONA DAY & NITE MOBIL Facility Address: 1910 MAIN ST, RAMONA, CA 92065 Facility City: RAMONA Facility Zip Code: 0 Facility Latitude: 33.033272472629584 Facility Longitude: -116.88298324059994 GIS Record ID: GIS Facility Name: GIS Facility Address: GIS Facility City: GIS Facility Zip Code: GIS Fac Latitude: GIS Fac Longitude: Tank Owner Name:						
HMD Inactive Permits Map Data						
Facilityid: Cers ID: Featureid: 0 Site Address: Street String: 1910 MAIN ST Point X: 6367671.51617 Point Y: 1956321.92264 X Mapcoord: 0 Y Mapcoord: 0 Record Type: LUEG-DEH/HMD/UPFP/Facility Record Alias: Unified Program Facility Permit Record Status: Completed Business Type: UST - Retail Site - No Repair Service Geo Src: Mapped to record address Tot Above Ground Petroleum Cap: 0 Rmp Calarp Level: Lrg Qty Mvgenerator: Own Operate Usts: Tot Num Usts: 3 Own Operate Apsa Tank: N Num Tanks 10kgal or Greater: Hazwaste Generator: Yes On Site Haz Waste Treatment: Rcra Lrg Qty Generator: Kivapertype Pernum: HK07 129206						
Latitude WGS84: 0 Longitude WGS84: 0 Ust Facilitytype: Agencyname: COSD Opened Date Dt: 2002-05-04 00:00:00 UTC Creator: Created Dt: 1970-01-01 00:00:00 UTC Editor: Edited Dt: 1970-01-01 00:00:00 UTC Parcel No: 282-222-08-00						
10	7 of 14	ENE	0.12 / 656.72	1,418.40 / 1	STARS PETROLEUM INC 1910 MAIN ST RAMONA CA 92065	HAZ SANDIEGO
Record ID: DEH2003-HUPFP-201678 Facility Name: STARS PETROLEUM INC Facility Address: 1910 MAIN ST RAMONA, CA 92065 Facility City: RAMONA Facility Zip Code: 92065 Facility Latitude: 33.03304658598331 Facility Longitude: -116.88263894845304						

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
GIS Record ID:		DEH2003-HUPFP-201678				
GIS Facility Name:		STARS PETROLEUM INC				
GIS Facility Address:		1910 MAIN ST				
GIS Facility City:		RAMONA				
GIS Facility Zip Code:		92065				
GIS Fac Latitude:		-117.14643072033888				
GIS Fac Longitude:		32.69897149373432				
Tank Owner Name:						

Hazardous Materials Facility Data

CERS ID:	10375228	Haz Mat on Site:	true
Facility ID No:	37-000-201678	Haz Waste Generatr:	true
EPA ID No:	CAL000306036	Own/Oper Under:	true
Active Permit:	true	Own/Oper Above:	false
Permit Status:	Permit Renewed	Recycle:	false
Bus Phone:	760-788-7800	RCRA Large Qty Gen:	false
Bus Fax:	7607887809	HHW Collection:	false
Last Updated:	09/07/2023 01:52:48 AM		
Mailing Address:	1910 MAIN ST, RAMONA, CA 92065		
Onsite H Waste Treatment:	false		
New Georeferenced Column:	(32.69897149373432, -117.14643072033888)		

Hazardous Waste and Materials

ID:	33454	Permit Status:	Permit Renewed
Child Record ID:	DEH2016-HCHEM-0091407	Active Permit:	true
CAS No:	68476-34-6	Haz Material Type:	Pure
Last Updated:	04/28/2016 02:30:51 AM	Trade Secret:	false
Chemical Name:	DIESEL FUEL		
Common Name Inventory:	UNDERGROUND TANK 129206 T004		
ID:	91649	Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HCHEM-0135497	Active Permit:	true
CAS No:	68476-34-6	Haz Material Type:	Pure
Last Updated:	04/28/2018 02:32:04 AM	Trade Secret:	false
Chemical Name:	DIESEL FUEL		
Common Name Inventory:	UNDERGROUND TANK 129206 T004		
ID:	167792	Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HCHEM-0186774	Active Permit:	true
CAS No:	68476-34-6	Haz Material Type:	Pure
Last Updated:	10/25/2018 01:52:56 PM	Trade Secret:	false
Chemical Name:	DIESEL FUEL		
Common Name Inventory:	UNDERGROUND TANK 129206 T004		
ID:	222343	Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HCHEM-0215387	Active Permit:	true
CAS No:	68476-34-6	Haz Material Type:	Pure
Last Updated:	04/02/2019 10:32:53 AM	Trade Secret:	false
Chemical Name:	DIESEL FUEL		
Common Name Inventory:	UNDERGROUND TANK 129206 T004		
ID:	238757	Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HCHEM-0223990	Active Permit:	true
CAS No:	68476-34-6	Haz Material Type:	Pure
Last Updated:	06/21/2019 02:41:50 AM	Trade Secret:	false
Chemical Name:	DIESEL FUEL		
Common Name Inventory:	UNDERGROUND TANK 129206 T004		
ID:	271913	Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HCHEM-0246941	Active Permit:	true
CAS No:	68476-34-6	Haz Material Type:	Pure
Last Updated:	04/24/2020 02:40:29 AM	Trade Secret:	false
Chemical Name:	DIESEL FUEL		
Common Name Inventory:	UNDERGROUND TANK 129206 T004		

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
ID:	318495				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HCHEM-0267115				Active Permit:	true
CAS No:	68476-34-6				Haz Material Type:	Pure
Last Updated:	06/17/2020 01:57:58 AM				Trade Secret:	false
Chemical Name:	DIESEL FUEL					
Common Name Inventory:	UNDERGROUND TANK 129206 T004					
ID:	384925				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HCHEM-0286431				Active Permit:	true
CAS No:	68476-34-6				Haz Material Type:	Pure
Last Updated:	07/02/2021 02:58:11 AM				Trade Secret:	false
Chemical Name:	Diesel Fuel					
Common Name Inventory:	Underground Tank 129206 T004					
ID:	487377				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HCHEM-0327482				Active Permit:	true
CAS No:	68476-34-6				Haz Material Type:	Pure
Last Updated:	09/15/2022 02:52:55 AM				Trade Secret:	false
Chemical Name:	Diesel Fuel					
Common Name Inventory:	Underground Tank 129206 T004					
ID:	533789				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HCHEM-0350958				Active Permit:	true
CAS No:	68476-34-6				Haz Material Type:	Pure
Last Updated:	01/04/2023 01:13:56 AM				Trade Secret:	false
Chemical Name:	Diesel Fuel					
Common Name Inventory:	Underground Tank 129206 T004					
ID:	573399				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HCHEM-0368497				Active Permit:	true
CAS No:	68476-34-6				Haz Material Type:	Pure
Last Updated:	06/22/2023 02:25:22 AM				Trade Secret:	false
Chemical Name:	Diesel Fuel					
Common Name Inventory:	Underground Tank 129206 T004					
ID:	601963				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HCHEM-0380536				Active Permit:	true
CAS No:	68476-34-6				Haz Material Type:	Pure
Last Updated:	09/07/2023 01:52:49 AM				Trade Secret:	false
Chemical Name:	Diesel Fuel					
Common Name Inventory:	Underground Tank 129206 T004					
ID:	33452				Permit Status:	Permit Renewed
Child Record ID:	DEH2016-HCHEM-0091405				Active Permit:	true
CAS No:	8006-61-9				Haz Material Type:	Pure
Last Updated:	04/28/2016 02:30:51 AM				Trade Secret:	false
Chemical Name:	PREMIUM UNLEADED					
Common Name Inventory:	UNDERGROUND TANK 129206 T003					
ID:	91647				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HCHEM-0135495				Active Permit:	true
CAS No:	8006-61-9				Haz Material Type:	Pure
Last Updated:	04/28/2018 02:32:04 AM				Trade Secret:	false
Chemical Name:	PREMIUM UNLEADED					
Common Name Inventory:	UNDERGROUND TANK 129206 T003					
ID:	167790				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HCHEM-0186772				Active Permit:	true
CAS No:	8006-61-9				Haz Material Type:	Pure
Last Updated:	10/25/2018 01:52:56 PM				Trade Secret:	false
Chemical Name:	PREMIUM UNLEADED					
Common Name Inventory:	UNDERGROUND TANK 129206 T003					
ID:	222341				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HCHEM-0215385				Active Permit:	true
CAS No:	8006-61-9				Haz Material Type:	Pure
Last Updated:	04/02/2019 10:32:53 AM				Trade Secret:	false
Chemical Name:	PREMIUM UNLEADED					
Common Name Inventory:	UNDERGROUND TANK 129206 T003					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
ID:	238755				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HCHEM-0223988				Active Permit:	true
CAS No:	8006-61-9				Haz Material Type:	Pure
Last Updated:	06/21/2019 02:41:50 AM				Trade Secret:	false
Chemical Name:	PREMIUM UNLEADED					
Common Name Inventory:	UNDERGROUND TANK 129206 T003					
ID:	271911				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HCHEM-0246939				Active Permit:	true
CAS No:	8006-61-9				Haz Material Type:	Pure
Last Updated:	04/24/2020 02:40:29 AM				Trade Secret:	false
Chemical Name:	PREMIUM UNLEADED					
Common Name Inventory:	UNDERGROUND TANK 129206 T003					
ID:	318469				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HCHEM-0267113				Active Permit:	true
CAS No:	8006-61-9				Haz Material Type:	Pure
Last Updated:	06/17/2020 01:57:58 AM				Trade Secret:	false
Chemical Name:	PREMIUM UNLEADED					
Common Name Inventory:	UNDERGROUND TANK 129206 T003					
ID:	601965				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HCHEM-0380538				Active Permit:	true
CAS No:	74-98-6				Haz Material Type:	Pure
Last Updated:	09/07/2023 01:52:49 AM				Trade Secret:	false
Chemical Name:	Propane					
Common Name Inventory:	Propane					
ID:	33451				Permit Status:	Permit Renewed
Child Record ID:	DEH2016-HCHEM-0091404				Active Permit:	true
CAS No:					Haz Material Type:	Pure
Last Updated:	04/28/2016 02:30:51 AM				Trade Secret:	false
Chemical Name:	REGULAR LEADED					
Common Name Inventory:	RACING FUEL					
ID:	91646				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HCHEM-0135494				Active Permit:	true
CAS No:					Haz Material Type:	Pure
Last Updated:	04/28/2018 02:32:04 AM				Trade Secret:	false
Chemical Name:	REGULAR LEADED					
Common Name Inventory:	RACING FUEL					
ID:	167789				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HCHEM-0186771				Active Permit:	true
CAS No:					Haz Material Type:	Pure
Last Updated:	10/25/2018 01:52:56 PM				Trade Secret:	false
Chemical Name:	REGULAR LEADED					
Common Name Inventory:	RACING FUEL					
ID:	222340				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HCHEM-0215384				Active Permit:	true
CAS No:					Haz Material Type:	Pure
Last Updated:	04/02/2019 10:32:53 AM				Trade Secret:	false
Chemical Name:	REGULAR LEADED					
Common Name Inventory:	RACING FUEL					
ID:	238754				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HCHEM-0223987				Active Permit:	true
CAS No:					Haz Material Type:	Pure
Last Updated:	06/21/2019 02:41:50 AM				Trade Secret:	false
Chemical Name:	REGULAR LEADED					
Common Name Inventory:	RACING FUEL					
ID:	271910				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HCHEM-0246938				Active Permit:	true
CAS No:					Haz Material Type:	Pure
Last Updated:	04/24/2020 02:40:29 AM				Trade Secret:	false
Chemical Name:	REGULAR LEADED					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Common Name Inventory:		RACING FUEL				
ID:	318468				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HCHEM-0267112				Active Permit:	true
CAS No:					Haz Material Type:	Pure
Last Updated:	06/17/2020 01:57:58 AM				Trade Secret:	false
Chemical Name:	REGULAR LEADED					
Common Name Inventory:	RACING FUEL					
ID:	384924				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HCHEM-0286430				Active Permit:	true
CAS No:					Haz Material Type:	Pure
Last Updated:	07/02/2021 02:58:11 AM				Trade Secret:	false
Chemical Name:	REGULAR LEADED					
Common Name Inventory:	RACING FUEL					
ID:	33450				Permit Status:	Permit Renewed
Child Record ID:	DEH2016-HCHEM-0091403				Active Permit:	true
CAS No:	8006-61-9				Haz Material Type:	Pure
Last Updated:	04/28/2016 02:30:51 AM				Trade Secret:	false
Chemical Name:	REGULAR UNLEADED					
Common Name Inventory:	UNDERGROUND TANK 129206 T001					
ID:	33453				Permit Status:	Permit Renewed
Child Record ID:	DEH2016-HCHEM-0091406				Active Permit:	true
CAS No:	8006-61-9				Haz Material Type:	Pure
Last Updated:	04/28/2016 02:30:51 AM				Trade Secret:	false
Chemical Name:	REGULAR UNLEADED					
Common Name Inventory:	UNDERGROUND TANK 129206 T002					
ID:	91648				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HCHEM-0135496				Active Permit:	true
CAS No:	8006-61-9				Haz Material Type:	Pure
Last Updated:	04/28/2018 02:32:04 AM				Trade Secret:	false
Chemical Name:	REGULAR UNLEADED					
Common Name Inventory:	UNDERGROUND TANK 129206 T002					
ID:	91645				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HCHEM-0135493				Active Permit:	true
CAS No:	8006-61-9				Haz Material Type:	Pure
Last Updated:	04/28/2018 02:32:04 AM				Trade Secret:	false
Chemical Name:	REGULAR UNLEADED					
Common Name Inventory:	UNDERGROUND TANK 129206 T001					
ID:	167791				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HCHEM-0186773				Active Permit:	true
CAS No:	8006-61-9				Haz Material Type:	Pure
Last Updated:	10/25/2018 01:52:56 PM				Trade Secret:	false
Chemical Name:	REGULAR UNLEADED					
Common Name Inventory:	UNDERGROUND TANK 129206 T002					
ID:	167788				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HCHEM-0186770				Active Permit:	true
CAS No:	8006-61-9				Haz Material Type:	Pure
Last Updated:	10/25/2018 01:52:56 PM				Trade Secret:	false
Chemical Name:	REGULAR UNLEADED					
Common Name Inventory:	UNDERGROUND TANK 129206 T001					
ID:	222342				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HCHEM-0215386				Active Permit:	true
CAS No:	8006-61-9				Haz Material Type:	Pure
Last Updated:	04/02/2019 10:32:53 AM				Trade Secret:	false
Chemical Name:	REGULAR UNLEADED					
Common Name Inventory:	UNDERGROUND TANK 129206 T002					
ID:	222339				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HCHEM-0215383				Active Permit:	true
CAS No:	8006-61-9				Haz Material Type:	Pure
Last Updated:	04/02/2019 10:32:53 AM				Trade Secret:	false

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Chemical Name:		REGULAR UNLEADED				
Common Name Inventory:		UNDERGROUND TANK 129206 T001				
ID:	238753			Permit Status:	Permit Renewed	
Child Record ID:	DEH2019-HCHEM-0223986			Active Permit:	true	
CAS No:	8006-61-9			Haz Material Type:	Pure	
Last Updated:	06/21/2019 02:41:50 AM			Trade Secret:	false	
Chemical Name:		REGULAR UNLEADED				
Common Name Inventory:		UNDERGROUND TANK 129206 T001				
ID:	238756			Permit Status:	Permit Renewed	
Child Record ID:	DEH2019-HCHEM-0223989			Active Permit:	true	
CAS No:	8006-61-9			Haz Material Type:	Pure	
Last Updated:	06/21/2019 02:41:50 AM			Trade Secret:	false	
Chemical Name:		REGULAR UNLEADED				
Common Name Inventory:		UNDERGROUND TANK 129206 T002				
ID:	271909			Permit Status:	Permit Renewed	
Child Record ID:	DEH2020-HCHEM-0246937			Active Permit:	true	
CAS No:	8006-61-9			Haz Material Type:	Pure	
Last Updated:	04/24/2020 02:40:29 AM			Trade Secret:	false	
Chemical Name:		REGULAR UNLEADED				
Common Name Inventory:		UNDERGROUND TANK 129206 T001				
ID:	271912			Permit Status:	Permit Renewed	
Child Record ID:	DEH2020-HCHEM-0246940			Active Permit:	true	
CAS No:	8006-61-9			Haz Material Type:	Pure	
Last Updated:	04/24/2020 02:40:29 AM			Trade Secret:	false	
Chemical Name:		REGULAR UNLEADED				
Common Name Inventory:		UNDERGROUND TANK 129206 T002				
ID:	318942			Permit Status:	Permit Renewed	
Child Record ID:	DEH2020-HCHEM-0267111			Active Permit:	true	
CAS No:	8006-61-9			Haz Material Type:	Pure	
Last Updated:	06/17/2020 01:57:58 AM			Trade Secret:	false	
Chemical Name:		REGULAR UNLEADED				
Common Name Inventory:		UNDERGROUND TANK 129206 T001				
ID:	318470			Permit Status:	Permit Renewed	
Child Record ID:	DEH2020-HCHEM-0267114			Active Permit:	true	
CAS No:	8006-61-9			Haz Material Type:	Pure	
Last Updated:	06/17/2020 01:57:58 AM			Trade Secret:	false	
Chemical Name:		REGULAR UNLEADED				
Common Name Inventory:		UNDERGROUND TANK 129206 T002				
ID:	487376			Permit Status:	Permit Renewed	
Child Record ID:	DEH2022-HCHEM-0327481			Active Permit:	true	
CAS No:				Haz Material Type:	Pure	
Last Updated:	09/15/2022 02:52:55 AM			Trade Secret:	false	
Chemical Name:		Regular Leaded				
Common Name Inventory:		Racing Fuel				
ID:	533788			Permit Status:	Permit Renewed	
Child Record ID:	DEH2023-HCHEM-0350957			Active Permit:	true	
CAS No:				Haz Material Type:	Pure	
Last Updated:	01/04/2023 01:13:56 AM			Trade Secret:	false	
Chemical Name:		Regular Leaded				
Common Name Inventory:		Racing Fuel				
ID:	573398			Permit Status:	Permit Renewed	
Child Record ID:	DEH2023-HCHEM-0368496			Active Permit:	true	
CAS No:				Haz Material Type:	Pure	
Last Updated:	06/22/2023 02:25:22 AM			Trade Secret:	false	
Chemical Name:		Regular Leaded				
Common Name Inventory:		Racing Fuel				
ID:	601962			Permit Status:	Permit Renewed	
Child Record ID:	DEH2023-HCHEM-0380535			Active Permit:	true	
CAS No:				Haz Material Type:	Pure	

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Last Updated:	09/07/2023 01:52:49 AM				Trade Secret:	false
Chemical Name:		Regular Leaded				
Common Name Inventory:		Racing Fuel				
ID:	533790				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HCHEM-0350959				Active Permit:	true
CAS No:					Haz Material Type:	Pure
Last Updated:	01/04/2023 01:13:56 AM				Trade Secret:	false
Chemical Name:		Ultra Clean Car Wash Detergent				
Common Name Inventory:		Ultra Clean Car Wash Detergent				
ID:	573400				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HCHEM-0368498				Active Permit:	true
CAS No:					Haz Material Type:	Pure
Last Updated:	06/22/2023 02:25:22 AM				Trade Secret:	false
Chemical Name:		Ultra Clean Car Wash Detergent				
Common Name Inventory:		Ultra Clean Car Wash Detergent				
ID:	601964				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HCHEM-0380537				Active Permit:	true
CAS No:					Haz Material Type:	Pure
Last Updated:	09/07/2023 01:52:49 AM				Trade Secret:	false
Chemical Name:		Ultra Clean Car Wash Detergent				
Common Name Inventory:		Ultra Clean Car Wash Detergent				
ID:	384923				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HCHEM-0286429				Active Permit:	true
CAS No:	8006-61-9				Haz Material Type:	Pure
Last Updated:	07/02/2021 02:58:11 AM				Trade Secret:	false
Chemical Name:		Unleaded Gasoline				
Common Name Inventory:		Underground Tank 129206 T001 T002 & T003				
ID:	487375				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HCHEM-0327480				Active Permit:	true
CAS No:	8006-61-9				Haz Material Type:	Pure
Last Updated:	09/15/2022 02:52:55 AM				Trade Secret:	false
Chemical Name:		Unleaded Gasoline				
Common Name Inventory:		Underground Tank 129206 T001 T002 & T003				
ID:	533787				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HCHEM-0350956				Active Permit:	true
CAS No:	8006-61-9				Haz Material Type:	Pure
Last Updated:	01/04/2023 01:13:56 AM				Trade Secret:	false
Chemical Name:		Unleaded Gasoline				
Common Name Inventory:		Underground Tank 129206 T001 T002 & T003				
ID:	573397				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HCHEM-0368495				Active Permit:	true
CAS No:	8006-61-9				Haz Material Type:	Pure
Last Updated:	06/22/2023 02:25:22 AM				Trade Secret:	false
Chemical Name:		Unleaded Gasoline				
Common Name Inventory:		Underground Tank 129206 T001 T002 & T003				
ID:	601961				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HCHEM-0380534				Active Permit:	true
CAS No:	8006-61-9				Haz Material Type:	Pure
Last Updated:	09/07/2023 01:52:49 AM				Trade Secret:	false
Chemical Name:		Unleaded Gasoline				
Common Name Inventory:		Underground Tank 129206 T001 T002 & T003				
ID:	33455				Permit Status:	Permit Renewed
Child Record ID:	DEH2016-HWAST-0073923				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	04/28/2016 02:30:51 AM				Trade Secret:	false
Chemical Name:		WASTE 134 AQUEOUS SOL'N W/LESS 10% ORG				
Common Name Inventory:		WATER WITH GASOLINE				
ID:	91650				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0113784				Active Permit:	true

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
CAS No:					Haz Material Type:	
Last Updated:	04/28/2018 02:32:04 AM				Trade Secret:	false
Chemical Name:		WASTE 134 AQUEOUS SOL'N W/LESS 10% ORG				
Common Name Inventory:		WATER WITH GASOLINE				
ID:	167793				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0161676				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/25/2018 01:52:56 PM				Trade Secret:	false
Chemical Name:		WASTE 134 AQUEOUS SOL'N W/LESS 10% ORG				
Common Name Inventory:		WATER WITH GASOLINE				
ID:	222344				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0185551				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	04/02/2019 10:32:53 AM				Trade Secret:	false
Chemical Name:		WASTE 134 AQUEOUS SOL'N W/LESS 10% ORG				
Common Name Inventory:		WATER WITH GASOLINE				
ID:	238758				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0193603				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	06/21/2019 02:41:50 AM				Trade Secret:	false
Chemical Name:		WASTE 134 AQUEOUS SOL'N W/LESS 10% ORG				
Common Name Inventory:		WATER WITH GASOLINE				
ID:	271914				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0217926				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	04/24/2020 02:40:29 AM				Trade Secret:	false
Chemical Name:		WASTE 134 AQUEOUS SOL'N W/LESS 10% ORG				
Common Name Inventory:		WATER WITH GASOLINE				
ID:	318943				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0237599				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	06/17/2020 01:57:59 AM				Trade Secret:	false
Chemical Name:		WASTE 134 AQUEOUS SOL'N W/LESS 10% ORG				
Common Name Inventory:		WATER WITH GASOLINE				
ID:	384926				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0255194				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	07/02/2021 02:58:11 AM				Trade Secret:	false
Chemical Name:		WASTE 134 AQUEOUS SOL'N W/LESS 10% ORG				
Common Name Inventory:		WATER WITH GASOLINE				
ID:	33456				Permit Status:	Permit Renewed
Child Record ID:	DEH2016-HWAST-0073924				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	04/28/2016 02:30:51 AM				Trade Secret:	false
Chemical Name:		WASTE 352 ORGANIC SOLIDS (OTHER)-				
Common Name Inventory:		GASOLINE FUEL FILTERS				
ID:	91651				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0113785				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	04/28/2018 02:32:04 AM				Trade Secret:	false
Chemical Name:		WASTE 352 ORGANIC SOLIDS (OTHER)-				
Common Name Inventory:		GASOLINE FUEL FILTERS				
ID:	167794				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0161677				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/25/2018 01:52:56 PM				Trade Secret:	false
Chemical Name:		WASTE 352 ORGANIC SOLIDS (OTHER)-				
Common Name Inventory:		GASOLINE FUEL FILTERS Used Absorbent				
ID:	222345				Permit Status:	Permit Renewed

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Child Record ID:	DEH2019-HWAST-0185552				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	04/02/2019 10:32:53 AM				Trade Secret:	false
Chemical Name:	WASTE 352 ORGANIC SOLIDS (OTHER)-					
Common Name Inventory:	GASOLINE FUEL FILTERS Used Absorbent					
ID:	238759				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0193604				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	06/21/2019 02:41:50 AM				Trade Secret:	false
Chemical Name:	WASTE 352 ORGANIC SOLIDS (OTHER)-					
Common Name Inventory:	GASOLINE FUEL FILTERS Used Absorbent					
ID:	271915				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0217927				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	04/24/2020 02:40:29 AM				Trade Secret:	false
Chemical Name:	WASTE 352 ORGANIC SOLIDS (OTHER)-					
Common Name Inventory:	GASOLINE FUEL FILTERS Used Absorbent					
ID:	318496				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0237600				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	06/17/2020 01:57:59 AM				Trade Secret:	false
Chemical Name:	WASTE 352 ORGANIC SOLIDS (OTHER)-					
Common Name Inventory:	GASOLINE FUEL FILTERS Used Absorbent					
ID:	384927				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0255195				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	07/02/2021 02:58:11 AM				Trade Secret:	false
Chemical Name:	WASTE 352 ORGANIC SOLIDS (OTHER)-					
Common Name Inventory:	GASOLINE FUEL FILTERS Used Absorbent					
ID:	487378				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HWAST-0294294				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	09/15/2022 02:52:55 AM				Trade Secret:	false
Chemical Name:	Waste 134 Aqueous Sol'n w/Less 10% Organic					
Common Name Inventory:	Water w/ Gasoline					
ID:	533791				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0318862				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	01/04/2023 01:13:56 AM				Trade Secret:	false
Chemical Name:	Waste 134 Aqueous Sol'n w/Less 10% Organic					
Common Name Inventory:	Water w/ Gasoline					
ID:	573401				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0337218				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	06/22/2023 02:25:22 AM				Trade Secret:	false
Chemical Name:	Waste 134 Aqueous Sol'n w/Less 10% Organic					
Common Name Inventory:	Water w/ Gasoline					
ID:	601966				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0349186				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	09/07/2023 01:52:49 AM				Trade Secret:	false
Chemical Name:	Waste 134 Aqueous Sol'n w/Less 10% Organic					
Common Name Inventory:	Water w/ Gasoline					
ID:	487379				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HWAST-0294295				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	09/15/2022 02:52:55 AM				Trade Secret:	false
Chemical Name:	Waste 352 Organic Solids (Other)					
Common Name Inventory:	Gasoline Fuel Filters Used Absorbent					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
ID:	533792				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0318863				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	01/04/2023 01:13:56 AM				Trade Secret:	false
Chemical Name:	Waste 352 Organic Solids (Other)					
Common Name Inventory:	Gasoline Fuel Filters Used Absorbent					
ID:	573402				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0337219				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	06/22/2023 02:25:22 AM				Trade Secret:	false
Chemical Name:	Waste 352 Organic Solids (Other)					
Common Name Inventory:	Gasoline Fuel Filters Used Absorbent					
ID:	601967				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0349187				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	09/07/2023 01:52:49 AM				Trade Secret:	false
Chemical Name:	Waste 352 Organic Solids (Other)					
Common Name Inventory:	Gasoline Fuel Filters Used Absorbent					
<u>Hazardous Materials Inspection Violations</u>						
Container Tank ID:	37-000-201678				Inspection No:	4977868
Facility ID No:	16230				Inspection Type:	Routine
ID:	07/08/2014 03:29:00 PM				Inspection Date:	
UST ID:	91				Compliance Date:	07/08/2014 12:00:00 AM
Permit Status:	Permit Renewed				Last Updated:	09/07/2023 01:52:46 AM
Active Permit:	true				NOV:	false
Program Element:	Underground Storage Tank					
Violation Code:	2030025 Failure of the pressurized piping to meet one or more of the following requirements: monitored at least hourly with the capability of detecting a release of 3.0 gallons per hour, and will restrict the flow of product through the piping or trigger an alarm when a release occurs. 23 CCR 16 2636(f)(2).					
Violation Classification:						
Container Tank ID:	37-000-201678				Inspection No:	4977868
Facility ID No:	16229				Inspection Type:	Routine
ID:	07/08/2014 03:29:00 PM				Inspection Date:	
UST ID:	87				Compliance Date:	07/08/2014 12:00:00 AM
Permit Status:	Permit Renewed				Last Updated:	09/07/2023 01:52:46 AM
Active Permit:	true				NOV:	false
Program Element:	Underground Storage Tank					
Violation Code:	2030043 Failure of the leak detection equipment to be properly programmed or properly operated. 23 CCR 16 2632, 2634, 2636, 2666					
Violation Classification:						
Container Tank ID:	37-000-201678				Inspection No:	5161628
Facility ID No:	16232				Inspection Type:	Routine
ID:	06/29/2015 10:30:00 AM				Inspection Date:	
UST ID:	28267				Compliance Date:	06/29/2015 12:00:00 AM
Permit Status:	Permit Renewed				Last Updated:	09/07/2023 01:52:46 AM
Active Permit:	true				NOV:	false
Program Element:	Underground Storage Tank					
Violation Code:	2030003 (RD) Failure of the leak detection equipment to have an audible and visual alarm as required. 23 CCR 2632, 2634, 2636, 2666					
Violation Classification:						
Container Tank ID:	37-000-201678				Inspection No:	5161628
Facility ID No:	16231				Inspection Type:	Routine
ID:	06/29/2015 10:30:00 AM				Inspection Date:	
UST ID:	28267				Compliance Date:	06/29/2015 12:00:00 AM
Permit Status:	Permit Renewed				Last Updated:	09/07/2023 01:52:46 AM
Active Permit:	true				NOV:	false
Program Element:	Underground Storage Tank					
Violation Code:	2030026 Failure of line leak detector to detect a leak and/or failure of audible and visual alarm. 23 CCR 16 2636(f)(2), 2666.					
Violation Classification:						

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Container Tank ID:	37-000-201678			Inspection No:	5161628	
Facility ID No:	16233			Inspection Type:	Routine	
ID:	06/29/2015 10:30:00 AM			Inspection Date:		
UST ID:	28267			Compliance Date:	06/29/2015 12:00:00 AM	
Permit Status:	Permit Renewed			Last Updated:	09/07/2023 01:52:46 AM	
Active Permit:	true			NOV:	false	
Program Element:	Underground Storage Tank					
Violation Code:	2030016 Failure to continuously monitor the interstitial space of the tank, piping and/or sumps sump such that the leak detection activates an audible/visual alarm when a leak is detected. 23 CCR 16 2631(g), 2632(c)(2)(A)&(B), 2633(c), 2636(f).					
Violation Classification:						
Container Tank ID:	37-000-201678			Inspection No:	5161628	
Facility ID No:	16237			Inspection Type:	Routine	
ID:	06/29/2015 10:30:00 AM			Inspection Date:		
UST ID:				Compliance Date:	07/14/2015 12:00:00 AM	
Permit Status:	Permit Renewed			Last Updated:	09/07/2023 01:52:46 AM	
Active Permit:	true			NOV:	false	
Program Element:	Hazardous Waste Generator					
Violation Code:	3030010 Accumulated waste too long (>180 or 270 days) (>90 days for an acutely hazardous waste). (40 CFR 262.34(e) and (f).) HSC 25201(a); 22 CCR 66262.34(d)					
Violation Classification:						
Container Tank ID:	37-000-201678			Inspection No:	5444891	
Facility ID No:	16234			Inspection Type:	Routine	
ID:	06/28/2016 01:21:58 PM			Inspection Date:		
UST ID:	28266			Compliance Date:	06/28/2016 12:00:00 AM	
Permit Status:	Permit Renewed			Last Updated:	09/07/2023 01:52:46 AM	
Active Permit:	true			NOV:	false	
Program Element:	Underground Storage Tank					
Violation Code:	2030025 (RD) Failure of the pressurized piping to meet one or more of the following requirements: monitored at least hourly with the capability of detecting a release of 3.0 gallons per hour, and will restrict the flow or product through the piping or trigger an alarm when a release occurs. 23 CCR 2636(f)(2)					
Violation Classification:						
Container Tank ID:	37-000-201678			Inspection No:	5668063	
Facility ID No:	16235			Inspection Type:	Routine	
ID:	06/28/2017 04:30:00 PM			Inspection Date:		
UST ID:	32496			Compliance Date:	06/28/2017 12:00:00 AM	
Permit Status:	Permit Renewed			Last Updated:	09/07/2023 01:52:46 AM	
Active Permit:	true			NOV:	false	
Program Element:	Underground Storage Tank					
Violation Code:	2030025 (RD) Failure of the pressurized piping to meet one or more of the following requirements: monitored at least hourly with the capability of detecting a release of 3.0 gallons per hour, and will restrict the flow or product through the piping or trigger an alarm when a release occurs. 23 CCR 2636(f)(2)					
Violation Classification:						
Container Tank ID:	37-000-201678			Inspection No:	5914775	
Facility ID No:	16236			Inspection Type:	Routine	
ID:	06/21/2018 03:30:59 PM			Inspection Date:		
UST ID:	28266			Compliance Date:	06/21/2018 12:00:00 AM	
Permit Status:	Permit Renewed			Last Updated:	09/07/2023 01:52:46 AM	
Active Permit:	true			NOV:	false	
Program Element:	Underground Storage Tank					
Violation Code:	2030025 (RD) Failure of the line leak detector (LLD) monitoring pressurized piping to meet one or more of the following requirements: Monitored at least hourly. with the capability of detecting a release of 3.0 gallons per hour leak at 10 p.s.i.g. and restrict or shut off the flow of product through the piping when a leak is detected. 23 CCR 2636(f)(2)					
Violation Classification:						
Container Tank ID:	37-000-201678			Inspection No:	6178535	
Facility ID No:	47036			Inspection Type:	Routine	
ID:	06/14/2019 12:00:00 AM			Inspection Date:		
UST ID:	28266			Compliance Date:	06/14/2019 12:00:00 AM	
Permit Status:	Permit Renewed			Last Updated:	09/07/2023 01:52:46 AM	
Active Permit:	true			NOV:	false	
Program Element:	Underground Storage Tank					
Violation Code:	2030018 (TCR 9d) Failure of the double-walled pressurized piping to be continuously monitored with a system that activates an audible and visual alarm or stops flow at dispenser when a leak is detected. 23 CCR 2636(f)(1)					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Violation Classification:		Class II				
Container Tank ID:	37-000-201678			Inspection No:	6178535	
Facility ID No:	47035			Inspection Type:	Routine	
ID:	06/14/2019 12:00:00 AM			Inspection Date:		
UST ID:	32496			Compliance Date:	06/14/2019 12:00:00 AM	
Permit Status:	Permit Renewed			Last Updated:	09/07/2023 01:52:46 AM	
Active Permit:	true			NOV:	false	
Program Element:	Underground Storage Tank					
Violation Code:	2030035 Failure to operate the UST system to prevent unauthorized releases including leaks, spills, and/or overfills. HSC 25292.1(a)					
Violation Classification:		Class II				
Container Tank ID:	37-000-201678			Inspection No:	6178535	
Facility ID No:	47037			Inspection Type:	Routine	
ID:	06/14/2019 12:00:00 AM			Inspection Date:		
UST ID:				Compliance Date:	06/19/2019 12:00:00 AM	
Permit Status:	Permit Renewed			Last Updated:	09/07/2023 01:52:46 AM	
Active Permit:	true			NOV:	false	
Program Element:	Hazardous Materials Release Response Plans					
Violation Code:	1010008 HMBP not certified annually as complete and accurate in CERS. HSC 25508(a)(1)(A), 25508.2, 19 CCR 2654(b)					
Violation Classification:		Minor				
Container Tank ID:	37-000-201678			Inspection No:	6667849	
Facility ID No:	55544			Inspection Type:	Routine	
ID:	06/30/2021 10:40:58 AM			Inspection Date:		
UST ID:	28267			Compliance Date:	06/30/2021 12:00:00 AM	
Permit Status:	Permit Renewed			Last Updated:	09/07/2023 01:52:46 AM	
Active Permit:	true			NOV:	false	
Program Element:	Underground Storage Tank					
Violation Code:	2060020 (TCR 9a) Failure to meet one or more of the following requirements: Install or maintain a liquid-tight spill container. Have a minimum capacity of 5 gallons. Have a functional drain valve or other method for the removal of liquid from the spill container. Be resistant to galvanic corrosion. Perform a tightness test at installation, every 12 months thereafter, or within 30 days after a repair to the spill container, tested using applicable manufacturer guidelines, industry codes, engineering standards, or a method approved by a professional engineer. Tested by a certified UST service technician. Maintain records of spill containment testing for 36 months. 23 CCR 2635(b), 2637.1(a-c), 2665(a-b), 2712(b)(1)(F); HSC 25284.2					
Violation Classification:		Class II				
Container Tank ID:	37-000-201678			Inspection No:	6944856	
Facility ID No:	63826			Inspection Type:	Routine	
ID:	06/02/2022 12:00:00 AM			Inspection Date:		
UST ID:				Compliance Date:	06/16/2022 12:00:00 AM	
Permit Status:	Permit Renewed			Last Updated:	09/07/2023 01:52:46 AM	
Active Permit:	true			NOV:	false	
Program Element:	Hazardous Waste Generator					
Violation Code:	3030007 Failed to properly label/date hazardous waste container &/or tank. 22 CCR 66262.34(f)					
Violation Classification:		Class II				
Container Tank ID:	37-000-201678			Inspection No:	6944856	
Facility ID No:	63827			Inspection Type:	Routine	
ID:	06/02/2022 12:00:00 AM			Inspection Date:		
UST ID:				Compliance Date:	06/16/2022 12:00:00 AM	
Permit Status:	Permit Renewed			Last Updated:	09/07/2023 01:52:46 AM	
Active Permit:	true			NOV:	false	
Program Element:	Hazardous Waste Generator					
Violation Code:	3030010 Failed to properly dispose of hazardous waste within 180 days (or 270 days if waste is transported over 200 miles). 22 CCR 66262.34(d); HSC 6.5 25123.3(h)(1)					
Violation Classification:		Class II				
Container Tank ID:	37-000-201678			Inspection No:	6944856	
Facility ID No:	63829			Inspection Type:	Routine	
ID:	06/02/2022 12:00:00 AM			Inspection Date:		
UST ID:				Compliance Date:	08/17/2022 12:00:00 AM	
Permit Status:	Permit Renewed			Last Updated:	09/07/2023 01:52:46 AM	
Active Permit:	true			NOV:	false	
Program Element:	Hazardous Materials Release Response Plans					
Violation Code:	1010004 Chemical inventory incomplete or not submitted in CERS. HSC 25505(a)(1); 25507(a); 25508.1(a-b); 19					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Violation Classification:		CCR 2654 (a) or (d) Class II				
Container Tank ID:	37-000-201678			Inspection No:	6944856	
Facility ID No:	63825			Inspection Type:	Routine	
ID:	06/02/2022 12:00:00 AM			Inspection Date:		
UST ID:				Compliance Date:		
Permit Status:	Permit Renewed			Last Updated:	09/07/2023 01:52:46 AM	
Active Permit:	true			NOV:		
Program Element:	Hazardous Waste Generator					
Violation Code:	HMD0000 HAZARDOUS WASTE REQUIREMENTS FOR SQGS ONLY					
Violation Classification:						
Container Tank ID:	37-000-201678			Inspection No:	6944856	
Facility ID No:	63828			Inspection Type:	Routine	
ID:	06/02/2022 12:00:00 AM			Inspection Date:		
UST ID:				Compliance Date:		
Permit Status:	Permit Renewed			Last Updated:	09/07/2023 01:52:46 AM	
Active Permit:	true			NOV:		
Program Element:	Hazardous Materials Release Response Plans					
Violation Code:	HMD0000 HAZARDOUS MATERIALS REQUIREMENTS					
Violation Classification:						
<u>HMD Permits Map Data</u>						
Epa ID:	CAL000306036			Opened Dt:	2003-04-17T00:00:00	
Cers ID:	10375228			Expiration Dt:	2025-04-30T00:00:00	
Sitemap:	MAP_201678.pdf			Rpt Name:	HMBP201678.pdf	
Record Status:	Permit Renewed			Hirt Flag:	Y	
Er Contact1:	Tim Kjonegaard			Billing Code1:	Base + CUPA	
Er Title1:	President			St No:	1910	
Er Phone1:	858-4-243-2635			St No End:		
Er Altphone:	760-788-7800			St Name:	MAIN	
Er Contact2:	THERESA KURTENBACH			St Dir:		
Er Title2:	VICE PRESIDENT			St Type:	ST	
Er Phone2:	858-243-2878			St Unit:		
Er Altphone2:	760-788-7800			Insp Dist Geoinfo:	HT202	
Biz Apn:	282-222-20-00					
Biz Phone:	760-788-7800					
Biz Email:	starsfuelpro@att.net					
Biz Owner:	Tim Kjonegaard					
Biz Type:	UST - Retail Site - No Repair Service					
Facility Subject To Calarp:						
Plating Shop Metal Finishing:						
Chemical Supplier Wholesale:						
Pesticide Applicator Fumigatio:						
Chem Gas Paint Manufacture:						
Resin Site With 6 Items:						
Petroleum Propane Fuel Supp:						
Site With Gt20 Inventory Items:						
Apsa Stor Tank Gt10000 Gal:						
Apsa Stor Tank Chem Gt999ga:						
Ust Stor Tank Fuel Gt30k Ga: Y						
Cryogas Gt20kcft200gal1200lb:						
Gases Gt20kCft 208 Gal 1666 L:						
Prop Gt185kCft5k Gal 2100:						
Extreme Haz Gt20 Cft 54 Gal 5:						
<u>HMD Facility Data</u>						
ID:	3794			Tank Status:	Active	
Facility ID No:	37-000-201678			Tank Cap in Galons:	12000	
Tank ID No:	28268			Tank Contents:	Premium Unleaded	
Permit Status:	Permit Renewed			Tank Use:	1a	
Active Permit:	true			Type of Tank:	Double Wall	
Dt UST Perm Closed:				Last Updated:	09/07/2023 01:52:49 AM	
Piping System Type:	Pressure					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Tank Owner Name:	Tim Kjonegaard
Facility Type UST Facility:	Motor Vehicle Fueling

HMD Facility Data

ID:	3792	Tank Status:	Active
Facility ID No:	37-000-201678	Tank Cap in Galons:	12000
Tank ID No:	28266	Tank Contents:	Regular Unleaded
Permit Status:	Permit Renewed	Tank Use:	1a
Active Permit:	true	Type of Tank:	Double Wall
Dt UST Perm Closed:		Last Updated:	09/07/2023 01:52:49 AM
Piping System Type:	Pressure		
Tank Owner Name:	Tim Kjonegaard		
Facility Type UST Facility:	Motor Vehicle Fueling		

HMD Facility Data

ID:	3793	Tank Status:	Active
Facility ID No:	37-000-201678	Tank Cap in Galons:	12000
Tank ID No:	28267	Tank Contents:	Regular Unleaded
Permit Status:	Permit Renewed	Tank Use:	1a
Active Permit:	true	Type of Tank:	Double Wall
Dt UST Perm Closed:		Last Updated:	09/07/2023 01:52:49 AM
Piping System Type:	Pressure		
Tank Owner Name:	Tim Kjonegaard		
Facility Type UST Facility:	Motor Vehicle Fueling		

HMD Facility Data

ID:	3795	Tank Status:	Active
Facility ID No:	37-000-201678	Tank Cap in Galons:	12000
Tank ID No:	32496	Tank Contents:	Diesel
Permit Status:	Permit Renewed	Tank Use:	1a
Active Permit:	true	Type of Tank:	Double Wall
Dt UST Perm Closed:		Last Updated:	09/07/2023 01:52:49 AM
Piping System Type:	Pressure		
Tank Owner Name:	Tim Kjonegaard		
Facility Type UST Facility:	Motor Vehicle Fueling		

10	8 of14	ENE	0.12 / 656.72	1,418.40 / 1	RAMONA DAY & NITE MOBIL 1910 HIGHWAY 67, RAMONA, CA 92065 RAMONA CA	LOP SANDIEGO
SWRCB Global ID:	T0607391310	Parcel No:	282-222-06-00			
Record ID:	DEH2000-LSAM-H29206-001	Census Tract:	208.05			
Record Status:	Completed	Zip Code 2:	92065			
Opened Date:	9/8/2000	Community:	Ramona			
Case Type:	LOP - Local Oversight Program	Jurisdiction:	UNINCORPORATED			
Historical Name:	NITE & DAY MOBIL STATION	Watershed Basin No:	905.41			
Lead Agency:	DEH/SAM	Latitude GS 84:	33.0329433			
Lead Agency Date:	9/15/2000	Longitude GS 84:	-116.8827735			
Funding:	S - LOP State Fund	X Map Coord:	6367735.065			
Fire Agency:	RAMONA MUNI WATER DIST	Y Map Coord:	1956201.764			
Water Purveyor:	RAMONA MUNI WATER IMP DIST A					
File Case Type:	CLOSED OR TRANSFERRED LOP CASES					

10	9 of14	ENE	0.12 / 656.72	1,418.40 / 1	STARS PETROLEUM 1910 Main Street RAMONA CA 920652524	LUST
Global ID:	T0607391310	Case Type (DL):	LUST Cleanup Site			
Site Facility Type:	LUST CLEANUP SITE	Oil Field (SRCH):				

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Site Fac Type (SRCH):	LUST CLEANUP SITE			Oil Field Oper (SRCH):		
Status:				Census Tract (SRCH):	6073020805	
Status (SRCH):	OPEN - REMEDIATION			Latitude (DL):	33.03316489	
Status (DL):	Open - Remediation			Longitude (DL):	-116.882685986	
Status Date (DL):	9/1/2023			RWQCB Region (DL):	SAN DIEGO RWQCB (REGION 9)	
Cleanup Status:	OPEN - REMEDIATION					
Site Facility Name (SRCH):	STARS PETROLEUM					
Address (SRCH):	1910 MAIN STREET					
City (SRCH):	RAMONA					
Zip (SRCH):	920652524					
County (SRCH):	SAN DIEGO					
Street No (DL):	1910					
Street Name (DL):	Main Street					
City (DL):	RAMONA					
Zip (DL):	920652524					
County (DL):	San Diego					
State (DL):	CA					
Business Name (DL):	STARS PETROLEUM					
Site Facility Name:	STARS PETROLEUM					
Address :	1910 MAIN STREET					
City :	RAMONA					
Zip :	920652524					
County :	SAN DIEGO					
Report Source:	LUST Cleanup Sites & Military UST Site from GeoTracker Project Search Results Export; LUST Cleanup Sites & Military UST Site from GeoTracker Cleanup Sites Data Download; LUST Cleanup Sites from GeoTracker Search					

GeoTracker Sites Data Download - Site Details

CUF Case:
Lead Agency: SAN DIEGO RWQCB (REGION 9)
Case Worker: LT
Local Agency:
RB Case No: 9UT4091
Local Case No:
File Location: Regional Board
Potential COC: MTBE / TBA / Other Fuel Oxygenates, Gasoline
Potential Media of Concern: Aquifer used for drinking water supply
Begin Date: 9/1/1999
How Discovered: UST System Modification
How Discovered Description: PIPE LEAK AND SOIL SAMPLING
Stop Method: Repair Product Piping
Stop Description: REPAIR PRODUCT PIPING
Calwater Watershed Name: San Dieguito - Santa Maria Valley - Ramona (905.41)
DWR GW Subbasin Name: Santa Maria Valley (9-011)
Disadvantaged Community:
CalEnvScreen Score:
Coordinate Source: * Historical Geocode - Exact Address Match
Discharge Cause:
Discharge Source: Piping
EPA Region: 9
Leak Reported Dt: 2000-09-08 00:00:00
Military DoD Site: No
No Further Action Dt:
Qty Rlsd Gallons:
Facility Project Sub Type:
Calenviroscreen 3 Score: 21-25%
Calenviroscreen 4 Score: 15-20%
Claim No: 16226, B0386, E0241, S0338
Claim Status: Active, Ineligible, Active, Active
A2022 Assembly District: 75
A2022 Congressional District: 48
A2022 Senate District: 40
Site History:

Assessment of hydrocarbon impacts at the site began on August 1999, when an underground storage tank (UST) system alarm indicated a breach in the piping system. The County of San Diego Department of Environmental Health (DEH) was notified and an iL½Unauthorized ReleaseiL½ case was opened. Subsequent investigation by the Jenal Engineering Corporation (Jenal) determined that the cause of the alarm was leaking unleaded product piping, improper piping joint closures, improper epoxy seals, and improper sloping of the secondary containment. In September of 1999, Jenal

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

excavated approximately 14 tons of hydrocarbon-impacted soil from the area of the leaks. The soil was transported to Soil Wash Technologies, Inc. for remediation and disposal. Additional soil sampling was conducted and upon receipt of the findings, the DEH issued a letter requiring $\frac{1}{2}$ No Further Action $\frac{1}{2}$. In June 2000, TRC Alton Geoscience (TRC) conducted an investigation of the subject property for Exxon Mobil Oil Corporation (Exxon Mobil). As part of this investigation, four monitoring wells (MW-1 through MW-4) were installed. Soil samples were collected from the borings and groundwater samples were collected from the monitoring wells. All soil and groundwater samples were analyzed for total petroleum hydrocarbons derived from gasoline or diesel (TPH_{g/d}), Benzene, Toluene, Ethylbenzene, Xylene (BTEX), and Methyl-t-Butyl ether (MTBE). Groundwater samples were also analyzed for other oxygenate compounds (Tertiary-butyl Alcohol [TBA], di-isopropyl ether [DIPE], ethyl-tertiary-butyl ether [ETBE], and tertiary-amyl-methyl ether [TAME]). Laboratory testing of the soil and groundwater detected the following: $\frac{1}{2}$ Concentrations of MTBE ranging from 0.038 to 0.22 milligrams per kilogram (mg/kg) in the soil from the boring for monitoring well MW-3. $\frac{1}{2}$ Concentrations of MTBE ranging from 0.1 to 0.14 mg/kg in the soil from the boring for monitoring well MW-4. $\frac{1}{2}$ Concentrations of TPH_g at 3,300 micrograms per liter (ug/l), Benzene at 3.3 ug/l, and MTBE at 1,100 ug/l were detected in the groundwater from monitoring well MW-3. Concentrations of TBA, ETBE, and TAME were also detected in the groundwater from monitoring well MW-3. The County of San Diego Department of Environmental Health (DEH) was notified and an NOR was issued to Vivi Eidsvig on 10/16/2000. On November 29, 2000, AMEC collected groundwater samples from monitoring wells MW-1 through MW-4, and laboratory analyses results detected the following: $\frac{1}{2}$ Concentrations of TPH_g at 770 ug/l and MTBE at 1,000 ug/l were detected in the groundwater from monitoring well MW-3. $\frac{1}{2}$ Concentrations of Benzene at 3.0 ug/l, and MTBE at 330 ug/l were detected in the groundwater from monitoring well MW-3. $\frac{1}{2}$ Concentrations of ETBE and TAME were detected in monitoring wells MW-3 and MW-4, respectively. On December 18, 2000, the DEH assigned a $\frac{1}{2}$ Priority A $\frac{1}{2}$ status to the site for MTBE impacts to a beneficial-use aquifer (AMEC, 2001a). In January 2001, ten drive-point sample points were advanced onsite by AMEC as a part of their assessment of the MTBE-impacted groundwater plume. Eighteen soil and one groundwater samples were collected during this investigation. The samples were analyzed for TPH_d, TPH_g, BTEX, MTBE, and other oxygenates. Laboratory analyses detected the following: $\frac{1}{2}$ Concentrations of MTBE in soil from borings DP-6, DP-10, DP-11, and DP-12, with the highest concentration detected in soil sample DP-6@19' at 4 mg/kg. $\frac{1}{2}$ Concentrations of TPH_g and MTBE were detected in the water sample collected from boring DP-6 at 3,500 ug/l and 98,000 ug/l, respectively. On June 20, 2000 and then again on April 4, 2001 tank and piping system integrity tests were conducted at the subject property. The tests detected no leaks in the tanks, product delivery piping, or vapor recovery lines. In June 2001, AMEC supervised the establishment of five additional groundwater monitoring wells at the subject property. The additional monitoring wells (MW-5 through MW-9) were established as part of plan to more adequately assess the MTBE-impacted groundwater plume. Additionally, seven soil borings were advanced to assess the soil in the area of the fuel dispenser islands. Thirty-two (32) soil samples were collected from the borings. Additionally, one groundwater sample was collected from boring B-2. On June 13 & 14, 2001, groundwater samples were collected from monitoring wells MW-1 through MW-9. Laboratory analysis of the collected soil and groundwater samples detected the following: $\frac{1}{2}$ Concentrations of detected soil TPH_g ranged from 0.97 mg/kg to 3,100 mg/kg. Soil sample MW-7@15' contained the highest detected TPH_g concentration. $\frac{1}{2}$ Concentrations of detected soil benzene ranged from 0.0097 mg/kg to 11 mg/kg. Soil sample MW-7@15' contained the highest detected benzene concentration. $\frac{1}{2}$ Concentrations of detected soil MTBE ranged from 0.033 mg/kg to 56 mg/kg. Soil sample MW-7@15' contained the highest detected MTBE concentration. $\frac{1}{2}$ A TPH_g concentration of 480,000 ug/l was detected in the groundwater sample from boring B-2. $\frac{1}{2}$ Concentrations of detected groundwater benzene ranged from 1.0 ug/l to 13,000 ug/l. The groundwater sample from boring B-2 contained the highest detected benzene concentration. $\frac{1}{2}$ Concentrations of detected groundwater MTBE ranged from 63 ug/l to 1,200,000 ug/l. The groundwater sample from monitoring well MW-7 contained the highest detected MTBE concentration. On November 27, 2001, the DEH reissued a Notice of Responsibility to Ms. Vivi Eidsvig and James Kurtenbach. On February 5, 2002, AMEC prepared a workplan for further assessment activities. On May 23, 2005, the DEH issued an $\frac{1}{2}$ Official Notice $\frac{1}{2}$ to Mr. James Kurtenbach requesting a report on previously approved work. On October 11, 2005, Applied Consultants (AC) prepared the report titled $\frac{1}{2}$ Groundwater Monitoring Testing, File Review, and Site Assessment of the Subject Property Located at 1910 Main Street, Ramona, California $\frac{1}{2}$ in which AC recommended the installation of additional monitoring wells to the west and south to complete the delineation of the dissolved-phase hydrocarbon groundwater plumes. On December 19, 2005 the DEH approved the AC workplan to install three groundwater monitoring wells and to initiate a quarterly groundwater monitoring program provided the support documentation for the groundwater sampling results are provided with monitoring reports. On June 17, 2006, AC prepared the report titled "Additional Site Assessment of the Subject Property located at 1910 Main Street, Ramona, California", detailing the installation of monitoring wells AMW10, AMW11, and AMW12. Petroleum constituents were not detected in any of the soil samples collected during well installation, nor in the groundwater sample from AMW12. Only MTBE was detected in groundwater samples from AMW10 and AMW11, at 11 and 8.4 ug/l, respectively. Laboratory analysis of groundwater samples from the existing monitoring wells detected the following: $\frac{1}{2}$ Concentrations of detected groundwater benzene ranged from 210 ug/l to 1,600 ug/l. The groundwater sample from MW-5 contained the highest detected benzene concentration. $\frac{1}{2}$ Concentrations of detected groundwater MTBE ranged from 8.4 ug/l to 820,000 ug/l. The groundwater sample from monitoring well MW-5 contained the highest detected MTBE concentration. MW-7 was not sampled as 0.06 feet of liquid phase hydrocarbons (LPH) were detected in this well. AC concluded that the dissolved-phase MTBE plume is migrating to the west-southwest, and that complete delineation of the impacted groundwater plume in the down-gradient direction has been achieved. AC recommended LPH removal from MW-7, continued quarterly groundwater monitoring, and preparation of a Corrective Action Plan (CAP). DEH did not concur with preparation of a CAP, as site delineation was incomplete, and required submittal of a workplan for additional groundwater assessment by September 30, 2006. On July 29, 2009, DEH issued a Past Due notice requiring submittal of a workplan for additional groundwater assessment within thirty days. On October 14, 2009, The Reynolds Group (TRG) prepared the report titled "Groundwater Monitoring and Status Report Third Quarter 2009". AMW11 was not sampled as it could not be located, and MW7 was not sampled as it contained 0.05' of LPH. An absorbent sock was placed into MW7 to remove LPH. Benzene was not detected in any of the groundwater samples. Concentrations of detected MTBE ranged from 5.3 ug/l to 41,981.2 ug/l. The groundwater sample from monitoring well MW-5 contained the highest detected MTBE concentration. On October 21, 2009, TRG prepared a "Workplan for Pilot Testing and Interim Remedial Action Plan". The workplan proposed to locate AMW11, perform an aquifer test, perform an air sparge/soil vapor extraction (AS/SVE) pilot test, and commence a groundwater pump and treat program to recover/reduce the dissolved phase plume at the site. In response to DEH comments, TRG prepared a supplement to the workplan dated February 10, 2010. The supplement included installation of 2 additional groundwater monitoring wells to further evaluate the extent of the MTBE plume and installation and sampling of a soil vapor probe to assess the vapor risk to on-site building occupants. DEH approved the workplan and addendum on March 11, 2010 with several changes/conditions. On April 26, 2010, TRG prepared a "Well Installation Report", which detailed the installation of MW13, MW14, MW15, AS1, and SVE1. Laboratory analysis of the collected soil and groundwater samples detected the following: $\frac{1}{2}$ Concentrations of detected soil TPH_g ranged from 0.3 mg/kg to 4.6 mg/kg. Soil sample MW13 @ 20' contained the highest detected TPH_g concentration. $\frac{1}{2}$ Concentrations of detected soil MTBE ranged from 5 ug/kg to 1,679 ug/kg. Soil sample MW-14 @ 25' contained the highest detected MTBE concentration. $\frac{1}{2}$ Concentrations of detected groundwater MTBE ranged from 1.6 ug/l to 300,153.4 ug/l. The groundwater sample from monitoring well MW-5 contained the highest detected MTBE concentration. MW7 was not sampled as it contained 0.02' of LPH, and benzene was not detected above reporting limits in any of the groundwater samples. On August 6, 2010, TRG prepared a "Human Health Vapor Risk Assessment Report. MTBE was the only vapor detected during 3 sampling events, and the SAM Vapor Risk Model was used to assess the risk to building occupants using a commercial exposure scenario. Per the model, the cancer risk from MTBE vapors was 5.49 x 10⁻¹⁰, and the consultant concluded that there is no significant risk from potential intrusion of gasoline constituent vapors to the on-site building occupants. DEH concurred with TRG's conclusions. On October 15, 2010, TRG prepared a "Pilot Test

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Report", summarizing the results of an aquifer test, SVE pilot test, and AS test. Based upon the results, the consultant concluded that groundwater extraction would not be feasible due to the cost of pumping, treating, sampling, and disposing of the high volume of groundwater that would be extracted. TRG also concluded that SVE would not be effective due to the shallow groundwater and lithology, which impedes the ability of the SVE system to achieve a large enough radius of influence. TRG concludes AS is the most economical and viable remediation approach for the site. The report included groundwater monitoring data collected in August, 2010. Laboratory analysis of groundwater samples from the existing monitoring wells detected the following: i. 1/2 Concentrations of detected benzene ranged from 1.9 ug/l to 4,039.8 ug/l. The groundwater sample from MW7 contained the highest detected benzene concentration. ii. 1/2 Concentrations of detected MTBE ranged from 2.3 ug/l to 269,294.9 ug/l. The groundwater sample from monitoring well MW-5 contained the highest detected MTBE concentration. On February 16, 2011, TRG prepared a "Corrective Action Plan", which evaluated monitored natural attenuation, dual phase extraction, and AS with SVE as remedial options for the site. TRG recommends remediation of the site using AS and SVE. DEH did not approve the CAP, as delineation of the dissolved phase plume has not been completed. The RP was directed to complete the additional groundwater assessment proposed in the CAP, which included installation of 2 groundwater monitoring wells in the west corner of the site and on the adjacent property to the west/southwest. The locations for the wells will be determined based upon the results of 6 Hydropunch samples, and DEH must approve of the proposed locations prior to drilling. DEH will request that the CAP be revised and resubmitted when site assessment is completed. Please see the Environmental Data Tab for additional information.

GeoTracker Sites Data Download - Regulatory Contacts

Contact Type: Regional Board Caseworker - Primary Caseworker
Contact Name: LALITHA THOTAKURA
Organization Name: SAN DIEGO RWQCB (REGION 9)
Address: 2375 NORTHSIDE DRIVE, SUITE 100
City: SAN DIEGO
Email: lalitha.thotakura@waterboards.ca.gov
Phone No: 6195213002

GeoTracker Sites Data Download - Status History

Status: Open - Remediation
Status Date: 9/1/2023

Status: Open - Remediation
Status Date: 7/19/2000

Status: Open - Case Begin Date
Status Date: 9/1/1999

GeoTracker Search - Regulatory Profile

Site Facility Name: STARS PETROLEUM
Site Facility Type: LUST CLEANUP SITE
Cleanup Status: OPEN - REMEDIATION
Address: 1910 MAIN STREET
City: RAMONA
Zip: 920652524
County: SAN DIEGO
Report Link: https://geotracker.waterboards.ca.gov/profile_report?global_id=T0607391310
Cleanup Status Detail: OPEN - REMEDIATION AS OF 9/1/2023
Project Status:
Cleanup History Link: https://geotracker.waterboards.ca.gov/profile_report_include?global_id=T0607391310&tabname=regulatoryhistory
Potential COC: GASOLINE, MTBE / TBA / OTHER FUEL OXYGENATES
Potential Media of Concern: AQUIFER USED FOR DRINKING WATER SUPPLY
File Location: REGIONAL BOARD
User Defined Beneficial Use:
Designated Beneficial Use: MUN, AGR, IND, PROC
DWR GW Sub Basin: Santa Maria Valley (9-011)
Calwater Watershed Name: San Dieguito - Santa Maria Valley - Ramona (905.41)
Post Closure Site Management:
Future Land Use:
Cleanup Oversight Agencies: SAN DIEGO RWQCB (REGION 9) (LEAD) - CASE #: 9UT4091
CASE MANAGER: LALITHA THOTAKURA
SAN DIEGO COUNTY - CASE #: H29206-001
CUF Claim No: 16226, E0241, S0338
CUF Priority Assig: B
CUF Amount Paid: \$1,495,000, \$0, \$0
WDR Place Type:

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

WDR File No:

WDR Order No:

Project Oversight Agencies:

Facility Type:

Composting Method:

Grndwtr Monitoring Frequency: # OF WELLS MONITORED - SEMI-ANNUALLY : 12

Designated Beneficial Use Municipal and Domestic Supply, Agricultural Supply, Industrial Service Supply, Industrial Process Supply

Desc:

Site History:

Assessment of hydrocarbon impacts at the site began on August 1999, when an underground storage tank (UST) system alarm indicated a breach in the piping system. The County of San Diego Department of Environmental Health (DEH) was notified and an ☐Unauthorized Release☐ case was opened. Subsequent investigation by the Jenal Engineering Corporation (Jenal) determined that the cause of the alarm was leaking unleaded product piping, improper piping joint closures, improper epoxy seals, and improper sloping of the secondary containment.

In September of 1999, Jenal excavated approximately 14 tons of hydrocarbon-impacted soil from the area of the leaks. The soil was transported to Soil Wash Technologies, Inc. for remediation and disposal. Additional soil sampling was conducted and upon receipt of the findings, the DEH issued a letter requiring ☐No Further Action☐.

In June 2000, TRC Alton Geoscience (TRC) conducted an investigation of the subject property for Exxon Mobil Oil Corporation (Exxon Mobil). As part of this investigation, four monitoring wells (MW-1 through MW-4) were installed. Soil samples were collected from the borings and groundwater samples were collected from the monitoring wells. All soil and groundwater samples were analyzed for total petroleum hydrocarbons derived from gasoline or diesel (TPHg/d), Benzene, Toluene, Ethylbenzene, Xylene (BTEX), and Methyl-t-Butyl ether (MTBE). Groundwater samples were also analyzed for other oxygenate compounds (Tertiary-butyl Alcohol [TBA], di-isopropyl ether [DIPE], ethyl-tertiary-butyl ether [ETBE], and tertiary-amyl-methyl ether [TAME]). Laboratory testing of the soil and groundwater detected the following:

- ☐ Concentrations of MTBE ranging from 0.038 to 0.22 milligrams per kilogram (mg/kg) in the soil from the boring for monitoring well MW-3.
- ☐ Concentrations of MTBE ranging from 0.1 to 0.14 mg/kg in the soil from the boring for monitoring well MW-4.
- ☐ Concentrations of TPHg at 3,300 micrograms per liter (ug/l), Benzene at 3.3 ug/l, and MTBE at 1,100 ug/l were detected in the groundwater from monitoring well MW-3. Concentrations of TBA, ETBE, and TAME were also detected in the groundwater from monitoring well MW-3.

The County of San Diego Department of Environmental Health (DEH) was notified and an NOR was issued to Vivi Eidsvig on 10/16/2000.

On November 29, 2000, AMEC collected groundwater samples from monitoring wells MW-1 through MW-4, and laboratory analyses results detected the following:

- ☐ Concentrations of TPHg at 770 ug/l and MTBE at 1,000 ug/l were detected in the groundwater from monitoring well MW-3.
- ☐ Concentrations of Benzene at 3.0 ug/l, and MTBE at 330 ug/l were detected in the groundwater from monitoring well MW-3.
- ☐ Concentrations of ETBE and TAME were detected in monitoring wells MW-3 and MW-4, respectively.

On December 18, 2000, the DEH assigned a ☐Priority A☐ status to the site for MTBE impacts to a beneficial-use aquifer (AMEC, 2001a). In January 2001, ten drive-point sample points were advanced onsite by AMEC as a part of their assessment of the MTBE-impacted groundwater plume. Eighteen soil and one groundwater samples were collected during this investigation. The samples were analyzed for TPHd, TPHg, BTEX, MTBE, and other oxygenates. Laboratory analyses detected the following:

- ☐ Concentrations of MTBE in soil from borings DP-6, DP-10, DP-11, and DP-12, with the highest concentration detected in soil sample DP-6@19' at 4 mg/kg.
- ☐ Concentrations of TPHg and MTBE were detected in the water sample collected from boring DP-6 at 3,500 ug/l and 98,000 ug/l, respectively.

On June 20, 2000 and then again on April 4, 2001 tank and piping system integrity tests were conducted at the subject property. The tests detected no leaks in the tanks, product delivery piping, or vapor recovery lines.

In June 2001, AMEC supervised the establishment of five additional groundwater monitoring wells at the subject property. The additional monitoring wells (MW-5 through MW-9) were established as part of plan to more adequately assess the MTBE-impacted groundwater plume. Additionally, seven soil borings were advanced to assess the soil in the area of the fuel dispenser islands. Thirty-two (32) soil samples were collected from the borings. Additionally, one groundwater sample was collected from boring B-2. On June 13 & 14, 2001, groundwater samples were collected from monitoring wells MW-1 through MW-9. Laboratory analysis of the collected soil and groundwater samples detected the following:

- ☐ Concentrations of detected soil TPHg ranged from 0.97 mg/kg to 3,100 mg/kg. Soil sample MW-7@15' contained the highest detected TPHg concentration.
- ☐ Concentrations of detected soil benzene ranged from 0.0097 mg/kg to 11 mg/kg. Soil sample MW-7@15' contained the highest detected benzene concentration.
- ☐ Concentrations of detected soil MTBE ranged from 0.033 mg/kg to 56 mg/kg. Soil sample MW-7@15' contained the highest detected MTBE concentration.
- ☐ A TPHg concentration of 480,000 ug/l was detected in the groundwater sample from boring B-2.
- ☐ Concentrations of detected groundwater benzene ranged from 1.0 ug/l to 13,000 ug/l. The groundwater sample from boring B-2 contained the highest detected benzene concentration.
- ☐ Concentrations of detected groundwater MTBE ranged from 63 ug/l to 1,200,000 ug/l. The groundwater sample from monitoring well MW-7 contained the highest detected MTBE concentration.

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

On November 27, 2001, the DEH reissued a Notice of Responsibility to Ms. Vivi Eidsvig and James Kurtenbach.

On February 5, 2002, AMEC prepared a workplan for further assessment activities. On May 23, 2005, the DEH issued an "Official Notice" to Mr. James Kurtenbach requesting a report on previously approved work.

On October 11, 2005, Applied Consultants (AC) prepared the report titled "Groundwater Monitoring Testing, File Review, and Site Assessment of the Subject Property Located at 1910 Main Street, Ramona, California" in which AC recommended the installation of additional monitoring wells to the west and south to complete the delineation of the dissolved-phase hydrocarbon groundwater plumes. On December 19, 2005 the DEH approved the AC workplan to install three groundwater monitoring wells and to initiate a quarterly groundwater monitoring program provided the support documentation for the groundwater sampling results are provided with monitoring reports.

On June 17, 2006, AC prepared the report titled "Additional Site Assessment of the Subject Property located at 1910 Main Street, Ramona, California", detailing the installation of monitoring wells AMW10, AMW11, and AMW12. Petroleum constituents were not detected in any of the soil samples collected during well installation, nor in the groundwater sample from AMW12. Only MTBE was detected in groundwater samples from AMW10 and AMW11, at 11 and 8.4 ug/l, respectively. Laboratory analysis of groundwater samples from the existing monitoring wells detected the following:

- Concentrations of detected groundwater benzene ranged from 210 ug/l to 1,600 ug/l. The groundwater sample from MW-5 contained the highest detected benzene concentration.

- Concentrations of detected groundwater MTBE ranged from 8.4 ug/l to 820,000 ug/l. The groundwater sample from monitoring well MW-5 contained the highest detected MTBE concentration.

MW-7 was not sampled as 0.06 feet of liquid phase hydrocarbons (LPH) were detected in this well. AC concluded that the dissolved-phase MTBE plume is migrating to the west-southwest, and that complete delineation of the impacted groundwater plume in the down-gradient direction has been achieved. AC recommended LPH removal from MW-7, continued quarterly groundwater monitoring, and preparation of a Corrective Action Plan (CAP). DEH did not concur with preparation of a CAP, as site delineation was incomplete, and required submittal of a workplan for additional groundwater assessment by September 30, 2006.

On July 29, 2009, DEH issued a Past Due notice requiring submittal of a workplan for additional groundwater assessment within thirty days.

On October 14, 2009, The Reynolds Group (TRG) prepared the report titled "Groundwater Monitoring and Status Report Third Quarter 2009". AMW11 was not sampled as it could not be located, and MW7 was not sampled as it contained 0.05' of LPH. An absorbent sock was placed into MW7 to remove LPH. Benzene was not detected in any of the groundwater samples. Concentrations of detected MTBE ranged from 5.3 ug/l to 41,981.2 ug/l. The groundwater sample from monitoring well MW-5 contained the highest detected MTBE concentration.

On October 21, 2009, TRG prepared a "Workplan for Pilot Testing and Interim Remedial Action Plan". The workplan proposed to locate AMW11, perform an aquifer test, perform an air sparge/soil vapor extraction (AS/SVE) pilot test, and commence a groundwater pump and treat program to recover/reduce the dissolved phase plume at the site. In response to DEH comments, TRG prepared a supplement to the workplan dated February 10, 2010. The supplement included installation of 2 additional groundwater monitoring wells to further evaluate the extent of the MTBE plume and installation and sampling of a soil vapor probe to assess the vapor risk to on-site building occupants. DEH approved the workplan and addendum on March 11, 2010 with several changes/conditions.

On April 26, 2010, TRG prepared a "Well Installation Report", which detailed the installation of MW13, MW14, MW15, AS1, and SVE1. Laboratory analysis of the collected soil and groundwater samples detected the following:

- Concentrations of detected soil TPHg ranged from 0.3 mg/kg to 4.6 mg/kg. Soil sample MW13 @ 20' contained the highest detected TPHg concentration.

- Concentrations of detected soil MTBE ranged from 5 ug/kg to 1,679 ug/kg. Soil sample MW-14 @ 25' contained the highest detected MTBE concentration.

- Concentrations of detected groundwater MTBE ranged from 1.6 ug/l to 300,153.4 ug/l. The groundwater sample from monitoring well MW-5 contained the highest detected MTBE concentration.

MW7 was not sampled as it contained 0.02' of LPH, and benzene was not detected above reporting limits in any of the groundwater samples.

On August 6, 2010, TRG prepared a "Human Health Vapor Risk Assessment Report. MTBE was the only vapor detected during 3 sampling events, and the SAM Vapor Risk Model was used to assess the risk to building occupants using a commercial exposure scenario. Per the model, the cancer risk from MTBE vapors was 5.49×10^{-10} , and the consultant concluded that there is no significant risk from potential intrusion of gasoline constituent vapors to the on-site building occupants. DEH concurred with TRG's conclusions.

On October 15, 2010, TRG prepared a "Pilot Test Report", summarizing the results of an aquifer test, SVE pilot test, and AS test. Based upon the results, the consultant concluded that groundwater extraction would not be feasible due to the cost of pumping, treating, sampling, and disposing of the high volume of groundwater that would be extracted. TRG also concluded that SVE would not be effective due to the shallow groundwater and lithology, which impedes the ability of the SVE system to achieve a large enough radius of influence. TRG concludes AS is the most economical and viable remediation approach for the site. The report included groundwater monitoring data collected in August, 2010. Laboratory analysis of groundwater samples from the existing monitoring wells detected the following:

- Concentrations of detected benzene ranged from 1.9 ug/l to 4,039.8 ug/l. The groundwater sample from MW7 contained the highest detected benzene concentration.

- Concentrations of detected MTBE ranged from 2.3 ug/l to 269,294.9 ug/l. The groundwater sample from monitoring well MW-5 contained the highest detected MTBE concentration.

On February 16, 2011, TRG prepared a "Corrective Action Plan", which evaluated monitored natural attenuation, dual phase extraction, and AS with SVE as remedial options for the site. TRG recommends remediation of the site using AS and SVE. DEH did not approve the CAP, as delineation of the

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

dissolved phase plume has not been completed. The RP was directed to complete the additional groundwater assessment proposed in the CAP, which included installation of 2 groundwater monitoring wells in the west corner of the site and on the adjacent property to the west/southwest. The locations for the wells will be determined based upon the results of 6 Hydropunch samples, and DEH must approve of the proposed locations prior to drilling. DEH will request that the CAP be revised and resubmitted when site assessment is completed.

Please see the Environmental Data Tab for additional information.

GeoTracker Search - Cleanup Status History

Status:	Open - Remediation
Date :	9/1/2023
Status:	Open - Remediation
Date :	7/19/2000
Status:	Open - Case Begin Date
Date :	9/1/1999

GeoTracker Search - Regulatory Activities

Action Type:	Response Requested - Reports
Action:	Monitoring Report - Quarterly
Action Date:	7/31/2025
Received Issue Date:	7/31/2025
Doc Link:	https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6153645
Title Description Comments:	

Water Supply Well Contingency Plan Progress Report - 2Q2025

Action Type:	Response Requested - Workplans
Action:	Well Installation Workplan
Action Date:	3/21/2025
Received Issue Date:	3/21/2025
Doc Link:	https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6144821
Title Description Comments:	

Site Investigation Workplan Addendum, Revision 1

Action Type:	Other Regulatory Actions
Action:	Meeting
Action Date:	3/13/2025
Received Issue Date:	3/13/2025
Doc Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6621837&temptable=ENFORCEMENT
Title Description Comments:	

Meeting request by RP to discuss USEPA/TBA funding

Action Type:	Other Regulatory Actions
Action:	Complaint
Action Date:	2/28/2025
Received Issue Date:	2/28/2025
Doc Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6620836&temptable=ENFORCEMENT
Title Description Comments:	

San Diego Water Board Response to Stars Letters

Action Type:	Other Regulatory Actions
Action:	Staff Letter
Action Date:	2/21/2025
Received Issue Date:	2/21/2025
Doc Link:	https://geotracker.waterboards.ca.gov/view_documents?

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
global_id=T0607391310&enforcement_id=6620309&temptable=ENFORCEMENT						
Title Description Comments:						
SDRWQCB staff response to Site Investigation Workplan Addendum						
Action Type: Other Regulatory Actions						
Action: Technical Correspondence / Assistance / Other						
Action Date: 2/4/2025						
Received Issue Date: 2/4/2025						
Doc Link: https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6618702&temptable=ENFORCEMENT						
Title Description Comments:						
Response to Stars Petroleum Inc. on 1/13/2025 for OSCF						
Action Type: Other Regulatory Actions						
Action: File review						
Action Date: 2/3/2025						
Received Issue Date: 2/3/2025						
Doc Link: https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6618399&temptable=ENFORCEMENT						
Title Description Comments:						
Historical Files						
Action Type: Response Requested - Workplans						
Action: Soil and Water Investigation Workplan - Addendum - Regulator Responded						
Action Date: 1/13/2025						
Received Issue Date: 1/13/2025						
Doc Link: https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6139257						
Title Description Comments:						
SITE INVESTIGATION WORKPLAN ADDENDUM						
Action Type: Other Regulatory Actions						
Action: File review						
Action Date: 1/13/2025						
Received Issue Date: 1/13/2025						
Doc Link: https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6618188&temptable=ENFORCEMENT						
Title Description Comments:						
Letter from RPs response to funding decision and Acknowledgement of receipt						
Action Type: Notices						
Action: Letter - Notice						
Action Date: 12/6/2024						
Received Issue Date: 12/6/2024						
Doc Link: https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6613559&temptable=ENFORCEMENT						
Title Description Comments:						
Request for Addendum to Work Plan						
Action Type: Other Regulatory Actions						
Action: Verbal Communication						
Action Date: 10/8/2024						
Received Issue Date: 10/8/2024						
Doc Link:						
Title Description Comments:						
Teams meeting with SCS - Discussed delays with respect to well installation activities. The homeowner adjacent to well MW-27 restricts access to install the well. Water Board requested for home owner contact details to request access for installation activities. This is the second time Water Board has requested this information. Also, Water Board again recommends coming up with a plan B to install the necessary wells and move forward with investigation activities without any further delay. Water Board has requested for a meeting to discuss the same.						

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Action Type:		Other Regulatory Actions				
Action:		Verbal Communication				
Action Date:		6/12/2024				
Received Issue Date:		6/12/2024				
Doc Link:						
Title Description Comments:						
SDWQCB contacts County of San Diego to requests to expedite permit approval process						
Action Type:		Other Regulatory Actions				
Action:		Staff Letter				
Action Date:		3/25/2024				
Received Issue Date:		3/25/2024				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6576591&temptable=ENFORCEMENT				
Title Description Comments:						
San Diego Water Board Response						
Action Type:		Response Requested - Workplans				
Action:		Soil and Water Investigation Workplan - Regulator Responded				
Action Date:		3/15/2024				
Received Issue Date:		3/15/2024				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6116445				
Title Description Comments:						
Site Investigation Workplan						
Action Type:		Other Regulatory Actions				
Action:		Staff Letter				
Action Date:		3/4/2024				
Received Issue Date:		3/4/2024				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6573759&temptable=ENFORCEMENT				
Title Description Comments:						
San Diego Water Board Response to Site Investigation Work Plan						
Action Type:		Response Requested - Workplans				
Action:		Soil and Water Investigation Workplan - Regulator Responded				
Action Date:		2/9/2024				
Received Issue Date:		2/9/2024				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6113996				
Title Description Comments:						
Site Investigation Workplan						
Action Type:		Other Regulatory Actions				
Action:		Staff Letter				
Action Date:		1/2/2024				
Received Issue Date:		1/2/2024				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6567456&temptable=ENFORCEMENT				
Title Description Comments:						
San Diego Water Board Response						
Action Type:		Response Requested - Reports				
Action:		Monitoring Report - Semi-Annually				
Action Date:		11/29/2023				
Received Issue Date:		11/29/2023				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6109057				
Title Description Comments:						

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Second Semiannual Groundwater Monitoring Report 2023

Action Type: Response Requested - Workplans
Action: Soil and Water Investigation Workplan - Regulator Responded
Action Date: 11/10/2023
Received Issue Date: 11/10/2023
Doc Link: https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6107607
Title Description Comments:

Site Investigation Workplan

Action Type: Other Regulatory Actions
Action: Email Correspondence
Action Date: 11/3/2023
Received Issue Date: 11/3/2023
Doc Link: https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6562891&temptable=ENFORCEMENT
Title Description Comments:

Request of Extension on Site Investigation Work Plan

Action Type: Response Requested - Workplans
Action: Other Workplan
Action Date: 11/1/2023
Received Issue Date:
Doc Link:
Title Description Comments:

Site Investigation Work Plan

Action Type: Other Regulatory Actions
Action: Staff Letter
Action Date: 8/14/2023
Received Issue Date: 8/14/2023
Doc Link: https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6551057&temptable=ENFORCEMENT
Title Description Comments:

San Diego Water Board Response

Action Type: Enforcement/Orders
Action: Clean-up and Abatement Order
Action Date: 8/4/2023
Received Issue Date: 8/4/2023
Doc Link: https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6551065&temptable=ENFORCEMENT
Title Description Comments:

Cleanup and Abatement Order No. R9-2023-0051

Action Type: Enforcement/Orders
Action: Response to Comments
Action Date: 8/2/2023
Received Issue Date: 8/2/2023
Doc Link: https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6551064&temptable=ENFORCEMENT
Title Description Comments:

Tentative CAO public comments and SDWB response

Action Type: Response Requested - Reports
Action: Final Remedial Action Report / Corrective Action Report - Regulator Responded
Action Date: 8/1/2023

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Received Issue Date:		8/1/2023				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6102067				
Title Description Comments:		Water Replacement Contingency Plan				
Action Type:		Other Regulatory Actions				
Action:		Staff Letter				
Action Date:		7/7/2023				
Received Issue Date:		7/7/2023				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6547355&temptable=ENFORCEMENT				
Title Description Comments:		San Diego Water Board Response				
Action Type:		Response Requested - Reports				
Action:		Final Remedial Action Report / Corrective Action Report - Regulator Responded				
Action Date:		6/29/2023				
Received Issue Date:		6/29/2023				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6100143				
Title Description Comments:		Water Replacement Contingency Plan				
Action Type:		Response Requested - Reports				
Action:		Monitoring Report - Semi-Annually				
Action Date:		6/16/2023				
Received Issue Date:		6/16/2023				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6099419				
Title Description Comments:		First Semiannual Groundwater Monitoring Report 2023				
Action Type:		Other Regulatory Actions				
Action:		Staff Letter				
Action Date:		6/8/2023				
Received Issue Date:		6/8/2023				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6547195&temptable=ENFORCEMENT				
Title Description Comments:		San Diego Water Board Response				
Action Type:		Response Requested - Reports				
Action:		Final Remedial Action Report / Corrective Action Report - Regulator Responded				
Action Date:		5/26/2023				
Received Issue Date:		5/26/2023				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6098082				
Title Description Comments:		Water Replacement Contingency Plan				
Action Type:		Other Regulatory Actions				
Action:		Staff Letter				
Action Date:		5/22/2023				
Received Issue Date:		5/22/2023				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6542461&temptable=ENFORCEMENT				
Title Description Comments:		San Diego Water Board Response				
Action Type:		Other Regulatory Actions				

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Action:		Staff Letter				
Action Date:		5/15/2023				
Received Issue Date:		5/15/2023				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents? global_id=T0607391310&enforcement_id=6541738&temptable=ENFORCEMENT				
Title Description Comments:						
San Diego Water Board Response to Contingency Plan						
Action Type:		Response Requested - Reports				
Action:		Monitoring Report - Semi-Annually - Regulator Responded				
Action Date:		4/28/2023				
Received Issue Date:		4/28/2023				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6095288				
Title Description Comments:						
First Semiannual Groundwater Monitoring Report 2023						
Action Type:		Enforcement/Orders				
Action:		Clean-up and Abatement Order				
Action Date:		4/24/2023				
Received Issue Date:		4/24/2023				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents? global_id=T0607391310&enforcement_id=6551059&temptable=ENFORCEMENT				
Title Description Comments:						
Tentative Cleanup and Abatement Order						
Action Type:		Response Requested - Reports				
Action:		Final Remedial Action Report / Corrective Action Report - Regulator Responded				
Action Date:		4/21/2023				
Received Issue Date:		4/21/2023				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6094730				
Title Description Comments:						
Water Replacement Contingency Plan						
Action Type:		Other Regulatory Actions				
Action:		Staff Letter				
Action Date:		3/17/2023				
Received Issue Date:		3/17/2023				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents? global_id=T0607391310&enforcement_id=6534627&temptable=ENFORCEMENT				
Title Description Comments:						
San Diego Water Board Response Letter						
Action Type:		Response Requested - Workplans				
Action:		Corrective Action Plan / Remedial Action Plan - Regulator Responded				
Action Date:		2/28/2023				
Received Issue Date:		2/28/2023				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6091270				
Title Description Comments:						
Water Replacement Contingency Plan						
Action Type:		Other Regulatory Actions				
Action:		Email Correspondence				
Action Date:		10/24/2022				
Received Issue Date:		10/24/2022				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents? global_id=T0607391310&enforcement_id=6520370&temptable=ENFORCEMENT				
Title Description Comments:						
San Diego Update on damaged water supply wells						

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Action Type: Other Regulatory Actions
Action: Staff Letter
Action Date: 10/7/2022
Received Issue Date: 10/7/2022
Doc Link: https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6508170&temptable=ENFORCEMENT

Title Description Comments:

San Diego Water Board Response Letter

Action Type: Response Requested - Reports
Action: Monitoring Report - Semi-Annually - Regulator Responded
Action Date: 9/26/2022
Received Issue Date: 9/26/2022
Doc Link: https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6080682

Title Description Comments:

2022 First Semiannual Groundwater Monitoring Report

Action Type: Other Regulatory Actions
Action: Staff Letter
Action Date: 5/23/2022
Received Issue Date: 5/23/2022
Doc Link: https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6495286&temptable=ENFORCEMENT

Title Description Comments:

San Diego Water Board Response to Revised Work Plan

Action Type: Response Requested - Workplans
Action: Soil and Water Investigation Workplan - Regulator Responded
Action Date: 5/19/2022
Received Issue Date: 5/19/2022
Doc Link: https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6073675

Title Description Comments:

Stars GW Monitoring and Analysis Plan 05172022

Action Type: Other Regulatory Actions
Action: Staff Letter
Action Date: 5/5/2022
Received Issue Date: 5/5/2022
Doc Link: https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6493884&temptable=ENFORCEMENT

Title Description Comments:

San Diego Water Board Comment Letter

Action Type: Response Requested - Workplans
Action: Other Workplan - Regulator Responded
Action Date: 3/31/2022
Received Issue Date: 3/31/2022
Doc Link: https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6071111

Title Description Comments:

Groundwater Monitoring and Analysis Plan

Action Type: Response Requested - Reports
Action: Monitoring Report - Semi-Annually
Action Date: 6/1/2021
Received Issue Date: 6/1/2021
Doc Link: https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6051246

Title Description Comments:

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

FIRST HALF 2021 SEMI-ANNUAL GROUNDWATER MONITORING REPORT

Action Type: Response Requested - Reports
Action: Site Assessment Report
Action Date: 5/5/2021
Received Issue Date: 5/5/2021
Doc Link: https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6049652
Title Description Comments:

Residential Well Sampling Report for Home at 2108 La Brea Street, Ramona, CA

Action Type: Other Regulatory Actions
Action: Meeting
Action Date: 5/3/2021
Received Issue Date: 5/3/2021
Doc Link:
Title Description Comments:

Project Status San Diego Water Board to receive suspected well owner information and related figures the week of May 3, 2021.

Action Type: Response Requested - Other
Action: Correspondence
Action Date: 5/3/2021
Received Issue Date: 5/3/2021
Doc Link: https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6049187
Title Description Comments:

Residential Well Inventory Report

Action Type: Response Requested - Reports
Action: Well Installation Report
Action Date: 4/13/2021
Received Issue Date: 4/13/2021
Doc Link: https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6048497
Title Description Comments:

WELL INSTALLATION REPORT (MW-24 & MW-25)

Action Type: Other Regulatory Actions
Action: Email Correspondence
Action Date: 1/15/2021
Received Issue Date: 1/15/2021
Doc Link: https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6455560&temptable=ENFORCEMENT
Title Description Comments:

San Diego Water Board Response to Revised Workplan

Action Type: Response Requested - Workplans
Action: Well Installation Workplan - Regulator Responded
Action Date: 11/6/2020
Received Issue Date: 11/6/2020
Doc Link: https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6039996
Title Description Comments:

Revised Workplan for Additional Offsite Groundwater Well Installations (MW24 and MW25), Ongoing Limited Groundwater Monitoring Events, and Public Inquiries

Action Type: Other Regulatory Actions
Action: Technical Correspondence / Assistance / Other
Action Date: 10/15/2020
Received Issue Date: 10/15/2020
Doc Link: https://geotracker.waterboards.ca.gov/view_documents?

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
global_id=T0607391310&enforcement_id=6449752&temptable=ENFORCEMENT						
Title Description Comments:						
San Diego Water Board Response to Workplan						
Action Type: Response Requested - Workplans						
Action: Well Installation Workplan - Regulator Responded						
Action Date: 9/28/2020						
Received Issue Date: 9/28/2020						
Doc Link: https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6032638						
Title Description Comments:						
Workplan for Additional Offsite Groundwater Well Installations (MW24 and MW25), Ongoing Limited Groundwater Monitoring Events, and Public Inquiries						
Action Type: Other Regulatory Actions						
Action: Email Correspondence						
Action Date: 9/1/2020						
Received Issue Date: 9/1/2020						
Doc Link: https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6448780&temptable=ENFORCEMENT						
Title Description Comments:						
TRG Position Regarding Private Well Ownership Inquiries						
Action Type: Response Requested - Reports						
Action: Remedial Progress Report						
Action Date: 7/2/2020						
Received Issue Date: 7/2/2020						
Doc Link: https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6026748						
Title Description Comments:						
REMEDIATION STATUS REPORT APRIL THOROUGH JUNE 2020 NON-OPERATIONAL						
Action Type: Response Requested - Reports						
Action: Monitoring Report - Semi-Annually						
Action Date: 6/22/2020						
Received Issue Date: 6/22/2020						
Doc Link: https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6026350						
Title Description Comments:						
SEMI-ANNUAL GROUNDWATER MONITORING REPORT FIRST HALF 2020						
Action Type: Response Requested - Reports						
Action: Sensitive Receptor Survey Report						
Action Date: 5/18/2020						
Received Issue Date: 5/18/2020						
Doc Link: https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6023677						
Title Description Comments:						
Summary of Suspected Private Use Water Wells in Site Vicinity						
Action Type: Response Requested - Other						
Action: Correspondence						
Action Date: 5/1/2020						
Received Issue Date: 5/1/2020						
Doc Link: https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6021755						
Title Description Comments:						
Email to Water Board with Well Photos						
Action Type: Response Requested - Other						
Action: Correspondence						
Action Date: 5/1/2020						

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Received Issue Date:		5/1/2020				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6021757				
Title Description Comments:		Email to Water Board with Manifest				
Action Type:		Response Requested - Reports				
Action:		Remedial Progress Report				
Action Date:		4/29/2020				
Received Issue Date:		4/29/2020				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6021759				
Title Description Comments:		REMEDATION STATUS REPORT JANUARY THROUGH APRIL 2020 -NON-OPERATIONAL				
Action Type:		Response Requested - Reports				
Action:		Soil and Water Investigation Report				
Action Date:		4/6/2020				
Received Issue Date:		4/6/2020				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6021761				
Title Description Comments:		Off-Site Assessment Report (HP19, HP20, HP21)				
Action Type:		Other Regulatory Actions				
Action:		Email Correspondence				
Action Date:		3/12/2020				
Received Issue Date:		3/12/2020				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6433661&temptable=ENFORCEMENT				
Title Description Comments:		Water well search radius				
Action Type:		Other Regulatory Actions				
Action:		Technical Correspondence / Assistance / Other				
Action Date:		3/12/2020				
Received Issue Date:		3/12/2020				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6433663&temptable=ENFORCEMENT				
Title Description Comments:		Limited Site Inspection				
Action Type:		Response Requested - Reports				
Action:		Remedial Progress Report				
Action Date:		1/17/2020				
Received Issue Date:		1/17/2020				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6014100				
Title Description Comments:		REMEDATION STATUS REPORT OCTOBER THROUGH DECEMBER 2019 NON-OPERATIONAL				
Action Type:		Response Requested - Reports				
Action:		Monitoring Report - Semi-Annually				
Action Date:		12/27/2019				
Received Issue Date:		12/27/2019				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6013102				
Title Description Comments:		GROUNDWATER MONITORING REPORT 2ND HALF 2019				
Action Type:		Other Regulatory Actions				
Action:		Email Correspondence				

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Action Date:		11/15/2019				
Received Issue Date:		11/15/2019				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6423160&temptable=ENFORCEMENT				
Title Description Comments:		Water Board response to upcoming sampling and new wells				
Action Type:		Response Requested - Reports				
Action:		Remedial Progress Report				
Action Date:		10/4/2019				
Received Issue Date:		10/4/2019				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6005743				
Title Description Comments:		REMEDICATION STATUS REPORT APRIL THROUGH SEPTEMBER 2019- NON OPERATIONAL				
Action Type:		Referral to Other Agency				
Action:		Referral to Regional Board				
Action Date:		10/3/2019				
Received Issue Date:		10/3/2019				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6416470&temptable=ENFORCEMENT				
Title Description Comments:		DEH Transfer Letter				
Action Type:		Response Requested - Reports				
Action:		Remedial Progress Report				
Action Date:		4/30/2019				
Received Issue Date:		4/1/2019				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5990050				
Title Description Comments:		Remediation Progress Report (July 23, 2018 to February 19, 2019)				
Action Type:		Response Requested - Reports				
Action:		Monitoring Report - Quarterly				
Action Date:		4/30/2019				
Received Issue Date:		2/20/2019				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5987993				
Title Description Comments:		Groundwater Monitoring Report Q1-2019				
Action Type:		Other Regulatory Actions				
Action:		Technical Correspondence / Assistance / Other				
Action Date:		3/28/2019				
Received Issue Date:		3/28/2019				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6397653&temptable=ENFORCEMENT				
Title Description Comments:		Workplan for Additional Offsite Groundwater Assessment and Well Installation				
Action Type:		Response Requested - Workplans				
Action:		Well Installation Workplan - Regulator Responded				
Action Date:		2/11/2019				
Received Issue Date:		2/11/2019				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5986586				
Title Description Comments:		Workplan for Additional Offsite Groundwater Assessment				

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Action Type:		Response Requested - Other				
Action:		Other Report / Document				
Action Date:		12/5/2018				
Received Issue Date:		12/5/2018				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5982856				
Title Description Comments:						
Summary of Offsite Well Research						
Action Type:		Response Requested - Reports				
Action:		Remedial Progress Report				
Action Date:		10/30/2018				
Received Issue Date:		9/21/2018				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5975770				
Title Description Comments:						
Remediation Progress Report (March 17 to July 22, 2018)						
Action Type:		Response Requested - Reports				
Action:		Monitoring Report - Quarterly - Regulator Responded				
Action Date:		10/30/2018				
Received Issue Date:		9/21/2018				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5975769				
Title Description Comments:						
Groundwater Monitoring Report Q3-2018						
Action Type:		Other Regulatory Actions				
Action:		Email Correspondence				
Action Date:		10/19/2018				
Received Issue Date:		10/19/2018				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6372935&temptable=ENFORCEMENT				
Title Description Comments:						
Reduction of groundwater monitoring frequency						
Action Type:		Other Regulatory Actions				
Action:		Clean Up Fund - Case Closure Review Summary Report (RSR)				
Action Date:		10/3/2018				
Received Issue Date:		10/3/2018				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6389098&temptable=ENFORCEMENT				
Title Description Comments:						
16226 5th RSR Rationale for Additional Work Octoer 2018						
Action Type:		Response Requested - Reports				
Action:		Monitoring Report - Quarterly				
Action Date:		4/30/2018				
Received Issue Date:		3/26/2018				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5965706				
Title Description Comments:						
Groundwater Monitoring Report Q1-2018						
Action Type:		Response Requested - Reports				
Action:		Remedial Progress Report				
Action Date:		3/19/2018				
Received Issue Date:		3/19/2018				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5960104				
Title Description Comments:						
Remediation Status Report						

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Action Type:		Response Requested - Reports				
Action:		Remedial Progress Report				
Action Date:		1/30/2018				
Received Issue Date:		2/14/2018				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5957227				
Title Description Comments:		Remedial Progress Report December 2017 to February 8, 2018				
Action Type:		Response Requested - Reports				
Action:		Well Installation Report				
Action Date:		1/26/2018				
Received Issue Date:		1/26/2018				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5965703				
Title Description Comments:		Well Installation Report				
Action Type:		Response Requested - Reports				
Action:		Remedial Progress Report				
Action Date:		12/8/2017				
Received Issue Date:		12/8/2017				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5950132				
Title Description Comments:		Remediation Progress Report July 16 to November 30, 2017				
Action Type:		Response Requested - Reports				
Action:		Monitoring Report - Quarterly				
Action Date:		10/30/2017				
Received Issue Date:		10/3/2017				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5945792				
Title Description Comments:		Groundwater Monitoring Report Q3-2017				
Action Type:		Other Regulatory Actions				
Action:		Technical Correspondence / Assistance / Other				
Action Date:		10/20/2017				
Received Issue Date:		10/20/2017				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6339575&temptable=ENFORCEMENT				
Title Description Comments:		CAP Addendum Concurrence				
Action Type:		Response Requested - Reports				
Action:		CAP/RAP - Other Report - Regulator Responded				
Action Date:		8/21/2017				
Received Issue Date:		8/21/2017				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5941751				
Title Description Comments:		CAP Addendum				
Action Type:		Response Requested - Reports				
Action:		Remedial Progress Report				
Action Date:		7/30/2017				
Received Issue Date:		7/18/2017				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5933657				
Title Description Comments:		Remediation Progress Report February 22 to July 15, 2017				

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Action Type:		Response Requested - Reports				
Action:		Monitoring Report - Quarterly				
Action Date:		7/30/2017				
Received Issue Date:		6/5/2017				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5923580				
Title Description Comments:		Groundwater Monitoring Report Q2-2017				
Action Type:		Response Requested - Reports				
Action:		Monitoring Report - Quarterly				
Action Date:		7/30/2017				
Received Issue Date:		3/27/2017				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5917255				
Title Description Comments:		Groundwater Monitoring Report Q1-2017				
Action Type:		Other Regulatory Actions				
Action:		Technical Correspondence / Assistance / Other				
Action Date:		5/18/2017				
Received Issue Date:		5/18/2017				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6320417&temptable=ENFORCEMENT				
Title Description Comments:		Additional Off-Site Groundwater Assessment Report & Well Installation Workplan				
Action Type:		Response Requested - Workplans				
Action:		Well Installation Workplan - Regulator Responded				
Action Date:		4/28/2017				
Received Issue Date:		5/3/2017				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5919799				
Title Description Comments:		Additional Off-Site Groundwater Assessment Report & Well Installation Workplan				
Action Type:		Other Regulatory Actions				
Action:		Email Correspondence				
Action Date:		2/23/2017				
Received Issue Date:		2/23/2017				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6312518&temptable=ENFORCEMENT				
Title Description Comments:		DEH email response: Revised hydropunch locations				
Action Type:		Response Requested - Reports				
Action:		Remedial Progress Report				
Action Date:		2/22/2017				
Received Issue Date:		2/22/2017				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5914148				
Title Description Comments:		Remediation Progress Report August 11, 2016 to February 17, 2017				
Action Type:		Response Requested - Reports				
Action:		Monitoring Report - Quarterly				
Action Date:		1/30/2017				
Received Issue Date:		2/22/2017				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5914151				
Title Description Comments:						

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Groundwater Monitoring Report Q4-2016

Action Type: Response Requested - Reports
Action: Monitoring Report - Quarterly
Action Date: 10/30/2016
Received Issue Date: 10/17/2016
Doc Link: https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5903965
Title Description Comments:

Groundwater Monitoring Report Q3-2016

Action Type: Other Regulatory Actions
Action: Technical Correspondence / Assistance / Other
Action Date: 10/19/2016
Received Issue Date: 10/19/2016
Doc Link: https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6301519&temptable=ENFORCEMENT
Title Description Comments:

DEH Response: Offsite Access Request letter

Action Type: Other Regulatory Actions
Action: Email Correspondence
Action Date: 10/11/2016
Received Issue Date: 10/11/2016
Doc Link: https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6300643&temptable=ENFORCEMENT
Title Description Comments:

DEH email response: Hydropunch relocations

Action Type: Response Requested - Reports
Action: Remedial Progress Report
Action Date: 8/11/2016
Received Issue Date: 8/11/2016
Doc Link: https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5897968
Title Description Comments:

Remediation Progress Report March 23 to August 10, 2016

Action Type: Response Requested - Reports
Action: Monitoring Report - Semi-Annually
Action Date: 7/30/2016
Received Issue Date: 7/25/2016
Doc Link: https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5896455
Title Description Comments:

Groundwater Monitoring Report Q2-2016

Action Type: Response Requested - Workplans
Action: Well Installation Workplan - Regulator Responded
Action Date: 7/29/2016
Received Issue Date: 8/10/2016
Doc Link: https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5897929
Title Description Comments:

Work Plan for Additional Downgradient Groundwater Assessment & Well Installation

Action Type: Other Regulatory Actions
Action: Clean Up Fund - Case Closure Review Summary Report (RSR)
Action Date: 6/27/2016
Received Issue Date: 6/27/2016
Doc Link: https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6388965&temptable=ENFORCEMENT

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Title Description Comments:

16226 4th RSR Additional Work June 2016

Action Type: Response Requested - Reports
Action: Site Assessment Report - Regulator Responded
Action Date: 6/24/2016
Received Issue Date: 6/24/2016
Doc Link: https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5896175

Title Description Comments:

Additional Off-site Groundwater Assessment Report - DEH concurs that the extent of downgradient MTBE groundwater impact remains undefined and a work plan for additional offsite downgradient assessment shall be submitted.

Action Type: Response Requested - Reports
Action: Monitoring Report - Quarterly
Action Date: 4/30/2016
Received Issue Date: 4/28/2016
Doc Link: https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5887763

Title Description Comments:

Groundwater Monitoring Report Q1-2016

Action Type: Response Requested - Reports
Action: Remedial Progress Report
Action Date: 4/30/2016
Received Issue Date: 4/28/2016
Doc Link: https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5887760

Title Description Comments:

Remediation Progress Report 12/18/15-3/22/2016

Action Type: Response Requested - Workplans
Action: Soil and Water Investigation Workplan - Regulator Responded
Action Date: 3/9/2016
Received Issue Date: 4/9/2016
Doc Link: https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5887948

Title Description Comments:

Workplan For Additional Offsite Downgradient Groundwater Plume Delineation

Action Type: Response Requested - Reports
Action: Site Assessment Report
Action Date: 3/7/2016
Received Issue Date: 4/28/2016
Doc Link: https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5887777

Title Description Comments:

Additional Off-Site Groundwater Assessment Report - DEH concurs that further assessment of the offsite MTBE groundwater plume is warranted. A work plan for further assessment was submitted concurrently and is pending review.

Action Type: Response Requested - Reports
Action: Monitoring Report - Quarterly
Action Date: 1/30/2016
Received Issue Date: 2/15/2016
Doc Link: https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5887747

Title Description Comments:

Groundwater Monitoring Report Q4-2015

Action Type: Response Requested - Reports
Action: Remedial Progress Report
Action Date: 1/30/2016
Received Issue Date: 2/15/2016

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5887722				
Title Description Comments:						
Remediation Progress Report 9/18/15-12/17/15						
Action Type:		Response Requested - Reports				
Action:		Remedial Progress Report				
Action Date:		10/30/2015				
Received Issue Date:		11/20/2015				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5887719				
Title Description Comments:						
Remediation Progress Report 6/16/15 to 9/18/15						
Action Type:		Response Requested - Reports				
Action:		Monitoring Report - Quarterly				
Action Date:		10/30/2015				
Received Issue Date:		11/9/2015				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5887660				
Title Description Comments:						
Groundwater Monitoring Report Q3-2015						
Action Type:		Response Requested - Workplans				
Action:		Soil and Water Investigation Workplan - Regulator Responded				
Action Date:		9/8/2015				
Received Issue Date:		10/15/2015				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5865856				
Title Description Comments:						
Workplan For Additional Offsite Downgradient Groundwater Plume Delineation and Contingency Well Installation						
Action Type:		Other Regulatory Actions				
Action:		Clean Up Fund - Case Closure Review Summary Report (RSR)				
Action Date:		8/20/2015				
Received Issue Date:		8/20/2015				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6395245&temptable=ENFORCEMENT				
Title Description Comments:						
Review Summary Report, August 2015						
Action Type:		Response Requested - Reports				
Action:		Monitoring Report - Quarterly				
Action Date:		7/30/2015				
Received Issue Date:		9/18/2015				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5887659				
Title Description Comments:						
Groundwater Monitoring Report Q2-2015						
Action Type:		Response Requested - Reports				
Action:		Remedial Progress Report				
Action Date:		7/30/2015				
Received Issue Date:		9/10/2015				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5887658				
Title Description Comments:						
Remedial Progress Report (April 1 to June 16, 2015)						
Action Type:		Response Requested - Reports				
Action:		Remedial Progress Report				
Action Date:		4/30/2015				
Received Issue Date:		7/17/2015				

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5887654				
Title Description Comments:						
Remediation Progress Report - November 1, 2014 to March 31, 2015						
Action Type:		Response Requested - Reports				
Action:		Monitoring Report - Quarterly				
Action Date:		4/30/2015				
Received Issue Date:		7/7/2015				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5887645				
Title Description Comments:						
Groundwater Monitoring Report Q1-2015						
Action Type:		Response Requested - Reports				
Action:		Remedial Progress Report - Regulator Responded				
Action Date:		1/31/2015				
Received Issue Date:		1/19/2015				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5828343				
Title Description Comments:						
Remediation Progress Report - July through December 2014						
Action Type:		Response Requested - Reports				
Action:		Monitoring Report - Quarterly				
Action Date:		10/30/2014				
Received Issue Date:		10/29/2014				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5821876				
Title Description Comments:						
Groundwater Monitoring and Sampling Q3-2014						
Action Type:		Response Requested - Reports				
Action:		Monitoring Report - Quarterly				
Action Date:		7/30/2014				
Received Issue Date:		6/27/2014				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5821875				
Title Description Comments:						
Groundwater Monitoring and Sampling Q2-2014						
Action Type:		Response Requested - Reports				
Action:		Monitoring Report - Quarterly				
Action Date:		4/30/2014				
Received Issue Date:		4/11/2014				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5821873				
Title Description Comments:						
Groundwater Monitoring and Sampling Q1-2014						
Action Type:		Other Regulatory Actions				
Action:		Technical Correspondence / Assistance / Other				
Action Date:		1/31/2014				
Received Issue Date:		1/31/2014				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6190755&temptable=ENFORCEMENT				
Title Description Comments:						
CAP Concurrence						
Action Type:		Response Requested - Reports				
Action:		Monitoring Report - Quarterly				
Action Date:		1/30/2014				
Received Issue Date:		1/6/2014				

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5796145				
Title Description Comments:						
Groundwater Monitoring and Sampling Q4-2013						
Action Type:		Other Regulatory Actions				
Action:		Technical Correspondence / Assistance / Other				
Action Date:		12/9/2013				
Received Issue Date:		12/9/2013				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6190748&temptable=ENFORCEMENT				
Title Description Comments:						
CAP: Public Notification letter, list of recipients, parcel map,						
Action Type:		Other Regulatory Actions				
Action:		Technical Correspondence / Assistance / Other				
Action Date:		11/5/2013				
Received Issue Date:		11/5/2013				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6181458&temptable=ENFORCEMENT				
Title Description Comments:						
Conditional Concurrence of Corrective Action Plan						
Action Type:		Other Regulatory Actions				
Action:		Technical Correspondence / Assistance / Other				
Action Date:		11/5/2013				
Received Issue Date:		11/5/2013				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6181457&temptable=ENFORCEMENT				
Title Description Comments:						
Response to Quarterly Groundwater Monitoring Report 3rd Quarter 2013						
Action Type:		Response Requested - Workplans				
Action:		Corrective Action Plan / Remedial Action Plan - Regulator Responded				
Action Date:		10/21/2013				
Received Issue Date:		10/21/2013				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5786639				
Title Description Comments:						
Corrective Action Plan, Revision #2 - See Conditional Concurrence of Corrective Action Plan dated 11/5/2013.						
Action Type:		Response Requested - Reports				
Action:		Monitoring Report - Quarterly - Regulator Responded				
Action Date:		10/14/2013				
Received Issue Date:		10/14/2013				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5785824				
Title Description Comments:						
Quarterly Groundwater Monitoring Report 3rd Quarter 2013 - See Response Letter dated 11/5/2013.						
Action Type:		Other Regulatory Actions				
Action:		Technical Correspondence / Assistance / Other				
Action Date:		9/11/2013				
Received Issue Date:		9/11/2013				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6174928&temptable=ENFORCEMENT				
Title Description Comments:						
Reponse to Revised Corrective Action Plan						
Action Type:		Response Requested - Workplans				

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Action:		Corrective Action Plan / Remedial Action Plan - Regulator Responded				
Action Date:		7/18/2013				
Received Issue Date:		7/18/2013				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5775980				
Title Description Comments:						
Revised Corrective Action Plan - See DEH Response Letter dated 9/11/2013.						
Action Type:		Other Regulatory Actions				
Action:		Technical Correspondence / Assistance / Other				
Action Date:		7/12/2013				
Received Issue Date:		7/12/2013				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6167151&temptable=ENFORCEMENT				
Title Description Comments:						
Response to Quarterly Groundwater Monitoring Report 2nd Quarter 2013						
Action Type:		Response Requested - Reports				
Action:		Monitoring Report - Quarterly - Regulator Responded				
Action Date:		5/22/2013				
Received Issue Date:		5/22/2013				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5771532				
Title Description Comments:						
Quarterly Groundwater Monitoring Report 2nd Quarter 2013 - See DEH response letter dated 7/12/2013.						
Action Type:		Other Regulatory Actions				
Action:		Technical Correspondence / Assistance / Other				
Action Date:		4/9/2013				
Received Issue Date:		4/9/2013				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6154629&temptable=ENFORCEMENT				
Title Description Comments:						
Response to Quarterly Groundwater Monitoring Report, 1st Quarter 2013						
Action Type:		Response Requested - Reports				
Action:		Monitoring Report - Quarterly - Regulator Responded				
Action Date:		3/20/2013				
Received Issue Date:		3/20/2013				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5765377				
Title Description Comments:						
Quarterly Groundwater Monitoring Report, 1st Quarter 2013 - See DEH response letter dated 4/9/2013.						
Action Type:		Other Regulatory Actions				
Action:		Technical Correspondence / Assistance / Other				
Action Date:		12/7/2012				
Received Issue Date:		12/7/2012				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6144457&temptable=ENFORCEMENT				
Title Description Comments:						
Response to Quarterly Groundwater Monitoring Report 4th Quarter 2012						
Action Type:		Response Requested - Reports				
Action:		Monitoring Report - Quarterly - Regulator Responded				
Action Date:		11/26/2012				
Received Issue Date:		11/26/2012				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5758085				
Title Description Comments:						
Quarterly Groundwater Monitoring Report 4th Quarter 2012 - See DEH response letter dated 12/7/2013.						

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Action Type:		Other Regulatory Actions				
Action:		Technical Correspondence / Assistance / Other				
Action Date:		10/9/2012				
Received Issue Date:		10/9/2012				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6139549&temptable=ENFORCEMENT				
Title Description Comments:						
Response to Quarterly Groundwater Monitoring Report 3rd Quarter 2012						
Action Type:		Response Requested - Reports				
Action:		Monitoring Report - Quarterly - Regulator Responded				
Action Date:		9/27/2012				
Received Issue Date:		9/27/2012				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5753537				
Title Description Comments:						
Quarterly Groundwater Monitoring Report 3rd Quarter 2012						
Action Type:		Other Regulatory Actions				
Action:		Clean Up Fund - Case Closure Review Summary Report (RSR)				
Action Date:		5/10/2012				
Received Issue Date:		5/10/2012				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6394335&temptable=ENFORCEMENT				
Title Description Comments:						
USTCF 5-Year Review Summary, 2nd Review - May 2012						
Action Type:		Other Regulatory Actions				
Action:		Technical Correspondence / Assistance / Other				
Action Date:		4/23/2012				
Received Issue Date:		4/23/2012				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6119725&temptable=ENFORCEMENT				
Title Description Comments:						
Response to Groundwater Well Installation Report						
Action Type:		Response Requested - Reports				
Action:		Well Installation Report - Regulator Responded				
Action Date:		4/4/2012				
Received Issue Date:		4/4/2012				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5734308				
Title Description Comments:						
Groundwater Well Installation Report						
Action Type:		Other Regulatory Actions				
Action:		Technical Correspondence / Assistance / Other				
Action Date:		12/14/2011				
Received Issue Date:		12/14/2011				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6106196&temptable=ENFORCEMENT				
Title Description Comments:						
Response to Additional Groundwater Assessment Report						
Action Type:		Other Regulatory Actions				
Action:		Clean Up Fund - Case Closure Review Summary Report (RSR)				
Action Date:		12/13/2011				
Received Issue Date:		12/13/2011				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6393391&temptable=ENFORCEMENT				

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Title Description Comments:						
1st 5-year review						
Action Type:	Response Requested - Reports					
Action:	Site Assessment Report - Regulator Responded					
Action Date:	11/14/2011					
Received Issue Date:	11/14/2011					
Doc Link:	https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5725536					
Title Description Comments:						
Additional Groundwater Assessment Report						
Action Type:	Other Regulatory Actions					
Action:	Technical Correspondence / Assistance / Other					
Action Date:	9/22/2011					
Received Issue Date:	9/22/2011					
Doc Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6099185&temptable=ENFORCEMENT					
Title Description Comments:						
Response to Semi-Annual Groundwater Monitoring Report Second Half 2011						
Action Type:	Response Requested - Reports					
Action:	Monitoring Report - Semi-Annually - Regulator Responded					
Action Date:	8/29/2011					
Received Issue Date:	8/29/2011					
Doc Link:	https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5721167					
Title Description Comments:						
Semi-Annual Groundwater Monitoring Report Second Half 2011						
Action Type:	Other Regulatory Actions					
Action:	Technical Correspondence / Assistance / Other					
Action Date:	6/29/2011					
Received Issue Date:	6/29/2011					
Doc Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6090825&temptable=ENFORCEMENT					
Title Description Comments:						
Response to Additional Groundwater Assessment and Well Installation Report						
Action Type:	Response Requested - Reports					
Action:	Site Assessment Report - Regulator Responded					
Action Date:	6/17/2011					
Received Issue Date:	6/17/2011					
Doc Link:	https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5715434					
Title Description Comments:						
Additional Groundwater Assessment and Well Installation Report						
Action Type:	Response Requested - Other					
Action:	Other Report / Document					
Action Date:	5/9/2011					
Received Issue Date:	5/9/2011					
Doc Link:	https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5712941					
Title Description Comments:						
Response to SDDEH Letter Dated 4-20-11						
Action Type:	Other Regulatory Actions					
Action:	Clean Up Fund - Case Closure Review Summary Report (RSR)					
Action Date:	5/3/2011					
Received Issue Date:	5/3/2011					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6392650&temptable=ENFORCEMENT				
Title Description Comments:						
Action Type:		Other Regulatory Actions				
Action:		Technical Correspondence / Assistance / Other				
Action Date:		4/27/2011				
Received Issue Date:		4/27/2011				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6085033&temptable=ENFORCEMENT				
Title Description Comments:						
		Response to Hydropunch Data and Proposed Monitoring Well and Additional Hydropunch Locations				
Action Type:		Other Regulatory Actions				
Action:		Technical Correspondence / Assistance / Other				
Action Date:		4/20/2011				
Received Issue Date:		4/20/2011				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6084108&temptable=ENFORCEMENT				
Title Description Comments:						
		Response to Semi-Annual Groundwater Monitoring Report First Half 2011				
Action Type:		Response Requested - Reports				
Action:		Monitoring Report - Semi-Annually - Regulator Responded				
Action Date:		4/5/2011				
Received Issue Date:		4/5/2011				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5710185				
Title Description Comments:						
		Semi-Annual Groundwater Monitoring Report First Half 2011				
Action Type:		Other Regulatory Actions				
Action:		Technical Correspondence / Assistance / Other				
Action Date:		3/21/2011				
Received Issue Date:		3/21/2011				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6081152&temptable=ENFORCEMENT				
Title Description Comments:						
		Response to CAP				
Action Type:		Other Regulatory Actions				
Action:		Technical Correspondence / Assistance / Other				
Action Date:		3/17/2011				
Received Issue Date:		3/17/2011				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6081007&temptable=ENFORCEMENT				
Title Description Comments:						
		Response to Pilot Test Report				
Action Type:		Other Regulatory Actions				
Action:		Technical Correspondence / Assistance / Other				
Action Date:		3/16/2011				
Received Issue Date:		3/16/2011				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6080838&temptable=ENFORCEMENT				
Title Description Comments:						
		Response to Human Health Vapor Risk Assessment Report				
Action Type:		Notices				

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Action: Action Date: Received Issue Date: Doc Link:		Letter - Notice 3/3/2011 3/3/2011 https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6079838&temptable=ENFORCEMENT				
Title Description Comments:		Neighbor Notification				
Action Type: Action: Action Date: Received Issue Date: Doc Link:		Response Requested - Workplans Corrective Action Plan / Remedial Action Plan - Regulator Responded 2/16/2011 2/16/2011 https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5707619				
Title Description Comments:		Corrective Action Plan				
Action Type: Action: Action Date: Received Issue Date: Doc Link:		Response Requested - Reports Pilot Study/ Treatability Report - Regulator Responded 12/25/2010 10/25/2010 https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5703209				
Title Description Comments:		Pilot Test Report				
Action Type: Action: Action Date: Received Issue Date: Doc Link:		Response Requested - Reports Risk Assessment Report - Regulator Responded 10/12/2010 8/13/2010 https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5699187				
Title Description Comments:		Human Health Vapor Risk Assessment Report				
Action Type: Action: Action Date: Received Issue Date: Doc Link:		Other Regulatory Actions Technical Correspondence / Assistance / Other 3/11/2010 3/11/2010 https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6045008&temptable=ENFORCEMENT				
Title Description Comments:		Work Plan and Addendum Approval letter.				
Action Type: Action: Action Date: Received Issue Date: Doc Link:		Response Requested - Workplans Soil and Water Investigation Workplan - Addendum 2/17/2010 2/17/2010 https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5662980				
Title Description Comments:		Supplement to Work Plan for Pilot Testing and Interim Remedial Action Plan, Dated October 21, 2009. - Reviewed workplan addendum.				
Action Type: Action: Action Date: Received Issue Date: Doc Link:		Other Regulatory Actions Technical Correspondence / Assistance / Other 12/23/2009 12/23/2009				
Title Description Comments:		Workplan approval letter for pilot testing				

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Action Type:		Other Regulatory Actions				
Action:		Technical Correspondence / Assistance / Other				
Action Date:		12/23/2009				
Received Issue Date:		12/23/2009				
Doc Link:						
Title Description Comments:						
Telcon with consultant to discuss workplan for pilot testing						
Action Type:		Other Regulatory Actions				
Action:		Technical Correspondence / Assistance / Other				
Action Date:		12/23/2009				
Received Issue Date:		12/23/2009				
Doc Link:						
Title Description Comments:						
Email to consultant requesting addendum to work plan						
Action Type:		Response Requested - Reports				
Action:		Monitoring Report - Semi-Annually				
Action Date:		10/30/2009				
Received Issue Date:		10/29/2009				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5657660				
Title Description Comments:						
Groundwater Monitoring and Status Report Third Quarter 2009 - Reviewed 12/22/2009						
Action Type:		Response Requested - Workplans				
Action:		Pilot Study / Treatability Workplan - Regulator Responded				
Action Date:		10/30/2009				
Received Issue Date:		10/29/2009				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=5657739				
Title Description Comments:						
Workplan for Pilot Testing and Interim Remedial Action Plan - Reviewed 12/23/2009						
Action Type:		Other Regulatory Actions				
Action:		Technical Correspondence / Assistance / Other				
Action Date:		8/5/2009				
Received Issue Date:		8/5/2009				
Doc Link:						
Title Description Comments:						
Telephone discussion with new consultant the Reynolds Group.						
Action Type:		Notices				
Action:		Letter - Notice				
Action Date:		7/29/2009				
Received Issue Date:		7/29/2009				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6028307&temptable=ENFORCEMENT				
Title Description Comments:						
Past Due Notice						
Action Type:		Enforcement/Orders				
Action:		Verbal Enforcement				
Action Date:		7/29/2009				
Received Issue Date:		7/29/2009				
Doc Link:						
Title Description Comments:						
Telephone conversation with RP regarding lack of work.						

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Action Type:		Notices				
Action:		Letter - Notice				
Action Date:		7/9/2009				
Received Issue Date:		7/9/2009				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents? global_id=T0607391310&enforcement_id=6024067&temptable=ENFORCEMENT				
Title Description Comments:						
Action Type:		Response Requested - Other				
Action:		Unauthorized Release Form				
Action Date:		10/25/2000				
Received Issue Date:		10/25/2000				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6060104				
Title Description Comments:						
UST Unauthorized Release Contamination Site Report						
Action Type:		Notices				
Action:		Notice of Responsibility				
Action Date:		10/16/2000				
Received Issue Date:		10/16/2000				
Doc Link:						
Title Description Comments:						
NOTICE OF REIMBURSEMENT / LOCAL						
Action Type:		Response Requested - Workplans				
Action:		Soil and Water Investigation Workplan				
Action Date:		10/5/2000				
Received Issue Date:		10/5/2000				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6060099				
Title Description Comments:						
Site Investigation Work Plan - Soil and groundwater with direct push						
Action Type:		Response Requested - Other				
Action:		Other Report / Document				
Action Date:		9/8/2000				
Received Issue Date:		9/8/2000				
Doc Link:		https://geotracker.waterboards.ca.gov/view_documents_all?global_id=T0607391310&doc_id=6060127				
Title Description Comments:						
Report of UST Unauthorized Release with Exxon Mobil Site Assessment Report						
Action Type:		Leak Action				
Action:		Leak Reported				
Action Date:		9/8/2000				
Received Issue Date:						
Doc Link:						
Title Description Comments:						
Action Type:		Leak Action				
Action:		Leak Began				
Action Date:		6/21/2000				
Received Issue Date:						
Doc Link:						
Title Description Comments:						
Action Type:		Leak Action				
Action:		Leak Discovery				
Action Date:		6/21/2000				
Received Issue Date:						
Doc Link:						

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Title Description Comments:

Action Type: Leak Action
 Action: Leak Stopped
 Action Date: 9/1/1999
 Received Issue Date:
 Doc Link:
 Title Description Comments:

Action Type: Other Regulatory Actions
 Action: Clean Up Fund - Case Closure Review Summary Report (RSR)
 Action Date: 5/4/1989
 Received Issue Date: 5/4/1989
 Doc Link:
 Title Description Comments:

787 RSR ADDL March

Action Type: Enforcement/Orders
 Action: Amendment to Order
 Action Date:
 Received Issue Date:
 Doc Link:
 Title Description Comments:

GeoTracker Search - Site Maps

Submitted: 4/13/2021
 Submitted By: THE REYNOLDS GROUP - TUSTIN (AUTH_RP)
 Title: GEO_MAP
 Link: https://geotracker.waterboards.ca.gov/esi/uploads/geo_map/3939563214/T0607391310.PDF

Submitted: 4/13/2021
 Submitted By: THE REYNOLDS GROUP - TUSTIN (AUTH_RP)
 Title: WELL INSTALLATION REPORT (MW-24 & MW-25) (MW-25)
 Link: https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/6482338666/T0607391310.PDF

Submitted: 4/13/2021
 Submitted By: THE REYNOLDS GROUP - TUSTIN (AUTH_RP)
 Title: WELL INSTALLATION REPORT (MW-24 & MW-25) (MW-24)
 Link: https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/3700610578/T0607391310.PDF

Submitted: 4/3/2020*
 Submitted By: THE REYNOLDS GROUP - TUSTIN (AUTH_RP)
 Title: GEO_MAP
 Link: https://geotracker.waterboards.ca.gov/esi/uploads/geo_map/2687206566/T0607391310.PDF

Submitted: 4/3/2020
 Submitted By: THE REYNOLDS GROUP - TUSTIN (AUTH_RP)
 Title: OFF-SITE ASSESSMENT REPORT (HP19, HP20, HP21) (HP21)
 Link: https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/3630351185/T0607391310.PDF

Submitted: 4/3/2020
 Submitted By: THE REYNOLDS GROUP - TUSTIN (AUTH_RP)
 Title: OFF-SITE ASSESSMENT REPORT (HP19, HP20, HP21) (HP19)
 Link: https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/3448696434/T0607391310.PDF

Submitted: 4/3/2020
 Submitted By: THE REYNOLDS GROUP - TUSTIN (AUTH_RP)
 Title: OFF-SITE ASSESSMENT REPORT (HP19, HP20, HP21) (HP20)
 Link: https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/7551428020/T0607391310.PDF

Submitted: 4/1/2020*
 Submitted By: THE REYNOLDS GROUP - TUSTIN (AUTH_RP)

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Title: Link:					JULY 2000 SITE# ASSESSMENT REPORT (MW1 TO MW4) (MW-1) https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/2021734416/T0607391310.PDF	
Submitted: Submitted By: Title: Link:		4/1/2020 THE REYNOLDS GROUP - TUSTIN (AUTH_RP)			AUGUST 2001 SITE# ASSESSMENT REPORT (MW5 TO MW9) (MW-5) https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/3114543080/T0607391310.PDF	
Submitted: Submitted By: Title: Link:		4/1/2020* THE REYNOLDS GROUP - TUSTIN (AUTH_RP)			MARCH 2012 WELL INSTALLATION REPORT (MW18, MW19, MW20) (MW-20) https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/9198809146/T0607391310.PDF	
Submitted: Submitted By: Title: Link:		4/1/2020 THE REYNOLDS GROUP - TUSTIN (AUTH_RP)			AUGUST 2001 SITE# ASSESSMENT REPORT (MW5 TO MW9) (MW-9) https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/9771660864/T0607391310.PDF	
Submitted: Submitted By: Title: Link:		4/1/2020* THE REYNOLDS GROUP - TUSTIN (AUTH_RP)			JULY 2000 SITE# ASSESSMENT REPORT (MW1 TO MW4) (MW-2) https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/8561874628/T0607391310.PDF	
Submitted: Submitted By: Title: Link:		4/1/2020* THE REYNOLDS GROUP - TUSTIN (AUTH_RP)			MARCH 2012 WELL INSTALLATION REPORT (MW18, MW19, MW20) (MW-18) https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/4206446766/T0607391310.PDF	
Submitted: Submitted By: Title: Link:		4/1/2020* THE REYNOLDS GROUP - TUSTIN (AUTH_RP)			MARCH 2012 WELL INSTALLATION REPORT (MW18, MW19, MW20) (MW-19) https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/8558718204/T0607391310.PDF	
Submitted: Submitted By: Title: Link:		4/1/2020 THE REYNOLDS GROUP - TUSTIN (AUTH_RP)			AUGUST 2001 SITE# ASSESSMENT REPORT (MW5 TO MW9) (MW-6) https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/6771754384/T0607391310.PDF	
Submitted: Submitted By: Title: Link:		4/1/2020 THE REYNOLDS GROUP - TUSTIN (AUTH_RP)			AUGUST 2001 SITE# ASSESSMENT REPORT (MW5 TO MW9) (MW-8) https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/9351125895/T0607391310.PDF	
Submitted: Submitted By: Title: Link:		4/1/2020 THE REYNOLDS GROUP - TUSTIN (AUTH_RP)			AUGUST 2001 SITE# ASSESSMENT REPORT (MW5 TO MW9) (MW-7) https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/7473013103/T0607391310.PDF	
Submitted: Submitted By: Title: Link:		4/1/2020* THE REYNOLDS GROUP - TUSTIN (AUTH_RP)			JULY 2000 SITE# ASSESSMENT REPORT (MW1 TO MW4) (MW-3) https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/1130193889/T0607391310.PDF	
Submitted: Submitted By: Title: Link:		4/1/2020 THE REYNOLDS GROUP - TUSTIN (AUTH_RP)			JULY 2000 SITE# ASSESSMENT REPORT (MW1 TO MW4) (MW-4) https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/7346096336/T0607391310.PDF	
Submitted: Submitted By: Title: Link:		1/26/2018 THE REYNOLDS GROUP - TUSTIN (AUTH_RP)			WELL INSTALLATION REPORT (AS11/SV11) https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/4110489130/T0607391310.PDF	
Submitted: Submitted By: Title: Link:		1/26/2018 THE REYNOLDS GROUP - TUSTIN (AUTH_RP)			WELL INSTALLATION REPORT (MW-22) https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/9915075898/T0607391310.PDF	
Submitted:		1/26/2018				

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Submitted By:		THE REYNOLDS GROUP - TUSTIN (AUTH_RP)				
Title:		WELL INSTALLATION REPORT (MW-23)				
Link:		https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/9636346638/T0607391310.PDF				
Submitted:		1/26/2018				
Submitted By:		THE REYNOLDS GROUP - TUSTIN (AUTH_RP)				
Title:		WELL INSTALLATION REPORT (AS9/SV9)				
Link:		https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/2927948236/T0607391310.PDF				
Submitted:		1/26/2018				
Submitted By:		THE REYNOLDS GROUP - TUSTIN (AUTH_RP)				
Title:		WELL INSTALLATION REPORT (AS7/SV7)				
Link:		https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/4191820144/T0607391310.PDF				
Submitted:		1/26/2018				
Submitted By:		THE REYNOLDS GROUP - TUSTIN (AUTH_RP)				
Title:		GEO_MAP				
Link:		https://geotracker.waterboards.ca.gov/esi/uploads/geo_map/8178107917/T0607391310.PDF				
Submitted:		1/26/2018				
Submitted By:		THE REYNOLDS GROUP - TUSTIN (AUTH_RP)				
Title:		WELL INSTALLATION REPORT (AS10/SV10)				
Link:		https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/5037469685/T0607391310.PDF				
Submitted:		1/26/2018				
Submitted By:		THE REYNOLDS GROUP - TUSTIN (AUTH_RP)				
Title:		WELL INSTALLATION REPORT (AS8/SV8)				
Link:		https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/6061670124/T0607391310.PDF				
Submitted:		1/26/2018				
Submitted By:		THE REYNOLDS GROUP - TUSTIN (AUTH_RP)				
Title:		WELL INSTALLATION REPORT (AS12/SV12)				
Link:		https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/5489233613/T0607391310.PDF				
Submitted:		1/26/2018				
Submitted By:		THE REYNOLDS GROUP - TUSTIN (AUTH_RP)				
Title:		WELL INSTALLATION REPORT (AS13/SV13)				
Link:		https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/4516516566/T0607391310.PDF				
Submitted:		1/26/2018				
Submitted By:		THE REYNOLDS GROUP - TUSTIN (AUTH_RP)				
Title:		WELL INSTALLATION REPORT (MW-21)				
Link:		https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/4289978265/T0607391310.PDF				
Submitted:		6/24/2016*				
Submitted By:		THE REYNOLDS GROUP - TUSTIN (AUTH_RP)				
Title:		ADDITIONAL OFF-SITE GROUNDWATER ASSESSMENT REPORT (HP15)				
Link:		https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/4231485724/T0607391310.PDF				
Submitted:		6/24/2016*				
Submitted By:		THE REYNOLDS GROUP - TUSTIN (AUTH_RP)				
Title:		ADDITIONAL OFF-SITE GROUNDWATER ASSESSMENT REPORT (HP14)				
Link:		https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/8160734713/T0607391310.PDF				
Submitted:		6/24/2016*				
Submitted By:		THE REYNOLDS GROUP - TUSTIN (AUTH_RP)				
Title:		GEO_MAP				
Link:		https://geotracker.waterboards.ca.gov/esi/uploads/geo_map/5603254854/T0607391310.PDF				
Submitted:		6/24/2016*				
Submitted By:		THE REYNOLDS GROUP - TUSTIN (AUTH_RP)				
Title:		ADDITIONAL OFF-SITE GROUNDWATER ASSESSMENT REPORT (HP16)				
Link:		https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/1813554763/T0607391310.PDF				
Submitted:		3/9/2016*				
Submitted By:		THE REYNOLDS GROUP - TUSTIN (AUTH_RP)				
Title:		ADDITIONAL OFF-SITE GROUNDWATER ASSESSMENT REPORT (HP-12-GW)				
Link:		https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/3949961066/T0607391310.PDF				

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Submitted: Submitted By: Title: Link:		3/9/2016*			THE REYNOLDS GROUP - TUSTIN (AUTH_RP) ADDITIONAL OFF-SITE GROUNDWATER ASSESSMENT REPORT (HP-11-GW) https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/9908804357/T0607391310.PDF	
Submitted: Submitted By: Title: Link:		3/9/2016*			THE REYNOLDS GROUP - TUSTIN (AUTH_RP) ADDITIONAL OFF-SITE GROUNDWATER ASSESSMENT REPORT (HP-13-GW) https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/5441618502/T0607391310.PDF	
Submitted: Submitted By: Title: Link:		4/2/2014			THE REYNOLDS GROUP - TUSTIN (AUTH_RP) REMEDATION WELL INSTALLATION REPORT (AS6) https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/8709446012/T0607391310.PDF	
Submitted: Submitted By: Title: Link:		4/2/2014			THE REYNOLDS GROUP - TUSTIN (AUTH_RP) REMEDATION WELL INSTALLATION REPORT (AS2) https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/9600725293/T0607391310.PDF	
Submitted: Submitted By: Title: Link:		4/2/2014			THE REYNOLDS GROUP - TUSTIN (AUTH_RP) REMEDATION WELL INSTALLATION REPORT (AS3) https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/3928484082/T0607391310.PDF	
Submitted: Submitted By: Title: Link:		4/2/2014			THE REYNOLDS GROUP - TUSTIN (AUTH_RP) REMEDATION WELL INSTALLATION REPORT (AS5) https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/7242478847/T0607391310.PDF	
Submitted: Submitted By: Title: Link:		4/2/2014			THE REYNOLDS GROUP - TUSTIN (AUTH_RP) GEO_MAP https://geotracker.waterboards.ca.gov/esi/uploads/geo_map/4743656218/T0607391310.PDF	
Submitted: Submitted By: Title: Link:		4/2/2014			THE REYNOLDS GROUP - TUSTIN (AUTH_RP) REMEDATION WELL INSTALLATION REPORT (AS4) https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/8689790248/T0607391310.PDF	
Submitted: Submitted By: Title: Link:		4/4/2012			THE REYNOLDS GROUP - TUSTIN (AUTH_RP) GEO_MAP https://geotracker.waterboards.ca.gov/esi/uploads/geo_map/8838902294/T0607391310.PDF	
Submitted: Submitted By: Title: Link:		11/14/2011			THE REYNOLDS GROUP - TUSTIN (AUTH_RP) HP8 GEO BORE (HP8) https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/2875306129/T0607391310.PDF	
Submitted: Submitted By: Title: Link:		11/14/2011			THE REYNOLDS GROUP - TUSTIN (AUTH_RP) HP10 GEO BORE (HP10) https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/4369389355/T0607391310.PDF	
Submitted: Submitted By: Title: Link:		11/14/2011			THE REYNOLDS GROUP - TUSTIN (AUTH_RP) HP9 GEO BORE (HP9) https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/1864286065/T0607391310.PDF	
Submitted: Submitted By: Title: Link:		11/14/2011			THE REYNOLDS GROUP - TUSTIN (AUTH_RP) HP7 GEO BORE (HP7) https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/6856444597/T0607391310.PDF	
Submitted: Submitted By: Title: Link:		11/14/2011			THE REYNOLDS GROUP - TUSTIN (AUTH_RP) GEO_MAP https://geotracker.waterboards.ca.gov/esi/uploads/geo_map/8486692309/T0607391310.PDF	

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Submitted: Submitted By: Title: Link:		6/15/2011 THE REYNOLDS GROUP - TUSTIN (AUTH_RP) GEO BORE HP6 (HP6) https://geotracker.waterboards.ca.gov/es/uploads/geo_bore/4364365577/T0607391310.PDF				
Submitted: Submitted By: Title: Link:		6/15/2011 THE REYNOLDS GROUP - TUSTIN (AUTH_RP) GEO BORE HP2 (HP2) https://geotracker.waterboards.ca.gov/es/uploads/geo_bore/1198038756/T0607391310.PDF				
Submitted: Submitted By: Title: Link:		6/15/2011 THE REYNOLDS GROUP - TUSTIN (AUTH_RP) GEO_MAP https://geotracker.waterboards.ca.gov/es/uploads/geo_map/1942288994/T0607391310.PDF				
Submitted: Submitted By: Title: Link:		6/15/2011 THE REYNOLDS GROUP - TUSTIN (AUTH_RP) GEO BORE MW16 (MW-16) https://geotracker.waterboards.ca.gov/es/uploads/geo_bore/4889994323/T0607391310.PDF				
Submitted: Submitted By: Title: Link:		6/15/2011 THE REYNOLDS GROUP - TUSTIN (AUTH_RP) GEO BORE MW17 (MW-17) https://geotracker.waterboards.ca.gov/es/uploads/geo_bore/5914544522/T0607391310.PDF				
Submitted: Submitted By: Title: Link:		6/15/2011 THE REYNOLDS GROUP - TUSTIN (AUTH_RP) GEO BORE HP1 (HP1) https://geotracker.waterboards.ca.gov/es/uploads/geo_bore/5127500176/T0607391310.PDF				
Submitted: Submitted By: Title: Link:		6/15/2011 THE REYNOLDS GROUP - TUSTIN (AUTH_RP) GEO BORE HP4 (HP4) https://geotracker.waterboards.ca.gov/es/uploads/geo_bore/4841654479/T0607391310.PDF				
Submitted: Submitted By: Title: Link:		6/15/2011 THE REYNOLDS GROUP - TUSTIN (AUTH_RP) GEO BORE HP5 (HP5) https://geotracker.waterboards.ca.gov/es/uploads/geo_bore/6813676238/T0607391310.PDF				
Submitted: Submitted By: Title: Link:		6/15/2011 THE REYNOLDS GROUP - TUSTIN (AUTH_RP) GEO BORE HP3 (HP3) https://geotracker.waterboards.ca.gov/es/uploads/geo_bore/3637277185/T0607391310.PDF				
Submitted: Submitted By: Title: Link:		4/28/2010 THE REYNOLDS GROUP - TUSTIN (AUTH_RP) GEO BORE AS1 (AS1) https://geotracker.waterboards.ca.gov/es/uploads/geo_bore/3705255091/T0607391310.PDF				
Submitted: Submitted By: Title: Link:		4/28/2010 THE REYNOLDS GROUP - TUSTIN (AUTH_RP) GEO BORE MW13 (MW-13) https://geotracker.waterboards.ca.gov/es/uploads/geo_bore/7672769010/T0607391310.PDF				
Submitted: Submitted By: Title: Link:		4/28/2010 THE REYNOLDS GROUP - TUSTIN (AUTH_RP) GEO BORE MW15 (MW-15) https://geotracker.waterboards.ca.gov/es/uploads/geo_bore/5113153040/T0607391310.PDF				
Submitted: Submitted By: Title: Link:		4/28/2010 THE REYNOLDS GROUP - TUSTIN (AUTH_RP) GEO BORE SVE1 (SVE1) https://geotracker.waterboards.ca.gov/es/uploads/geo_bore/5249655485/T0607391310.PDF				
Submitted: Submitted By: Title:		4/28/2010 THE REYNOLDS GROUP - TUSTIN (AUTH_RP) GEO BORE MW14 (MW-14)				

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Link:		https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/1429230690/T0607391310.PDF				
Submitted:		4/27/2010				
Submitted By:		THE REYNOLDS GROUP - TUSTIN (AUTH_RP)				
Title:		GEO_MAP				
Link:		https://geotracker.waterboards.ca.gov/esi/uploads/geo_map/1039559900/T0607391310.PDF				
Submitted:		6/22/2006				
Submitted By:		APPLIED CONSULTANTS (AUTH_RP)				
Title:		GEO_BORE (MW-12)				
Link:		https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/1252104043/T0607391310.pdf				
Submitted:		6/22/2006				
Submitted By:		APPLIED CONSULTANTS (AUTH_RP)				
Title:		GEO_BORE (MW-10)				
Link:		https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/1744389176/T0607391310.pdf				
Submitted:		6/22/2006				
Submitted By:		APPLIED CONSULTANTS (AUTH_RP)				
Title:		GEO_BORE (MW-11)				
Link:		https://geotracker.waterboards.ca.gov/esi/uploads/geo_bore/8995503067/T0607391310.pdf				
Submitted:		6/22/2006				
Submitted By:		APPLIED CONSULTANTS (AUTH_RP)				
Title:		GEO_MAP				
Link:		https://geotracker.waterboards.ca.gov/esi/uploads/geo_map/3134571671/T0607391310.pdf				
Submitted:		6/27/2002				
Submitted By:		GARY MCCUE (AUTH_RP)				
Title:		GEO_MAP				
Link:		https://geotracker.waterboards.ca.gov/esi/uploads/geo_map/3959272086/T0607391310.pdf				

GeoTracker Search - Documents

Document Type:	Monitoring Reports	Document Date:	7/31/2025
Type:	MONITORING REPORT - QUARTERLY	Submitted:	
Submitted By:	KEITH ETCHHELLS (AUTH_RP)		
Title:	WATER SUPPLY WELL CONTINGENCY PLAN PROGRESS REPORT - 2Q2025		
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/9029371321/T0607391310.PDF		
Document Type:	Site Documents	Document Date:	4/29/2025*
Type:	OTHER REPORT / DOCUMENT	Submitted:	
Submitted By:	KEITH ETCHHELLS (AUTH_RP)		
Title:	WATER SUPPLY CONTINGENCY PLAN PROGRESS REPORT - 1Q2025		
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/8249891340/T0607391310.PDF		
Document Type:	Site Documents	Document Date:	3/21/2025
Type:	WELL INSTALLATION WORKPLAN	Submitted:	
Submitted By:	KEITH ETCHHELLS (AUTH_RP)		
Title:	SITE INVESTIGATION WORKPLAN ADDENDUM, REVISION 1		
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/2193445146/T0607391310.PDF		
Document Type:	Site Documents	Document Date:	3/13/2025
Type:	MEETING	Submitted:	
Submitted By:	LALITHA THOTAKURA (REGULATOR)		
Title:	MEETING REQUEST BY RP TO DISCUSS USEPA/TBA FUNDING		
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6621837		
Document Type:	Site Documents	Document Date:	2/28/2025
Type:	COMPLAINT	Submitted:	
Submitted By:	LALITHA THOTAKURA (REGULATOR)		
Title:	SAN DIEGO WATER BOARD RESPONSE TO STARS LETTERS		
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6620836		
Document Type:	Site Documents	Document Date:	2/21/2025
Type:	STAFF LETTER	Submitted:	
Submitted By:	THANH DO (REGULATOR)		
Title:	SDRWQCB STAFF RESPONSE TO SITE INVESTIGATION WORKPLAN ADDENDUM		

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Title Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6620309				
Document Type:	Site Documents			Document Date:	2/4/2025	
Type:	TECHNICAL CORRESPONDENCE / ASSISTANCE / OTHER			Submitted:		
Submitted By:	THANH DO (REGULATOR)					
Title:	RESPONSE TO STARS PETROLEUM INC. ON 1/13/2025 FOR OSCF					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6618702					
Document Type:	Site Documents			Document Date:	2/3/2025	
Type:	FILE REVIEW			Submitted:		
Submitted By:	THANH DO (REGULATOR)					
Title:	HISTORICAL FILES					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6618399					
Document Type:	Site Documents			Document Date:	1/28/2025	
Type:	OTHER REPORT / DOCUMENT			Submitted:		
Submitted By:	KEITH ETCHELLS (AUTH_RP)					
Title:	WATER SUPPLY WELL CONTINGENCY PLAN PROGRESS REPORT - 4Q2024					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/9598188459/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	1/13/2025	
Type:	FILE REVIEW			Submitted:		
Submitted By:	THANH DO (REGULATOR)					
Title:	LETTER FROM RPS RESPONSE TO FUNDING DECISION AND ACKNOWLEDGEMENT OF RECEIPT					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6618188					
Document Type:	Site Documents			Document Date:	1/13/2025	
Type:	SOIL AND WATER INVESTIGATION WORKPLAN - ADDENDUM			Submitted:		
Submitted By:	KEITH ETCHELLS (AUTH_RP)					
Title:	SITE INVESTIGATION WORKPLAN ADDENDUM					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/3164520144/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	12/6/2024	
Type:	LETTER - NOTICE			Submitted:		
Submitted By:	THANH DO (REGULATOR)					
Title:	REQUEST FOR ADDENDUM TO WORK PLAN					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6613559					
Document Type:	Site Documents			Document Date:	10/1/2024	
Type:	OTHER REPORT / DOCUMENT			Submitted:		
Submitted By:	KEITH ETCHELLS (AUTH_RP)					
Title:	WATER SUPPLY CONTINGENCY PLAN PROGRESS REPORT - 3Q2024					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/3725083589/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	7/19/2024	
Type:	OTHER REPORT / DOCUMENT			Submitted:		
Submitted By:	KEITH ETCHELLS (AUTH_RP)					
Title:	WATER SUPPLY CONTINGENCY PLAN PROGRESS REPORT - 2Q2024					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/1756651699/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	3/29/2024*	
Type:	OTHER REPORT / DOCUMENT			Submitted:		
Submitted By:	KEITH ETCHELLS (AUTH_RP)					
Title:	WATER SUPPLY CONTINGENCY PLAN PROGRESS REPORT - 4Q2023 AND 1Q2024					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/8293762087/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	3/25/2024	
Type:	STAFF LETTER			Submitted:		
Submitted By:	LALITHA THOTAKURA (REGULATOR)					
Title:	SAN DIEGO WATER BOARD RESPONSE					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6576591					
Document Type:	Site Documents			Document Date:	3/15/2024	
Type:	SOIL AND WATER INVESTIGATION WORKPLAN			Submitted:		
Submitted By:	KEITH ETCHELLS (AUTH_RP)					
Title:	SITE INVESTIGATION WORKPLAN					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Title Link:		https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/1832681596/T0607391310.PDF				
Document Type:	Site Documents			Document Date:	3/4/2024	
Type:	STAFF LETTER			Submitted:		
Submitted By:	LALITHA THOTAKURA (REGULATOR)					
Title:	SAN DIEGO WATER BOARD RESPONSE TO SITE INVESTIGATION WORK PLAN					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6573759					
Document Type:	Site Documents			Document Date:	2/9/2024	
Type:	SOIL AND WATER INVESTIGATION WORKPLAN			Submitted:		
Submitted By:	KEITH ETCHELLS (AUTH_RP)					
Title:	SITE INVESTIGATION WORKPLAN					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/4249023079/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	1/2/2024	
Type:	STAFF LETTER			Submitted:		
Submitted By:	LALITHA THOTAKURA (REGULATOR)					
Title:	SAN DIEGO WATER BOARD RESPONSE					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6567456					
Document Type:	Monitoring Reports			Document Date:	11/29/2023	
Type:	MONITORING REPORT - SEMI-ANNUALLY			Submitted:		
Submitted By:	KEITH ETCHELLS (AUTH_RP)					
Title:	SECOND SEMIANNUAL GROUNDWATER MONITORING REPORT 2023					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/8702193856/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	11/10/2023	
Type:	SOIL AND WATER INVESTIGATION WORKPLAN			Submitted:		
Submitted By:	KEITH ETCHELLS (AUTH_RP)					
Title:	SITE INVESTIGATION WORKPLAN					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/3264525234/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	11/3/2023	
Type:	EMAIL CORRESPONDENCE			Submitted:		
Submitted By:	LALITHA THOTAKURA (REGULATOR)					
Title:	REQUEST OF EXTENSION ON SITE INVESTIGATION WORK PLAN					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6562891					
Document Type:	Site Documents			Document Date:	8/14/2023	
Type:	STAFF LETTER			Submitted:		
Submitted By:	LALITHA THOTAKURA (REGULATOR)					
Title:	SAN DIEGO WATER BOARD RESPONSE					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6551057					
Document Type:	Site Documents			Document Date:	8/4/2023	
Type:	CLEAN-UP AND ABATEMENT ORDER			Submitted:		
Submitted By:	LALITHA THOTAKURA (REGULATOR)					
Title:	CLEANUP AND ABATEMENT ORDER NO. R9-2023-0051					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6551065					
Document Type:	Site Documents			Document Date:	8/2/2023	
Type:	RESPONSE TO COMMENTS			Submitted:		
Submitted By:	LALITHA THOTAKURA (REGULATOR)					
Title:	TENTATIVE CAO PUBLIC COMMENTS AND SDWB RESPONSE					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6551064					
Document Type:	Site Documents			Document Date:	8/1/2023	
Type:	FINAL REMEDIAL ACTION REPORT / CORRECTIVE ACTION REPORT			Submitted:		
Submitted By:	KEITH ETCHELLS (AUTH_RP)					
Title:	WATER REPLACEMENT CONTINGENCY PLAN					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/8038761794/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	7/7/2023	
Type:	STAFF LETTER			Submitted:		
Submitted By:	LALITHA THOTAKURA (REGULATOR)					
Title:	SAN DIEGO WATER BOARD RESPONSE					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Title Link:		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6547355				
Document Type:	Site Documents			Document Date:	6/29/2023	
Type:	FINAL REMEDIAL ACTION REPORT / CORRECTIVE ACTION REPORT			Submitted:		
Submitted By:	KEITH ETCHHELLS (AUTH_RP)					
Title:	WATER REPLACEMENT CONTINGENCY PLAN					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/6601749002/T0607391310.PDF					
Document Type:	Monitoring Reports			Document Date:	6/16/2023	
Type:	MONITORING REPORT - SEMI-ANNUALLY			Submitted:		
Submitted By:	KEITH ETCHHELLS (AUTH_RP)					
Title:	FIRST SEMIANNUAL GROUNDWATER MONITORING REPORT 2023					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/1799361050/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	6/8/2023	
Type:	STAFF LETTER			Submitted:		
Submitted By:	LALITHA THOTAKURA (REGULATOR)					
Title:	SAN DIEGO WATER BOARD RESPONSE					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6547195					
Document Type:	Site Documents			Document Date:	5/26/2023	
Type:	FINAL REMEDIAL ACTION REPORT / CORRECTIVE ACTION REPORT			Submitted:		
Submitted By:	KEITH ETCHHELLS (AUTH_RP)					
Title:	WATER REPLACEMENT CONTINGENCY PLAN					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/5777270674/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	5/22/2023	
Type:	STAFF LETTER			Submitted:		
Submitted By:	LALITHA THOTAKURA (REGULATOR)					
Title:	SAN DIEGO WATER BOARD RESPONSE					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6542461					
Document Type:	Site Documents			Document Date:	5/15/2023	
Type:	STAFF LETTER			Submitted:		
Submitted By:	LALITHA THOTAKURA (REGULATOR)					
Title:	SAN DIEGO WATER BOARD RESPONSE TO CONTINGENCY PLAN					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6541738					
Document Type:	Monitoring Reports			Document Date:	4/28/2023	
Type:	MONITORING REPORT - SEMI-ANNUALLY			Submitted:		
Submitted By:	KEITH ETCHHELLS (AUTH_RP)					
Title:	FIRST SEMIANNUAL GROUNDWATER MONITORING REPORT 2023					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/3157668709/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	4/24/2023	
Type:	CLEAN-UP AND ABATEMENT ORDER			Submitted:		
Submitted By:	LALITHA THOTAKURA (REGULATOR)					
Title:	TENTATIVE CLEANUP AND ABATEMENT ORDER					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6551059					
Document Type:	Site Documents			Document Date:	4/21/2023	
Type:	FINAL REMEDIAL ACTION REPORT / CORRECTIVE ACTION REPORT			Submitted:		
Submitted By:	KEITH ETCHHELLS (AUTH_RP)					
Title:	WATER REPLACEMENT CONTINGENCY PLAN					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/1041289925/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	3/17/2023	
Type:	STAFF LETTER			Submitted:		
Submitted By:	LALITHA THOTAKURA (REGULATOR)					
Title:	SAN DIEGO WATER BOARD RESPONSE LETTER					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6534627					
Document Type:	Site Documents			Document Date:	2/28/2023	
Type:	CORRECTIVE ACTION PLAN / REMEDIAL ACTION PLAN			Submitted:		
Submitted By:	KEITH ETCHHELLS (AUTH_RP)					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Title:	WATER REPLACEMENT CONTINGENCY PLAN					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/5624653518/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	10/24/2022	
Type:	EMAIL CORRESPONDENCE			Submitted:		
Submitted By:	LALITHA THOTAKURA (REGULATOR)					
Title:	SAN DIEGO UPDATE ON DAMAGED WATER SUPPLY WELLS					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6520370					
Document Type:	Site Documents			Document Date:	10/7/2022	
Type:	STAFF LETTER			Submitted:		
Submitted By:	LALITHA THOTAKURA (REGULATOR)					
Title:	SAN DIEGO WATER BOARD RESPONSE LETTER					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6508170					
Document Type:	Monitoring Reports			Document Date:	9/22/2022	
Type:	MONITORING REPORT - SEMI-ANNUALLY			Submitted:		
Submitted By:	SHERRY WATTS (AUTH_RP)					
Title:	2022 FIRST SEMIANNUAL GROUNDWATER MONITORING REPORT					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/4065279960/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	5/23/2022	
Type:	STAFF LETTER			Submitted:		
Submitted By:	LALITHA THOTAKURA (REGULATOR)					
Title:	SAN DIEGO WATER BOARD RESPONSE TO REVISED WORK PLAN					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6495286					
Document Type:	Site Documents			Document Date:	5/17/2022	
Type:	SOIL AND WATER INVESTIGATION WORKPLAN			Submitted:		
Submitted By:	SHERRY WATTS (AUTH_RP)					
Title:	STARS GW MONITORING AND ANALYSIS PLAN 05172022					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/5528842329/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	5/5/2022	
Type:	STAFF LETTER			Submitted:		
Submitted By:	LALITHA THOTAKURA (REGULATOR)					
Title:	SAN DIEGO WATER BOARD COMMENT LETTER					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6493884					
Document Type:	Site Documents			Document Date:	3/30/2022	
Type:	OTHER WORKPLAN			Submitted:		
Submitted By:	SHERRY WATTS (AUTH_RP)					
Title:	GROUNDWATER MONITORING AND ANALYSIS PLAN					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/2654025495/T0607391310.PDF					
Document Type:	Monitoring Reports			Document Date:	6/1/2021	
Type:	MONITORING REPORT - SEMI-ANNUALLY			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	FIRST HALF 2021 SEMI-ANNUAL GROUNDWATER MONITORING REPORT					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/1854823231/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	5/5/2021	
Type:	SITE ASSESSMENT REPORT			Submitted:		
Submitted By:	LALITHA THOTAKURA (REGULATOR)					
Title:	RESIDENTIAL WELL SAMPLING REPORT FOR HOME AT 2108 LA BREA STREET, RAMONA, CA					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&document_id=6049652					
Document Type:	Site Documents			Document Date:	5/5/2021	
Type:	SITE ASSESSMENT REPORT			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	RESIDENTIAL WELL SAMPLING REPORT FOR HOME AT 2108 LA BREA STREET, RAMONA, CA					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/9715899884/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	4/30/2021	
Type:	CORRESPONDENCE			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	RESIDENTIAL WELL INVENTORY REPORT					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/5819176435/T0607391310.PDF					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Document Type:	Site Documents			Document Date:	4/13/2021	
Type:	WELL INSTALLATION REPORT			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	WELL INSTALLATION REPORT (MW-24 & MW-25)					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/4985324323/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	1/15/2021	
Type:	EMAIL CORRESPONDENCE			Submitted:		
Submitted By:	LALITHA THOTAKURA (REGULATOR)					
Title:	SAN DIEGO WATER BOARD RESPONSE TO REVISED WORKPLAN					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6455560					
Document Type:	Site Documents			Document Date:	11/6/2020	
Type:	WELL INSTALLATION WORKPLAN			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	REVISED WORKPLAN FOR ADDITIONAL OFFSITE GROUNDWATER WELL INSTALLATIONS (MW24 AND MW25), ONGOING LIMITED GROUNDWATER MONITORING EVENTS, AND PUBLIC INQUIRIES					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/8825183331/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	10/15/2020	
Type:	TECHNICAL CORRESPONDENCE / ASSISTANCE / OTHER			Submitted:		
Submitted By:	LALITHA THOTAKURA (REGULATOR)					
Title:	SAN DIEGO WATER BOARD RESPONSE TO WORKPLAN					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6449752					
Document Type:	Site Documents			Document Date:	9/28/2020	
Type:	WELL INSTALLATION WORKPLAN			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	WORKPLAN FOR ADDITIONAL OFFSITE GROUNDWATER WELL INSTALLATIONS (MW24 AND MW25), ONGOING LIMITED GROUNDWATER MONITORING EVENTS, AND PUBLIC INQUIRIES					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/2343239545/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	9/1/2020	
Type:	EMAIL CORRESPONDENCE			Submitted:		
Submitted By:	LALITHA THOTAKURA (REGULATOR)					
Title:	TRG POSITION REGARDING PRIVATE WELL OWNERSHIP INQUIRIES					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6448780					
Document Type:	Site Documents			Document Date:	7/2/2020	
Type:	REMEDIAL PROGRESS REPORT			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	REMEDICATION STATUS REPORT APRIL THOROUGH JUNE 2020 NON-OPERATIONAL					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/8850698649/T0607391310.PDF					
Document Type:	Monitoring Reports			Document Date:	6/22/2020	
Type:	MONITORING REPORT - SEMI-ANNUALLY			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	SEMI-ANNUAL GROUNDWATER MONITORING REPORT FIRST HALF 2020					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/1364009022/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	5/15/2020	
Type:	SENSITIVE RECEPTOR SURVEY REPORT			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	SUMMARY OF SUSPECTED PRIVATE USE WATER WELLS IN SITE VICINITY					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/4517497181/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	4/29/2020	
Type:	REMEDIAL PROGRESS REPORT			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	REMEDICATION STATUS REPORT JANUARY THROUGH APRIL 2020 -NON-OPERATIONAL					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/7222387492/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	4/15/2020	
Type:	CORRESPONDENCE			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	EMAIL TO WATER BOARD WITH MANIFEST					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/6440554141/T0607391310.PDF					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Document Type:	Site Documents			Document Date:	4/3/2020	
Type:	CORRESPONDENCE			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	EMAIL TO WATER BOARD WITH WELL PHOTOS					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/7742533802/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	4/3/2020	
Type:	SOIL AND WATER INVESTIGATION REPORT			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	OFF-SITE ASSESSMENT REPORT (HP19, HP20, HP21)					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/7243479847/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	3/12/2020	
Type:	EMAIL CORRESPONDENCE			Submitted:		
Submitted By:	LALITHA THOTAKURA (REGULATOR)					
Title:	WATER WELL SEARCH RADIUS					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6433661					
Document Type:	Site Documents			Document Date:	3/12/2020	
Type:	TECHNICAL CORRESPONDENCE / ASSISTANCE / OTHER			Submitted:		
Submitted By:	LALITHA THOTAKURA (REGULATOR)					
Title:	LIMITED SITE INSPECTION					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6433663					
Document Type:	Site Documents			Document Date:	1/15/2020	
Type:	REMEDIAL PROGRESS REPORT			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	REMEDICATION STATUS REPORT OCTOBER THROUGH DECEMBER 2019 NON-OPERATIONAL					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/1659796595/T0607391310.PDF					
Document Type:	Monitoring Reports			Document Date:	12/27/2019	
Type:	MONITORING REPORT - SEMI-ANNUALLY			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	GROUNDWATER MONITORING REPORT 2ND HALF 2019					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/4270697474/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	11/15/2019	
Type:	EMAIL CORRESPONDENCE			Submitted:		
Submitted By:	LALITHA THOTAKURA (REGULATOR)					
Title:	WATER BOARD RESPONSE TO UPCOMING SAMPLING AND NEW WELLS					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6423160					
Document Type:	Site Documents			Document Date:	10/4/2019	
Type:	REMEDIAL PROGRESS REPORT			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	REMEDICATION STATUS REPORT APRIL THROUGH SEPTEMBER 2019- NON OPERATIONAL					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/6442007899/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	10/3/2019	
Type:	REFERRAL TO REGIONAL BOARD			Submitted:		
Submitted By:	COLLEEN HINES (REGULATOR)					
Title:	DEH TRANSFER LETTER					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6416470					
Document Type:	Site Documents			Document Date:	3/29/2019	
Type:	REMEDIAL PROGRESS REPORT			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	REMEDICATION PROGRESS REPORT					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/5460531830/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	3/28/2019	
Type:	TECHNICAL CORRESPONDENCE / ASSISTANCE / OTHER			Submitted:		
Submitted By:	ED PAREDES (REGULATOR)					
Title:	WORKPLAN FOR ADDITIONAL OFFSITE GROUNDWATER ASSESSMENT AND WELL INSTALLATION					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6397653					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Document Type:	Monitoring Reports			Document Date:	2/20/2019	
Type:	MONITORING REPORT - QUARTERLY			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	GROUNDWATER MONITORING REPORT 1ST HALF 2019					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/6590048670/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	2/11/2019	
Type:	WELL INSTALLATION WORKPLAN			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	WORKPLAN FOR ADDITIONAL OFFSITE GROUNDWATER ASSESSMENT(HP19, HP20, HP21) AND WELL INSTALLATION (MW24)					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/3588784992/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	12/5/2018	
Type:	STATUS / PROGRESS REPORTS			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	SUMMARY OF OFFSITE WELL RESEARCH					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/5976065278/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	10/19/2018	
Type:	EMAIL CORRESPONDENCE			Submitted:		
Submitted By:	ED PAREDES (REGULATOR)					
Title:	REDUCTION OF GROUNDWATER MONITORING FREQUENCY					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6372935					
Document Type:	Site Documents			Document Date:	10/3/2018	
Type:	CLEAN UP FUND - CASE CLOSURE			Submitted:		
Submitted By:	REVIEW SUMMARY REPORT (RSR)					
Title:	(REGULATOR)					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6389098					
Document Type:	Monitoring Reports			Document Date:	9/21/2018	
Type:	MONITORING REPORT - QUARTERLY			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	GROUNDWATER MONITORING REPORT THIRD QUARTER 2018					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/6222612857/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	9/21/2018	
Type:	REMEDIAL PROGRESS REPORT			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	REMEDIAL PROGRESS REPORT (MARCH 17 TO JULY 22, 2018)					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/3571251928/T0607391310.PDF					
Document Type:	Monitoring Reports			Document Date:	3/26/2018	
Type:	MONITORING REPORT - QUARTERLY			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	GROUNDWATER MONITORING REPORT 1ST QUARTER 2018					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/9547348260/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	3/16/2018	
Type:	REMEDIAL PROGRESS REPORT			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	REMEDIAL STATUS REPORT					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/3958767831/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	2/14/2018	
Type:	REMEDIAL PROGRESS REPORT			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	REMEDIAL PROGRESS REPORT DECEMBER 2017 TO FEBRUARY 8, 2018					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/5346460163/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	1/26/2018	
Type:	WELL INSTALLATION REPORT			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	WELL INSTALLATION REPORT					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/4804922699/T0607391310.PDF					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Document Type:	Site Documents				Document Date: 12/8/2017	
Type:	REMEDIAL PROGRESS REPORT				Submitted:	
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	REMEDIAL PROGRESS REPORT-JULY 16 TO NOVEMBER 30, 2017					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/5435302972/T0607391310.PDF					
Document Type:	Site Documents				Document Date: 10/20/2017	
Type:	TECHNICAL CORRESPONDENCE / ASSISTANCE / OTHER				Submitted:	
Submitted By:	ED PAREDES (REGULATOR)					
Title:	CAP ADDENDUM CONCURRENCE					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6339575					
Document Type:	Monitoring Reports				Document Date: 10/3/2017	
Type:	MONITORING REPORT - QUARTERLY				Submitted:	
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	GROUNDWATER MONITORING REPORT 3RD QUARTER 2017					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/7205847382/T0607391310.PDF					
Document Type:	Site Documents				Document Date: 8/18/2017	
Type:	CORRECTIVE ACTION PLAN / REMEDIAL ACTION PLAN - ADDENDUM				Submitted:	
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	CORRECTIVE ACTION PLAN ADDENDUM					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/4812720954/T0607391310.PDF					
Document Type:	Site Documents				Document Date: 7/18/2017	
Type:	REMEDIAL PROGRESS REPORT				Submitted:	
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	REMEDIAL PROGRESS REPORT (FEBRUARY 22 TO JULY 15, 2017)					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/6669204950/T0607391310.PDF					
Document Type:	Monitoring Reports				Document Date: 6/5/2017	
Type:	MONITORING REPORT - QUARTERLY				Submitted:	
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	GROUNDWATER MONITORING REPORT 2ND QUARTER 2017					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/9458427131/T0607391310.PDF					
Document Type:	Site Documents				Document Date: 5/18/2017	
Type:	TECHNICAL CORRESPONDENCE / ASSISTANCE / OTHER				Submitted:	
Submitted By:	ED PAREDES (REGULATOR)					
Title:	ADDITIONAL OFF-SITE GROUNDWATER ASSESSMENT REPORT & WELL INSTALLATION WORKPLAN					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6320417					
Document Type:	Site Documents				Document Date: 4/28/2017	
Type:	WELL INSTALLATION WORKPLAN				Submitted:	
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	ADDITIONAL OFF-SITE GROUNDWATER ASSESSMENT REPORT & WELL INSTALLATION WORKPLAN					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/1638849079/T0607391310.PDF					
Document Type:	Monitoring Reports				Document Date: 3/27/2017	
Type:	MONITORING REPORT - QUARTERLY				Submitted:	
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	GROUNDWATER MONITORING REPORT 1ST QUARTER 2017					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/3929145514/T0607391310.PDF					
Document Type:	Site Documents				Document Date: 2/23/2017	
Type:	EMAIL CORRESPONDENCE				Submitted:	
Submitted By:	ED PAREDES (REGULATOR)					
Title:	DEH EMAIL RESPONSE: REVISED HYDROPUNCH LOCATIONS					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6312518					
Document Type:	Site Documents				Document Date: 2/22/2017	
Type:	REMEDIAL PROGRESS REPORT				Submitted:	
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	REMEDIAL PROGRESS REPORT-AUGUST 11, 2016 TO FEBRUARY 17, 2017					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/2288267672/T0607391310.PDF					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Document Type:	Monitoring Reports			Document Date:	2/22/2017	
Type:	MONITORING REPORT - QUARTERLY			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	GROUNDWATER MONITORING REPORT 4TH QUARTER 2016					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/6879691839/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	10/19/2016	
Type:	TECHNICAL CORRESPONDENCE / ASSISTANCE / OTHER			Submitted:		
Submitted By:	ED PAREDES (REGULATOR)					
Title:	DEH RESPONSE: OFFSITE ACCESS REQUEST LETTER					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6301519					
Document Type:	Monitoring Reports			Document Date:	10/17/2016	
Type:	MONITORING REPORT - QUARTERLY			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	GROUNDWATER MONITORING REPORT 3RD QUARTER 2016					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/1710420608/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	10/11/2016	
Type:	EMAIL CORRESPONDENCE			Submitted:		
Submitted By:	ED PAREDES (REGULATOR)					
Title:	DEH EMAIL RESPONSE: HYDROPUNCH RELOCATIONS					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6300643					
Document Type:	Site Documents			Document Date:	8/11/2016	
Type:	REMEDIAL PROGRESS REPORT			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	REMEDIAL PROGRESS REPORT MARCH 23 TO AUGUST 10, 2016					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/1702108979/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	8/10/2016	
Type:	WELL INSTALLATION WORKPLAN			Submitted:		
Submitted By:	ED PAREDES (REGULATOR)					
Title:	WORK PLAN FOR ADDITIONAL DOWNGRADE GROUNDWATER ASSESSMENT & WELL INSTALLATION - REGULATOR RESPONSE					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&document_id=5897929					
Document Type:	Site Documents			Document Date:	7/29/2016	
Type:	WELL INSTALLATION WORKPLAN			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	WORKPLAN FOR ADDITIONAL DOWNGRADE GROUNDWATER ASSESSMENT AND WELL INSTALLATION					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/6728187263/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	6/27/2016	
Type:	CLEAN UP FUND - CASE CLOSURE REVIEW SUMMARY REPORT (RSR)			Submitted:		
Submitted By:	(REGULATOR)					
Title:	16226 4TH RSR ADDITIONAL WORK JUNE 2016					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6388965					
Document Type:	Monitoring Reports			Document Date:	6/24/2016	
Type:	MONITORING REPORT - QUARTERLY			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	GROUNDWATER MONITORING REPORT 2ND QUARTER 2016					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/5551276862/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	6/24/2016	
Type:	SITE INVESTIGATION COMPLETE			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	ADDITIONAL OFF-SITE GROUNDWATER ASSESSMENT REPORT					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/5284788668/T0607391310.PDF					
Document Type:	Monitoring Reports			Document Date:	4/21/2016	
Type:	MONITORING REPORT - QUARTERLY			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	GROUNDWATER MONITORING REPORT -1ST QUARTER 2016					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/7491838455/T0607391310.PDF					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Document Type:	Site Documents			Document Date:	4/21/2016	
Type:	REMEDIAL PROGRESS REPORT			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	REMEDIAL PROGRESS REPORT (DECEMBER 18, 2015 TO MARCH 22, 2016)					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/3131776809/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	4/9/2016	
Type:	SOIL AND WATER INVESTIGATION WORKPLAN			Submitted:		
Submitted By:	ED PAREDES (REGULATOR)					
Title:	WORKPLAN FOR ADDITIONAL OFFSITE DOWNGRADIENT GROUNDWATER PLUME DELINEATION - REGULATOR RESPONSE					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&document_id=5887948					
Document Type:	Site Documents			Document Date:	3/7/2016	
Type:	SOIL AND WATER INVESTIGATION WORKPLAN			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	WORKPLAN FOR ADDITIONAL OFFSITE DOWNGRADIENT GROUNDWATER PLUME DELINEATION					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/5141966402/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	3/7/2016	
Type:	SITE INVESTIGATION			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	ADDITIONAL OFF-SITE GROUNDWATER ASSESSMENT REPORT					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/9407968878/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	1/15/2016	
Type:	REMEDIAL PROGRESS REPORT			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	REMEDIAL PROGRESS REPORT (SEPTEMBER 18 TO DECEMBER 17, 2015)					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/4989679694/T0607391310.PDF					
Document Type:	Monitoring Reports			Document Date:	1/15/2016	
Type:	MONITORING REPORT - QUARTERLY			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	GROUNDWATER MONITORING REPORT-4TH QUARTER 2015					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/9549417853/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	10/15/2015	
Type:	SOIL AND WATER INVESTIGATION WORKPLAN			Submitted:		
Submitted By:	ED PAREDES (REGULATOR)					
Title:	WORKPLAN FOR ADDITIONAL OFFSITE DOWNGRADIENT GROUNDWATER PLUME DELINEATION AND CONTINGENCY WELL INSTALLATION - REGULATOR RESPONSE					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&document_id=5865856					
Document Type:	Site Documents			Document Date:	10/12/2015	
Type:	REMEDIAL PROGRESS REPORT			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	REMEDIAL PROGRESS REPORT (JUNE 16 TO SEPTEMBER 18, 2015)					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/8089011907/T0607391310.PDF					
Document Type:	Monitoring Reports			Document Date:	10/9/2015	
Type:	MONITORING REPORT - QUARTERLY			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	QUARTERLY GROUNDWATER MONITORING REPORT-3RD QUARTER 2015					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/6909815192/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	9/14/2015	
Type:	SOIL AND WATER INVESTIGATION WORKPLAN			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	WORKPLAN FOR ADDITIONAL OFFSITE DOWNGRADIENT GROUNDWATER PLUME DELINEATION (HP11, HP12, AND HP13) AND CONTINGENCY WELL INSTALLATION					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/8438102483/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	8/20/2015	

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Type:	CLEAN UP FUND - CASE CLOSURE		Submitted:			
Submitted By:	REVIEW SUMMARY REPORT (RSR)					
Title:	KIRK T. LARSON (REGULATOR)					
Title Link:	REVIEW SUMMARY REPORT, AUGUST 2015					
	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6395245					
Document Type:	Monitoring Reports		Document Date:		8/18/2015	
Type:	MONITORING REPORT - QUARTERLY		Submitted:			
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	QUARTERLY GROUNDWATER MONITORING REPORT 2ND QUARTER 2015					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/3912054479/T0607391310.PDF					
Document Type:	Site Documents		Document Date:		8/10/2015	
Type:	REMEDIAL PROGRESS REPORT		Submitted:			
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	REMEDIAL PROGRESS REPORT (APRIL 1 TO JUNE 16, 2015)					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/4988258123/T0607391310.PDF					
Document Type:	Monitoring Reports		Document Date:		5/15/2015	
Type:	MONITORING REPORT - QUARTERLY		Submitted:			
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	GROUNDWATER MONITORING REPORT - 1ST QUARTER 2015					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/6045417547/T0607391310.PDF					
Document Type:	Site Documents		Document Date:		5/15/2015	
Type:	REMEDIAL PROGRESS REPORT		Submitted:			
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	REMEDIAL PROGRESS REPORT - NOVEMBER 1, 2014 TO MARCH 31, 2015					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/1675468206/T0607391310.PDF					
Document Type:	Site Documents		Document Date:		1/19/2015	
Type:	REMEDIAL PROGRESS REPORT		Submitted:			
Submitted By:	CAROL A. FENNER (REGULATOR)					
Title:	REMEDIAL PROGRESS REPORT - JULY THROUGH DECEMBER 2014 - REGULATOR RESPONSE					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&document_id=5828343					
Document Type:	Site Documents		Document Date:		1/15/2015	
Type:	REMEDIAL PROGRESS REPORT		Submitted:			
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	REMEDIAL PROGRESS REPORT - JULY THROUGH OCTOBER 2014					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/6014441788/T0607391310.PDF					
Document Type:	Monitoring Reports		Document Date:		12/15/2014	
Type:	MONITORING REPORT - QUARTERLY		Submitted:			
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	QUARTERLY GROUNDWATER MONITORING REPORT - 4TH QUARTER 2014					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/4252723455/T0607391310.PDF					
Document Type:	Monitoring Reports		Document Date:		10/15/2014	
Type:	MONITORING REPORT - QUARTERLY		Submitted:			
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	QUARTERLY GROUNDWATER MONITORING REPORT - 3RD QUARTER 2014					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/6621985733/T0607391310.PDF					
Document Type:	Site Documents		Document Date:		8/29/2014	
Type:	REMEDIAL PROGRESS REPORT		Submitted:			
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	REMEDIAL SYSTEM STARTUP REPORT					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/3969001531/T0607391310.PDF					
Document Type:	Monitoring Reports		Document Date:		6/25/2014	
Type:	MONITORING REPORT - QUARTERLY		Submitted:			
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	QUARTERLY GROUNDWATER MONITORING REPORT - 2ND QUARTER 2014					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/4078513443/T0607391310.PDF					
Document Type:	Monitoring Reports		Document Date:		4/11/2014	
Type:	MONITORING REPORT - QUARTERLY		Submitted:			
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Title:	QUARTERLY GROUNDWATER MONITORING REPORT - 1ST QUARTER 2014					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/7890175998/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	4/2/2014	
Type:	WELL INSTALLATION REPORT			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	REMEDATION WELL INSTALLATION REPORT					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/6212541699/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	1/31/2014	
Type:	TECHNICAL CORRESPONDENCE / ASSISTANCE / OTHER			Submitted:		
Submitted By:	ED PAREDES (REGULATOR)					
Title:	CAP CONCURRENCE					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6190755					
Document Type:	Monitoring Reports			Document Date:	12/30/2013	
Type:	MONITORING REPORT - QUARTERLY			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	QUARTERLY GROUNDWATER MONITORING REPORT - 4TH QUARTER 2013					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/2222169995/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	12/9/2013	
Type:	TECHNICAL CORRESPONDENCE / ASSISTANCE / OTHER			Submitted:		
Submitted By:	ED PAREDES (REGULATOR)					
Title:	CAP: PUBLIC NOTIFICATION LETTER, LIST OF RECIPIENTS, PARCEL MAP,					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6190748					
Document Type:	Site Documents			Document Date:	11/5/2013	
Type:	TECHNICAL CORRESPONDENCE / ASSISTANCE / OTHER			Submitted:		
Submitted By:	COLLEEN HINES (REGULATOR)					
Title:	RESPONSE TO QUARTERLY GROUNDWATER MONITORING REPORT 3RD QUARTER 2013					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6181457					
Document Type:	Site Documents			Document Date:	11/5/2013	
Type:	TECHNICAL CORRESPONDENCE / ASSISTANCE / OTHER			Submitted:		
Submitted By:	COLLEEN HINES (REGULATOR)					
Title:	CONDITIONAL CONCURRENCE OF CORRECTIVE ACTION PLAN					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6181458					
Document Type:	Site Documents			Document Date:	10/18/2013	
Type:	CORRECTIVE ACTION PLAN / REMEDIAL ACTION PLAN			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	REVISED #2 CORRECTIVE ACTION PLAN					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/9976232945/T0607391310.PDF					
Document Type:	Monitoring Reports			Document Date:	10/4/2013	
Type:	MONITORING REPORT - QUARTERLY			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	QUARTERLY GROUNDWATER MONITORING REPORT - 3RD QUARTER 2013					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/4106079041/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	9/11/2013	
Type:	TECHNICAL CORRESPONDENCE / ASSISTANCE / OTHER			Submitted:		
Submitted By:	COLLEEN HINES (REGULATOR)					
Title:	REPOSE TO REVISED CORRECTIVE ACTION PLAN					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6174928					
Document Type:	Site Documents			Document Date:	7/15/2013	
Type:	CORRECTIVE ACTION PLAN / REMEDIAL ACTION PLAN			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	REVISED CORRECTIVE ACTION PLAN - PART 1 OF 2					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/7725908398/T0607391310.PDF					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Document Type:	Site Documents			Document Date:	7/15/2013	
Type:	CORRECTIVE ACTION PLAN / REMEDIAL ACTION PLAN			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	REVISED CORRECTIVE ACTION PLAN - PART 2 OF 2					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/8222614347/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	7/12/2013	
Type:	TECHNICAL CORRESPONDENCE / ASSISTANCE / OTHER			Submitted:		
Submitted By:	COLLEEN HINES (REGULATOR)					
Title:	RESPONSE TO QUARTERLY GROUNDWATER MONITORING REPORT 2ND QUARTER 2013					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6167151					
Document Type:	Monitoring Reports			Document Date:	5/20/2013	
Type:	MONITORING REPORT - QUARTERLY			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	QUARTERLY GROUNDWATER MONITORING REPORT - SECOND QUARTER 2013					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/5740295350/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	4/9/2013	
Type:	TECHNICAL CORRESPONDENCE / ASSISTANCE / OTHER			Submitted:		
Submitted By:	COLLEEN HINES (REGULATOR)					
Title:	RESPONSE TO QUARTERLY GROUNDWATER MONITORING REPORT, 1ST QUARTER 2013					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6154629					
Document Type:	Monitoring Reports			Document Date:	3/15/2013	
Type:	MONITORING REPORT - QUARTERLY			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	QTRLY GWM REPORT - 1ST QTR 2013					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/6541963100/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	12/7/2012	
Type:	TECHNICAL CORRESPONDENCE / ASSISTANCE / OTHER			Submitted:		
Submitted By:	COLLEEN HINES (REGULATOR)					
Title:	RESPONSE TO QUARTERLY GROUNDWATER MONITORING REPORT 4TH QUARTER 2012					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6144457					
Document Type:	Monitoring Reports			Document Date:	11/26/2012	
Type:	MONITORING REPORT - QUARTERLY			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	GROUNDWATER MONITORING REPORT 4TH QTR. 2012					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/2838626921/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	10/9/2012	
Type:	TECHNICAL CORRESPONDENCE / ASSISTANCE / OTHER			Submitted:		
Submitted By:	COLLEEN HINES (REGULATOR)					
Title:	RESPONSE TO QUARTERLY GROUNDWATER MONITORING REPORT 3RD QUARTER 2012					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6139549					
Document Type:	Monitoring Reports			Document Date:	9/21/2012	
Type:	MONITORING REPORT - QUARTERLY			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	QUARTERLY GWM REPORT 3RD QTR. 2012					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/5542646050/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	5/10/2012	
Type:	CLEAN UP FUND - CASE CLOSURE REVIEW SUMMARY REPORT (RSR)			Submitted:		
Submitted By:	COLLEEN HINES (REGULATOR)					
Title:	USTCF 5-YEAR REVIEW SUMMARY, 2ND REVIEW - MAY 2012					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6394335					
Document Type:	Site Documents			Document Date:	4/23/2012	
Type:	TECHNICAL CORRESPONDENCE /			Submitted:		

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Submitted By:	ASSISTANCE / OTHER					
Title:	COLLEEN HINES (REGULATOR)					
Title Link:	RESPONSE TO GROUNDWATER WELL INSTALLATION REPORT					
	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6119725					
Document Type:	Site Documents			Document Date:	3/30/2012	
Type:	WELL INSTALLATION REPORT			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	3.30.2012 GROUNDWATER WELL INSTALLATION REPORT					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/6547483086/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	12/14/2011	
Type:	TECHNICAL CORRESPONDENCE / ASSISTANCE / OTHER			Submitted:		
Submitted By:	COLLEEN HINES (REGULATOR)					
Title:	RESPONSE TO ADDITIONAL GROUNDWATER ASSESSMENT REPORT					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6106196					
Document Type:	Site Documents			Document Date:	12/13/2011	
Type:	CLEAN UP FUND - CASE CLOSURE REVIEW SUMMARY REPORT (RSR)			Submitted:		
Submitted By:	RAMESH SUNDARESWARAN (REGULATOR)					
Title:	1ST 5-YEAR REVIEW					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6393391					
Document Type:	Site Documents			Document Date:	11/9/2011	
Type:	SITE ASSESSMENT REPORT			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	11.9.2011 ADDITIONAL GROUNDWATER ASSESSMENT REPORT					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/6229844093/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	9/22/2011	
Type:	TECHNICAL CORRESPONDENCE / ASSISTANCE / OTHER			Submitted:		
Submitted By:	COLLEEN HINES (REGULATOR)					
Title:	RESPONSE TO SEMI-ANNUAL GROUNDWATER MONITORING REPORT SECOND HALF 2011					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6099185					
Document Type:	Monitoring Reports			Document Date:	8/26/2011	
Type:	MONITORING REPORT - SEMI-ANNUALLY			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	8.26.2011 2ND HALF 2011 GWM REPORT					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/5167083680/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	6/29/2011	
Type:	TECHNICAL CORRESPONDENCE / ASSISTANCE / OTHER			Submitted:		
Submitted By:	COLLEEN HINES (REGULATOR)					
Title:	RESPONSE TO ADDITIONAL GROUNDWATER ASSESSMENT AND WELL INSTALLATION REPORT					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6090825					
Document Type:	Site Documents			Document Date:	6/15/2011	
Type:	WELL INSTALLATION REPORT			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	6.10.11 ADDITIONAL GW ASSESSMENT AND WELL INSTALLATION REPORT (MW16&MW17)					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/3360732316/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	5/3/2011	
Type:	CLEAN UP FUND - CASE CLOSURE REVIEW SUMMARY REPORT (RSR)			Submitted:		
Submitted By:	COLLEEN HINES (REGULATOR)					
Title:	CLEAN UP FUND - CASE CLOSURE REVIEW SUMMARY REPORT (RSR)					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6392650					
Document Type:	Site Documents			Document Date:	5/2/2011	
Type:	CORRESPONDENCE			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	RESPONSE TO SDDEH LETTER DATED 4-20-11					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/8911961376/T0607391310.PDF					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Document Type:	Site Documents			Document Date:	4/28/2011	
Type:	PILOT STUDY / TREATABILITY WORKPLAN			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	6.16.2010 REVISED ADDITIONAL PILOT TEST INFORMATION PER MARCH 11, 2010 LETTER AND JUNE 7, 2010 EMAIL 7433					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/6590879082/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	4/28/2011	
Type:	PILOT STUDY / TREATABILITY WORKPLAN			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	4.28.2010 ADDITIONAL PILOT TEST INFORMATION PER MARCH 11, 2010 LETTER 7433					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/1412888526/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	4/27/2011	
Type:	TECHNICAL CORRESPONDENCE / ASSISTANCE / OTHER			Submitted:		
Submitted By:	COLLEEN HINES (REGULATOR)					
Title:	RESPONSE TO HYDROPUNCH DATA AND PROPOSED MONITORING WELL AND ADDITIONAL HYDROPUNCH LOCATIONS					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6085033					
Document Type:	Site Documents			Document Date:	4/20/2011	
Type:	TECHNICAL CORRESPONDENCE / ASSISTANCE / OTHER			Submitted:		
Submitted By:	COLLEEN HINES (REGULATOR)					
Title:	RESPONSE TO SEMI-ANNUAL GROUNDWATER MONITORING REPORT FIRST HALF 2011					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6084108					
Document Type:	Monitoring Reports			Document Date:	4/4/2011	
Type:	MONITORING REPORT - SEMI-ANNUALLY			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	3.28.2011 GWM REPORT FIRST HALF 2011 7433					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/4441129326/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	3/21/2011	
Type:	TECHNICAL CORRESPONDENCE / ASSISTANCE / OTHER			Submitted:		
Submitted By:	COLLEEN HINES (REGULATOR)					
Title:	RESPONSE TO CAP					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6081152					
Document Type:	Site Documents			Document Date:	3/17/2011	
Type:	TECHNICAL CORRESPONDENCE / ASSISTANCE / OTHER			Submitted:		
Submitted By:	COLLEEN HINES (REGULATOR)					
Title:	RESPONSE TO PILOT TEST REPORT					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6081007					
Document Type:	Site Documents			Document Date:	3/16/2011	
Type:	TECHNICAL CORRESPONDENCE / ASSISTANCE / OTHER			Submitted:		
Submitted By:	COLLEEN HINES (REGULATOR)					
Title:	RESPONSE TO HUMAN HEALTH VAPOR RISK ASSESSMENT REPORT					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6080838					
Document Type:	Site Documents			Document Date:	3/3/2011	
Type:	LETTER - NOTICE			Submitted:		
Submitted By:	COLLEEN HINES (REGULATOR)					
Title:	NEIGHBOR NOTIFICATION					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6079838					
Document Type:	Site Documents			Document Date:	2/16/2011	
Type:	CAP/RAP - OTHER REPORT			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	20110210 CORRECTIVE ACTION PLAN 7433					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/4410578429/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	10/25/2010	

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Type: Submitted By: Title: Title Link:		PILOT STUDY/ TREATABILITY REPORT		Submitted:		
		THE REYNOLDS GROUP - TUSTIN (AUTH_RP)				
		20101015 PILOT TEST REPORT				
		https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/2830720305/T0607391310.PDF				
Document Type: Type: Submitted By: Title: Title Link:		Monitoring Reports MONITORING REPORT - SEMI-ANNUALLY		Document Date: Submitted:	9/20/2010	
		THE REYNOLDS GROUP - TUSTIN (AUTH_RP)				
		GROUNDWATER MONITORING REPORT AUGUST 2010				
		https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/2645139336/T0607391310.PDF				
Document Type: Type: Submitted By: Title: Title Link:		Site Documents RISK ASSESSMENT REPORT		Document Date: Submitted:	8/6/2010	
		THE REYNOLDS GROUP - TUSTIN (AUTH_RP)				
		HUMAN HEALTH RISK ASSESSMENT REPORT				
		https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/9402491271/T0607391310.PDF				
Document Type: Type: Submitted By: Title: Title Link:		Site Documents WELL INSTALLATION REPORT		Document Date: Submitted:	4/26/2010	
		THE REYNOLDS GROUP - TUSTIN (AUTH_RP)				
		WELL INSTALLATION REPORT				
		https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/7735291838/T0607391310.PDF				
Document Type: Type: Submitted By: Title: Title Link:		Monitoring Reports MONITORING REPORT - QUARTERLY		Document Date: Submitted:	3/31/2010	
		THE REYNOLDS GROUP - TUSTIN (AUTH_RP)				
		GWM REPORT 4TH QTR '09 & 1ST QTR '10				
		https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/3496217131/T0607391310.PDF				
Document Type: Type: Submitted By: Title: Title Link:		Site Documents TECHNICAL CORRESPONDENCE / ASSISTANCE / OTHER (REGULATOR)		Document Date: Submitted:	3/11/2010	
		WORK PLAN AND ADDENDUM APPROVAL LETTER.				
		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6045008				
Document Type: Type: Submitted By: Title: Title Link:		Site Documents OTHER WORKPLAN		Document Date: Submitted:	2/10/2010	
		THE REYNOLDS GROUP - TUSTIN (AUTH_RP)				
		SUPPLEMENT TO OCTOBER 2009 WORKPLAN				
		https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/6407403111/T0607391310.PDF				
Document Type: Type: Submitted By: Title: Title Link:		Site Documents PILOT STUDY / TREATABILITY WORKPLAN		Document Date: Submitted:	10/21/2009	
		THE REYNOLDS GROUP - TUSTIN (AUTH_RP)				
		WORKPLAN FOR PILOT TESTING AND INTERIM REMEDIAL ACTION				
		https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/7290691554/T0607391310.PDF				
Document Type: Type: Submitted By: Title: Title Link:		Monitoring Reports MONITORING REPORT - QUARTERLY		Document Date: Submitted:	10/14/2009	
		THE REYNOLDS GROUP - TUSTIN (AUTH_RP)				
		3RD QTR GWM REPORT AUGUST 2009				
		https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/4985650479/T0607391310.PDF				
Document Type: Type: Submitted By: Title: Title Link:		Site Documents LETTER - NOTICE (REGULATOR)		Document Date: Submitted:	7/29/2009	
		PAST DUE NOTICE				
		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6028307				
Document Type: Type: Submitted By: Title: Title Link:		Site Documents LETTER - NOTICE (REGULATOR)		Document Date: Submitted:	7/9/2009	
		LETTER - NOTICE				
		https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&enforcement_id=6024067				
Document Type: Type: Submitted By:		Site Documents REPORTS - INVESTIGATION RPT. APPLIED CONSULTANTS (AUTH_RP)		Document Date: Submitted:	7/26/2006	

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Title:	ADDITIONAL SITE ASSESSMENT REPORT					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/4728823602/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	1/12/2006	
Type:	PRELIMINARY SITE ASSESSMENT WORKPLAN - ADDENDUM			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	ADDENDUM TO APPROVED SITE ASSESSMENT AND QUARTERLY GWM AND SAMPLING WORKPLAN					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/9181838274/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	11/14/2005	
Type:	PRELIMINARY SITE ASSESSMENT WORKPLAN			Submitted:		
Submitted By:	THE REYNOLDS GROUP - TUSTIN (AUTH_RP)					
Title:	WORKPLAN FOR ADDITIONAL SITE ASSESSMENT AND QUARTERLY GWM AND SAMPLING					
Title Link:	https://geotracker.waterboards.ca.gov/esi/uploads/geo_report/4328591883/T0607391310.PDF					
Document Type:	Site Documents			Document Date:	10/25/2000	
Type:	UNAUTHORIZED RELEASE FORM			Submitted:		
Submitted By:	KRISTIN SCHWALL (REGULATOR)					
Title:	UST UNAUTHORIZED RELEASE CONTAMINATION SITE REPORT					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&document_id=6060104					
Document Type:	Site Documents			Document Date:	10/5/2000	
Type:	SOIL AND WATER INVESTIGATION WORKPLAN			Submitted:		
Submitted By:	KRISTIN SCHWALL (REGULATOR)					
Title:	SITE INVESTIGATION WORK PLAN - SOIL AND GROUNDWATER WITH DIRECT PUSH					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&document_id=6060099					
Document Type:	Site Documents			Document Date:	9/8/2000	
Type:	OTHER REPORT / DOCUMENT			Submitted:		
Submitted By:	KRISTIN SCHWALL (REGULATOR)					
Title:	REPORT OF UST UNAUTHORIZED RELEASE WITH EXXON MOBIL SITE ASSESSMENT REPORT					
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0607391310&document_id=6060127					

<u>10</u>	10 of 14	ENE	0.12 / 656.72	1,418.40 / 1	STARS PETROLEUM 1910 MAIN ST RAMONA CA 92065-2524	RCRA NON GEN
Handler ID:	CAL000306036					
Generator Status:	N					
Recycler Activity?:	NO					
Recycler Activity Note:	This facility has not been identified as a Recycler Facility from both the RCRA Handler and Biennial Report Modules.					

Violation/Evaluation Summary

Note: NO RECORDS: As of Nov 2025, there are no Compliance Monitoring and Enforcement (violation) records associated with this facility (EPA ID).

Handler Summary

Importer:	No	Used Oil Transpor:	No
Mixed Waste Gen:	No	Used Oil Trans Fac:	No
Transporter:	No	Used Oil Processor:	No
Transfer Facility:	No	Used Oil Refiner:	No
Recycler:	No	Used Oil Burner:	No
Onsite Burner Exem:	No	Commercial TSD:	No
Furnace Exemption:	No	Recycl Nonstorage:	No
Underground Injec:	No		
Used Oil Market Burner:	No		
Used Oil Spec Marketer:	No		

Additional Handler Summary Details

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Source Type:	I				NAIC 1:	22121
Seq No:	1				NAIC 2:	44719
Non Notifier:					NAIC 3:	
Receive Date:	20060427				NAIC 4:	
Active Site:	-----				State:	CA
Land Type:					Location Latitude:	33.033386
In Handler Univ:	N				Location Longitude:	-116.882832
In A Universe:	N				Loc GIS Primary:	N
Gen Status:	N				Loc GIS Origin:	AG
Report Cycle:					State District Owner:	
Accessibility:					State District:	
Region:	09					
Fed Waste Gen Owner:		HQ				
State Waste Generator Owner:		CA				
State Waste Generator:		2				
Short Term Generator:		N				
Uni Waste:		N				
Universal Waste Dest Facility:		N				
Federal Universal Waste:		N				
As Federally Regulated Tsdf:		-----				
As Converter Tsdf:		-----				
As State Regulated Tsdf:		-----				
As State Regulated Handler:		---				
Federal Indicator:		---				
Hsm:		N				
Subpart K:		----				
GPRA Permit:		N				
GPRA Renewal:		N				
Permit Renewal Wrkld:		-----				
Permwrk ID:		-----				
Perm Prog:		-----				
Pcwrkld:		-----				
Closwrkld:		-----				
GPRA Ca:		N				
Cawrkld:		N				
Subjca Tsd Discretion:		N				
NCAPS:		N				
EC Indicator:		N				
Ca725 Indicator:		N				
Ca750 Indicator:		N				
Operating Tsdf:		-----				
Full Enforcement:		-----				
Snc:		N				
Unaddressed Snc:		N				
Addressed Snc:		N				
Snc With Comp Sched:		N				
Fa Required:		-----				
Hhandler Last Change:		20210812				
Recognized Trader Importer:		N				
Recognized Trader Exporter:		N				
Slab Importer:		N				
Slab Exporter:		N				
Manifest Broker:		N				
Subpart P:		N				
Contact Language:		EN				
Handler Name:		STARS PETROLEUM				
Location Street No:						
Location Street1:		1910 MAIN ST				
Location Street2:						
Location City:		RAMONA				
Location State:		CA				
Location Zip:		92065-2524				
Location County Code:		CA073				
Location County Name:		SAN DIEGO				
Location Country:		US				
Contact Name:		TIM KJONEGAARD				
Contact Street No:						
Contact Street1:		1910 MAIN ST				

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Contact Street2:
Contact City: RAMONA
Contact State: CA
Contact Zip: 92065
Contact Country:
Contact Phone & Ext: 760-788-7800
Contact Fax: 760-788-7809
Contact Email Address: STARSFUELPRO@ATT.NET
Contact Title:
Owner Name: JAMES KURTENBACH
Owner Type: O
Owner Seq: 1
Operator Name: TIM KJONEGAARD
Operator Type: O
Operator Seq: 2
Public Notes:

Contact DTSC for information.

Hazardous Waste Handler Details

Seq No: 1
Receive Date: 20060427
Handler Name: STARS PETROLEUM
Fed Waste Generator: N
Generator Code Description: Not a Generator, Verified
Source Type: Implementer
TSD Activity: N

Owner/Operator Details

Owner/Operator Ind:	Current Operator	Street No:	
Type:	Other	Street1:	1910 MAIN ST
Name:	TIM KJONEGAARD	Street2:	
Dt Became Current:		City:	RAMONA
Dt Ended Current:		State:	CA
Phone:	760-788-7800	Country:	
Source Type:	Implementer	Zip:	92065
Owner/Operator Ind:	Current Owner	Street No:	
Type:	Other	Street1:	1910 MAIN ST
Name:	JAMES KURTENBACH	Street2:	
Dt Became Current:		City:	RAMONA
Dt Ended Current:		State:	CA
Phone:	760-788-7800	Country:	
Source Type:	Implementer	Zip:	92065-2524

10	11 of 14	ENE	0.12 / 656.72	1,418.40 / 1	RAMONA DAY & NITE MOBIL 1910 HIGHWAY 67 RAMONA CA 92065	SAM SANDIEGO
Record ID:	DEH2000-LSAM-H29206-001	Agency Name:	COSD			
Record ID (Map):	DEH2000-LSAM-H29206-001	Lead Agency:	DEH/SAM			
Record Type (Map):	LUEG-DEH/LWQD/SAM Investigation/NA	Lead Agcy Date:	9/14/2000, 8:00 PM			
ID:	6505	Object ID:	6380			
ThomasBros Map Gd:	1152 E 7	SWRCB Global ID:	T0607391310			
Jurisdiction:	UNINCORPORATED	Feature ID:	2822221900			
Census Tract:	208.05	Parcel No:	282-222-06-00			
Watershed Basin:	905.41	Case No:	H29206-001			
GT Global ID:	T0607391310	H No:	H29206			
GT RB Case No:	9UT4091	KIVA per Tp per No:	6SAM H29206			
GT Status Date:	7/18/2000, 8:00 PM	Status:	Completed			
GT Case Type:	LUST Cleanup Site	Record Status:	Open			
GT CUF Case:	YES	Record Type:	SAM Investigation			
GT County:	San Diego	Record Alias:	SAM Investigation			

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
GT Latitude:	33.03316489			Date:	09/08/2000	
GT Longitude:	-116.88268599			Per Type:	LWQD	
Latitude GS84:	33.0329433			Primary Parcel:	Yes	
Longitude GS84:	-116.8827735			Primary Address:	Yes	
Point X:	-116.88254990160208			Address Type:	MASTER	
Point Y:	33.03309906747787			Community:	Ramona	
X:	6367735.065			Zip Code:	92065	
Y:	1956201.764			Zip Community:	92065	
BOS District:	2			Gt Stat Dt:	2000-07-19 00:00:00 UTC	
Lead Agc Dt:	2000-09-15 00:00:00 UTC			Opened Dt:	2000-09-08 00:00:00 UTC	
Edited Dt:						
Project Name:	RAMONA DAY & NITE MOBIL					
Address:	1910 HIGHWAY 67, RAMONA CA 92065					
Street String:	1910 HIGHWAY 67					
City:	RAMONA					
Record Name (Map):	RAMONA DAY & NITE MOBIL					
Address (Map):	1910 HIGHWAY 67, RAMONA, CA 92065					
GT Lead Agency:	SAN DIEGO COUNTY LOP					
GT Status:	Open - Remediation					
DEH Permit Owner:						
Water Purveyor:	RAMONA MUNI WATER IMP DIST A					
Case Type:	LOP - Local Oversight Program					
Geo SRC:	Mapped to XY from previous SAM Layer					
Historical Name:	NITE & DAY MOBIL STATION					
Fire Agency:	RAMONA MUNI WATER DIST					
Funding:	S - LOP State Fund					
Short Notes:						
Source File:	Citizen Access DEH Site Assessment and Mitigation Investigation Sites (as of 26 Oct 2025); San Diego Site Assessment and Mitigation Investigation Sites (Map) (as of 1 Nov 2016)					

10	12 of 14	ENE	0.12 / 656.72	1,418.40 / 1	STARS PETROLEUM INC 1910 MAIN ST RAMONA CA 92065	UST

Facility ID:	37-000-201678	CERS ID:	10375228
Site Facility Type:	PERMITTED UNDERGROUND STORAGE TANK (UST)		
Note:	Information related to facilities can be searched on Geo Tracker Website: https://geotracker.waterboards.ca.gov/search		

Permitted UST Tank Details

EPA Region:	9	Tank Closure Date:	
No. of Closed UST:	0	Tank Configuration:	Stand Alone Tank
No. of Inuse UST:	3	Tank Contents:	Regular Unleaded
No. of Oos UST:	0	Tank Cp Impr Curr:	No
Owner Type:	Non-Government	Tank Cp Shutoff:	No
Tank ID No.:	28266	Tank Installtn Dt:	1/1/1989 12:00:00 AM
Tank Status:	Confirmed/Updated Information	Tank No of Compart:	1
Tank Type:	Double Wall	Tank Pc Constructn:	Fiberglass
Tank Alarms:	Yes	Tank Spill Bucket:	Yes
Tank Ball Float:	No	Tribal Lands:	No
Tank Operator Name:	Stars Petroleum Inc.		
Tank Operator Mail Address:	1910 Main St.		
Tank Operator Mail City:	Ramona		
Tank Operator Mail State:	CA		
Tank Operator Mail Zip:	92065		
Tank Owner Name:	Stars Petroleum Inc.		
Tank Owner Mailing Address:	1910 Main St.		
Tank Owner Mailing City:	Ramona		
Tank Owner Mailing State:	CA		
Tank Owner Mailing Zip:	92065		
Tank Capacity Gallons:	12000		
Tank Piping Construction:	Double Walled		
Tank Piping Type:	Pressure		
Tank Pw Piping Construction:	Flexible		
Tank Sacrificial Anode:	No		

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Permitted UST Tank Details

EPA Region:	9				Tank Closure Date:	
No. of Closed UST:	0				Tank Configuration:	Stand Alone Tank
No. of Inuse UST:	3				Tank Contents:	Regular Unleaded
No. of Oos UST:	0				Tank Cp Impr Curr:	No
Owner Type:	Non-Government				Tank Cp Shutoff:	No
Tank ID No.:	28267				Tank Installatn Dt:	1/1/1989 12:00:00 AM
Tank Status:	Confirmed/Updated Information				Tank No of Compart:	1
Tank Type:	Double Wall				Tank Pc Constructn:	Fiberglass
Tank Alarms:	Yes				Tank Spill Bucket:	Yes
Tank Ball Float:	No				Tribal Lands:	No
Tank Operator Name:	Stars Petroleum Inc.					
Tank Operator Mail Address:	1910 Main St.					
Tank Operator Mail City:	Ramona					
Tank Operator Mail State:	CA					
Tank Operator Mail Zip:	92065					
Tank Owner Name:	Stars Petroleum Inc.					
Tank Owner Mailing Address:	1910 Main St.					
Tank Owner Mailing City:	Ramona					
Tank Owner Mailing State:	CA					
Tank Owner Mailing Zip:	92065					
Tank Capacity Gallons:	12000					
Tank Piping Construction:	Double Walled					
Tank Piping Type:	Pressure					
Tank Pw Piping Construction:	Flexible					
Tank Sacrificial Anode:	No					

Permitted UST Tank Details

EPA Region:	9				Tank Closure Date:	
No. of Closed UST:	0				Tank Configuration:	Stand Alone Tank
No. of Inuse UST:	3				Tank Contents:	Diesel
No. of Oos UST:	0				Tank Cp Impr Curr:	No
Owner Type:	Non-Government				Tank Cp Shutoff:	No
Tank ID No.:	32496				Tank Installatn Dt:	2/25/2004 12:00:00 AM
Tank Status:	Confirmed/Updated Information				Tank No of Compart:	1
Tank Type:	Double Wall				Tank Pc Constructn:	Fiberglass
Tank Alarms:	Yes				Tank Spill Bucket:	Yes
Tank Ball Float:	No				Tribal Lands:	No
Tank Operator Name:	Stars Petroleum Inc.					
Tank Operator Mail Address:	1910 Main St.					
Tank Operator Mail City:	Ramona					
Tank Operator Mail State:	CA					
Tank Operator Mail Zip:	92065					
Tank Owner Name:	Stars Petroleum Inc.					
Tank Owner Mailing Address:	1910 Main St.					
Tank Owner Mailing City:	Ramona					
Tank Owner Mailing State:	CA					
Tank Owner Mailing Zip:	92065					
Tank Capacity Gallons:	12000					
Tank Piping Construction:	Double Walled					
Tank Piping Type:	Pressure					
Tank Pw Piping Construction:	Flexible					
Tank Sacrificial Anode:	No					

Permitted UST Tank Details

EPA Region:	9				Tank Closure Date:	
No. of Closed UST:	0				Tank Configuration:	Stand Alone Tank
No. of Inuse UST:	3				Tank Contents:	Premium Unleaded
No. of Oos UST:	0				Tank Cp Impr Curr:	No
Owner Type:	Non-Government				Tank Cp Shutoff:	No
Tank ID No.:	28268				Tank Installatn Dt:	1/1/1989 12:00:00 AM

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Tank Status:	Confirmed/Updated Information			Tank No of Compart:	1	
Tank Type:	Double Wall			Tank Pc Constructn:	Fiberglass	
Tank Alarms:	Yes			Tank Spill Bucket:	Yes	
Tank Ball Float:	No			Tribal Lands:	No	
Tank Operator Name:	Stars Petroleum Inc.					
Tank Operator Mail Address:	1910 Main St.					
Tank Operator Mail City:	Ramona					
Tank Operator Mail State:	CA					
Tank Operator Mail Zip:	92065					
Tank Owner Name:	Stars Petroleum Inc.					
Tank Owner Mailing Address:	1910 Main St.					
Tank Owner Mailing City:	Ramona					
Tank Owner Mailing State:	CA					
Tank Owner Mailing Zip:	92065					
Tank Capacity Gallons:	12000					
Tank Piping Construction:	Double Walled					
Tank Piping Type:	Pressure					
Tank Pw Piping Construction:	Flexible					
Tank Sacrificial Anode:	No					

Permitted UST Site Details

CERS ID:	10375228	CalEnviroScrn 4 Pct:	15-20%
Facility ID:	37-000-201678	Latitude:	33.03337
Permitting Agency:	San Diego County Department of Environmental Health	Longitude:	-116.88283
Senate District:	40	County:	San Diego
Congress District:	48		

10	13 of 14	ENE	0.12 / 656.72	1,418.40 / 1	STARS PETROLEUM INC 1910 MAIN ST RAMONA CA 92065	UST SANDIEGO
Facility ID:	37-000-201678	RCRA Large Qty. Gen:	false			
Record ID:	DEH2003-HUPFP-201678	HHW Collection:	false			
CERS ID:	10,375,228	Recycle:	false			
EPA ID No:	CAL000306036	Own or Operate UG:	true			
Permit Status:	Permit Renewed	Own or Operate AG:	false			
Active Permit:	true	Business Phone:	760-788-7800			
Haz. Mat. On-Site:	true	Business Fax:	7607887809			
Haz. Waste Gen:	true	Last Updated:	2023 Sep 07 01:52:48 AM			
Onsite Haz Wt Trt:	false					
Mailing Address:	1910 MAIN ST, RAMONA, CA 92065					

Tank Information

Tank ID:	28267	Tank Capacity in Gal:	12,000
Tank Status:	Active	Tank Contents:	Regular Unleaded
Permit Status:	Permit Renewed	Tank Use:	1a
Active Permit:	true	Piping Sys Type:	Pressure
Dt UST Perm Closed:		Fac Type (UST Fac):	Motor Vehicle Fueling
Type of Tank:	Double Wall	Last Updated:	2025 Jun 25 02:49:21 AM
Tank Owner Name:	Tim Kjonegaard		
Tank ID:	28266	Tank Capacity in Gal:	12,000
Tank Status:	Active	Tank Contents:	Regular Unleaded
Permit Status:	Permit Renewed	Tank Use:	1a
Active Permit:	true	Piping Sys Type:	Pressure
Dt UST Perm Closed:		Fac Type (UST Fac):	Motor Vehicle Fueling
Type of Tank:	Double Wall	Last Updated:	2025 Jun 25 02:49:21 AM
Tank Owner Name:	Tim Kjonegaard		
Tank ID:	28268	Tank Capacity in Gal:	12,000
Tank Status:	Active	Tank Contents:	Premium Unleaded
Permit Status:	Permit Renewed	Tank Use:	1a
Active Permit:	true	Piping Sys Type:	Pressure

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Dt UST Perm Closed:					Fac Type (UST Fac):	Motor Vehicle Fueling
Type of Tank:	Double Wall				Last Updated:	2025 Jun 25 02:49:21 AM
Tank Owner Name:	Tim Kjonegaard					
Tank ID:	32496				Tank Capacity in Gal:	12,000
Tank Status:	Active				Tank Contents:	Diesel
Permit Status:	Permit Renewed				Tank Use:	1a
Active Permit:	true				Piping Sys Type:	Pressure
Dt UST Perm Closed:					Fac Type (UST Fac):	Motor Vehicle Fueling
Type of Tank:	Double Wall				Last Updated:	2025 Jun 25 02:49:21 AM
Tank Owner Name:	Tim Kjonegaard					

<u>10</u>	14 of 14	ENE	0.12 / 656.72	1,418.40 / 1	RAMONA DAY & NITE 1910 MAIN ST RAMONA CA	UST SWEEPS

C C:	A37-000-29206	D Filename:	SITE02A
BOE:	44-023765	Page No:	207
Comp:	29206	County:	SAN DIEGO
Status:	ACTIVE	State :	CA
No of Tanks:	3	Zip:	92065
Jurisdic:	SAN DIEGO COUNTY	Latitude:	33.040604
Agency:	SAN DIEGO COUNTY - U.S.T.	Longitude:	-116.871254
Phone:		Georesult:	S5HPNTSCZA

Tank Details

Tank ID:	000001	S Contain:	
O Tank ID:		Stg:	P
SWRCB No:	37-000-029206-000001	Storage :	
Removed:		Storag Type:	PRODUCT
Installed:		P Contain:	
A Date:		Content:	REG UNLEADED
Capac:	10000	ONA:	
Tank Use:	M.V. FUEL	D File Name:	TANK2A

Tank Details

Tank ID:	000002	S Contain:	
O Tank ID:		Stg:	P
SWRCB No:	37-000-029206-000002	Storage :	
Removed:		Storag Type:	PRODUCT
Installed:		P Contain:	
A Date:		Content:	REG UNLEADED
Capac:	10000	ONA:	
Tank Use:	M.V. FUEL	D File Name:	TANK2A

Tank Details

Tank ID:	000003	S Contain:	
O Tank ID:		Stg:	P
SWRCB No:	37-000-029206-000003	Storage :	
Removed:		Storag Type:	PRODUCT
Installed:		P Contain:	
A Date:		Content:	REG UNLEADED
Capac:	10000	ONA:	
Tank Use:	M.V. FUEL	D File Name:	TANK2A

<u>11</u>	1 of 3	ENE	0.18 / 935.37	1,417.72 / 0	AUTOZONE #2845 370 PALA ST RAMONA CA 92065	C&D DEBRIS RECY

County: SAN DIEGO

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Activity Type:		USED OIL COLLECTION				
Phone No:						
11	2 of 3	ENE	0.18 / 935.37	1,417.72 / 0	AutoZone #2845 370 PALA ST RAMONA CA 92065	HAZ SANDIEGO

Record ID: DEH2002-HUPFP-100017
Facility Name: AutoZone #2845
Facility Address: 370 PALA ST RAMONA, CA 92065
Facility City: RAMONA
Facility Zip Code: 92065
Facility Latitude: 33.03340422650245
Facility Longitude: -116.88190610661772
GIS Record ID: DEH2002-HUPFP-100017
GIS Facility Name: AutoZone #2845
GIS Facility Address: 370 PALA ST
GIS Facility City: RAMONA
GIS Facility Zip Code: 92065
GIS Fac Latitude: -116.88205396633678
GIS Fac Longitude: 33.03314946745119
Tank Owner Name:

Hazardous Materials Facility Data

CERS ID:	10139951	Haz Mat on Site:	true
Facility ID No:	37-000-100017	Haz Waste Generatr:	true
EPA ID No:	CAL000219707	Own/Oper Under:	false
Active Permit:	true	Own/Oper Above:	false
Permit Status:	Permit Renewed	Recycle:	false
Bus Phone:	760-787-0489	RCRA Large Qty Gen:	false
Bus Fax:	9014958399	HHW Collection:	false
Last Updated:	12/01/2023 01:35:54 AM		
Mailing Address:	Dept 8190, 123 South Front Street, MEMPHIS, TN 38103		
Onsite H Waste Treatment:	false		
New Georeferenced Column:	(33.03314946745119, -116.88205396633678)		

Hazardous Waste and Materials

ID:	553867	Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0331214	Active Permit:	true
CAS No:		Haz Material Type:	
Last Updated:	10/05/2023 02:31:10 AM	Trade Secret:	false
Chemical Name:	Misc Alkaline Products		
Common Name Inventory:	Damaged Non-Saleable Retail Alkaline Products		
ID:	553868	Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0331215	Active Permit:	true
CAS No:		Haz Material Type:	
Last Updated:	10/05/2023 02:31:10 AM	Trade Secret:	false
Chemical Name:	Misc Corrosive Products		
Common Name Inventory:	Damaged Non-Saleable Corrosive Retail products		
ID:	553870	Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0331217	Active Permit:	true
CAS No:		Haz Material Type:	
Last Updated:	10/05/2023 02:31:10 AM	Trade Secret:	false
Chemical Name:	Misc Flammable Aerosol Products		
Common Name Inventory:	Damaged Non-Saleable Flammable Aerosol Retail Products		
ID:	553869	Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0331216	Active Permit:	true
CAS No:		Haz Material Type:	
Last Updated:	10/05/2023 02:31:10 AM	Trade Secret:	false
Chemical Name:	Misc Flammable Products		
Common Name Inventory:	Damaged Non-Saleable Flammable Retail Products		

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
ID:	553871				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0331218				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/05/2023 02:31:10 AM				Trade Secret:	false
Chemical Name:	Misc Non-RCRA Regulated Products					
Common Name Inventory:	Damaged Non-Saleable Non-RCRA Retail Products					
ID:	553872				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0331219				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/05/2023 02:31:10 AM				Trade Secret:	false
Chemical Name:	Misc Reactive Products					
Common Name Inventory:	Damaged Non-Saleable Reactive Retail Products					
ID:	553876				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0331223				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/05/2023 02:31:10 AM				Trade Secret:	false
Chemical Name:	Sodium Carbonate, Anhydrous					
Common Name Inventory:	Use Soda Ash					
ID:	553875				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0331222				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/05/2023 02:31:10 AM				Trade Secret:	false
Chemical Name:	Spent Motor Oil					
Common Name Inventory:	Used Oil Filter					
ID:	553877				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0331224				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/05/2023 02:31:10 AM				Trade Secret:	false
Chemical Name:	Used Motor Oil					
Common Name Inventory:	Used Motor Oil					
ID:	71689				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0112086				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/11/2017 02:31:55 AM				Trade Secret:	false
Chemical Name:	Used Soda Ash					
Common Name Inventory:	Used Soda Ash					
ID:	146788				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0151739				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/23/2018 02:32:16 AM				Trade Secret:	false
Chemical Name:	Used Soda Ash					
Common Name Inventory:	Used Soda Ash					
ID:	192227				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0175831				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	01/05/2019 01:04:07 AM				Trade Secret:	false
Chemical Name:	Used Soda Ash					
Common Name Inventory:	Used Soda Ash					
ID:	226876				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0197596				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/09/2019 02:33:08 AM				Trade Secret:	false
Chemical Name:	Used Soda Ash					
Common Name Inventory:	Used Soda Ash					
ID:	288493				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0226905				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	12/23/2020 01:09:14 AM				Trade Secret:	false
Chemical Name:	Used Soda Ash					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Common Name Inventory:		Used Soda Ash				
ID:	383670				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0255708				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	09/24/2022 02:31:53 AM				Trade Secret:	false
Chemical Name:	Used Soda Ash					
Common Name Inventory:	Used Soda Ash					
ID:	517162				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HWAST-0309621				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/14/2022 12:35:16 AM				Trade Secret:	false
Chemical Name:	Used Soda Ash					
Common Name Inventory:	Used Soda Ash					
ID:	20				Permit Status:	Permit Renewed
Child Record ID:	DEH2016-HWAST-0084044				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/26/2016 02:32:24 AM				Trade Secret:	false
Chemical Name:	WASTE 123 UNSPECIFIED ALKALINE SOL'N					
Common Name Inventory:	WASTE CORROSIVE - BASES					
ID:	71685				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0112082				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/11/2017 02:31:55 AM				Trade Secret:	false
Chemical Name:	WASTE 123 UNSPECIFIED ALKALINE SOL'N					
Common Name Inventory:	WASTE CORROSIVE - BASES					
ID:	146784				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0151735				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/23/2018 02:32:16 AM				Trade Secret:	false
Chemical Name:	WASTE 123 UNSPECIFIED ALKALINE SOL'N					
Common Name Inventory:	WASTE CORROSIVE - BASES					
ID:	192223				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0175827				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	01/05/2019 01:04:07 AM				Trade Secret:	false
Chemical Name:	WASTE 123 UNSPECIFIED ALKALINE SOL'N					
Common Name Inventory:	WASTE CORROSIVE - BASES					
ID:	226872				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0197592				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/09/2019 02:33:08 AM				Trade Secret:	false
Chemical Name:	WASTE 123 UNSPECIFIED ALKALINE SOL'N					
Common Name Inventory:	WASTE CORROSIVE - BASES					
ID:	288489				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0226901				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	12/23/2020 01:09:14 AM				Trade Secret:	false
Chemical Name:	WASTE 123 UNSPECIFIED ALKALINE SOL'N					
Common Name Inventory:	WASTE CORROSIVE - BASES					
ID:	383666				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0255704				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	09/24/2022 02:31:53 AM				Trade Secret:	false
Chemical Name:	WASTE 123 UNSPECIFIED ALKALINE SOL'N					
Common Name Inventory:	WASTE CORROSIVE - BASES					
ID:	517158				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HWAST-0309617				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/14/2022 12:35:16 AM				Trade Secret:	false

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Chemical Name:		WASTE 123 UNSPECIFIED ALKALINE SOL'N				
Common Name Inventory:		WASTE CORROSIVE - BASES				
ID:	22			Permit Status:	Permit Renewed	
Child Record ID:	DEH2016-HWAST-0084046			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	10/26/2016 02:32:24 AM			Trade Secret:	false	
Chemical Name:		WASTE 131 AQUEOUS SOL'N W/REACTIVE ANION				
Common Name Inventory:		WASTE OXIDIZERS				
ID:	71687			Permit Status:	Permit Renewed	
Child Record ID:	DEH2017-HWAST-0112084			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	10/11/2017 02:31:55 AM			Trade Secret:	false	
Chemical Name:		WASTE 131 AQUEOUS SOL'N W/REACTIVE ANION				
Common Name Inventory:		WASTE OXIDIZERS				
ID:	146786			Permit Status:	Permit Renewed	
Child Record ID:	DEH2018-HWAST-0151737			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	10/23/2018 02:32:16 AM			Trade Secret:	false	
Chemical Name:		WASTE 131 AQUEOUS SOL'N W/REACTIVE ANION				
Common Name Inventory:		WASTE OXIDIZERS				
ID:	192225			Permit Status:	Permit Renewed	
Child Record ID:	DEH2019-HWAST-0175829			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	01/05/2019 01:04:07 AM			Trade Secret:	false	
Chemical Name:		WASTE 131 AQUEOUS SOL'N W/REACTIVE ANION				
Common Name Inventory:		WASTE OXIDIZERS				
ID:	226874			Permit Status:	Permit Renewed	
Child Record ID:	DEH2019-HWAST-0197594			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	10/09/2019 02:33:08 AM			Trade Secret:	false	
Chemical Name:		WASTE 131 AQUEOUS SOL'N W/REACTIVE ANION				
Common Name Inventory:		WASTE OXIDIZERS				
ID:	288491			Permit Status:	Permit Renewed	
Child Record ID:	DEH2020-HWAST-0226903			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	12/23/2020 01:09:14 AM			Trade Secret:	false	
Chemical Name:		WASTE 131 AQUEOUS SOL'N W/REACTIVE ANION				
Common Name Inventory:		WASTE OXIDIZERS				
ID:	383668			Permit Status:	Permit Renewed	
Child Record ID:	DEH2021-HWAST-0255706			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	09/24/2022 02:31:53 AM			Trade Secret:	false	
Chemical Name:		WASTE 131 AQUEOUS SOL'N W/REACTIVE ANION				
Common Name Inventory:		WASTE OXIDIZERS				
ID:	517160			Permit Status:	Permit Renewed	
Child Record ID:	DEH2022-HWAST-0309619			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	10/14/2022 12:35:16 AM			Trade Secret:	false	
Chemical Name:		WASTE 131 AQUEOUS SOL'N W/REACTIVE ANION				
Common Name Inventory:		WASTE OXIDIZERS				
ID:	19			Permit Status:	Permit Renewed	
Child Record ID:	DEH2016-HWAST-0084043			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	10/26/2016 02:32:24 AM			Trade Secret:	false	
Chemical Name:		WASTE 214 UNSPEC SOLVENT MIXTURE				
Common Name Inventory:		AEROSOLS AND FLAMMABLES				
ID:	71684			Permit Status:	Permit Renewed	
Child Record ID:	DEH2017-HWAST-0112081			Active Permit:	true	
CAS No:				Haz Material Type:		

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Last Updated:	10/11/2017 02:31:55 AM				Trade Secret:	false
Chemical Name:		WASTE 214 UNSPEC SOLVENT MIXTURE				
Common Name Inventory:		AEROSOLS AND FLAMMABLES				
ID:	146783				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0151734				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/23/2018 02:32:16 AM				Trade Secret:	false
Chemical Name:		WASTE 214 UNSPEC SOLVENT MIXTURE				
Common Name Inventory:		AEROSOLS AND FLAMMABLES				
ID:	192222				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0175826				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	01/05/2019 01:04:07 AM				Trade Secret:	false
Chemical Name:		WASTE 214 UNSPEC SOLVENT MIXTURE				
Common Name Inventory:		AEROSOLS AND FLAMMABLES				
ID:	226871				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0197591				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/09/2019 02:33:08 AM				Trade Secret:	false
Chemical Name:		WASTE 214 UNSPEC SOLVENT MIXTURE				
Common Name Inventory:		AEROSOLS AND FLAMMABLES				
ID:	288488				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0226900				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	12/23/2020 01:09:14 AM				Trade Secret:	false
Chemical Name:		WASTE 214 UNSPEC SOLVENT MIXTURE				
Common Name Inventory:		AEROSOLS AND FLAMMABLES				
ID:	383665				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0255703				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	09/24/2022 02:31:53 AM				Trade Secret:	false
Chemical Name:		WASTE 214 UNSPEC SOLVENT MIXTURE				
Common Name Inventory:		AEROSOLS AND FLAMMABLES				
ID:	517157				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HWAST-0309616				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/14/2022 12:35:16 AM				Trade Secret:	false
Chemical Name:		WASTE 214 UNSPEC SOLVENT MIXTURE				
Common Name Inventory:		AEROSOLS AND FLAMMABLES				
ID:	18				Permit Status:	Permit Renewed
Child Record ID:	DEH2016-HWAST-0084042				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/26/2016 02:32:24 AM				Trade Secret:	false
Chemical Name:		WASTE 221 WASTE OIL & MIXED OIL				
Common Name Inventory:		AST IS SET ON WHEELS				
ID:	71683				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0112080				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/11/2017 02:31:55 AM				Trade Secret:	false
Chemical Name:		WASTE 221 WASTE OIL & MIXED OIL				
Common Name Inventory:		AST IS SET ON WHEELS				
ID:	146782				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0151733				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/23/2018 02:32:16 AM				Trade Secret:	false
Chemical Name:		WASTE 221 WASTE OIL & MIXED OIL				
Common Name Inventory:		AST IS SET ON WHEELS				
ID:	192221				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0175825				Active Permit:	true

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
CAS No:					Haz Material Type:	
Last Updated:	01/05/2019 01:04:07 AM				Trade Secret:	false
Chemical Name:		WASTE 221 WASTE OIL & MIXED OIL				
Common Name Inventory:		AST IS SET ON WHEELS				
ID:	226870				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0197590				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/09/2019 02:33:08 AM				Trade Secret:	false
Chemical Name:		WASTE 221 WASTE OIL & MIXED OIL				
Common Name Inventory:		AST IS SET ON WHEELS				
ID:	288487				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0226899				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	12/23/2020 01:09:14 AM				Trade Secret:	false
Chemical Name:		WASTE 221 WASTE OIL & MIXED OIL				
Common Name Inventory:		AST IS SET ON WHEELS				
ID:	383664				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0255702				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	09/24/2022 02:31:53 AM				Trade Secret:	false
Chemical Name:		WASTE 221 WASTE OIL & MIXED OIL				
Common Name Inventory:		AST IS SET ON WHEELS				
ID:	517156				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HWAST-0309615				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/14/2022 12:35:16 AM				Trade Secret:	false
Chemical Name:		WASTE 221 WASTE OIL & MIXED OIL				
Common Name Inventory:		AST IS SET ON WHEELS				
ID:	21				Permit Status:	Permit Renewed
Child Record ID:	DEH2016-HWAST-0084045				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/26/2016 02:32:24 AM				Trade Secret:	false
Chemical Name:		WASTE 352 ORGANIC SOLIDS (OTHER)				
Common Name Inventory:		OILY ABSORBENT				
ID:	71686				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0112083				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/11/2017 02:31:55 AM				Trade Secret:	false
Chemical Name:		WASTE 352 ORGANIC SOLIDS (OTHER)				
Common Name Inventory:		OILY ABSORBENT				
ID:	146785				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0151736				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/23/2018 02:32:16 AM				Trade Secret:	false
Chemical Name:		WASTE 352 ORGANIC SOLIDS (OTHER)				
Common Name Inventory:		OILY ABSORBENT				
ID:	192224				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0175828				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	01/05/2019 01:04:07 AM				Trade Secret:	false
Chemical Name:		WASTE 352 ORGANIC SOLIDS (OTHER)				
Common Name Inventory:		OILY ABSORBENT				
ID:	226873				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0197593				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/09/2019 02:33:08 AM				Trade Secret:	false
Chemical Name:		WASTE 352 ORGANIC SOLIDS (OTHER)				
Common Name Inventory:		OILY ABSORBENT				
ID:	288490				Permit Status:	Permit Renewed

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Child Record ID:	DEH2020-HWAST-0226902				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	12/23/2020 01:09:14 AM				Trade Secret:	false
Chemical Name:	WASTE 352 ORGANIC SOLIDS (OTHER)					
Common Name Inventory:	OILY ABSORBENT					
ID:	383667				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0255705				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	09/24/2022 02:31:53 AM				Trade Secret:	false
Chemical Name:	WASTE 352 ORGANIC SOLIDS (OTHER)					
Common Name Inventory:	OILY ABSORBENT					
ID:	517159				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HWAST-0309618				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/14/2022 12:35:16 AM				Trade Secret:	false
Chemical Name:	WASTE 352 ORGANIC SOLIDS (OTHER)					
Common Name Inventory:	OILY ABSORBENT					
ID:	23				Permit Status:	Permit Renewed
Child Record ID:	DEH2016-HWAST-0084047				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/26/2016 02:32:24 AM				Trade Secret:	false
Chemical Name:	WASTE 791 LIQUIDS WITH PH <OR= 2					
Common Name Inventory:	WASTE CORROSIVE - ACIDIC					
ID:	71688				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0112085				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/11/2017 02:31:55 AM				Trade Secret:	false
Chemical Name:	WASTE 791 LIQUIDS WITH PH <OR= 2					
Common Name Inventory:	WASTE CORROSIVE - ACIDIC					
ID:	146787				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0151738				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/23/2018 02:32:16 AM				Trade Secret:	false
Chemical Name:	WASTE 791 LIQUIDS WITH PH <OR= 2					
Common Name Inventory:	WASTE CORROSIVE - ACIDIC					
ID:	192226				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0175830				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	01/05/2019 01:04:07 AM				Trade Secret:	false
Chemical Name:	WASTE 791 LIQUIDS WITH PH <OR= 2					
Common Name Inventory:	WASTE CORROSIVE - ACIDIC					
ID:	226875				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0197595				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/09/2019 02:33:08 AM				Trade Secret:	false
Chemical Name:	WASTE 791 LIQUIDS WITH PH <OR= 2					
Common Name Inventory:	WASTE CORROSIVE - ACIDIC					
ID:	288492				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0226904				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	12/23/2020 01:09:14 AM				Trade Secret:	false
Chemical Name:	WASTE 791 LIQUIDS WITH PH <OR= 2					
Common Name Inventory:	WASTE CORROSIVE - ACIDIC					
ID:	383669				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0255707				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	09/24/2022 02:31:53 AM				Trade Secret:	false
Chemical Name:	WASTE 791 LIQUIDS WITH PH <OR= 2					
Common Name Inventory:	WASTE CORROSIVE - ACIDIC					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
ID:	517161				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HWAST-0309620				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/14/2022 12:35:16 AM				Trade Secret:	false
Chemical Name:	WASTE 791 LIQUIDS WITH PH <OR= 2					
Common Name Inventory:	WASTE CORROSIVE - ACIDIC					
ID:	553874				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0331221				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/05/2023 02:31:10 AM				Trade Secret:	false
Chemical Name:	WASTE ABSORBENT					
Common Name Inventory:	Waste Absorbent and Oil Paper Filters					
ID:	553873				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0331220				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/05/2023 02:31:10 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Spent Lead Acid Batteries Containing Sulfuric Acid					
<u>Hazardous Materials Inspection Violations</u>						
Container Tank ID:	37-000-100017				Inspection No:	7311779
Facility ID No:	84333				Inspection Type:	Routine
ID:	11/30/2023 12:00:00 AM				Inspection Date:	
UST ID:					Compliance Date:	
Permit Status:	Permit Renewed				Last Updated:	12/01/2023 01:35:54 AM
Active Permit:	true				NOV:	
Program Element:	Hazardous Waste Generator					
Violation Code:	HMD0000 HAZARDOUS WASTE REQUIREMENTS FOR SQGS ONLY					
Violation Classification:						
Container Tank ID:	37-000-100017				Inspection No:	7311779
Facility ID No:	84334				Inspection Type:	Routine
ID:	11/30/2023 12:00:00 AM				Inspection Date:	
UST ID:					Compliance Date:	
Permit Status:	Permit Renewed				Last Updated:	12/01/2023 01:35:54 AM
Active Permit:	true				NOV:	false
Program Element:	Hazardous Waste Generator					
Violation Code:	3030017 Failed to properly close hazardous waste container(s). 22 CCR 66262.34(d)(2); 40 CFR 262.34(d)(2), 265.173					
Violation Classification:	Minor					
<u>HMD Permits Map Data</u>						
Epa ID:	CAL000219707				Opened Dt:	2002-05-04T00:00:00
Cers ID:	10139951				Expiration Dt:	2024-10-31T00:00:00
Sitemap:	MAP_100017.pdf				Rpt Name:	HMBP100017.pdf
Record Status:	Permit Renewed				Hirt Flag:	N
Er Contact1:	Store Manager On Duty (Various Shifts)				Billing Code1:	Base + CUPA
Er Title1:	Store Manager				St No:	370
Er Phone1:	800-313-9693				St No End:	
Er Altphone:	760-787-0489				St Name:	PALA
Er Contact2:	Alarm Central				St Dir:	
Er Title2:	24 Hour Manned Monitor				St Type:	ST
Er Phone2:	800-313-9693				St Unit:	
Er Altphone2:	800-313-9693				Insp Dist Geoinfo:	HE020
Biz Apn:	282-150-33-00					
Biz Phone:	901-495-6500					
Biz Email:	deborah.j.williams@autozone.com					
Biz Owner:	AUTOZONE INC					
Biz Type:	Retail Stores					
Facility Subject To Calarp:						
Plating Shop Metal Finishing:						
Chemical Supplier Wholesale:						
Pesticide Applicator Fumigation:						

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Chem Gas Paint Manufacture:
 Resin Site With 6 Items:
 Petroleum Propane Fuel Supp:
 Site With Gt20 Inventory Items:
 Apsa Stor Tank Gt10000 Gal:
 Apsa Stor Tank Chem Gt999ga:
 Ust Stor Tank Fuel Gt30k Ga:
 Cryogas Gt20kcft200gal1200lb:
 Gases Gt20kCft 208 Gal 1666 L:
 Prop Gt185kCft5k Gal 2100:
 Extreme Haz Gt20 Cft 54 Gal 5:

11	3 of3	ENE	0.18 / 935.37	1,417.72 / 0	AUTOZONE #2845 370 PALA ST RAMONA CA 92065-0000	RCRA NON GEN

Handler ID:	CAL000219707
Generator Status:	N
Recycler Activity?:	NO
Recycler Activity Note:	This facility has not been identified as a Recycler Facility from both the RCRA Handler and Biennial Report Modules.

Violation/Evaluation Summary

Note:	NO RECORDS: As of Nov 2025, there are no Compliance Monitoring and Enforcement (violation) records associated with this facility (EPA ID).

Handler Summary

Importer:	No	Used Oil Transpor:	No
Mixed Waste Gen:	No	Used Oil Trans Fac:	No
Transporter:	No	Used Oil Processor:	No
Transfer Facility:	No	Used Oil Refiner:	No
Recycler:	No	Used Oil Burner:	No
Onsite Burner Exem:	No	Commercial TSD:	No
Furnace Exemption:	No	Recycl Nonstorage:	No
Underground Injec:	No		
Used Oil Market Burner:	No		
Used Oil Spec Marketer:	No		

Additional Handler Summary Details

Source Type:	I	NAIC 1:	45299
Seq No:	1	NAIC 2:	
Non Notifier:		NAIC 3:	
Receive Date:	20000612	NAIC 4:	
Active Site:	H----	State:	CA
Land Type:		Location Latitude:	33.033238
In Handler Univ:	Y	Location Longitude:	-116.882195
In A Universe:	Y	Loc GIS Primary:	N
Gen Status:	N	Loc GIS Origin:	AG
Report Cycle:		State District Owner:	
Accessibility:		State District:	
Region:	09		
Fed Waste Gen Owner:	HQ		
State Waste Generator Owner:	CA		
State Waste Generator:	2		
Short Term Generator:	N		
Uni Waste:	Y		
Universal Waste Dest Facility:	Y		
Federal Universal Waste:	N		
As Federally Regulated Tsdf:	-----		
As Converter Tsdf:	-----		
As State Regulated Tsdf:	-----		
As State Regulated Handler:	---		

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Federal Indicator:		---				
Hsm:		N				
Subpart K:		----				
GPRA Permit:		N				
GPRA Renewal:		N				
Permit Renewal Wrkld:		-----				
Permwrk ID:		-----				
Perm Prog:		-----				
Pcwrkld:		-----				
Closwrkld:		-----				
GPRA Ca:		N				
Cawrkld:		N				
Subjca Tsd Discretion:		N				
NCAPS:		N				
EC Indicator:		N				
Ca725 Indicator:		N				
Ca750 Indicator:		N				
Operating Tsdf:		-----				
Full Enforcement:		-----				
Snc:		N				
Unaddressed Snc:		N				
Addressed Snc:		N				
Snc With Comp Sched:		N				
Fa Required:		-----				
Hhandler Last Change:		20180905				
Recognized Trader Importer:		N				
Recognized Trader Exporter:		N				
Slab Importer:		N				
Slab Exporter:		N				
Manifest Broker:		N				
Subpart P:		N				
Contact Language:		EN				
Handler Name:		AUTOZONE #2845				
Location Street No:						
Location Street1:		370 PALA ST				
Location Street2:						
Location City:		RAMONA				
Location State:		CA				
Location Zip:		92065-0000				
Location County Code:		CA073				
Location County Name:		SAN DIEGO				
Location Country:		US				
Contact Name:		BRYAN BLAIR				
Contact Street No:						
Contact Street1:		DEPT 8190, 123 SOUTH FRONT STREET				
Contact Street2:						
Contact City:		MEMPHIS				
Contact State:		TN				
Contact Zip:		38103				
Contact Country:						
Contact Phone & Ext:		901-495-7217				
Contact Fax:		901-495-8399				
Contact Email Address:		BRYAN.BLAIR@AUTOZONE.COM				
Contact Title:						
Owner Name:		AUTO ZONE CORPORTATION				
Owner Type:		O				
Owner Seq:		1				
Operator Name:		BRYAN BLAIR				
Operator Type:		O				
Operator Seq:		2				
Public Notes:						

Contact DTSC for information.

Hazardous Waste Handler Details

Seq No: 1

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Receive Date: 20000612
 Handler Name: AUTOZONE #2845
 Fed Waste Generator: N
 Generator Code Description: Not a Generator, Verified
 Source Type: Implementer
 TSD Activity: N

Owner/Operator Details

Owner/Operator Ind:	Current Owner	Street No:	
Type:	Other	Street1:	123 S FRONT ST
Name:	AUTO ZONE CORPORTATION	Street2:	
Dt Became Current:		City:	MEMPHIS
Dt Ended Current:		State:	TN
Phone:	901-495-6500	Country:	
Source Type:	Implementer	Zip:	38103-3607
Owner/Operator Ind:	Current Operator	Street No:	
Type:	Other	Street1:	DEPT 8190, 123 SOUTH FRONT STREET
Name:	BRYAN BLAIR	Street2:	
Dt Became Current:		City:	MEMPHIS
Dt Ended Current:		State:	TN
Phone:	901-495-7217	Country:	
Source Type:	Implementer	Zip:	38103

12	1 of3	NE	0.20 / 1,059.08	1,420.74 / 3	Kmart #3678 1855 MAIN ST 1855 MAIN ST RAMONA CA 92065	HAZ SANDIEGO

Record ID: DEH2007-HUPFP-208141
 Facility Name: Kmart #3678
 Facility Address: 1855 MAIN ST, RAMONA, CA 92065
 Facility City: RAMONA
 Facility Zip Code: 92065
 Facility Latitude: 1957009.76100001
 Facility Longitude: 6367814.40100001
 GIS Record ID:
 GIS Facility Name:
 GIS Facility Address:
 GIS Facility City:
 GIS Facility Zip Code:
 GIS Fac Latitude:
 GIS Fac Longitude:
 Tank Owner Name:

Hazardous Waste and Materials

ID:	43980	Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HCHEM-0126188	Active Permit:	true
CAS No:	74-98-6	Haz Material Type:	Pure
Last Updated:	01/13/2017 12:50:50 AM	Trade Secret:	false
Chemical Name:	Propane		
Common Name Inventory:	Propane		
ID:	43983	Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0104994	Active Permit:	true
CAS No:		Haz Material Type:	
Last Updated:	01/13/2017 12:50:50 AM	Trade Secret:	false
Chemical Name:	Propane		
Common Name Inventory:	Waste Propane		
ID:	96973	Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HCHEM-0135654	Active Permit:	true
CAS No:	74-98-6	Haz Material Type:	Pure
Last Updated:	10/06/2017 02:31:25 AM	Trade Secret:	false
Chemical Name:	Propane		

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Common Name Inventory:		Propane				
ID:	96976			Permit Status:	Permit Renewed	
Child Record ID:	DEH2017-HWAST-0113973			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	10/06/2017 02:31:25 AM			Trade Secret:	false	
Chemical Name:	Propane					
Common Name Inventory:	Waste Propane					
ID:	139321			Permit Status:	Permit Renewed	
Child Record ID:	DEH2018-HWAST-0142749			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	10/06/2018 02:32:56 AM			Trade Secret:	false	
Chemical Name:	Propane					
Common Name Inventory:	Waste Propane					
ID:	139318			Permit Status:	Permit Renewed	
Child Record ID:	DEH2018-HCHEM-0168496			Active Permit:	true	
CAS No:	74-98-6			Haz Material Type:	Pure	
Last Updated:	10/06/2018 02:32:56 AM			Trade Secret:	false	
Chemical Name:	Propane					
Common Name Inventory:	Propane					
ID:	43981			Permit Status:	Permit Renewed	
Child Record ID:	DEH2017-HCHEM-0126189			Active Permit:	true	
CAS No:	Mixture			Haz Material Type:	Mixture	
Last Updated:	01/13/2017 12:50:50 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:	Floor Stripper					
ID:	43987			Permit Status:	Permit Renewed	
Child Record ID:	DEH2017-HWAST-0104998			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	01/13/2017 12:50:50 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:	Waste Oxidizers					
ID:	43982			Permit Status:	Permit Renewed	
Child Record ID:	DEH2017-HWAST-0104993			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	01/13/2017 12:50:50 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:	Used Lead Acid Batteries					
ID:	43984			Permit Status:	Permit Renewed	
Child Record ID:	DEH2017-HWAST-0104995			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	01/13/2017 12:50:50 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:	Waste Flammable Liquids					
ID:	43985			Permit Status:	Permit Renewed	
Child Record ID:	DEH2017-HWAST-0104996			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	01/13/2017 12:50:50 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:	Waste Corrosives - Acidic					
ID:	43986			Permit Status:	Permit Renewed	
Child Record ID:	DEH2017-HWAST-0104997			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	01/13/2017 12:50:50 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:	Waste Corrosives - Basic					
ID:	43988			Permit Status:	Permit Renewed	
Child Record ID:	DEH2017-HWAST-0104999			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	01/13/2017 12:50:50 AM			Trade Secret:	false	

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Chemical Name:						
Common Name Inventory:		Waste Toxics				
ID:	43989			Permit Status:	Permit Renewed	
Child Record ID:	DEH2017-HWAST-0105000			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	01/13/2017 12:50:50 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Waste Aerosols				
ID:	96979			Permit Status:	Permit Renewed	
Child Record ID:	DEH2017-HWAST-0113976			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	10/06/2017 02:31:25 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Waste Corrosives - Basic				
ID:	96980			Permit Status:	Permit Renewed	
Child Record ID:	DEH2017-HWAST-0113977			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	10/06/2017 02:31:25 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Waste Oxidizers				
ID:	96975			Permit Status:	Permit Renewed	
Child Record ID:	DEH2017-HWAST-0113972			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	10/06/2017 02:31:25 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Used Lead Acid Batteries				
ID:	96978			Permit Status:	Permit Renewed	
Child Record ID:	DEH2017-HWAST-0113975			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	10/06/2017 02:31:25 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Waste Corrosives - Acidic				
ID:	96974			Permit Status:	Permit Renewed	
Child Record ID:	DEH2017-HCHEM-0135655			Active Permit:	true	
CAS No:	Mixture			Haz Material Type:	Mixture	
Last Updated:	10/06/2017 02:31:25 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Floor Stripper				
ID:	96982			Permit Status:	Permit Renewed	
Child Record ID:	DEH2017-HWAST-0113979			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	10/06/2017 02:31:25 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Waste Aerosols				
ID:	96977			Permit Status:	Permit Renewed	
Child Record ID:	DEH2017-HWAST-0113974			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	10/06/2017 02:31:25 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Waste Flammable Liquids				
ID:	96981			Permit Status:	Permit Renewed	
Child Record ID:	DEH2017-HWAST-0113978			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	10/06/2017 02:31:25 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Waste Toxics				
ID:	139322			Permit Status:	Permit Renewed	
Child Record ID:	DEH2018-HWAST-0142750			Active Permit:	true	
CAS No:				Haz Material Type:		

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Last Updated:	10/06/2018 02:32:56 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Waste Flammable Liquids					
ID:	139323				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0142751				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/06/2018 02:32:56 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Waste Corrosives - Acidic					
ID:	139320				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0142748				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/06/2018 02:32:56 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Used Lead Acid Batteries					
ID:	139327				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0142755				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/06/2018 02:32:56 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Waste Aerosols					
ID:	139324				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0142752				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/06/2018 02:32:56 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Waste Corrosives - Basic					
ID:	139326				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0142754				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/06/2018 02:32:56 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Waste Toxics					
ID:	139325				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0142753				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/06/2018 02:32:56 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Waste Oxidizers					
ID:	139319				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HCHEM-0168497				Active Permit:	true
CAS No:	Mixture				Haz Material Type:	Mixture
Last Updated:	10/06/2018 02:32:56 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Floor Stripper					

Hazardous Materials Inspection Violations

Container Tank ID:		Inspection No:	5591701
Facility ID No:	37-000-208141	Inspection Type:	Routine
ID:	23209	Inspection Date:	01/11/2017 02:28:00 PM
UST ID:		Compliance Date:	03/16/2017 12:00:00 AM
Permit Status:	Permit Suspended	Last Updated:	10/20/2020 12:35:23 AM
Active Permit:	false	NOV:	false
Program Element:	Hazardous Materials Release Response Plans		
Violation Code:	1010005 Site map not submitted in CERS or not sufficient. HSC 25505(a)(2) and 25508(a)(1)(A)		
Violation Classification:	Minor		

HMD Permits Map Data as of Feb 13, 2023

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
GIS Facility ID:	37-000-208141				Parcel No:	282-130-64-00
GIS CERS ID:	10140617				Status:	
GIS Record Type:	LUEG-DEH/HMD/UPFP/Facility				Census Tract:	208.05
Per Type:					Parcel Zip:	92065
Per Sub Type:					Community:	Ramona
Per Cat:					Jurisdiction:	UNINCORPORATED
Record Status:	Permit Renewed				Basin No:	905.41
LRG QTY MW Gener:	No				BOS Dist:	2
EPA ID No:	CAL000409136				Tbpg Grid:	
RMP CAL ARP:	Not Applicable				Insp Dist:	HE017
Tank Owner:					Feature ID:	2821306400
SIC Code:	5311				Kiva Per Typ:	HK07 208141
NAICS Code:	452990				Agency Name:	COSD
Exp Date:					Loc Name:	
Own/Operate USTs :					Score:	
UST Facility:					Side:	
Total No USTs:					User Fld:	
No of Tanks:					Addr Type:	
Own Oper APS:	N				Match Addr:	
Tot AGP Cap:	0				Match Type:	
Capacity LR:					Farm Nursery:	
Hazmat EHS:	N				Record Alias:	Unified Program Facility Permit
Hazmat Rad:	No				Hirt Flag:	No
Haz Waste G:	Y				Indian or Territory:	
Haz Wst Coll Site:	N				County ID:	
Haz Waste Rad:	N				Zip:	
Haz Waste EHS:	N				X Coord:	6367814.401
Recycle100:	N				Y Coord:	1957009.761
RCRA LRG Qty:	N				X Map Coord:	
Accept Offs:	N				Y Map Coord:	
Univ Waste Gen Typ:					Point X:	6367814.40100001
Univ Waste Gen Han:	N				Point Y:	1957009.76100001
Toxic Gas:	No				Lat GS84:	33.0351653
Email Perm:					Lon GS84:	-116.8825306
Phone Perm:	847-286-3667					
Full Name:	Kmart Operations, LLC					
Site Address:	1855 MAIN ST					
Address:	1855 MAIN ST					
Business Type:	Retail Stores					
HW Tier:	Not Applicable					
Disclose Qty Haz Mat:	Y					
Onsite Haz Waste Tre:	N					
Bill Code:	Not Applicable					
Bill Code 2:	Not Applicable					
Bill Code 3:	Not Applicable					
ER Con Name:	Lance Doty					
ER Contact:	951-200-0598					
ER Con Title:	Store Manager					
ER Con Work Ph:	760-788-7886					
ARC APN:						
ARC Address:						
ARC City:						
ARC Zipcode:						
ARC State:						
Water Purv:	RAMONA MUNICIPAL WATER DISTRICT					
Fire Agency:	RAMONA MUNI WATER DIST					
Geo SRC:	Mapped to record APN/Parcel XY center					
Frhmbp Report Filename:	HMBP208141.pdf					
Frhmbp Sitemap Filename:	MAP_208141.pdf					

<u>12</u>	2 of 3	NE	0.20 / 1,059.08	1,420.74 / 3	KMART #3678 1855 MAIN ST RAMONA CA 92065	RCRA NON GEN

Handler ID:	CAL000231575
Generator Status:	N
Recycler Activity?:	NO
Recycler Activity Note:	This facility has not been identified as a Recycler Facility from both the RCRA Handler and Biennial Report

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Modules.

Violation/Evaluation Summary

Note: NO RECORDS: As of Nov 2025, there are no Compliance Monitoring and Enforcement (violation) records associated with this facility (EPA ID).

Handler Summary

Importer:	No	Used Oil Transpor:	No
Mixed Waste Gen:	No	Used Oil Trans Fac:	No
Transporter:	No	Used Oil Processor:	No
Transfer Facility:	No	Used Oil Refiner:	No
Recycler:	No	Used Oil Burner:	No
Onsite Burner Exem:	No	Commercial TSD:	No
Furnace Exemption:	No	Recycl Nonstorage:	No
Underground Injec:	No		
Used Oil Market Burner:	No		
Used Oil Spec Marketer:	No		

Additional Handler Summary Details

Source Type:	I	NAIC 1:	45211
Seq No:	1	NAIC 2:	
Non Notifier:		NAIC 3:	
Receive Date:	20011015	NAIC 4:	
Active Site:	H----	State:	CA
Land Type:		Location Latitude:	33.034351
In Handler Univ:	Y	Location Longitude:	-116.881719
In A Universe:	Y	Loc GIS Primary:	N
Gen Status:	N	Loc GIS Origin:	AG
Report Cycle:		State District Owner:	
Accessibility:		State District:	
Region:	09		
Fed Waste Gen Owner:	HQ		
State Waste Generator Owner:	CA		
State Waste Generator:	2		
Short Term Generator:	N		
Uni Waste:	Y		
Universal Waste Dest Facility:	Y		
Federal Universal Waste:	N		
As Federally Regulated Tsdf:	-----		
As Converter Tsdf:	-----		
As State Regulated Tsdf:	-----		
As State Regulated Handler:	---		
Federal Indicator:	---		
Hsm:	N		
Subpart K:	----		
GPRA Permit:	N		
GPRA Renewal:	N		
Permit Renewal Wrkld:	-----		
Permwrk ID:	-----		
Perm Prog:	-----		
Pcwrkld:	-----		
Closwrkld:	-----		
GPRA Ca:	N		
Cawrkld:	N		
Subjca Tsd Discretion:	N		
NCAPS:	N		
EC Indicator:	N		
Ca725 Indicator:	N		
Ca750 Indicator:	N		
Operating Tsdf:	-----		
Full Enforcement:	-----		
Snc:	N		
Unaddressed Snc:	N		

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Addressed Snc:		N				
Snc With Comp Sched:		N				
Fa Required:		-----				
Hhandler Last Change:		20180905				
Recognized Trader Importer:		N				
Recognized Trader Exporter:		N				
Slab Importer:		N				
Slab Exporter:		N				
Manifest Broker:		N				
Subpart P:		N				
Contact Language:		EN				
Handler Name:		KMART #3678				
Location Street No:						
Location Street1:		1855 MAIN ST				
Location Street2:						
Location City:		RAMONA				
Location State:		CA				
Location Zip:		92065				
Location County Code:		CA073				
Location County Name:		SAN DIEGO				
Location Country:		US				
Contact Name:		JAMES TUNNEY				
Contact Street No:						
Contact Street1:		3333 BEVERLY ROAD, B5-348A				
Contact Street2:						
Contact City:		HOFFMAN ESTATES				
Contact State:		IL				
Contact Zip:		60179-0000				
Contact Country:						
Contact Phone & Ext:		847-286-3667				
Contact Fax:						
Contact Email Address:		JAMES.TUNNEY@SEARSHC.COM				
Contact Title:						
Owner Name:		KMART CORPORATION				
Owner Type:		O				
Owner Seq:		1				
Operator Name:		JAMES TUNNEY				
Operator Type:		O				
Operator Seq:		2				
Public Notes:						

Contact DTSC for information.

Hazardous Waste Handler Details

Seq No: 1
 Receive Date: 20011015
 Handler Name: KMART #3678
 Fed Waste Generator: N
 Generator Code Description: Not a Generator, Verified
 Source Type: Implementer
 TSD Activity: N

Owner/Operator Details

Owner/Operator Ind:	Current Operator	Street No:	
Type:	Other	Street1:	3333 BEVERLY ROAD, B5-348A
Name:	JAMES TUNNEY	Street2:	
Dt Became Current:		City:	HOFFMAN ESTATES
Dt Ended Current:		State:	IL
Phone:	847-286-3667	Country:	
Source Type:	Implementer	Zip:	60179-0000

Owner/Operator Ind:	Current Owner	Street No:	
Type:	Other	Street1:	3333 BEVERLY RD B5-362A
Name:	KMART CORPORATION	Street2:	

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
<i>Dt Became Current:</i>					City:	HOFFMAN ESTATES
<i>Dt Ended Current:</i>					State:	IL
<i>Phone:</i>	847-286-3667				Country:	
<i>Source Type:</i>	Implementer				Zip:	60179-0000

12	3 of 3	NE	0.20 / 1,059.08	1,420.74 / 3	KMART #3678 1855 MAIN ST RAMONA CA 92065	RCRA NON GEN

Handler ID: CAL000409136
Generator Status: N
Recycler Activity?: NO
Recycler Activity Note: This facility has not been identified as a Recycler Facility from both the RCRA Handler and Biennial Report Modules.

Violation/Evaluation Summary

Note: NO RECORDS: As of Nov 2025, there are no Compliance Monitoring and Enforcement (violation) records associated with this facility (EPA ID).

Handler Summary

Importer:	No	Used Oil Transpor:	No
Mixed Waste Gen:	No	Used Oil Trans Fac:	No
Transporter:	No	Used Oil Processor:	No
Transfer Facility:	No	Used Oil Refiner:	No
Recycler:	No	Used Oil Burner:	No
Onsite Burner Exem:	No	Commercial TSD:	No
Furnace Exemption:	No	Recycl Nonstorage:	No
Underground Injec:	No		
Used Oil Market Burner:	No		
Used Oil Spec Marketer:	No		

Additional Handler Summary Details

Source Type:	I	NAIC 1:	45211
Seq No:	1	NAIC 2:	
Non Notifier:		NAIC 3:	
Receive Date:	20150807	NAIC 4:	
Active Site:	H----	State:	CA
Land Type:		Location Latitude:	33.034351
In Handler Univ:	Y	Location Longitude:	-116.881719
In A Universe:	Y	Loc GIS Primary:	N
Gen Status:	N	Loc GIS Origin:	AG
Report Cycle:		State District Owner:	
Accessibility:		State District:	
Region:	09		
Fed Waste Gen Owner:	HQ		
State Waste Generator Owner:	CA		
State Waste Generator:	2		
Short Term Generator:	N		
Uni Waste:	Y		
Universal Waste Dest Facility:	Y		
Federal Universal Waste:	N		
As Federally Regulated Tsdf:	-----		
As Converter Tsdf:	-----		
As State Regulated Tsdf:	-----		
As State Regulated Handler:	---		
Federal Indicator:	---		
Hsm:	N		
Subpart K:	----		
GPRA Permit:	N		
GPRA Renewal:	N		
Permit Renewal Wrkld:	-----		
Permwrk ID:	-----		

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Perm Prog:		-----				
Pcwrkld:		-----				
Closwrkld:		-----				
GPRA Ca:		N				
Cawrkld:		N				
Subjca Tsd Discretion:		N				
NCAPS:		N				
EC Indicator:		N				
Ca725 Indicator:		N				
Ca750 Indicator:		N				
Operating Tsd:		-----				
Full Enforcement:		-----				
Snc:		N				
Unaddressed Snc:		N				
Addressed Snc:		N				
Snc With Comp Sched:		N				
Fa Required:		-----				
Hhandler Last Change:		20180906				
Recognized Trader Importer:		N				
Recognized Trader Exporter:		N				
Slab Importer:		N				
Slab Exporter:		N				
Manifest Broker:		N				
Subpart P:		N				
Contact Language:		EN				
Handler Name:		KMART #3678				
Location Street No:						
Location Street1:		1855 MAIN ST				
Location Street2:						
Location City:		RAMONA				
Location State:		CA				
Location Zip:		92065				
Location County Code:		CA073				
Location County Name:		SAN DIEGO				
Location Country:		US				
Contact Name:		JAMES TUNNEY				
Contact Street No:						
Contact Street1:		3333 BEVERLY RD # B5-348A				
Contact Street2:		ENVIRONMENTAL AFFAIRS				
Contact City:		HOFFMAN ESTATES				
Contact State:		IL				
Contact Zip:		60179				
Contact Country:						
Contact Phone & Ext:		847-286-3667				
Contact Fax:		847-747-1609				
Contact Email Address:		JAMES.TUNNEY@SEARSHC.COM				
Contact Title:						
Owner Name:		KMART OPERATIONS LLC				
Owner Type:		O				
Owner Seq:		1				
Operator Name:		JAMES TUNNEY				
Operator Type:		O				
Operator Seq:		2				
Public Notes:						

Contact DTSC for information.

Hazardous Waste Handler Details

Seq No: 1
Receive Date: 20150807
Handler Name: KMART #3678
Fed Waste Generator: N
Generator Code Description: Not a Generator, Verified
Source Type: Implementer
TSD Activity: N

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
<u>Owner/Operator Details</u>						
Owner/Operator Ind:	Current Owner				Street No:	
Type:	Other				Street1:	3333 BEVERLY RD # B5-348A
Name:	KMART OPERATIONS LLC				Street2:	
Dt Became Current:					City:	HOFFMAN ESTATES
Dt Ended Current:					State:	IL
Phone:	847-286-0037				Country:	
Source Type:	Implementer				Zip:	60179-0001
Owner/Operator Ind:	Current Operator				Street No:	
Type:	Other				Street1:	3333 BEVERLY RD # B5-348A
Name:	JAMES TUNNEY				Street2:	ENVIRONMENTAL AFFAIRS
Dt Became Current:					City:	HOFFMAN ESTATES
Dt Ended Current:					State:	IL
Phone:	847-286-3667				Country:	
Source Type:	Implementer				Zip:	60179

13	1 of 3	ENE	0.21 / 1,087.89	1,416.55 / -1	Jiffy Lube #3777 1850 MAIN ST RAMONA CA 92065	CERS TANK
Site ID:	547382					
Latitude:	33.033680					
Longitude:	-116.881660					

Regulated Programs

EI ID:	10769407
EI Description:	Aboveground Petroleum Storage
EI ID:	10769407
EI Description:	Hazardous Waste Generator

Violations

Violation Date:	04/16/2021	Violation Source:	CERS
Violation Program:	APSA	Violation Division:	San Diego County Department of Env Health
Citation:	HSC 6.67 25270.6(a)(1), 25270.6(a)(2) - California Health and Safety Code, Chapter 6.67, Section(s) 25270.6(a)(1), 25270.6(a)(2)		
Violation Notes:			

Returned to compliance on 02/14/2023. Inspection Sequence ID:6251796

Violation Description:

Failure to submit a tank facility statement on or before January 1 annually unless a current Business Plan has been submitted.

Violations

Violation Date:	04/16/2021	Violation Source:	CERS
Violation Program:	HMRP	Violation Division:	San Diego County Department of Env Health
Citation:	HSC 6.95 25508.2 - California Health and Safety Code, Chapter 6.95, Section(s) 25508.2		
Violation Notes:			

Returned to compliance on 08/31/2023. Inspection Sequence ID:6251796

Violation Description:

Failure to annually review and electronically certify that the business plan is complete and accurate on or before the annual due date.

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Violations

Violation Date:	04/16/2021	Violation Source:	CERS
Violation Program:	HW	Violation Division:	San Diego County Department of Env Health
Citation:	HSC 6.5 Multiple - California Health and Safety Code, Chapter 6.5, Section(s) Multiple		
Violation Notes:			

Returned to compliance on 08/31/2023. Inspection Sequence ID:6251796; Violation:HMD0152 Failed to report &/or update the required inventory information for hazardous waste(s) generated at the facility in CERS. SDCC 68.904(a)(2)

Violation Description:

Hazardous Waste Generator Program - Operations/Maintenance - General

Violations

Violation Date:	04/16/2021	Violation Source:	CERS
Violation Program:	HMRRP	Violation Division:	San Diego County Department of Env Health
Citation:	HSC 6.95 25508(a)(3) - California Health and Safety Code, Chapter 6.95, Section(s) 25508(a)(3)		
Violation Notes:			

Returned to compliance on 08/31/2023. Inspection Sequence ID:6251796

Violation Description:

Failure to complete and electronically submit a site map with all required content.

Violations

Violation Date:	04/16/2021	Violation Source:	CERS
Violation Program:	HMRRP	Violation Division:	San Diego County Department of Env Health
Citation:	HSC 6.95 25508(a)(3) - California Health and Safety Code, Chapter 6.95, Section(s) 25508(a)(3)		
Violation Notes:			

Returned to compliance on 08/31/2023. Inspection Sequence ID:6251796

Violation Description:

Failure to complete and electronically submit hazardous material inventory information for all reportable hazardous materials on site at or above reportable quantities.

Evaluations

Eval Date:	02/22/2024
Violations Found:	No
Eval General Type:	Compliance Evaluation Inspection
Eval Type:	Routine done by local agency
Eval Division:	San Diego County Department of Env Health
Eval Program:	APSA
Eval Source:	CERS
Eval Notes:	

Inspector: Murphy Sky Inspection ID:7361156; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date:	02/22/2024
Violations Found:	No
Eval General Type:	Compliance Evaluation Inspection
Eval Type:	Routine done by local agency
Eval Division:	San Diego County Department of Env Health
Eval Program:	HW
Eval Source:	CERS
Eval Notes:	

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Inspector: Murphy Sky Inspection ID:7361156; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date: 04/16/2021
Violations Found: Yes
Eval General Type: Compliance Evaluation Inspection
Eval Type: Routine done by local agency
Eval Division: San Diego County Department of Env Health
Eval Program: APSA
Eval Source: CERS
Eval Notes:

Inspector: Villalvazo Olivia Inspection ID:6251796; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date: 04/16/2021
Violations Found: Yes
Eval General Type: Compliance Evaluation Inspection
Eval Type: Routine done by local agency
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS
Eval Notes:

Inspector: Villalvazo Olivia Inspection ID:6251796; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date: 02/22/2024
Violations Found: No
Eval General Type: Compliance Evaluation Inspection
Eval Type: Routine done by local agency
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS
Eval Notes:

Inspector: Murphy Sky Inspection ID:7361156; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date: 04/16/2021
Violations Found: Yes
Eval General Type: Compliance Evaluation Inspection
Eval Type: Routine done by local agency
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS
Eval Notes:

Inspector: Villalvazo Olivia Inspection ID:6251796; Note: data in [EVAL Notes] field for some records is truncated from the source.

Affiliations

Affil Type Desc: Document Preparer
Entity Name: Lillian Nicholson
Entity Title:
Address:
City:
State:
Country:
Zip Code:
Phone:

Affil Type Desc: CUPA District
Entity Name: San Diego County Env Health Qlty
Entity Title:
Address: PO Box 129261
City: San Diego
State: CA

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Country: Zip Code: 92112-9261 Phone: (858) 505-6880 Affil Type Desc: Legal Owner Entity Name: Team Car Care West LLC Entity Title: Address: 105 Decker Court Suite 900 City: Irving State: TX Country: United States Zip Code: 75062 Phone: (972) 812-7900 Affil Type Desc: Operator Entity Name: Team Car Care West LLC Entity Title: Address: City: State: Country: Zip Code: Phone: (972) 812-7900 Affil Type Desc: Parent Corporation Entity Name: Team Car Care West LLC Entity Title: Address: City: State: Country: Zip Code: Phone: Affil Type Desc: Facility Mailing Address Entity Name: Mailing Address Entity Title: Address: 105 Decker Court Suite 900 City: Irving State: TX Country: Zip Code: 75062 Phone: Affil Type Desc: Environmental Contact Entity Name: Lillian Nicholson Entity Title: Address: 105 Decker Court Suite 900 City: Irving State: TX Country: Zip Code: 75062 Phone: Affil Type Desc: Identification Signer Entity Name: Lillian Nicholson Entity Title: Compliance Manager Address: City: State: Country: Zip Code: Phone:						
13	2 of 3	ENE	0.21 / 1,087.89	1,416.55 / -1	Jiffy Lube #3777 1850 MAIN ST RAMONA CA 92065	HAZ SANDIEGO

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Record ID:		DEH2019-HUPFP-005055				
Facility Name:		Jiffy Lube #3777				
Facility Address:		1850 MAIN ST RAMONA, CA 92065				
Facility City:		RAMONA				
Facility Zip Code:		92065				
Facility Latitude:		33.03368746316979				
Facility Longitude:		-116.88166567926025				
GIS Record ID:		DEH2019-HUPFP-005055				
GIS Facility Name:		Jiffy Lube #3777				
GIS Facility Address:		1850 MAIN ST				
GIS Facility City:		RAMONA				
GIS Facility Zip Code:		92065				
GIS Fac Latitude:						
GIS Fac Longitude:						
Tank Owner Name:						

Hazardous Materials Facility Data

CERS ID:	10769407	Haz Mat on Site:	true
Facility ID No:	37-000-005055	Haz Waste Generatr:	true
EPA ID No:	CAL000439708	Own/Oper Under:	false
Active Permit:	true	Own/Oper Above:	true
Permit Status:	Permit Renewed	Recycle:	false
Bus Phone:	972-812-7900	RCRA Large Qty Gen:	false
Bus Fax:	0	HHW Collection:	false
Last Updated:	09/03/2023 07:03:35 PM		
Mailing Address:	105 Decker Court Suite 900, Irving, TX 75062		
Onsite H Waste Treatment:	false		
New Georeferenced Column:			

Hazardous Waste and Materials

ID:	317254	Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HCHEM-0241558	Active Permit:	true
CAS No:	848301-69-9	Haz Material Type:	Pure
Last Updated:	06/15/2022 02:30:46 AM	Trade Secret:	false
Chemical Name:	Automatic Transmission Fluid		
Common Name Inventory:	Automatic Transmission Fluid		
ID:	564654	Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HCHEM-0357623	Active Permit:	true
CAS No:	848301-69-9	Haz Material Type:	Pure
Last Updated:	07/06/2023 02:31:53 AM	Trade Secret:	false
Chemical Name:	Automatic Transmission Fluid		
Common Name Inventory:	Automatic Transmission Fluid		
ID:	605650	Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HCHEM-0380137	Active Permit:	true
CAS No:	848301-69-9	Haz Material Type:	Pure
Last Updated:	09/03/2023 07:03:35 PM	Trade Secret:	false
Chemical Name:	Automatic Transmission Fluid		
Common Name Inventory:	Automatic Transmission Fluid		
ID:	605652	Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HCHEM-0380139	Active Permit:	true
CAS No:	107-21-1	Haz Material Type:	Pure
Last Updated:	09/03/2023 07:03:35 PM	Trade Secret:	false
Chemical Name:	Ethylene Glycol		
Common Name Inventory:	Ethylene Glycol		
ID:	317253	Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HCHEM-0241557	Active Permit:	true
CAS No:		Haz Material Type:	Mixture
Last Updated:	06/15/2022 02:30:46 AM	Trade Secret:	false
Chemical Name:	Motor Oil		
Common Name Inventory:	Motor Oil		

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
ID:	564655				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HCHEM-0357624				Active Permit:	true
CAS No:					Haz Material Type:	Mixture
Last Updated:	07/06/2023 02:31:53 AM				Trade Secret:	false
Chemical Name:	Motor Oil					
Common Name Inventory:	Motor Oil					
ID:	605651				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HCHEM-0380138				Active Permit:	true
CAS No:					Haz Material Type:	Mixture
Last Updated:	09/03/2023 07:03:35 PM				Trade Secret:	false
Chemical Name:	Motor Oil					
Common Name Inventory:	Motor Oil					
ID:	605655				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0348781				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	09/03/2023 07:03:35 PM				Trade Secret:	false
Chemical Name:	USED ETHYLENE GLYCOL					
Common Name Inventory:	USED ANTIFREEZE					
ID:	317256				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0212289				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	06/15/2022 02:30:46 AM				Trade Secret:	false
Chemical Name:	USed Oil Filters (Draind)					
Common Name Inventory:	Used Oil Filters (Drained)					
ID:	564656				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0326213				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	07/06/2023 02:31:53 AM				Trade Secret:	false
Chemical Name:	USed Oil Filters (Draind)					
Common Name Inventory:	Used Oil Filters (Drained)					
ID:	605653				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0348779				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	09/03/2023 07:03:35 PM				Trade Secret:	false
Chemical Name:	USed Oil Filters (Draind)					
Common Name Inventory:	Used Oil Filters (Drained)					
ID:	317255				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0212288				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	06/15/2022 02:30:46 AM				Trade Secret:	false
Chemical Name:	Used Motor Oil					
Common Name Inventory:	Used Motor Oil					
ID:	564657				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0326214				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	07/06/2023 02:31:53 AM				Trade Secret:	false
Chemical Name:	Used Motor Oil					
Common Name Inventory:	Used Motor Oil					
ID:	605654				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0348780				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	09/03/2023 07:03:35 PM				Trade Secret:	false
Chemical Name:	Used Motor Oil					
Common Name Inventory:	Used Motor Oil					
ID:	605656				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0348782				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	09/03/2023 07:03:35 PM				Trade Secret:	false
Chemical Name:	WASTE BRAKE FLUID					
Common Name Inventory:	BRAKE FLUID					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Hazardous Materials Inspection Violations

Container Tank ID: 37-000-005055
Facility ID No: 54447
ID: 04/16/2021 12:00:00 AM
UST ID:
Permit Status: Permit Renewed
Active Permit: true
Program Element: Aboveground Petroleum Storage Act
Violation Code: 4010032 Failed to submit a tank facility statement or update/certify Business Plan annually. HSC 25270.6(a)(1) or (a)(2)
Violation Classification: Minor

Inspection No: 6251796
Inspection Type: Initial Inspection
Inspection Date:
Compliance Date: 02/14/2023 12:00:00 AM
Last Updated: 09/03/2023 07:03:35 PM
NOV: false

Container Tank ID: 37-000-005055
Facility ID No: 54449
ID: 04/16/2021 12:00:00 AM
UST ID:
Permit Status: Permit Renewed
Active Permit: true
Program Element: Hazardous Materials Release Response Plans
Violation Code: 1010008 HMBP not certified as complete and accurate in CERS by the required due date. HSC 25508.2, 19 CCR 2654(b)
Violation Classification: Minor

Inspection No: 6251796
Inspection Type: Initial Inspection
Inspection Date:
Compliance Date: 08/31/2023 12:00:00 AM
Last Updated: 09/03/2023 07:03:35 PM
NOV: false

Container Tank ID: 37-000-005055
Facility ID No: 54448
ID: 04/16/2021 12:00:00 AM
UST ID:
Permit Status: Permit Renewed
Active Permit: true
Program Element: Hazardous Materials Release Response Plans
Violation Code: 1010005 Site map not submitted in CERS or not sufficient. HSC 25505(a)(2); 25508.1(f); 19 CCR 2652(a)(3)
Violation Classification: Minor

Inspection No: 6251796
Inspection Type: Initial Inspection
Inspection Date:
Compliance Date: 08/31/2023 12:00:00 AM
Last Updated: 09/03/2023 07:03:35 PM
NOV: false

Container Tank ID: 37-000-005055
Facility ID No: 54450
ID: 04/16/2021 12:00:00 AM
UST ID:
Permit Status: Permit Renewed
Active Permit: true
Program Element: Hazardous Materials Release Response Plans
Violation Code: 1010004 Chemical inventory incomplete or not submitted in CERS. HSC 25505(a)(1); 25507(a); 25508.1(a-b); 19 CCR 2654 (a) or (d)
Violation Classification: Class II

Inspection No: 6251796
Inspection Type: Initial Inspection
Inspection Date:
Compliance Date: 08/31/2023 12:00:00 AM
Last Updated: 09/03/2023 07:03:35 PM
NOV: false

Container Tank ID: 37-000-005055
Facility ID No: 54446
ID: 04/16/2021 12:00:00 AM
UST ID:
Permit Status: Permit Renewed
Active Permit: true
Program Element: Hazardous Waste Generator
Violation Code: HMD0152 Failed to report &/or update the required inventory information for hazardous waste(s) generated at the facility in CERS. SDCC 68.904(a)(2)
Violation Classification: Class II

Inspection No: 6251796
Inspection Type: Initial Inspection
Inspection Date:
Compliance Date: 08/31/2023 12:00:00 AM
Last Updated: 09/03/2023 07:03:35 PM
NOV: false

HMD Permits Map Data

Epa ID: CAL000439708
Cers ID: 10769407
Sitemap: MAP_005055.pdf
Record Status: Permit Renewed
Er Contact1: Anthony Soto
Er Title1: Regional Vice President
Er Phone1: 520-390-1252
Er Altphone: 520-390-1252

Opened Dt: 2019-06-01T00:00:00
Expiration Dt: 2024-07-31T00:00:00
Rpt Name: HMBP005055.pdf
Hirt Flag: Y
Billing Code1: Base + CUPA
St No: 1850
St No End:
St Name: MAIN

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Er Contact2:	CODY KIDDER			St Dir:		
Er Title2:	RVP			St Type:	ST	
Er Phone2:	951-312-0024			St Unit:		
Er Altphone2:	951-312-0024			Insp Dist Geoinfo:	HE020	
Biz Apn:	282-150-03-00					
Biz Phone:	972-812-7900					
Biz Email:	Compliance@jiffyworld.com					
Biz Owner:	Team Car Care West LLC					
Biz Type:	Auto Repair, General - Waste USTs Only					
Facility Subject To Calarp:						
Plating Shop Metal Finishing:						
Chemical Supplier Wholesale:						
Pesticide Applicator Fumigatio:						
Chem Gas Paint Manufacture:						
Resin Site With 6 Items:						
Petroleum Propane Fuel Supp:						
Site With Gt20 Inventory Items:						
Apsa Stor Tank Gt10000 Gal:	Y					
Apsa Stor Tank Chem Gt999ga:						
Ust Stor Tank Fuel Gt30k Ga:						
Cryogas Gt20kcft200gal1200lb:						
Gases Gt20kCft 208 Gal 1666 L:						
Prop Gt185kCft5k Gal 2100:						
Extreme Haz Gt20 Cft 54 Gal 5:						

13	3 of 3	ENE	0.21 / 1,087.89	1,416.55 / -1	TEAM CAR CARE WEST LLC DBA JIFFY LUBE 1850 MAIN ST RAMONA CA 92065	RCRA NON GEN

Handler ID:	CAL000439708
Generator Status:	N
Recycler Activity?:	NO
Recycler Activity Note:	This facility has not been identified as a Recycler Facility from both the RCRA Handler and Biennial Report Modules.

Violation/Evaluation Summary

Note:	NO RECORDS: As of Nov 2025, there are no Compliance Monitoring and Enforcement (violation) records associated with this facility (EPA ID).

Handler Summary

Importer:	No	Used Oil Transpor:	No
Mixed Waste Gen:	No	Used Oil Trans Fac:	No
Transporter:	No	Used Oil Processor:	No
Transfer Facility:	No	Used Oil Refiner:	No
Recycler:	No	Used Oil Burner:	No
Onsite Burner Exem:	No	Commercial TSD:	No
Furnace Exemption:	No	Recycl Nonstorage:	No
Underground Injec:	No		
Used Oil Market Burner:	No		
Used Oil Spec Marketer:	No		

Additional Handler Summary Details

Source Type:	I	NAIC 1:	811198
Seq No:	1	NAIC 2:	
Non Notifier:		NAIC 3:	
Receive Date:	20181010	NAIC 4:	
Active Site:	H----	State:	CA
Land Type:		Location Latitude:	33.034077
In Handler Univ:	Y	Location Longitude:	-116.881978
In A Universe:	Y	Loc GIS Primary:	N
Gen Status:	N	Loc GIS Origin:	AG

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Report Cycle:			State District Owner:			
Accessibility:			State District:			
Region:	09					
Fed Waste Gen Owner:		HQ				
State Waste Generator Owner:		CA				
State Waste Generator:		2				
Short Term Generator:		N				
Uni Waste:		Y				
Universal Waste Dest Facility:		Y				
Federal Universal Waste:		N				
As Federally Regulated Tsdf:		-----				
As Converter Tsdf:		-----				
As State Regulated Tsdf:		-----				
As State Regulated Handler:		---				
Federal Indicator:		---				
Hsm:		N				
Subpart K:		----				
GPRA Permit:		N				
GPRA Renewal:		N				
Permit Renewal Wrkld:		-----				
Permwrk ID:		-----				
Perm Prog:		-----				
Pcwrkld:		-----				
Closwrkld:		-----				
GPRA Ca:		N				
Cawrkld:		N				
Subjca Tsd Discretion:		N				
NCAPS:		N				
EC Indicator:		N				
Ca725 Indicator:		N				
Ca750 Indicator:		N				
Operating Tsdf:		-----				
Full Enforcement:		-----				
Snc:		N				
Unaddressed Snc:		N				
Addressed Snc:		N				
Snc With Comp Sched:		N				
Fa Required:		-----				
Hhandler Last Change:		20181120				
Recognized Trader Importer:		N				
Recognized Trader Exporter:		N				
Slab Importer:		N				
Slab Exporter:		N				
Manifest Broker:		N				
Subpart P:		N				
Contact Language:		EN				
Handler Name:		TEAM CAR CARE WEST LLC DBA JIFFY LUBE				
Location Street No:						
Location Street1:		1850 MAIN ST				
Location Street2:						
Location City:		RAMONA				
Location State:		CA				
Location Zip:		92065				
Location County Code:		CA073				
Location County Name:		SAN DIEGO				
Location Country:		US				
Contact Name:		JAMES WILLIS				
Contact Street No:						
Contact Street1:		105 DECKER COURT SUITE 900				
Contact Street2:						
Contact City:		IRVING				
Contact State:		TX				
Contact Zip:		75062				
Contact Country:						
Contact Phone & Ext:		972-812-7935				
Contact Fax:		469-426-3960				
Contact Email Address:		COMPLIANCE@JIFFYWORLD.COM				
Contact Title:						
Owner Name:		TEAM CAR CARE W LLC DBA JIFFY LUBE				

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Owner Type:	O
Owner Seq:	1
Operator Name:	JAMES WILLIS
Operator Type:	O
Operator Seq:	2
Public Notes:	

Contact DTSC for information.

Hazardous Waste Handler Details

Seq No:	1
Receive Date:	20181010
Handler Name:	TEAM CAR CARE WEST LLC DBA JIFFY LUBE
Fed Waste Generator:	N
Generator Code Description:	Not a Generator, Verified
Source Type:	Implementer
TSD Activity:	N

Owner/Operator Details

Owner/Operator Ind:	Current Operator	Street No:	
Type:	Other	Street1:	105 DECKER COURT SUITE 900
Name:	JAMES WILLIS	Street2:	
Dt Became Current:		City:	IRVING
Dt Ended Current:		State:	TX
Phone:	972-812-7935	Country:	
Source Type:	Implementer	Zip:	75062
Owner/Operator Ind:	Current Owner	Street No:	
Type:	Other	Street1:	105 DECKER CT STE 900
Name:	TEAM CAR CARE W LLC DBA JIFFY LUBE	Street2:	
Dt Became Current:		City:	IRVING
Dt Ended Current:		State:	TX
Phone:	972-812-7900	Country:	
Source Type:	Implementer	Zip:	75062-0000

14	1 of2	SW	0.21 / 1,096.15	1,410.23 / -7	Tractor Supply Company Store #1862- Ramona 203 HUNTER ST RAMONA CA 92065	HAZ SANDIEGO
Record ID:	DEH2014-HUPFP-000934					
Facility Name:	Tractor Supply Company Store #1862- Ramona					
Facility Address:	203 HUNTER ST RAMONA, CA 92065					
Facility City:	RAMONA					
Facility Zip Code:	92065					
Facility Latitude:	33.02975180583526					
Facility Longitude:	-116.88834014552957					
GIS Record ID:	DEH2014-HUPFP-000934					
GIS Facility Name:	Tractor Supply Company Store #1862- Ramona					
GIS Facility Address:	203 HUNTER ST					
GIS Facility City:	RAMONA					
GIS Facility Zip Code:	92065					
GIS Fac Latitude:						
GIS Fac Longitude:						
Tank Owner Name:						

Hazardous Materials Facility Data

CERS ID:	10586290	Haz Mat on Site:	true
Facility ID No:	37-000-000934	Haz Waste Generatr:	true
EPA ID No:	CAL000395864	Own/Oper Under:	false
Active Permit:	true	Own/Oper Above:	false

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Permit Status:	Permit Renewed				Recycle:	false
Bus Phone:	760-789-7052				RCRA Large Qty Gen:	false
Bus Fax:	0				HHW Collection:	false
Last Updated:	07/11/2023 02:30:39 AM					
Mailing Address:	5401 Virginia Way, Brentwood, TN 37027					
Onsite H Waste Treatment:	false					
New Georeferenced Column:						

Hazardous Waste and Materials

ID:	65349	Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HCHEM-0131337	Active Permit:	true
CAS No:	74-98-6	Haz Material Type:	Pure
Last Updated:	04/26/2017 02:36:38 AM	Trade Secret:	false
Chemical Name:	Propane		
Common Name Inventory:	Liquefied Petroleum Gas (lpg)		
ID:	143751	Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HCHEM-0170410	Active Permit:	true
CAS No:	74-98-6	Haz Material Type:	Pure
Last Updated:	04/25/2018 02:35:16 AM	Trade Secret:	false
Chemical Name:	Propane		
Common Name Inventory:	Liquefied Petroleum Gas (lpg)		
ID:	189593	Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HCHEM-0195058	Active Permit:	true
CAS No:	74-98-6	Haz Material Type:	Pure
Last Updated:	10/26/2018 10:37:11 PM	Trade Secret:	false
Chemical Name:	Propane		
Common Name Inventory:	Liquefied Petroleum Gas (lpg)		
ID:	208008	Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HCHEM-0207717	Active Permit:	true
CAS No:	74-98-6	Haz Material Type:	Pure
Last Updated:	04/30/2019 02:34:13 AM	Trade Secret:	false
Chemical Name:	Propane		
Common Name Inventory:	Liquefied Petroleum Gas (lpg)		
ID:	278168	Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HCHEM-0241505	Active Permit:	true
CAS No:	74-98-6	Haz Material Type:	Pure
Last Updated:	05/14/2020 02:34:01 AM	Trade Secret:	false
Chemical Name:	Propane		
Common Name Inventory:	Liquefied Petroleum Gas (lpg)		
ID:	386214	Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HCHEM-0286749	Active Permit:	true
CAS No:	74-98-6	Haz Material Type:	Pure
Last Updated:	02/20/2021 01:53:48 AM	Trade Secret:	false
Chemical Name:	Propane		
Common Name Inventory:	Liquefied Petroleum Gas (lpg)		
ID:	423573	Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HCHEM-0299107	Active Permit:	true
CAS No:	74-98-6	Haz Material Type:	Pure
Last Updated:	05/04/2022 02:30:47 AM	Trade Secret:	false
Chemical Name:	Propane		
Common Name Inventory:	Liquefied Petroleum Gas (lpg)		
ID:	490235	Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HCHEM-0328545	Active Permit:	true
CAS No:	74-98-6	Haz Material Type:	Pure
Last Updated:	05/06/2022 12:37:44 AM	Trade Secret:	false
Chemical Name:	Propane		
Common Name Inventory:	Liquefied Petroleum Gas (lpg)		
ID:	592805	Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HCHEM-0365969	Active Permit:	true

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
CAS No:	74-98-6				Haz Material Type:	Pure
Last Updated:	07/11/2023 02:30:39 AM				Trade Secret:	false
Chemical Name:	Propane					
Common Name Inventory:	Liquefied Petroleum Gas (lpg)					
ID:	65353				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0109804				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	04/26/2017 02:36:38 AM				Trade Secret:	false
Chemical Name:	Sulfuric Acid					
Common Name Inventory:	Sulfuric Acid					
ID:	143755				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0144390				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	04/25/2018 02:35:16 AM				Trade Secret:	false
Chemical Name:	Sulfuric Acid					
Common Name Inventory:	Sulfuric Acid (Core Batteries)					
ID:	189597				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0168240				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/26/2018 10:37:11 PM				Trade Secret:	false
Chemical Name:	Sulfuric Acid					
Common Name Inventory:	Sulfuric Acid (Core Batteries)					
ID:	208012				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0179818				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	04/30/2019 02:34:13 AM				Trade Secret:	false
Chemical Name:	Sulfuric Acid					
Common Name Inventory:	Sulfuric Acid (Core Batteries)					
ID:	278172				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0212240				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/14/2020 02:34:01 AM				Trade Secret:	false
Chemical Name:	Sulfuric Acid					
Common Name Inventory:	Sulfuric Acid (Core Batteries)					
ID:	386218				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0255687				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	02/20/2021 01:53:48 AM				Trade Secret:	false
Chemical Name:	Sulfuric Acid					
Common Name Inventory:	Sulfuric Acid (Core Batteries)					
ID:	423577				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0266731				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/04/2022 02:30:47 AM				Trade Secret:	false
Chemical Name:	Sulfuric Acid					
Common Name Inventory:	Sulfuric Acid (Core Batteries)					
ID:	65357				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0109808				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	04/26/2017 02:36:38 AM				Trade Secret:	false
Chemical Name:	Waste Lamps					
Common Name Inventory:	Waste Lamps					
ID:	143758				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0144393				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	04/25/2018 02:35:16 AM				Trade Secret:	false
Chemical Name:	Waste Lamps					
Common Name Inventory:	Waste Lamps					
ID:	189600				Permit Status:	Permit Renewed

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Child Record ID:	DEH2018-HWAST-0168243				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/26/2018 10:37:11 PM				Trade Secret:	false
Chemical Name:	Waste Lamps					
Common Name Inventory:	Waste Lamps					
ID:	208015				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0179821				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	04/30/2019 02:34:13 AM				Trade Secret:	false
Chemical Name:	Waste Lamps					
Common Name Inventory:	Waste Lamps					
ID:	278175				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0212243				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/14/2020 02:34:01 AM				Trade Secret:	false
Chemical Name:	Waste Lamps					
Common Name Inventory:	Waste Lamps					
ID:	386221				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0255690				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	02/20/2021 01:53:48 AM				Trade Secret:	false
Chemical Name:	Waste Lamps					
Common Name Inventory:	Waste Lamps					
ID:	423580				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0266734				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/04/2022 02:30:47 AM				Trade Secret:	false
Chemical Name:	Waste Lamps					
Common Name Inventory:	Waste Lamps					
ID:	65355				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0109806				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	04/26/2017 02:36:38 AM				Trade Secret:	false
Chemical Name:	Waste Pet Medications					
Common Name Inventory:	Waste Pet Medications					
ID:	65354				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0109805				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	04/26/2017 02:36:38 AM				Trade Secret:	false
Chemical Name:	Waste Toxics					
Common Name Inventory:	Waste Toxics					
ID:	143756				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0144391				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	04/25/2018 02:35:16 AM				Trade Secret:	false
Chemical Name:	Waste Toxics					
Common Name Inventory:	Waste Toxics					
ID:	189598				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0168241				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/26/2018 10:37:11 PM				Trade Secret:	false
Chemical Name:	Waste Toxics					
Common Name Inventory:	Waste Toxics					
ID:	208013				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0179819				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	04/30/2019 02:34:13 AM				Trade Secret:	false
Chemical Name:	Waste Toxics					
Common Name Inventory:	Waste Toxics					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
ID:	278173				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0212241				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/14/2020 02:34:01 AM				Trade Secret:	false
Chemical Name:	Waste Toxics					
Common Name Inventory:	Waste Toxics					
ID:	386219				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0255688				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	02/20/2021 01:53:48 AM				Trade Secret:	false
Chemical Name:	Waste Toxics					
Common Name Inventory:	Waste Toxics					
ID:	423578				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0266732				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/04/2022 02:30:47 AM				Trade Secret:	false
Chemical Name:	Waste Toxics					
Common Name Inventory:	Waste Toxics					
ID:	490239				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HWAST-0295188				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/06/2022 12:37:45 AM				Trade Secret:	false
Chemical Name:	Waste Toxics					
Common Name Inventory:	Waste Toxics					
ID:	592809				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0334899				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	07/11/2023 02:30:39 AM				Trade Secret:	false
Chemical Name:	Waste Toxics					
Common Name Inventory:	Waste Toxics					
ID:	65350				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0109801				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	04/26/2017 02:36:38 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Misc Corrosive Liquids					
ID:	65356				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0109807				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	04/26/2017 02:36:38 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Non RCRA Hazardous Waste Liquid (Unspecified oil-containing waste)					
ID:	65352				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0109803				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	04/26/2017 02:36:38 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Misc Flammable Liquids					
ID:	65351				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0109802				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	04/26/2017 02:36:38 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Misc Aerosols					
ID:	143752				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0144387				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	04/25/2018 02:35:16 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Misc Corrosive Liquids					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
ID:	143759				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0144394				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	04/25/2018 02:35:16 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Batteries for Recycling					
ID:	143760				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0144395				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	04/25/2018 02:35:16 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Electronic Devices (E-Waste)					
ID:	143754				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0144389				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	04/25/2018 02:35:16 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Misc Flammable Liquids					
ID:	143753				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0144388				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	04/25/2018 02:35:16 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Misc Aerosols					
ID:	143757				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0144392				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	04/25/2018 02:35:16 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Non RCRA/State Regulated Hazardous Waste					
ID:	189595				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0168238				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/26/2018 10:37:11 PM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Misc Aerosols					
ID:	189601				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0168244				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/26/2018 10:37:11 PM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Batteries for Recycling					
ID:	189602				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0168245				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/26/2018 10:37:11 PM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Electronic Devices (E-Waste)					
ID:	189599				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0168242				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/26/2018 10:37:11 PM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Non RCRA/State Regulated Hazardous Waste					
ID:	189596				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0168239				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/26/2018 10:37:11 PM				Trade Secret:	false
Chemical Name:						

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Common Name Inventory:		Misc Flammable Liquids				
ID:	189594			Permit Status:	Permit Renewed	
Child Record ID:	DEH2018-HWAST-0168237			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	10/26/2018 10:37:11 PM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Misc Corrosive Liquids				
ID:	208014			Permit Status:	Permit Renewed	
Child Record ID:	DEH2019-HWAST-0179820			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	04/30/2019 02:34:13 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Non RCRA/State Regulated Hazardous Waste				
ID:	208016			Permit Status:	Permit Renewed	
Child Record ID:	DEH2019-HWAST-0179822			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	04/30/2019 02:34:13 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Batteries for Recycling				
ID:	208009			Permit Status:	Permit Renewed	
Child Record ID:	DEH2019-HWAST-0179815			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	04/30/2019 02:34:13 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Misc Corrosive Liquids				
ID:	208011			Permit Status:	Permit Renewed	
Child Record ID:	DEH2019-HWAST-0179817			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	04/30/2019 02:34:13 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Misc Flammable Liquids				
ID:	208017			Permit Status:	Permit Renewed	
Child Record ID:	DEH2019-HWAST-0179823			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	04/30/2019 02:34:13 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Electronic Devices (E-Waste)				
ID:	208010			Permit Status:	Permit Renewed	
Child Record ID:	DEH2019-HWAST-0179816			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	04/30/2019 02:34:13 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Misc Aerosols				
ID:	278174			Permit Status:	Permit Renewed	
Child Record ID:	DEH2019-HWAST-0212242			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	05/14/2020 02:34:01 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Non RCRA/State Regulated Hazardous Waste				
ID:	278176			Permit Status:	Permit Renewed	
Child Record ID:	DEH2019-HWAST-0212244			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	05/14/2020 02:34:01 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Batteries for Recycling				
ID:	278169			Permit Status:	Permit Renewed	
Child Record ID:	DEH2019-HWAST-0212237			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	05/14/2020 02:34:01 AM			Trade Secret:	false	

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Chemical Name:						
Common Name Inventory:		Misc Corrosive Liquids				
ID:	278171			Permit Status:	Permit Renewed	
Child Record ID:	DEH2019-HWAST-0212239			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	05/14/2020 02:34:01 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Misc Flammable Liquids				
ID:	278177			Permit Status:	Permit Renewed	
Child Record ID:	DEH2019-HWAST-0212245			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	05/14/2020 02:34:01 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Electronic Devices (E-Waste)				
ID:	278170			Permit Status:	Permit Renewed	
Child Record ID:	DEH2019-HWAST-0212238			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	05/14/2020 02:34:01 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Misc Aerosols				
ID:	386217			Permit Status:	Permit Renewed	
Child Record ID:	DEH2021-HWAST-0255686			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	02/20/2021 01:53:48 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Misc Flammable Liquids				
ID:	386216			Permit Status:	Permit Renewed	
Child Record ID:	DEH2021-HWAST-0255685			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	02/20/2021 01:53:48 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Misc Aerosols				
ID:	386222			Permit Status:	Permit Renewed	
Child Record ID:	DEH2021-HWAST-0255691			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	02/20/2021 01:53:48 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Batteries for Recycling				
ID:	386223			Permit Status:	Permit Renewed	
Child Record ID:	DEH2021-HWAST-0255692			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	02/20/2021 01:53:48 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Electronic Devices (E-Waste)				
ID:	386215			Permit Status:	Permit Renewed	
Child Record ID:	DEH2021-HWAST-0255684			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	02/20/2021 01:53:48 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Misc Corrosive Liquids				
ID:	386220			Permit Status:	Permit Renewed	
Child Record ID:	DEH2021-HWAST-0255689			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	02/20/2021 01:53:48 AM			Trade Secret:	false	
Chemical Name:						
Common Name Inventory:		Non RCRA/State Regulated Hazardous Waste				
ID:	423579			Permit Status:	Permit Renewed	
Child Record ID:	DEH2021-HWAST-0266733			Active Permit:	true	
CAS No:				Haz Material Type:		

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Last Updated:	05/04/2022 02:30:47 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Non RCRA/State Regulated Hazardous Waste					
ID:	423575				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0266729				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/04/2022 02:30:47 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Misc Aerosols					
ID:	423574				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0266728				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/04/2022 02:30:47 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Misc Corrosive Liquids					
ID:	423576				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0266730				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/04/2022 02:30:47 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Misc Flammable Liquids					
ID:	423582				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0266736				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/04/2022 02:30:47 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Electronic Devices (E-Waste)					
ID:	423581				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0266735				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/04/2022 02:30:47 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Batteries for Recycling					
ID:	490237				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HWAST-0295186				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/06/2022 12:37:45 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Misc. Waste Aerosols					
ID:	490241				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HWAST-0295190				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/06/2022 12:37:45 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Misc. Waste Corrosive Liquids, Basic					
ID:	490238				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HWAST-0295187				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/06/2022 12:37:45 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Misc. Waste Flammable Liquids					
ID:	490240				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HWAST-0295189				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	05/06/2022 12:37:45 AM				Trade Secret:	false
Chemical Name:						
Common Name Inventory:	Non RCRA/State Regulated Hazardous Waste Liquids					
ID:	490236				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HWAST-0295185				Active Permit:	true

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB		
CAS No:	05/06/2022 12:37:45 AM			Haz Material Type:				
Last Updated:				Trade Secret:	false			
Chemical Name:								
Common Name Inventory:	Misc. Waste Corrosive Liquids, Acidic							
ID:	592808			Permit Status:	Permit Renewed			
Child Record ID:	DEH2023-HWAST-0334898			Active Permit:	true			
CAS No:				Haz Material Type:				
Last Updated:	07/11/2023 02:30:39 AM			Trade Secret:	false			
Chemical Name:								
Common Name Inventory:	Misc. Waste Flammable Liquids							
ID:	592806			Permit Status:	Permit Renewed			
Child Record ID:	DEH2023-HWAST-0334896			Active Permit:	true			
CAS No:				Haz Material Type:				
Last Updated:	07/11/2023 02:30:39 AM			Trade Secret:	false			
Chemical Name:								
Common Name Inventory:	Misc. Waste Corrosive Liquids, Acidic							
ID:	592810			Permit Status:	Permit Renewed			
Child Record ID:	DEH2023-HWAST-0334900			Active Permit:	true			
CAS No:				Haz Material Type:				
Last Updated:	07/11/2023 02:30:39 AM			Trade Secret:	false			
Chemical Name:								
Common Name Inventory:	Non RCRA/State Regulated Hazardous Waste Liquids							
ID:	592811			Permit Status:	Permit Renewed			
Child Record ID:	DEH2023-HWAST-0334901			Active Permit:	true			
CAS No:				Haz Material Type:				
Last Updated:	07/11/2023 02:30:39 AM			Trade Secret:	false			
Chemical Name:								
Common Name Inventory:	Misc. Waste Corrosive Liquids, Basic							
ID:	592807			Permit Status:	Permit Renewed			
Child Record ID:	DEH2023-HWAST-0334897			Active Permit:	true			
CAS No:				Haz Material Type:				
Last Updated:	07/11/2023 02:30:39 AM			Trade Secret:	false			
Chemical Name:								
Common Name Inventory:	Misc. Waste Aerosols							
<u>Hazardous Materials Inspection Violations</u>								
Container Tank ID:	37-000-000934			Inspection No:	5134860			
Facility ID No:	38079			Inspection Type:	Routine			
ID:	09/24/2014 03:25:00 PM			Inspection Date:				
UST ID:				Compliance Date:	03/06/2015 12:00:00 AM			
Permit Status:	Permit Renewed			Last Updated:	07/11/2023 12:00:00 AM			
Active Permit:	true			NOV:	false			
Program Element:	Hazardous Materials Release Response Plans							
Violation Code:	1010002 Owner/Operator failed to complete and/or submit a Hazardous Materials Business Plan when storing hazardous materials at or above the thresholds quantities of 55 gallons/500 lbs/200 cubic feet; 19 CCR 4 2729.2 (a); HSC 6.95 25505(a).							
Violation Classification:	Minor							
Container Tank ID:	37-000-000934			Inspection No:	5134860			
Facility ID No:	38080			Inspection Type:	Routine			
ID:	09/24/2014 03:25:00 PM			Inspection Date:				
UST ID:				Compliance Date:	03/06/2015 12:00:00 AM			
Permit Status:	Permit Renewed			Last Updated:	07/11/2023 12:00:00 AM			
Active Permit:	true			NOV:	false			
Program Element:	Hazardous Materials Release Response Plans							
Violation Code:	1010001 Owner/Operator failed to establish and implement a Hazardous Materials Business Plan when storing hazardous materials at or above the thresholds quantities of 55 gallons/500 lbs/200 cubic feet; 19 CCR 4 2729.1 (a); HSC 6.95 25503.5(a).							
Violation Classification:	Minor							
Container Tank ID:	37-000-000934			Inspection No:	5134860			
Facility ID No:	38077			Inspection Type:	Routine			

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
ID:	09/24/2014 03:25:00 PM				Inspection Date:	
UST ID:					Compliance Date:	05/12/2015 12:00:00 AM
Permit Status:	Permit Renewed				Last Updated:	07/11/2023 12:00:00 AM
Active Permit:	true				NOV:	false
Program Element:	Hazardous Waste Generator					
Violation Code:	HMD0131 No Unified Program Facility (UPF) permit not obtained for the generation of hazardous waste. SDCC 68.905.					
Violation Classification:	Class II					
Container Tank ID:	37-000-000934				Inspection No:	5134860
Facility ID No:	38078				Inspection Type:	Routine
ID:	09/24/2014 03:25:00 PM				Inspection Date:	
UST ID:					Compliance Date:	05/12/2015 12:00:00 AM
Permit Status:	Permit Renewed				Last Updated:	07/11/2023 12:00:00 AM
Active Permit:	true				NOV:	false
Program Element:	Hazardous Materials Release Response Plans					
Violation Code:	HMD1001 Unified Program Facility (UPF) permit was not obtained for the handling of hazardous materials; SDCC 68.905.					
Violation Classification:	Class II					
Container Tank ID:	37-000-000934				Inspection No:	5515612
Facility ID No:	38081				Inspection Type:	Routine
ID:	09/19/2016 04:48:00 PM				Inspection Date:	
UST ID:					Compliance Date:	09/26/2016 12:00:00 AM
Permit Status:	Permit Renewed				Last Updated:	07/11/2023 12:00:00 AM
Active Permit:	true				NOV:	false
Program Element:	Hazardous Materials Release Response Plans					
Violation Code:	1010005 Site map not submitted in CERS or not sufficient. HSC 25505(a)(2) and 25508(a)(1)(A)					
Violation Classification:	Minor					
Container Tank ID:	37-000-000934				Inspection No:	6001979
Facility ID No:	38082				Inspection Type:	Routine
ID:	09/11/2018 09:48:00 AM				Inspection Date:	
UST ID:					Compliance Date:	01/22/2019 12:00:00 AM
Permit Status:	Permit Renewed				Last Updated:	07/11/2023 12:00:00 AM
Active Permit:	true				NOV:	false
Program Element:	Hazardous Materials Release Response Plans					
Violation Code:	1010005 Site map not submitted in CERS or not sufficient. HSC 25505(a)(2); 25508.1(f); 19 CCR 2652(a)(3)					
Violation Classification:	Minor					

HMD Permits Map Data

Epa ID:	CAL000395864	Opened Dt:	2014-07-31T00:00:00
Cers ID:	10586290	Expiration Dt:	2025-05-31T00:00:00
Sitemap:	MAP_000934.pdf	Rpt Name:	HMBP000934.pdf
Record Status:	Permit Renewed	Hirt Flag:	Y
Er Contact1:	Store Manager	Billing Code1:	Base + CUPA
Er Title1:	Store Manager	St No:	203
Er Phone1:	855-872-4968 (Option 3)	St No End:	
Er Altphone:	760-789-7052	St Name:	HUNTER
Er Contact2:	Ryan Zick	St Dir:	
Er Title2:	Manager, Environmental and Strategy Compliance	St Type:	ST
Er Phone2:	855-872-4968 (Option 3)	St Unit:	
Er Altphone2:	(615) 440-4278	Insp Dist Geoinfo:	HE020
Biz Apn:	282-192-40-00		
Biz Phone:	(615) 440-4000		
Biz Email:	hazmat@tractorsupply.com		
Biz Owner:	Tractor Supply Company		
Biz Type:	Retail Stores		
Facility Subject To Calarp:			
Plating Shop Metal Finishing:			
Chemical Supplier Wholesale:			
Pesticide Applicator Fumigation:			
Chem Gas Paint Manufacture:			
Resin Site With 6 Items:			
Petroleum Propane Fuel Supp:			
Site With Gt20 Inventory Items:			

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Apsa Stor Tank Gt10000 Gal: Apsa Stor Tank Chem Gt999ga: Y Ust Stor Tank Fuel Gt30k Ga: Cryogas Gt20kcft200gal1200lb: Gases Gt20kCft 208 Gal 1666 L: Prop Gt185kCft5k Gal 2100: Extreme Haz Gt20 Cft 54 Gal 5:						

14	2 of2	SW	0.21 / 1,096.15	1,410.23 / -7	TRACTOR SUPPLY COMPANY #1862 203 HUNTER ST RAMONA CA 92065	RCRA NON GEN

Handler ID: CAL000395864
Generator Status: N
Recycler Activity?: NO
Recycler Activity Note: This facility has not been identified as a Recycler Facility from both the RCRA Handler and Biennial Report Modules.

Violation/Evaluation Summary

Note: NO RECORDS: As of Nov 2025, there are no Compliance Monitoring and Enforcement (violation) records associated with this facility (EPA ID).

Handler Summary

Importer:	No	Used Oil Transpor:	No
Mixed Waste Gen:	No	Used Oil Trans Fac:	No
Transporter:	No	Used Oil Processor:	No
Transfer Facility:	No	Used Oil Refiner:	No
Recycler:	No	Used Oil Burner:	No
Onsite Burner Exem:	No	Commercial TSD:	No
Furnace Exemption:	No	Recycl Nonstorage:	No
Underground Injec:	No		
Used Oil Market Burner:	No		
Used Oil Spec Marketer:	No		

Additional Handler Summary Details

Source Type:	I	NAIC 1:	56299
Seq No:	1	NAIC 2:	
Non Notifier:		NAIC 3:	
Receive Date:	20140415	NAIC 4:	
Active Site:	H----	State:	CA
Land Type:		Location Latitude:	33.030393
In Handler Univ:	Y	Location Longitude:	-116.887899
In A Universe:	Y	Loc GIS Primary:	N
Gen Status:	N	Loc GIS Origin:	AG
Report Cycle:		State District Owner:	
Accessibility:		State District:	
Region:	09		
Fed Waste Gen Owner:	HQ		
State Waste Generator Owner:	CA		
State Waste Generator:	2		
Short Term Generator:	N		
Uni Waste:	Y		
Universal Waste Dest Facility:	Y		
Federal Universal Waste:	N		
As Federally Regulated Tsdf:	-----		
As Converter Tsdf:	-----		
As State Regulated Tsdf:	-----		
As State Regulated Handler:	---		
Federal Indicator:	---		
Hsm:	N		
Subpart K:	----		

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
GPRA Permit:		N				
GPRA Renewal:		N				
Permit Renewal Wrkld:		-----				
Permwrk ID:		-----				
Perm Prog:		-----				
Pcwrkld:		-----				
Closwrkld:		-----				
GPRA Ca:		N				
Cawrkld:		N				
Subjca Tsd Discretion:		N				
NCAPS:		N				
EC Indicator:		N				
Ca725 Indicator:		N				
Ca750 Indicator:		N				
Operating Tsdf:		-----				
Full Enforcement:		-----				
Snc:		N				
Unaddressed Snc:		N				
Addressed Snc:		N				
Snc With Comp Sched:		N				
Fa Required:		-----				
Hhandler Last Change:		20180906				
Recognized Trader Importer:		N				
Recognized Trader Exporter:		N				
Slab Importer:		N				
Slab Exporter:		N				
Manifest Broker:		N				
Subpart P:		N				
Contact Language:		EN				
Handler Name:		TRACTOR SUPPLY COMPANY #1862				
Location Street No:						
Location Street1:		203 HUNTER ST				
Location Street2:						
Location City:		RAMONA				
Location State:		CA				
Location Zip:		92065				
Location County Code:		CA073				
Location County Name:		SAN DIEGO				
Location Country:		US				
Contact Name:		BRIAN SPEARS				
Contact Street No:						
Contact Street1:		5401 VIRGINIA WAY				
Contact Street2:						
Contact City:		BRENTWOOD				
Contact State:		TN				
Contact Zip:		37027-0000				
Contact Country:						
Contact Phone & Ext:		615-440-4115				
Contact Fax:		615-484-4115				
Contact Email Address:		HAZMAT@TRACTORSUPPLY.COM				
Contact Title:						
Owner Name:		TRACTOR SUPPLY COMPANY				
Owner Type:		O				
Owner Seq:		1				
Operator Name:		BRIAN SPEARS				
Operator Type:		O				
Operator Seq:		2				
Public Notes:						

Contact DTSC for information.

Hazardous Waste Handler Details

Seq No:	1
Receive Date:	20140415
Handler Name:	TRACTOR SUPPLY COMPANY #1862
Fed Waste Generator:	N

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Generator Code Description:	Not a Generator, Verified
Source Type:	Implementer
TSD Activity:	N

Owner/Operator Details

Owner/Operator Ind:	Current Owner	Street No:	
Type:	Other	Street1:	5401 VIRGINIA WAY
Name:	TRACTOR SUPPLY COMPANY	Street2:	
Dt Became Current:		City:	BRENTWOOD
Dt Ended Current:		State:	TN
Phone:	615-440-4000	Country:	
Source Type:	Implementer	Zip:	37027-0000

Owner/Operator Ind:	Current Operator	Street No:	
Type:	Other	Street1:	5401 VIRGINIA WAY
Name:	BRIAN SPEARS	Street2:	
Dt Became Current:		City:	BRENTWOOD
Dt Ended Current:		State:	TN
Phone:	615-440-4115	Country:	
Source Type:	Implementer	Zip:	37027-0000

15	1 of2	NE	0.24 / 1,277.30	1,422.07 / 4	RAMONA TIRE PROS & SERVICE CENTER 1811 MAIN ST RAMONA CA 92065	HAZ SANDIEGO

Record ID:	DEH2002-HUPFP-135421
Facility Name:	RAMONA TIRE PROS & SERVICE CENTER
Facility Address:	1811 MAIN ST RAMONA, CA 92065
Facility City:	RAMONA
Facility Zip Code:	92065
Facility Latitude:	33.03475492445718
Facility Longitude:	-116.88156499702033
GIS Record ID:	DEH2002-HUPFP-135421
GIS Facility Name:	RAMONA TIRE PROS & SERVICE CENTER
GIS Facility Address:	1811 MAIN ST
GIS Facility City:	RAMONA
GIS Facility Zip Code:	92065
GIS Fac Latitude:	-117.14815101703327
GIS Fac Longitude:	32.70001949989015
Tank Owner Name:	

Hazardous Materials Facility Data

CERS ID:	10375081	Haz Mat on Site:	true
Facility ID No:	37-000-135421	Haz Waste Generatr:	true
EPA ID No:	CAL000219530	Own/Oper Under:	false
Active Permit:	true	Own/Oper Above:	false
Permit Status:	Permit Renewed	Recycle:	false
Bus Phone:	760-789-8877	RCRA Large Qty Gen:	false
Bus Fax:	7607898152	HHW Collection:	false
Last Updated:	11/28/2023 02:32:26 AM		
Mailing Address:	1811 MAIN ST, RAMONA, CA 92065		
Onsite H Waste Treatment:	false		
New Georeferenced Column:	(32.70001949989015, -117.14815101703327)		

Hazardous Waste and Materials

ID:	134825	Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0145001	Active Permit:	true
CAS No:		Haz Material Type:	
Last Updated:	03/09/2018 02:30:17 AM	Trade Secret:	false
Chemical Name:	WASTE 135 UNSPECIFIED AQUEOUS SOL'N		
Common Name Inventory:	PARTS WASHER		

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
ID:	175555				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0165852				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	07/20/2021 01:58:48 AM				Trade Secret:	false
Chemical Name:	WASTE 135 UNSPECIFIED AQUEOUS SOL'N					
Common Name Inventory:	PARTS WASHER					
ID:	439810				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0274208				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	11/17/2021 03:52:02 AM				Trade Secret:	false
Chemical Name:	WASTE 135 UNSPECIFIED AQUEOUS SOL'N					
Common Name Inventory:	PARTS WASHER					
ID:	531616				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HWAST-0313537				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	11/28/2023 02:32:26 AM				Trade Secret:	false
Chemical Name:	WASTE 135 UNSPECIFIED AQUEOUS SOL'N					
Common Name Inventory:	PARTS WASHER					
ID:	134824				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0145000				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	03/09/2018 02:30:17 AM				Trade Secret:	false
Chemical Name:	WASTE 342 ORGANIC LIQUIDS W/METALS					
Common Name Inventory:	ANTIFREEZE WASTE					
ID:	175554				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0165851				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	07/20/2021 01:58:48 AM				Trade Secret:	false
Chemical Name:	WASTE 342 ORGANIC LIQUIDS W/METALS					
Common Name Inventory:	ANTIFREEZE WASTE					
ID:	134826				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0145002				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	03/09/2018 02:30:17 AM				Trade Secret:	false
Chemical Name:	WASTE 343 UNSPEC ORGANIC LIQUID MIXTURE					
Common Name Inventory:	BRAKE FLUID					
ID:	175556				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0165853				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	07/20/2021 01:58:48 AM				Trade Secret:	false
Chemical Name:	WASTE 343 UNSPEC ORGANIC LIQUID MIXTURE					
Common Name Inventory:	BRAKE FLUID					
ID:	439811				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0274209				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	11/17/2021 03:52:02 AM				Trade Secret:	false
Chemical Name:	WASTE 343 UNSPEC ORGANIC LIQUID MIXTURE					
Common Name Inventory:	BRAKE FLUID					
ID:	531617				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HWAST-0313538				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	11/28/2023 02:32:26 AM				Trade Secret:	false
Chemical Name:	WASTE 343 UNSPEC ORGANIC LIQUID MIXTURE					
Common Name Inventory:	BRAKE FLUID					
ID:	439812				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0274210				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	11/17/2021 03:52:02 AM				Trade Secret:	false
Chemical Name:	Waste 342 Organic Liquid					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Common Name Inventory:		Antifreeze Waste				
ID:	531618				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HWAST-0313539				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	11/28/2023 02:32:26 AM				Trade Secret:	false
Chemical Name:	Waste 342 Organic Liquid					
Common Name Inventory:	Antifreeze Waste					
<u>Hazardous Materials Inspection Violations</u>						
Container Tank ID:	37-000-135421				Inspection No:	4246015
Facility ID No:	11925				Inspection Type:	Routine
ID:	05/09/2014 04:38:00 PM				Inspection Date:	
UST ID:					Compliance Date:	09/10/2014 12:00:00 AM
Permit Status:	Permit Renewed				Last Updated:	11/28/2023 12:00:00 AM
Active Permit:	true				NOV:	false
Program Element:	Hazardous Materials Release Response Plans					
Violation Code:	1010008 Failure to submit inventory reports (Activities, Owner/Operator, Hazardous Materials Descriptions and Map pages, if required. Documentation must be resubmitted (for facilities which exceed EPCRA thresholds) or re-certified (for facilities which do not exceed EPCRA thresholds) by March 1; 19 CCR 4 2729.4(b), 2729.5.					
Violation Classification:	Minor					
Container Tank ID:	37-000-135421				Inspection No:	5993666
Facility ID No:	11926				Inspection Type:	Routine
ID:	08/10/2018 03:51:00 PM				Inspection Date:	
UST ID:					Compliance Date:	08/13/2018 12:00:00 AM
Permit Status:	Permit Renewed				Last Updated:	11/28/2023 12:00:00 AM
Active Permit:	true				NOV:	false
Program Element:	Hazardous Materials Release Response Plans					
Violation Code:	1010005 Site map not submitted in CERS or not sufficient. HSC 25505(a)(2); 25508.1(f); 19 CCR 2652(a)(3)					
Violation Classification:	Minor					
Container Tank ID:	37-000-135421				Inspection No:	6492891
Facility ID No:	55869				Inspection Type:	Routine
ID:	07/16/2021 12:00:00 AM				Inspection Date:	
UST ID:					Compliance Date:	08/16/2021 12:00:00 AM
Permit Status:	Permit Renewed				Last Updated:	11/28/2023 12:00:00 AM
Active Permit:	true				NOV:	false
Program Element:	Hazardous Materials Release Response Plans					
Violation Code:	1020001 Employee training and/or plan for safety procedures in the event of a release or threatened release of a hazardous material not adequate, not established or not submitted in CERS. HSC 25505(a)(4), 25508(a)(1)(A), 25508(a)(3); 19 CCR 2658, 2659(a)					
Violation Classification:	Minor					
Container Tank ID:	37-000-135421				Inspection No:	6492891
Facility ID No:	55867				Inspection Type:	Routine
ID:	07/16/2021 12:00:00 AM				Inspection Date:	
UST ID:					Compliance Date:	08/16/2021 12:00:00 AM
Permit Status:	Permit Renewed				Last Updated:	11/28/2023 12:00:00 AM
Active Permit:	true				NOV:	false
Program Element:	Hazardous Materials Release Response Plans					
Violation Code:	1010008 HMBP not certified as complete and accurate in CERS by the required due date. HSC 25508.2, 19 CCR 2654(b)					
Violation Classification:	Class II					
Container Tank ID:	37-000-135421				Inspection No:	6492891
Facility ID No:	55868				Inspection Type:	Routine
ID:	07/16/2021 12:00:00 AM				Inspection Date:	
UST ID:					Compliance Date:	08/16/2021 12:00:00 AM
Permit Status:	Permit Renewed				Last Updated:	11/28/2023 12:00:00 AM
Active Permit:	true				NOV:	false
Program Element:	Hazardous Materials Release Response Plans					
Violation Code:	1010004 Chemical inventory incomplete or not submitted in CERS. HSC 25505(a)(1); 25507(a); 25508.1(a-b); 19 CCR 2654 (a) or (d)					
Violation Classification:	Minor					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

HMD Permits Map Data

Epa ID:	CAL000219530	Opened Dt:	2002-05-04T00:00:00
Cers ID:	10375081	Expiration Dt:	2024-12-31T00:00:00
Sitemap:	MAP_135421.pdf	Rpt Name:	HMBP135421.pdf
Record Status:	Permit Renewed	Hirt Flag:	N
Er Contact1:	ELMER VIRES	Billing Code1:	Base + CUPA
Er Title1:	PRESIDENT	St No:	1811
Er Phone1:	858-442-1081	St No End:	
Er Altphone:	760-789-8877	St Name:	MAIN
Er Contact2:	PAULA VIRES	St Dir:	
Er Title2:	VICE PRESIDENT	St Type:	ST
Er Phone2:	858-705-1142	St Unit:	
Er Altphone2:	760-789-8877	Insp Dist Geoinfo:	HE020
Biz Apn:	282-130-66-00		
Biz Phone:	760-789-8877		
Biz Email:	RAMONATIREPROS@HOTMAIL.COM		
Biz Owner:	American Residential Services, Inc.		
Biz Type:	Auto Repair, General - Waste USTs Only		
Facility Subject To Calarp:			
Plating Shop Metal Finishing:			
Chemical Supplier Wholesale:			
Pesticide Applicator Fumigatio:			
Chem Gas Paint Manufacture:			
Resin Site With 6 Items:			
Petroleum Propane Fuel Supp:			
Site With Gt20 Inventory Items:			
Apsa Stor Tank Gt10000 Gal:			
Apsa Stor Tank Chem Gt999ga:			
Ust Stor Tank Fuel Gt30k Ga:			
Cryogas Gt20kcft200gal1200lb:			
Gases Gt20kCft 208 Gal 1666 L:			
Prop Gt185kCft5k Gal 2100:			
Extreme Haz Gt20 Cft 54 Gal 5:			

15	2 of2	NE	0.24 / 1,277.30	1,422.07 / 4	DBA TRACTION TIRE & SERVICE CENTER 1811 MAIN ST RAMONA CA 92065-0000	RCRA NON GEN

Handler ID:	CAL000219530
Generator Status:	N
Recycler Activity?:	NO
Recycler Activity Note:	This facility has not been identified as a Recycler Facility from both the RCRA Handler and Biennial Report Modules.

Violation/Evaluation Summary

Note:	NO RECORDS: As of Nov 2025, there are no Compliance Monitoring and Enforcement (violation) records associated with this facility (EPA ID).

Handler Summary

Importer:	No	Used Oil Transpor:	No
Mixed Waste Gen:	No	Used Oil Trans Fac:	No
Transporter:	No	Used Oil Processor:	No
Transfer Facility:	No	Used Oil Refiner:	No
Recycler:	No	Used Oil Burner:	No
Onsite Burner Exem:	No	Commercial TSD:	No
Furnace Exemption:	No	Recycl Nonstorage:	No
Underground Injec:	No		
Used Oil Market Burner:	No		
Used Oil Spec Marketer:	No		

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
<u>Additional Handler Summary Details</u>						
Source Type:	I			NAIC 1:	811118	
Seq No:	1			NAIC 2:		
Non Notifier:				NAIC 3:		
Receive Date:	20010807			NAIC 4:		
Active Site:	H----			State:	CA	
Land Type:				Location Latitude:	33.034583	
In Handler Univ:	Y			Location Longitude:	-116.881438	
In A Universe:	Y			Loc GIS Primary:	N	
Gen Status:	N			Loc GIS Origin:	AG	
Report Cycle:				State District Owner:		
Accessibility:				State District:		
Region:	09					
Fed Waste Gen Owner:	HQ					
State Waste Generator Owner:	CA					
State Waste Generator:	2					
Short Term Generator:	N					
Uni Waste:	Y					
Universal Waste Dest Facility:	Y					
Federal Universal Waste:	N					
As Federally Regulated Tsdf:	-----					
As Converter Tsdf:	-----					
As State Regulated Tsdf:	-----					
As State Regulated Handler:	---					
Federal Indicator:	---					
Hsm:	N					
Subpart K:	----					
GPRA Permit:	N					
GPRA Renewal:	N					
Permit Renewal Wrkld:	-----					
Permwrk ID:	-----					
Perm Prog:	-----					
Pcwrkld:	-----					
Closwrkld:	-----					
GPRA Ca:	N					
Cawrkld:	N					
Subjca Tsd Discretion:	N					
NCAPS:	N					
EC Indicator:	N					
Ca725 Indicator:	N					
Ca750 Indicator:	N					
Operating Tsdf:	-----					
Full Enforcement:	-----					
Snc:	N					
Unaddressed Snc:	N					
Addressed Snc:	N					
Snc With Comp Sched:	N					
Fa Required:	----					
Hhandler Last Change:	20180905					
Recognized Trader Importer:	N					
Recognized Trader Exporter:	N					
Slab Importer:	N					
Slab Exporter:	N					
Manifest Broker:	N					
Subpart P:	N					
Contact Language:	EN					
Handler Name:	DBA TRACTION TIRE & SERVICE CENTER					
Location Street No:						
Location Street1:	1811 MAIN ST					
Location Street2:						
Location City:	RAMONA					
Location State:	CA					
Location Zip:	92065-0000					
Location County Code:	CA073					
Location County Name:	SAN DIEGO					
Location Country:	US					
Contact Name:	ELMER VIRES					
Contact Street No:						

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Contact Street1:	1811 MAIN ST
Contact Street2:	
Contact City:	RAMONA
Contact State:	CA
Contact Zip:	92065
Contact Country:	
Contact Phone & Ext:	760-789-8877
Contact Fax:	760-789-8152
Contact Email Address:	TRACTIONTIRE@HOTMAIL.COM
Contact Title:	
Owner Name:	AMERICAN RESDENTIAL SERV INC
Owner Type:	O
Owner Seq:	1
Operator Name:	ELMER VIRES
Operator Type:	O
Operator Seq:	2
Public Notes:	

Contact DTSC for information.

Hazardous Waste Handler Details

Seq No:	1
Receive Date:	20010807
Handler Name:	DBA TRACTION TIRE & SERVICE CENTER
Fed Waste Generator:	N
Generator Code Description:	Not a Generator, Verified
Source Type:	Implementer
TSD Activity:	N

Owner/Operator Details

Owner/Operator Ind:	Current Operator	Street No:	
Type:	Other	Street1:	1811 MAIN ST
Name:	ELMER VIRES	Street2:	
Dt Became Current:		City:	RAMONA
Dt Ended Current:		State:	CA
Phone:	760-789-8877	Country:	
Source Type:	Implementer	Zip:	92065
Owner/Operator Ind:	Current Owner	Street No:	
Type:	Other	Street1:	1811 MAIN ST
Name:	AMERICAN RESDENTIAL SERV INC	Street2:	
Dt Became Current:		City:	RAMONA
Dt Ended Current:		State:	CA
Phone:	760-789-8877	Country:	
Source Type:	Implementer	Zip:	92065-2521

16	1 of2	NE	0.24 / 1,280.22	1,420.00 / 2	Dollar Tree #05003 1853 MAIN ST RAMONA CA 92065-2512	HAZ SANDIEGO

Record ID:	DEH2012-HUPFP-216679
Facility Name:	Dollar Tree #05003
Facility Address:	1853 MAIN ST RAMONA, CA 92065-2512
Facility City:	RAMONA
Facility Zip Code:	92065-2512
Facility Latitude:	33.035165269929834
Facility Longitude:	-116.88253065072539
GIS Record ID:	DEH2012-HUPFP-216679
GIS Facility Name:	Dollar Tree #05003
GIS Facility Address:	1853 MAIN ST
GIS Facility City:	RAMONA
GIS Facility Zip Code:	92065-2512
GIS Fac Latitude:	

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

GIS Fac Longitude:
Tank Owner Name:

Hazardous Materials Facility Data

CERS ID:	10175973	Haz Mat on Site:	true
Facility ID No:	37-000-216679	Haz Waste Generatr:	true
EPA ID No:	CAL000377750	Own/Oper Under:	false
Active Permit:	true	Own/Oper Above:	false
Permit Status:	Permit Renewed	Recycle:	false
Bus Phone:	7609066060	RCRA Large Qty Gen:	false
Bus Fax:	7573215160	HHW Collection:	false
Last Updated:	10/03/2023 02:31:27 AM		
Mailing Address:	500 Volvo Parkway, Chesapeake, VA 23320		
Onsite H Waste Treatment:	false		
New Georeferenced Column:			

Hazardous Waste and Materials

ID:	61662	Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0108299	Active Permit:	true
CAS No:		Haz Material Type:	
Last Updated:	10/18/2017 02:32:10 AM	Trade Secret:	false
Chemical Name:	Consumer Commodities		
Common Name Inventory:	Waste Flammable Solids		
ID:	61665	Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0108302	Active Permit:	true
CAS No:		Haz Material Type:	
Last Updated:	10/18/2017 02:32:10 AM	Trade Secret:	false
Chemical Name:	Consumer Commodities		
Common Name Inventory:	Waste State Regulated Liquids		
ID:	61660	Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0108297	Active Permit:	true
CAS No:		Haz Material Type:	
Last Updated:	10/18/2017 02:32:10 AM	Trade Secret:	false
Chemical Name:	Consumer Commodities		
Common Name Inventory:	Waste Basic Liquids, Corrosive		
ID:	61664	Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0108301	Active Permit:	true
CAS No:		Haz Material Type:	
Last Updated:	10/18/2017 02:32:10 AM	Trade Secret:	false
Chemical Name:	Consumer Commodities		
Common Name Inventory:	Waste Oxidizing Liquids		
ID:	61661	Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0108298	Active Permit:	true
CAS No:		Haz Material Type:	
Last Updated:	10/18/2017 02:32:10 AM	Trade Secret:	false
Chemical Name:	Consumer Commodities		
Common Name Inventory:	Waste Flammable Liquids		
ID:	61663	Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0108300	Active Permit:	true
CAS No:		Haz Material Type:	
Last Updated:	10/18/2017 02:32:10 AM	Trade Secret:	false
Chemical Name:	Consumer Commodities		
Common Name Inventory:	Waste Lighters		
ID:	61659	Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0108296	Active Permit:	true
CAS No:		Haz Material Type:	
Last Updated:	10/18/2017 02:32:10 AM	Trade Secret:	false
Chemical Name:	Consumer Commodities		
Common Name Inventory:	Waste Aerosols		

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
ID:	61667				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0108304				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/18/2017 02:32:10 AM				Trade Secret:	false
Chemical Name:	Consumer Commodities					
Common Name Inventory:	Waste Toxic Liquids					
ID:	61658				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0108295				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/18/2017 02:32:10 AM				Trade Secret:	false
Chemical Name:	Consumer Commodities					
Common Name Inventory:	Waste Acidic Liquids, Corrosive					
ID:	61668				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0108305				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/18/2017 02:32:10 AM				Trade Secret:	false
Chemical Name:	Consumer Commodities					
Common Name Inventory:	Waste Toxic Solids					
ID:	61666				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0108303				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/18/2017 02:32:10 AM				Trade Secret:	false
Chemical Name:	Consumer Commodities					
Common Name Inventory:	Waste State Regulated Solids					
ID:	142832				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0147275				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	09/26/2018 02:33:56 AM				Trade Secret:	false
Chemical Name:	Consumer Commodities					
Common Name Inventory:	Waste Toxic Liquids					
ID:	142826				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0147269				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	09/26/2018 02:33:56 AM				Trade Secret:	false
Chemical Name:	Consumer Commodities					
Common Name Inventory:	Waste Basic Liquids, Corrosive					
ID:	142833				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0147276				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	09/26/2018 02:33:56 AM				Trade Secret:	false
Chemical Name:	Consumer Commodities					
Common Name Inventory:	Waste Toxic Solids					
ID:	142825				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0147268				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	09/26/2018 02:33:56 AM				Trade Secret:	false
Chemical Name:	Consumer Commodities					
Common Name Inventory:	Waste Aerosols					
ID:	142828				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0147271				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	09/26/2018 02:33:56 AM				Trade Secret:	false
Chemical Name:	Consumer Commodities					
Common Name Inventory:	Waste Flammable Solids					
ID:	142824				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0147267				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	09/26/2018 02:33:56 AM				Trade Secret:	false
Chemical Name:	Consumer Commodities					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Common Name Inventory:		Waste Acidic Liquids, Corrosive				
ID:	142831				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0147274				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	09/26/2018 02:33:56 AM				Trade Secret:	false
Chemical Name:	Consumer Commodities					
Common Name Inventory:	Waste State Regulated Solids					
ID:	142829				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0147272				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	09/26/2018 02:33:56 AM				Trade Secret:	false
Chemical Name:	Consumer Commodities					
Common Name Inventory:	Waste Oxidizing Liquids					
ID:	142827				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0147270				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	09/26/2018 02:33:56 AM				Trade Secret:	false
Chemical Name:	Consumer Commodities					
Common Name Inventory:	Waste Flammable Liquids					
ID:	142830				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0147273				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	09/26/2018 02:33:56 AM				Trade Secret:	false
Chemical Name:	Consumer Commodities					
Common Name Inventory:	Waste State Regulated Liquids					
ID:	225130				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0187492				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	11/16/2019 02:32:32 AM				Trade Secret:	false
Chemical Name:	Consumer Commodities					
Common Name Inventory:	Waste State Regulated Liquids					
ID:	225132				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0187494				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	11/16/2019 02:32:32 AM				Trade Secret:	false
Chemical Name:	Consumer Commodities					
Common Name Inventory:	Waste Toxic Liquids					
ID:	225127				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0187489				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	11/16/2019 02:32:32 AM				Trade Secret:	false
Chemical Name:	Consumer Commodities					
Common Name Inventory:	Waste Flammable Liquids					
ID:	225126				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0187488				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	11/16/2019 02:32:32 AM				Trade Secret:	false
Chemical Name:	Consumer Commodities					
Common Name Inventory:	Waste Basic Liquids, Corrosive					
ID:	225129				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0187491				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	11/16/2019 02:32:32 AM				Trade Secret:	false
Chemical Name:	Consumer Commodities					
Common Name Inventory:	Waste Oxidizing Liquids					
ID:	225133				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0187495				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	11/16/2019 02:32:32 AM				Trade Secret:	false

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Chemical Name:		Consumer Commodities				
Common Name Inventory:		Waste Toxic Solids				
ID:	225131				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0187493				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	11/16/2019 02:32:32 AM				Trade Secret:	false
Chemical Name:		Consumer Commodities				
Common Name Inventory:		Waste State Regulated Solids				
ID:	225128				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0187490				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	11/16/2019 02:32:32 AM				Trade Secret:	false
Chemical Name:		Consumer Commodities				
Common Name Inventory:		Waste Flammable Solids				
ID:	225125				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0187487				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	11/16/2019 02:32:32 AM				Trade Secret:	false
Chemical Name:		Consumer Commodities				
Common Name Inventory:		Waste Aerosols				
ID:	225124				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0187486				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	11/16/2019 02:32:32 AM				Trade Secret:	false
Chemical Name:		Consumer Commodities				
Common Name Inventory:		Waste Acidic Liquids, Corrosive				
ID:	364272				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0248093				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	12/03/2020 02:33:20 AM				Trade Secret:	false
Chemical Name:		Consumer Commodities				
Common Name Inventory:		Waste Oxidizing Liquids				
ID:	364268				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0248089				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	12/03/2020 02:33:20 AM				Trade Secret:	false
Chemical Name:		Consumer Commodities				
Common Name Inventory:		Waste Aerosols				
ID:	364269				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0248090				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	12/03/2020 02:33:20 AM				Trade Secret:	false
Chemical Name:		Consumer Commodities				
Common Name Inventory:		Waste Basic Liquids, Corrosive				
ID:	364270				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0248091				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	12/03/2020 02:33:20 AM				Trade Secret:	false
Chemical Name:		Consumer Commodities				
Common Name Inventory:		Waste Flammable Liquids				
ID:	364275				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0248096				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	12/03/2020 02:33:20 AM				Trade Secret:	false
Chemical Name:		Consumer Commodities				
Common Name Inventory:		Waste Toxic Liquids				
ID:	364271				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0248092				Active Permit:	true
CAS No:					Haz Material Type:	

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Last Updated:	12/03/2020 02:33:20 AM			Trade Secret:	false	
Chemical Name:	Consumer Commodities					
Common Name Inventory:	Waste Flammable Solids					
ID:	364267			Permit Status:	Permit Renewed	
Child Record ID:	DEH2020-HWAST-0248088			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	12/03/2020 02:33:20 AM			Trade Secret:	false	
Chemical Name:	Consumer Commodities					
Common Name Inventory:	Waste Acidic Liquids, Corrosive					
ID:	364274			Permit Status:	Permit Renewed	
Child Record ID:	DEH2020-HWAST-0248095			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	12/03/2020 02:33:20 AM			Trade Secret:	false	
Chemical Name:	Consumer Commodities					
Common Name Inventory:	Waste State Regulated Solids					
ID:	364276			Permit Status:	Permit Renewed	
Child Record ID:	DEH2020-HWAST-0248097			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	12/03/2020 02:33:20 AM			Trade Secret:	false	
Chemical Name:	Consumer Commodities					
Common Name Inventory:	Waste Toxic Solids					
ID:	364273			Permit Status:	Permit Renewed	
Child Record ID:	DEH2020-HWAST-0248094			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	12/03/2020 02:33:20 AM			Trade Secret:	false	
Chemical Name:	Consumer Commodities					
Common Name Inventory:	Waste State Regulated Liquids					
ID:	385966			Permit Status:	Permit Renewed	
Child Record ID:	DEH2021-HWAST-0255610			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	02/20/2021 01:14:52 AM			Trade Secret:	false	
Chemical Name:	Consumer Commodities					
Common Name Inventory:	Waste State Regulated Solids					
ID:	385961			Permit Status:	Permit Renewed	
Child Record ID:	DEH2021-HWAST-0255605			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	02/20/2021 01:14:52 AM			Trade Secret:	false	
Chemical Name:	Consumer Commodities					
Common Name Inventory:	Waste Basic Liquids, Corrosive					
ID:	385965			Permit Status:	Permit Renewed	
Child Record ID:	DEH2021-HWAST-0255609			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	02/20/2021 01:14:52 AM			Trade Secret:	false	
Chemical Name:	Consumer Commodities					
Common Name Inventory:	Waste State Regulated Liquids					
ID:	385959			Permit Status:	Permit Renewed	
Child Record ID:	DEH2021-HWAST-0255603			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	02/20/2021 01:14:52 AM			Trade Secret:	false	
Chemical Name:	Consumer Commodities					
Common Name Inventory:	Waste Acidic Liquids, Corrosive					
ID:	385960			Permit Status:	Permit Renewed	
Child Record ID:	DEH2021-HWAST-0255604			Active Permit:	true	
CAS No:				Haz Material Type:		
Last Updated:	02/20/2021 01:14:52 AM			Trade Secret:	false	
Chemical Name:	Consumer Commodities					
Common Name Inventory:	Waste Aerosols					
ID:	385962			Permit Status:	Permit Renewed	
Child Record ID:	DEH2021-HWAST-0255606			Active Permit:	true	

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
CAS No:					Haz Material Type:	
Last Updated:	02/20/2021 01:14:52 AM				Trade Secret:	false
Chemical Name:		Consumer Commodities				
Common Name Inventory:		Waste Flammable Liquids				
ID:	385963				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0255607				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	02/20/2021 01:14:52 AM				Trade Secret:	false
Chemical Name:		Consumer Commodities				
Common Name Inventory:		Waste Flammable Solids				
ID:	385968				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0255612				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	02/20/2021 01:14:52 AM				Trade Secret:	false
Chemical Name:		Consumer Commodities				
Common Name Inventory:		Waste Toxic Solids				
ID:	385964				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0255608				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	02/20/2021 01:14:52 AM				Trade Secret:	false
Chemical Name:		Consumer Commodities				
Common Name Inventory:		Waste Oxidizing Liquids				
ID:	385967				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0255611				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	02/20/2021 01:14:52 AM				Trade Secret:	false
Chemical Name:		Consumer Commodities				
Common Name Inventory:		Waste Toxic Liquids				
ID:	549670				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0322498				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/03/2023 02:31:27 AM				Trade Secret:	false
Chemical Name:		Consumer Commodities				
Common Name Inventory:		Waste Flammable Solids				
ID:	549672				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0322500				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/03/2023 02:31:27 AM				Trade Secret:	false
Chemical Name:		Consumer Commodities				
Common Name Inventory:		Waste State Regulated Liquids				
ID:	549671				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0322499				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/03/2023 02:31:27 AM				Trade Secret:	false
Chemical Name:		Consumer Commodities				
Common Name Inventory:		Waste Oxidizing Liquids				
ID:	549675				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0322503				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/03/2023 02:31:27 AM				Trade Secret:	false
Chemical Name:		Consumer Commodities				
Common Name Inventory:		Waste Toxic Solids				
ID:	549667				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0322495				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/03/2023 02:31:27 AM				Trade Secret:	false
Chemical Name:		Consumer Commodities				
Common Name Inventory:		Waste Aerosols				
ID:	549673				Permit Status:	Permit Renewed

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Child Record ID:	DEH2023-HWAST-0322501				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/03/2023 02:31:27 AM				Trade Secret:	false
Chemical Name:	Consumer Commodities					
Common Name Inventory:	Waste State Regulated Solids					
ID:	549674				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0322502				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/03/2023 02:31:27 AM				Trade Secret:	false
Chemical Name:	Consumer Commodities					
Common Name Inventory:	Waste Toxic Liquids					
ID:	549666				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0322494				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/03/2023 02:31:27 AM				Trade Secret:	false
Chemical Name:	Consumer Commodities					
Common Name Inventory:	Waste Acidic Liquids, Corrosive					
ID:	549668				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0322496				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/03/2023 02:31:27 AM				Trade Secret:	false
Chemical Name:	Consumer Commodities					
Common Name Inventory:	Waste Basic Liquids, Corrosive					
ID:	549669				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0322497				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	10/03/2023 02:31:27 AM				Trade Secret:	false
Chemical Name:	Consumer Commodities					
Common Name Inventory:	Waste Flammable Liquids					
ID:	61657				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HCHEM-0129906				Active Permit:	true
CAS No:	7440-59-7				Haz Material Type:	Pure
Last Updated:	10/18/2017 02:32:10 AM				Trade Secret:	false
Chemical Name:	Helium					
Common Name Inventory:	Helium					
ID:	142823				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HCHEM-0173178				Active Permit:	true
CAS No:	7440-59-7				Haz Material Type:	Pure
Last Updated:	09/26/2018 02:33:56 AM				Trade Secret:	false
Chemical Name:	Helium					
Common Name Inventory:	Helium					
ID:	225123				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HCHEM-0217343				Active Permit:	true
CAS No:	7440-59-7				Haz Material Type:	Pure
Last Updated:	11/16/2019 02:32:32 AM				Trade Secret:	false
Chemical Name:	Helium					
Common Name Inventory:	Helium					
ID:	364266				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HCHEM-0280338				Active Permit:	true
CAS No:	7440-59-7				Haz Material Type:	Pure
Last Updated:	12/03/2020 02:33:20 AM				Trade Secret:	false
Chemical Name:	Helium					
Common Name Inventory:	Helium					
ID:	385958				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HCHEM-0286731				Active Permit:	true
CAS No:	7440-59-7				Haz Material Type:	Pure
Last Updated:	02/20/2021 01:14:52 AM				Trade Secret:	false
Chemical Name:	Helium					
Common Name Inventory:	Helium					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
ID:	549665				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HCHEM-0354200				Active Permit:	true
CAS No:	7440-59-7				Haz Material Type:	Pure
Last Updated:	10/03/2023 02:31:27 AM				Trade Secret:	false
Chemical Name:	Helium					
Common Name Inventory:	Helium					
<u>Hazardous Materials Inspection Violations</u>						
Container Tank ID:	37-000-216679				Inspection No:	4087311
Facility ID No:	35612				Inspection Type:	Status Verification
ID:	08/14/2013 07:40:00 AM				Inspection Date:	
UST ID:					Compliance Date:	08/14/2013 12:00:00 AM
Permit Status:	Permit Renewed				Last Updated:	10/03/2023 12:00:00 AM
Active Permit:	true				NOV:	false
Program Element:	Hazardous Waste Generator					
Violation Code:	3030007 Failure to properly label hazardous waste accumulation containers with the following requirements: "Hazardous Waste", name and address of the generator, physical and chemical characteristics of the Hazardous Waste, and starting accumulation date.; 22 CCR 12 66262.34(f).					
Violation Classification:	Minor					
Container Tank ID:	37-000-216679				Inspection No:	4087311
Facility ID No:	35613				Inspection Type:	Status Verification
ID:	08/14/2013 07:40:00 AM				Inspection Date:	
UST ID:					Compliance Date:	10/09/2013 12:00:00 AM
Permit Status:	Permit Renewed				Last Updated:	10/03/2023 12:00:00 AM
Active Permit:	true				NOV:	false
Program Element:	Hazardous Materials Release Response Plans					
Violation Code:	1010007 Failure to submit a revised business plan upon a substantial change in the handler's operations; HSC 6.95 25505(b).					
Violation Classification:	Minor					
Container Tank ID:	37-000-216679				Inspection No:	5571277
Facility ID No:	35614				Inspection Type:	Routine
ID:	12/28/2016 02:04:00 PM				Inspection Date:	
UST ID:					Compliance Date:	01/25/2017 12:00:00 AM
Permit Status:	Permit Renewed				Last Updated:	10/03/2023 12:00:00 AM
Active Permit:	true				NOV:	false
Program Element:	Hazardous Materials Release Response Plans					
Violation Code:	1010005 Site map not submitted in CERS or not sufficient. HSC 25505(a)(2) and 25508(a)(1)(A)					
Violation Classification:	Class II					
Container Tank ID:	37-000-216679				Inspection No:	5571277
Facility ID No:	35615				Inspection Type:	Routine
ID:	12/28/2016 02:04:00 PM				Inspection Date:	
UST ID:					Compliance Date:	01/25/2017 12:00:00 AM
Permit Status:	Permit Renewed				Last Updated:	10/03/2023 12:00:00 AM
Active Permit:	true				NOV:	false
Program Element:	Hazardous Materials Release Response Plans					
Violation Code:	1010006 HMBP not updated to reflect inventory changes or facility information. HSC 25508.1(a-e)					
Violation Classification:	Class II					
<u>HMD Permits Map Data</u>						
Epa ID:	CAL000377750				Opened Dt:	2012-06-28T00:00:00
Cers ID:	10175973				Expiration Dt:	2024-10-31T00:00:00
Sitemap:	MAP_216679.pdf				Rpt Name:	HMBP216679.pdf
Record Status:	Permit Renewed				Hirt Flag:	N
Er Contact1:	Frank Covarrubias				Billing Code1:	Base + CUPA
Er Title1:	District Manager				St No:	1853
Er Phone1:	3235280083				St No End:	
Er Altphone:	3235280083				St Name:	MAIN
Er Contact2:	Yvette Carapia				St Dir:	
Er Title2:	Store Manager				St Type:	ST
Er Phone2:	6194539262				St Unit:	
Er Altphone2:	7609066060				Insp Dist Geoinfo:	HE020
Biz Apn:	282-130-64-00					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Biz Phone: Biz Email: Biz Owner: Biz Type: Facility Subject To Calarp: Plating Shop Metal Finishing: Chemical Supplier Wholesale: Pesticide Applicator Fumigatio: Chem Gas Paint Manufacture: Resin Site With 6 Items: Petroleum Propane Fuel Supp: Site With Gt20 Inventory Items: Apsa Stor Tank Gt10000 Gal: Apsa Stor Tank Chem Gt999ga: Ust Stor Tank Fuel Gt30k Ga: Cryogas Gt20kcft200gal1200lb: Gases Gt20kCft 208 Gal 1666 L: Prop Gt185kCft5k Gal 2100: Extreme Haz Gt20 Cft 54 Gal 5:		757-321-5000 LPinvoices@dollartree.com Dollar Tree Stores, Inc. Retail Stores				

16	2 of 2	NE	0.24 / 1,280.22	1,420.00 / 2	DOLLAR TREE #05003 1853 MAIN ST STE J RAMONA CA 92065	RCRA VSQG
Handler ID: Generator Status: Recycler Activity?: Recycler Activity Note:		CAL000377750 VSG NO This facility has not been identified as a Recycler Facility from both the RCRA Handler and Biennial Report Modules.				

Violation/Evaluation Summary

Note: NO RECORDS: As of Nov 2025, there are no Compliance Monitoring and Enforcement (violation) records associated with this facility (EPA ID).

Handler Summary

Importer:	No	Used Oil Transpor:	No
Mixed Waste Gen:	No	Used Oil Trans Fac:	No
Transporter:	No	Used Oil Processor:	No
Transfer Facility:	No	Used Oil Refiner:	No
Recycler:	No	Used Oil Burner:	No
Onsite Burner Exem:	No	Commercial TSD:	No
Furnace Exemption:	No	Recycl Nonstorage:	No
Underground Injec:	No		
Used Oil Market Burner:	No		
Used Oil Spec Marketer:	No		

Additional Handler Summary Details

Source Type:	N	NAIC 1:	455219
Seq No:	1	NAIC 2:	
Non Notifier:		NAIC 3:	
Receive Date:	20250122	NAIC 4:	
Active Site:	H----	State:	CA
Land Type:	P	Location Latitude:	33.03436
In Handler Univ:	Y	Location Longitude:	-116.881719
In A Universe:	Y	Loc GIS Primary:	N
Gen Status:	VSG	Loc GIS Origin:	AG
Report Cycle:		State District Owner:	
Accessibility:		State District:	
Region:	09		
Fed Waste Gen Owner:	HQ		
State Waste Generator Owner:	CA		
State Waste Generator:	2		

<i>Map Key</i>	<i>Number of Records</i>	<i>Direction</i>	<i>Distance (mi/ft)</i>	<i>Elev/Diff (ft)</i>	<i>Site</i>	<i>DB</i>
<i>Short Term Generator:</i>		N				
<i>Uni Waste:</i>		N				
<i>Universal Waste Dest Facility:</i>		N				
<i>Federal Universal Waste:</i>		N				
<i>As Federally Regulated Tsdf:</i>		-----				
<i>As Converter Tsdf:</i>		-----				
<i>As State Regulated Tsdf:</i>		-----				
<i>As State Regulated Handler:</i>		---				
<i>Federal Indicator:</i>		---				
<i>Hsm:</i>		N				
<i>Subpart K:</i>		----				
<i>GPRA Permit:</i>		N				
<i>GPRA Renewal:</i>		N				
<i>Permit Renewal Wrkld:</i>		-----				
<i>Permwrk ID:</i>		-----				
<i>Perm Prog:</i>		-----				
<i>Pcwrkld:</i>		-----				
<i>Closwrkld:</i>		-----				
<i>GPRA Ca:</i>		N				
<i>Cawrkld:</i>		N				
<i>Subjca Tsd Discretion:</i>		N				
<i>NCAPS:</i>		N				
<i>EC Indicator:</i>		N				
<i>Ca725 Indicator:</i>		N				
<i>Ca750 Indicator:</i>		N				
<i>Operating Tsdf:</i>		-----				
<i>Full Enforcement:</i>		-----				
<i>Snc:</i>		N				
<i>Unaddressed Snc:</i>		N				
<i>Addressed Snc:</i>		N				
<i>Snc With Comp Sched:</i>		N				
<i>Fa Required:</i>		-----				
<i>Hhandler Last Change:</i>		20250127				
<i>Recognized Trader Importer:</i>		N				
<i>Recognized Trader Exporter:</i>		N				
<i>Slab Importer:</i>		N				
<i>Slab Exporter:</i>		N				
<i>Manifest Broker:</i>		N				
<i>Subpart P:</i>		N				
<i>Contact Language:</i>		EN				
<i>Handler Name:</i>		DOLLAR TREE #05003				
<i>Location Street No:</i>		1853				
<i>Location Street1:</i>		MAIN ST				
<i>Location Street2:</i>		STE J				
<i>Location City:</i>		RAMONA				
<i>Location State:</i>		CA				
<i>Location Zip:</i>		92065				
<i>Location County Code:</i>		CA073				
<i>Location County Name:</i>		SAN DIEGO				
<i>Location Country:</i>		US				
<i>Contact Name:</i>		JOSE FIGUEROA				
<i>Contact Street No:</i>		3529				
<i>Contact Street1:</i>		NOBLE AVENUE				
<i>Contact Street2:</i>						
<i>Contact City:</i>		VISALIA				
<i>Contact State:</i>		CA				
<i>Contact Zip:</i>		93277				
<i>Contact Country:</i>		US				
<i>Contact Phone & Ext:</i>		661-808-4202				
<i>Contact Fax:</i>						
<i>Contact Email Address:</i>		JFIGUE79@DOLLARTREE.COM				
<i>Contact Title:</i>		ENVIRONMENTAL HEALTH AND SAFETY SPECIALIST				
<i>Owner Name:</i>		RAMONA STATION LLC				
<i>Owner Type:</i>		P				
<i>Owner Seq:</i>		1				
<i>Operator Name:</i>		DOLLAR TREE STORES, INC.				
<i>Operator Type:</i>		P				
<i>Operator Seq:</i>		2				
<i>Public Notes:</i>						

<i>Map Key</i>	<i>Number of Records</i>	<i>Direction</i>	<i>Distance (mi/ft)</i>	<i>Elev/Diff (ft)</i>	<i>Site</i>	<i>DB</i>

DOLLAR TREE IS UPDATING THE GENERATOR STATUS, WASTE CODES, AND CONTACT INFORMATION FOR THIS FACILITY.

Hazardous Waste Handler Details

Seq No: 1
Receive Date: 20120829
Handler Name: DOLLAR TREE #05003
Fed Waste Generator: N
Generator Code Description: Not a Generator, Verified
Source Type: Implementer
TSD Activity: N

Hazardous Waste Handler Details

Seq No: 1
Receive Date: 20250122
Handler Name: DOLLAR TREE #05003
Fed Waste Generator: 3
Generator Code Description: Very Small Quantity Generator
Source Type: Notification
TSD Activity: N

Waste Code Details

Waste Code: 122
Waste Code Desc: Alkaline solution without metals (pH > 12.5)

Waste Code: 135
Waste Code Desc: Unspecified aqueous solution

Waste Code: 141
Waste Code Desc: Off-specification, aged, or surplus inorganics

Waste Code: 181
Waste Code Desc: Other inorganic solid waste

Waste Code: 214
Waste Code Desc: Unspecified solvent mixture

Waste Code: 232
Waste Code Desc: Pesticides and other waste associated with pesticide production

Waste Code: 311
Waste Code Desc: Pharmaceutical waste

Waste Code: 331
Waste Code Desc: Off-specification, aged, or surplus organics

Waste Code: 343
Waste Code Desc: Unspecified organic liquid mixture

Waste Code: 352
Waste Code Desc: Other organic solids

Waste Code: 791
Waste Code Desc: Liquids with pH < 2

Waste Code: D001
Waste Code Desc: IGNITABLE WASTE

Waste Code: D002
Waste Code Desc: CORROSIVE WASTE

Waste Code: D004

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Waste Code Desc:		ARSENIC				
Waste Code:		D005				
Waste Code Desc:		BARIUM				
Waste Code:		D007				
Waste Code Desc:		CHROMIUM				
Waste Code:		D008				
Waste Code Desc:		LEAD				
Waste Code:		D009				
Waste Code Desc:		MERCURY				
Waste Code:		D010				
Waste Code Desc:		SELENIUM				
Waste Code:		D011				
Waste Code Desc:		SILVER				
Waste Code:		D013				
Waste Code Desc:		LINDANE (1,2,3,4,5,6-HEXA-CHLOROCYCLOHEXANE, GAMMA ISOMER)				
Waste Code:		D016				
Waste Code Desc:		2,4-D (2,4-DICHLOROPHENOXYACETIC ACID)				
Waste Code:		D018				
Waste Code Desc:		BENZENE				
Waste Code:		D022				
Waste Code Desc:		CHLOROFORM				
Waste Code:		D024				
Waste Code Desc:		M-CRESOL				
Waste Code:		D026				
Waste Code Desc:		CRESOL				
Waste Code:		D027				
Waste Code Desc:		1,4-DICHLOROBENZENE				
Waste Code:		D035				
Waste Code Desc:		METHYL ETHYL KETONE				
Waste Code:		D039				
Waste Code Desc:		TETRACHLOROETHYLENE				
Waste Code:		U002				
Waste Code Desc:		2-PROPANONE (I) (OR) ACETONE (I)				
Waste Code:		U058				
Waste Code Desc:		2H-1,3,2-OXAZAPHOSPHORIN-2-AMINE, N,N-BIS(2-CHLOROETHYL)TETRAHYDRO-, 2-OXIDE (OR) CYCLOPHOSPHAMIDE				
Waste Code:		U154				
Waste Code Desc:		METHANOL (I) (OR) METHYL ALCOHOL (I)				
Waste Code:		U188				
Waste Code Desc:		PHENOL				
Waste Code:		U201				
Waste Code Desc:		1,3-BENZENEDIOL (OR) RESORCINOL				
Waste Code:		U279				
Waste Code Desc:		CARBARYL (OR) 1-NAPHTHALENOL, METHYLCARBAMATE				

Owner/Operator Details

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Owner/Operator Ind:	Current Operator			Street No:		
Type:	Other			Street1:	500 VOLVO PKWY	
Name:	ANGELA JONES			Street2:		
Dt Became Current:				City:	CHESAPEAKE	
Dt Ended Current:				State:	VA	
Phone:	757-321-5761			Country:		
Source Type:	Implementer			Zip:	23320-1604	
Owner/Operator Ind:	Current Owner			Street No:		
Type:	Other			Street1:	500 VOLVO PKWY	
Name:	DOLLAR TREE STORES, INC.			Street2:		
Dt Became Current:				City:	CHESAPEAKE	
Dt Ended Current:				State:	VA	
Phone:	757-321-5000			Country:		
Source Type:	Implementer			Zip:	23320-1604	
Owner/Operator Ind:	Current Owner			Street No:	1620	
Type:	Private			Street1:	FIFTH AVENUE	
Name:	RAMONA STATION LLC			Street2:	SUITE 770	
Dt Became Current:	20120728			City:	SAN DIEGO	
Dt Ended Current:				State:	CA	
Phone:	661-808-4202			Country:	US	
Source Type:	Notification			Zip:	92101	
Owner/Operator Ind:	Current Operator			Street No:	500	
Type:	Private			Street1:	VOLVO PKWY	
Name:	DOLLAR TREE STORES, INC.			Street2:		
Dt Became Current:	20120728			City:	CHESAPEAKE	
Dt Ended Current:				State:	VA	
Phone:	661-808-4202			Country:	US	
Source Type:	Notification			Zip:	23320-1604	

Historical Handler Details

Receive Dt: 20120829
Generator Code Description: Not a Generator, Verified
Handler Name: DOLLAR TREE #05003

<u>17</u>	1 of 1	ENE	0.24 / 1,282.92	1,417.18 / 0	John R. Harper III, M.D., APC 1834 MAIN ST 1834 MAIN ST RAMONA CA 92065	HAZ SANDIEGO

Record ID: DEH2002-HUPFP-153936
Facility Name: John R. Harper III, M.D., APC
Facility Address: 1834 MAIN ST, RAMONA, CA 92065
Facility City: RAMONA
Facility Zip Code: 92065
Facility Latitude: 1956519.20500001
Facility Longitude: 6368181.13800001
GIS Record ID:
GIS Facility Name:
GIS Facility Address:
GIS Facility City:
GIS Facility Zip Code:
GIS Fac Latitude:
GIS Fac Longitude:
Tank Owner Name:

HMD Permits Map Data as of Feb 13, 2023

GIS Facility ID:	37-000-153936	Parcel No:	282-150-25-00
GIS CERS ID:	10375135	Status:	
GIS Record Type:	LUEG-DEH/HMD/UPFP/Facility	Census Tract:	208.05
Per Type:		Parcel Zip:	92065
Per Sub Type:		Community:	Ramona
Per Cat:		Jurisdiction:	UNINCORPORATED

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Record Status: Permit Renewed LRG QTY MW Gener: No EPA ID No: RMP CAL ARP: Not Applicable Tank Owner: SIC Code: 8011 NAICS Code: 621111 Exp Date: Own/Operate USTs : UST Facility: Total No USTs: No of Tanks: Own Oper APS: N Tot AGP Cap: 0 Capacity LR: Hazmat EHS: Hazmat Rad: Haz Waste G: N Haz Wst Coll Site: N Haz Waste Rad: N Haz Waste EHS: N Recycle100: N RCRA LRG Qty: N Accept Offs: N Univ Waste Gen Typ: Universl Waste Han: N Toxic Gas: Email Perm: Phone Perm: 760 789-2629 Full Name: John Harper Site Address: 1834 MAIN ST Address: 1834 MAIN ST Business Type: Medical Waste, Small Qty - No Treatment HW Tier: Not Applicable Disclose Qty Haz Mat: Y Onsite Haz Waste Tre: N Bill Code: Small Quantity Medical Waste Generators Bill Code 2: Not Applicable Bill Code 3: Not Applicable ER Con Name: John Harper ER Contact: 858 204-1199 ER Con Title: President ER Con Work Ph: 760 789-2629 ARC APN: ARC Address: ARC City: ARC Zipcode: ARC State: Water Purv: RAMONA MUNICIPAL WATER DISTRICT Fire Agency: RAMONA MUNI WATER DIST Geo SRC: Mapped to record APN/Parcel XY center Frhmbp Report Filename: HMBP153936.pdf Frhmbp Sitemap Filename: Basin No: 905.41 BOS Dist: 2 Tbpg Grid: Insp Dist: HE017 Feature ID: 2821502500 Kiva Per Typ: HK10 153936 Agency Name: COSD Loc Name: Score: Side: User Fld: Addr Type: Match Addr: Match Type: Farm Nursery: Record Alias: Unified Program Facility Permit Hirt Flag: No Indian or Territry: County ID: Zip: X Coord: 6368181.138 Y Coord: 1956519.205 X Map Coord: Y Map Coord: Point X: 6368181.13800001 Point Y: 1956519.20500001 Lat GS84: 33.0338232 Lon GS84: -116.8813243						

18	1 of5	NE	0.25 / 1,302.09	1,421.84 / 4	OIL CHANGER #619 1809 MAIN ST, RAMONA, 92065-CA	AST
Total Capacity(Gal): CUPA: 1845 San Diego Owner Name: County: LUBE MANAGEMENT San Diego						
18	2 of5	NE	0.25 / 1,302.09	1,421.84 / 4	OIL CHANGER #619 1809 MAIN ST RAMONA CA 92065	C&D DEBRIS RECY
County: SAN DIEGO						

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Activity Type: Phone No:		USED OIL COLLECTION				

18	3 of 5	NE	0.25 / 1,302.09	1,421.84 / 4	OIL CHANGERS #619 1809 MAIN ST RAMONA CA 92065	CERS TANK

Site ID: 139740
 Latitude: 33.035040
 Longitude: -116.880900

Regulated Programs

EI ID: 10055608
 EI Description: Aboveground Petroleum Storage
 EI ID: 10055608
 EI Description: Hazardous Waste Generator

Violations

Violation Date: 05/02/2017
 Violation Program: APSA
 Citation: HSC 6.67 25270.4.5(a) - California Health and Safety Code, Chapter 6.67, Section(s) 25270.4.5(a)
 Violation Notes:

Returned to compliance on 05/05/2017.

Violation Description:

Failure to comply with one or more of the following requirements:

1. Have record of inspections and integrity tests signed by the appropriate supervisor or inspector.
2. Keep written procedures and records of inspections and integrity tests for at least three years.
3. Keep comparison records.

Violations

Violation Date: 05/02/2017
 Violation Program: HMRRP
 Citation: HSC 6.95 25508(a)(1) - California Health and Safety Code, Chapter 6.95, Section(s) 25508(a)(1)
 Violation Notes:

Returned to compliance on 05/11/2017.

Violation Description:

Failure to complete and electronically submit hazardous material inventory information for all reportable hazardous materials on site at or above reportable quantities.

Evaluations

Eval Date: 05/14/2015
 Violations Found: No
 Eval General Type: Compliance Evaluation Inspection
 Eval Type: Routine done by local agency
 Eval Division: San Diego County Department of Env Health
 Eval Program: APSA
 Eval Source: CERS

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Eval Notes:

Inspector: Fitzmaurice Mark Inspection ID:4091307; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date: 05/14/2015
Violations Found: No
Eval General Type: Compliance Evaluation Inspection
Eval Type: Routine done by local agency
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS
Eval Notes:

Inspector: Fitzmaurice Mark Inspection ID:4091307; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date: 01/04/2023
Violations Found: No
Eval General Type: Compliance Evaluation Inspection
Eval Type: Routine done by local agency
Eval Division: San Diego County Department of Env Health
Eval Program: APSA
Eval Source: CERS
Eval Notes:

Inspector: Patel Manan Inspection ID:7101611; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date: 05/02/2017
Violations Found: No
Eval General Type: Compliance Evaluation Inspection
Eval Type: Routine done by local agency
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS
Eval Notes:

Inspector: Griffin Donelle Inspection ID:5660084; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date: 05/02/2017
Violations Found: Yes
Eval General Type: Compliance Evaluation Inspection
Eval Type: Routine done by local agency
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS
Eval Notes:

Inspector: Griffin Donelle Inspection ID:5660084; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date: 01/04/2023
Violations Found: No
Eval General Type: Compliance Evaluation Inspection
Eval Type: Routine done by local agency
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS
Eval Notes:

Inspector: Patel Manan Inspection ID:7101611; Note: data in [EVAL Notes] field for some records is truncated from the source.

Eval Date: 01/10/2020
Violations Found: No
Eval General Type: Compliance Evaluation Inspection
Eval Type: Routine done by local agency
Eval Division: San Diego County Department of Env Health

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Eval Program:		APSA				
Eval Source:		CERS				
Eval Notes:						
Inspector: Denslow Vikki Inspection ID:6165048; Note: data in [EVAL Notes] field for some records is truncated from the source.						
Eval Date:		01/10/2020				
Violations Found:		No				
Eval General Type:		Compliance Evaluation Inspection				
Eval Type:		Routine done by local agency				
Eval Division:		San Diego County Department of Env Health				
Eval Program:		HW				
Eval Source:		CERS				
Eval Notes:						
Inspector: Denslow Vikki Inspection ID:6165048; Note: data in [EVAL Notes] field for some records is truncated from the source.						
Eval Date:		01/10/2020				
Violations Found:		No				
Eval General Type:		Compliance Evaluation Inspection				
Eval Type:		Routine done by local agency				
Eval Division:		San Diego County Department of Env Health				
Eval Program:		HMRRP				
Eval Source:		CERS				
Eval Notes:						
Inspector: Denslow Vikki Inspection ID:6165048; Note: data in [EVAL Notes] field for some records is truncated from the source.						
Eval Date:		01/04/2023				
Violations Found:		No				
Eval General Type:		Compliance Evaluation Inspection				
Eval Type:		Routine done by local agency				
Eval Division:		San Diego County Department of Env Health				
Eval Program:		HW				
Eval Source:		CERS				
Eval Notes:						
Inspector: Patel Manan Inspection ID:7101611; Note: data in [EVAL Notes] field for some records is truncated from the source.						
Eval Date:		05/02/2017				
Violations Found:		Yes				
Eval General Type:		Compliance Evaluation Inspection				
Eval Type:		Routine done by local agency				
Eval Division:		San Diego County Department of Env Health				
Eval Program:		APSA				
Eval Source:		CERS				
Eval Notes:						
Inspector: Griffin Donelle Inspection ID:5660084; Note: data in [EVAL Notes] field for some records is truncated from the source.						
Eval Date:		05/14/2015				
Violations Found:		No				
Eval General Type:		Compliance Evaluation Inspection				
Eval Type:		Routine done by local agency				
Eval Division:		San Diego County Department of Env Health				
Eval Program:		HMRRP				
Eval Source:		CERS				
Eval Notes:						
Inspector: Fitzmaurice Mark Inspection ID:4091307; Note: data in [EVAL Notes] field for some records is truncated from the source.						

Affiliations

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Affil Type Desc: Entity Name: Entity Title: Address: City: State: Country: Zip Code: Phone:		Parent Corporation Oil Changers				
Affil Type Desc: Entity Name: Entity Title: Address: City: State: Country: Zip Code: Phone:		CUPA District San Diego County Env Health Qlty PO Box 129261 San Diego CA 92112-9261 (858) 505-6880				
Affil Type Desc: Entity Name: Entity Title: Address: City: State: Country: Zip Code: Phone:		Facility Mailing Address Mailing Address 4511 Willow Road, Suite 1 Pleasanton CA 94588				
Affil Type Desc: Entity Name: Entity Title: Address: City: State: Country: Zip Code: Phone:		Legal Owner Oil Changer, Inc. dba Oil Changers 4511 Willow Road, Suite 1 Pleasanton CA United States 94588 (925) 734-5800				
Affil Type Desc: Entity Name: Entity Title: Address: City: State: Country: Zip Code: Phone:		Document Preparer Michael Steven Chilberto				
Affil Type Desc: Entity Name: Entity Title: Address: City: State: Country: Zip Code: Phone:		Identification Signer Michael Steven Chilberto Environmental Compliance Officer				
Affil Type Desc: Entity Name: Entity Title: Address: City: State: Country: Zip Code: Phone:		Operator Oil Changer, Inc. dba Oil Changers (925) 734-5800				

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Affil Type Desc: Environmental Contact Entity Name: Michael Chilberto Entity Title: Address: 4511 Willow Road, Suite 1 City: Pleasanton State: CA Country: Zip Code: 94588 Phone:						
Coordinates						
Env Int Type Code:	HWG			Longitude:	-116.880909	
Program ID:	10055608			Coord Name:		
Latitude:	33.035040			Ref Point Type Desc:	Unknown	
18	4 of 5	NE	0.25 / 1,302.09	1,421.84 / 4	OIL CHANGERS #619 1809 MAIN ST RAMONA CA 92065	HAZ SANDIEGO
Record ID: DEH2002-HUPFP-135285 Facility Name: OIL CHANGERS #619 Facility Address: 1809 MAIN ST RAMONA, CA 92065 Facility City: RAMONA Facility Zip Code: 92065 Facility Latitude: 33.035143396007 Facility Longitude: -116.8811207371609 GIS Record ID: DEH2002-HUPFP-135285 GIS Facility Name: OIL CHANGERS #619 GIS Facility Address: 1809 MAIN ST GIS Facility City: RAMONA GIS Facility Zip Code: 92065 GIS Fac Latitude: -117.14818304565239 GIS Fac Longitude: 32.70004162250994 Tank Owner Name:						
Hazardous Materials Facility Data						
CERS ID:	10055608			Haz Mat on Site:	true	
Facility ID No:	37-000-135285			Haz Waste Generatr:	true	
EPA ID No:	CAL000123149			Own/Oper Under:	false	
Active Permit:	true			Own/Oper Above:	true	
Permit Status:	Permit Renewed			Recycle:	false	
Bus Phone:	(760) 789-5426			RCRA Large Qty Gen:	false	
Bus Fax:	0			HHW Collection:	false	
Last Updated:	09/26/2023 12:48:57 AM					
Mailing Address:	4511 Willow Road, Suite 1, Pleasanton, CA 94588					
Onsite H Waste Treatment:	false					
New Georeferenced Column:	(32.70004162250994, -117.14818304565239)					
Hazardous Waste and Materials						
ID:	269540			Permit Status:	Permit Renewed	
Child Record ID:	DEH2020-HCHEM-0244597			Active Permit:	true	
CAS No:	Mixture			Haz Material Type:	Mixture	
Last Updated:	01/31/2020 01:09:38 AM			Trade Secret:	false	
Chemical Name:	COLE HBC30 DEGREASER					
Common Name Inventory:	DEGREASER CONCENTRATE					
ID:	309522			Permit Status:	Permit Renewed	
Child Record ID:	DEH2020-HCHEM-0263590			Active Permit:	true	
CAS No:	Mixture			Haz Material Type:	Mixture	
Last Updated:	07/15/2020 02:35:24 AM			Trade Secret:	false	
Chemical Name:	COLE HBC30 DEGREASER					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Common Name Inventory:		DEGREASER CONCENTRATE				
ID:	380902				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HCHEM-0285469				Active Permit:	true
CAS No:	Mixture				Haz Material Type:	Mixture
Last Updated:	06/11/2022 02:33:10 AM				Trade Secret:	false
Chemical Name:	COLE HBC30 DEGREASER					
Common Name Inventory:	DEGREASER CONCENTRATE					
ID:	518552				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HCHEM-0341797				Active Permit:	true
CAS No:	Mixture				Haz Material Type:	Mixture
Last Updated:	01/05/2023 02:51:51 AM				Trade Secret:	false
Chemical Name:	COLE HBC30 DEGREASER					
Common Name Inventory:	DEGREASER CONCENTRATE					
ID:	546216				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HCHEM-0354539				Active Permit:	true
CAS No:	Mixture				Haz Material Type:	Mixture
Last Updated:	06/22/2023 02:33:04 AM				Trade Secret:	false
Chemical Name:	COLE HBC30 DEGREASER					
Common Name Inventory:	DEGREASER CONCENTRATE					
ID:	601522				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HCHEM-0380187				Active Permit:	true
CAS No:	Mixture				Haz Material Type:	Mixture
Last Updated:	09/02/2023 12:48:44 AM				Trade Secret:	false
Chemical Name:	COLE HBC30 DEGREASER					
Common Name Inventory:	DEGREASER CONCENTRATE					
ID:	607898				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HCHEM-0382160				Active Permit:	true
CAS No:	Mixture				Haz Material Type:	Mixture
Last Updated:	09/26/2023 12:48:58 AM				Trade Secret:	false
Chemical Name:	COLE HBC30 DEGREASER					
Common Name Inventory:	DEGREASER CONCENTRATE					
ID:	21699				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HCHEM-0132298				Active Permit:	true
CAS No:					Haz Material Type:	Mixture
Last Updated:	03/02/2017 12:57:35 AM				Trade Secret:	false
Chemical Name:	COOLANT/ANTIFREEZE					
Common Name Inventory:	COOLANT/ANTIFREEZE					
ID:	86159				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HCHEM-0141520				Active Permit:	true
CAS No:					Haz Material Type:	Mixture
Last Updated:	12/12/2017 01:48:03 AM				Trade Secret:	false
Chemical Name:	COOLANT/ANTIFREEZE					
Common Name Inventory:	COOLANT/ANTIFREEZE					
ID:	134743				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HCHEM-0170382				Active Permit:	true
CAS No:					Haz Material Type:	Mixture
Last Updated:	02/21/2018 01:32:55 AM				Trade Secret:	false
Chemical Name:	COOLANT/ANTIFREEZE					
Common Name Inventory:	COOLANT/ANTIFREEZE					
ID:	150258				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HCHEM-0175650				Active Permit:	true
CAS No:					Haz Material Type:	Mixture
Last Updated:	08/22/2018 04:17:40 AM				Trade Secret:	false
Chemical Name:	COOLANT/ANTIFREEZE					
Common Name Inventory:	COOLANT/ANTIFREEZE					
ID:	197917				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HCHEM-0205765				Active Permit:	true
CAS No:					Haz Material Type:	Mixture
Last Updated:	08/24/2019 03:15:13 AM				Trade Secret:	false

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Chemical Name:		COOLANT/ANTIFREEZE				
Common Name Inventory:		COOLANT/ANTIFREEZE				
ID:	269537				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HCHEM-0244594				Active Permit:	true
CAS No:					Haz Material Type:	Mixture
Last Updated:	01/31/2020 01:09:38 AM				Trade Secret:	false
Chemical Name:		COOLANT/ANTIFREEZE				
Common Name Inventory:		COOLANT/ANTIFREEZE				
ID:	309519				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HCHEM-0263587				Active Permit:	true
CAS No:					Haz Material Type:	Mixture
Last Updated:	07/15/2020 02:35:24 AM				Trade Secret:	false
Chemical Name:		COOLANT/ANTIFREEZE				
Common Name Inventory:		COOLANT/ANTIFREEZE				
ID:	380899				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HCHEM-0285466				Active Permit:	true
CAS No:					Haz Material Type:	Mixture
Last Updated:	06/11/2022 02:33:10 AM				Trade Secret:	false
Chemical Name:		COOLANT/ANTIFREEZE				
Common Name Inventory:		COOLANT/ANTIFREEZE				
ID:	518549				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HCHEM-0341794				Active Permit:	true
CAS No:					Haz Material Type:	Mixture
Last Updated:	01/05/2023 02:51:51 AM				Trade Secret:	false
Chemical Name:		COOLANT/ANTIFREEZE				
Common Name Inventory:		COOLANT/ANTIFREEZE				
ID:	546213				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HCHEM-0354536				Active Permit:	true
CAS No:					Haz Material Type:	Mixture
Last Updated:	06/22/2023 02:33:04 AM				Trade Secret:	false
Chemical Name:		COOLANT/ANTIFREEZE				
Common Name Inventory:		COOLANT/ANTIFREEZE				
ID:	601519				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HCHEM-0380184				Active Permit:	true
CAS No:					Haz Material Type:	Mixture
Last Updated:	09/02/2023 12:48:44 AM				Trade Secret:	false
Chemical Name:		COOLANT/ANTIFREEZE				
Common Name Inventory:		COOLANT/ANTIFREEZE				
ID:	607895				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HCHEM-0382157				Active Permit:	true
CAS No:					Haz Material Type:	Mixture
Last Updated:	09/26/2023 12:48:58 AM				Trade Secret:	false
Chemical Name:		COOLANT/ANTIFREEZE				
Common Name Inventory:		COOLANT/ANTIFREEZE				
ID:	21701				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0110714				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	03/02/2017 12:57:35 AM				Trade Secret:	false
Chemical Name:		ETHYLENE GLYCOL				
Common Name Inventory:		ETHYLENE GLYCOL				
ID:	86163				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0120062				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	12/12/2017 01:48:04 AM				Trade Secret:	false
Chemical Name:		ETHYLENE GLYCOL				
Common Name Inventory:		ETHYLENE GLYCOL				
ID:	134745				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0144346				Active Permit:	true
CAS No:					Haz Material Type:	

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Last Updated:	02/21/2018 01:32:56 AM				Trade Secret:	false
Chemical Name:	ETHYLENE GLYCOL					
Common Name Inventory:	ETHYLENE GLYCOL					
ID:	150260				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0150290				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	08/22/2018 04:17:41 AM				Trade Secret:	false
Chemical Name:	ETHYLENE GLYCOL					
Common Name Inventory:	ETHYLENE GLYCOL					
ID:	197919				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0177686				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	08/24/2019 03:15:14 AM				Trade Secret:	false
Chemical Name:	ETHYLENE GLYCOL					
Common Name Inventory:	ETHYLENE GLYCOL					
ID:	21698				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HCHEM-0132297				Active Permit:	true
CAS No:	0101-02				Haz Material Type:	Pure
Last Updated:	03/02/2017 12:57:35 AM				Trade Secret:	false
Chemical Name:	GREASE					
Common Name Inventory:	GREASE					
ID:	86160				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HCHEM-0141521				Active Permit:	true
CAS No:	0101-02				Haz Material Type:	Pure
Last Updated:	12/12/2017 01:48:03 AM				Trade Secret:	false
Chemical Name:	GREASE					
Common Name Inventory:	GREASE					
ID:	134742				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HCHEM-0170381				Active Permit:	true
CAS No:	0101-02				Haz Material Type:	Mixture
Last Updated:	02/21/2018 01:32:55 AM				Trade Secret:	false
Chemical Name:	GREASE					
Common Name Inventory:	GREASE					
ID:	150257				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HCHEM-0175649				Active Permit:	true
CAS No:	0101-02				Haz Material Type:	Mixture
Last Updated:	08/22/2018 04:17:40 AM				Trade Secret:	false
Chemical Name:	GREASE					
Common Name Inventory:	GREASE					
ID:	197916				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HCHEM-0205764				Active Permit:	true
CAS No:	0101-02				Haz Material Type:	Mixture
Last Updated:	08/24/2019 03:15:13 AM				Trade Secret:	false
Chemical Name:	GREASE					
Common Name Inventory:	GREASE					
ID:	21700				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HCHEM-0132299				Active Permit:	true
CAS No:	MIXTURE				Haz Material Type:	Pure
Last Updated:	03/02/2017 12:57:35 AM				Trade Secret:	false
Chemical Name:	MOTOR OIL					
Common Name Inventory:	MOTOR OIL					
ID:	86158				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HCHEM-0141519				Active Permit:	true
CAS No:	MIXTURE				Haz Material Type:	Pure
Last Updated:	12/12/2017 01:48:03 AM				Trade Secret:	false
Chemical Name:	MOTOR OIL					
Common Name Inventory:	MOTOR OIL					
ID:	134744				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HCHEM-0170383				Active Permit:	true

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
CAS No:	MIXTURE				Haz Material Type:	Mixture
Last Updated:	02/21/2018 01:32:55 AM				Trade Secret:	false
Chemical Name:	MOTOR OIL					
Common Name Inventory:	MOTOR OIL					
ID:	150259				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HCHEM-0175651				Active Permit:	true
CAS No:	MIXTURE				Haz Material Type:	Mixture
Last Updated:	08/22/2018 04:17:40 AM				Trade Secret:	false
Chemical Name:	MOTOR OIL					
Common Name Inventory:	MOTOR OIL					
ID:	197918				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HCHEM-0205766				Active Permit:	true
CAS No:	MIXTURE				Haz Material Type:	Mixture
Last Updated:	08/24/2019 03:15:13 AM				Trade Secret:	false
Chemical Name:	MOTOR OIL					
Common Name Inventory:	MOTOR OIL					
ID:	269538				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HCHEM-0244595				Active Permit:	true
CAS No:	MIXTURE				Haz Material Type:	Mixture
Last Updated:	01/31/2020 01:09:38 AM				Trade Secret:	false
Chemical Name:	MOTOR OIL					
Common Name Inventory:	MOTOR OIL					
ID:	309520				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HCHEM-0263588				Active Permit:	true
CAS No:	MIXTURE				Haz Material Type:	Mixture
Last Updated:	07/15/2020 02:35:24 AM				Trade Secret:	false
Chemical Name:	MOTOR OIL					
Common Name Inventory:	MOTOR OIL					
ID:	380900				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HCHEM-0285467				Active Permit:	true
CAS No:	MIXTURE				Haz Material Type:	Mixture
Last Updated:	06/11/2022 02:33:10 AM				Trade Secret:	false
Chemical Name:	MOTOR OIL					
Common Name Inventory:	MOTOR OIL					
ID:	518550				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HCHEM-0341795				Active Permit:	true
CAS No:	MIXTURE				Haz Material Type:	Mixture
Last Updated:	01/05/2023 02:51:51 AM				Trade Secret:	false
Chemical Name:	MOTOR OIL					
Common Name Inventory:	MOTOR OIL					
ID:	546214				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HCHEM-0354537				Active Permit:	true
CAS No:	MIXTURE				Haz Material Type:	Mixture
Last Updated:	06/22/2023 02:33:04 AM				Trade Secret:	false
Chemical Name:	MOTOR OIL					
Common Name Inventory:	MOTOR OIL					
ID:	601520				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HCHEM-0380185				Active Permit:	true
CAS No:	MIXTURE				Haz Material Type:	Mixture
Last Updated:	09/02/2023 12:48:44 AM				Trade Secret:	false
Chemical Name:	MOTOR OIL					
Common Name Inventory:	MOTOR OIL					
ID:	607896				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HCHEM-0382158				Active Permit:	true
CAS No:	MIXTURE				Haz Material Type:	Mixture
Last Updated:	09/26/2023 12:48:58 AM				Trade Secret:	false
Chemical Name:	MOTOR OIL					
Common Name Inventory:	MOTOR OIL					
ID:	269542				Permit Status:	Permit Renewed

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Child Record ID:	DEH2020-HWAST-0215413				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	01/31/2020 01:09:40 AM				Trade Secret:	false
Chemical Name:	USED MOTOR OIL					
Common Name Inventory:	USED MOTOR OIL					
ID:	309524				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0234212				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	07/15/2020 02:35:24 AM				Trade Secret:	false
Chemical Name:	USED MOTOR OIL					
Common Name Inventory:	USED MOTOR OIL					
ID:	380904				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0253999				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	06/11/2022 02:33:10 AM				Trade Secret:	false
Chemical Name:	USED MOTOR OIL					
Common Name Inventory:	USED MOTOR OIL					
ID:	518554				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HWAST-0309056				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	01/05/2023 02:51:51 AM				Trade Secret:	false
Chemical Name:	USED MOTOR OIL					
Common Name Inventory:	USED MOTOR OIL					
ID:	546218				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0322880				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	06/22/2023 02:33:04 AM				Trade Secret:	false
Chemical Name:	USED MOTOR OIL					
Common Name Inventory:	USED MOTOR OIL					
ID:	601524				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0348818				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	09/02/2023 12:48:44 AM				Trade Secret:	false
Chemical Name:	USED MOTOR OIL					
Common Name Inventory:	USED MOTOR OIL					
ID:	607900				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0350518				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	09/26/2023 12:48:58 AM				Trade Secret:	false
Chemical Name:	USED MOTOR OIL					
Common Name Inventory:	USED MOTOR OIL					
ID:	601525				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0348819				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	09/02/2023 12:48:44 AM				Trade Secret:	false
Chemical Name:	USED OIL FILTERS (DRAINED)					
Common Name Inventory:	USED OIL FILTERS (DRAINED)					
ID:	607901				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0350519				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	09/26/2023 12:48:58 AM				Trade Secret:	false
Chemical Name:	USED OIL FILTERS (DRAINED)					
Common Name Inventory:	USED OIL FILTERS (DRAINED)					
ID:	269541				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0215412				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	01/31/2020 01:09:40 AM				Trade Secret:	false
Chemical Name:	Used Coolant/Antifreeze					
Common Name Inventory:	ETHYLENE GLYCOL - ANTIFREEZE					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
ID:	309523				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0234211				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	07/15/2020 02:35:24 AM				Trade Secret:	false
Chemical Name:	Used Coolant/Antifreeze					
Common Name Inventory:	ETHYLENE GLYCOL - ANTIFREEZE					
ID:	380903				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0253998				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	06/11/2022 02:33:10 AM				Trade Secret:	false
Chemical Name:	Used Coolant/Antifreeze					
Common Name Inventory:	ETHYLENE GLYCOL - ANTIFREEZE					
ID:	518553				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HWAST-0309055				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	01/05/2023 02:51:51 AM				Trade Secret:	false
Chemical Name:	Used Coolant/Antifreeze					
Common Name Inventory:	ETHYLENE GLYCOL - ANTIFREEZE					
ID:	546217				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0322879				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	06/22/2023 02:33:04 AM				Trade Secret:	false
Chemical Name:	Used Coolant/Antifreeze					
Common Name Inventory:	ETHYLENE GLYCOL - ANTIFREEZE					
ID:	601523				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0348817				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	09/02/2023 12:48:44 AM				Trade Secret:	false
Chemical Name:	Used Coolant/Antifreeze					
Common Name Inventory:	ETHYLENE GLYCOL - ANTIFREEZE					
ID:	607899				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0350517				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	09/26/2023 12:48:58 AM				Trade Secret:	false
Chemical Name:	Used Coolant/Antifreeze					
Common Name Inventory:	ETHYLENE GLYCOL - ANTIFREEZE					
ID:	86161				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0120060				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	12/12/2017 01:48:04 AM				Trade Secret:	false
Chemical Name:	Used Oil Filters (Drained)					
Common Name Inventory:	Used Oil Filters (Drained)					
ID:	134747				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0144348				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	02/21/2018 01:32:56 AM				Trade Secret:	false
Chemical Name:	Used Oil Filters (Drained)					
Common Name Inventory:	Used Oil Filters (Drained)					
ID:	150262				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0150292				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	08/22/2018 04:17:41 AM				Trade Secret:	false
Chemical Name:	Used Oil Filters (Drained)					
Common Name Inventory:	Used Oil Filters (Drained)					
ID:	197921				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0177688				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	08/24/2019 03:15:14 AM				Trade Secret:	false
Chemical Name:	Used Oil Filters (Drained)					
Common Name Inventory:	Used Oil Filters (Drained)					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
ID:	269543				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0215414				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	01/31/2020 01:09:40 AM				Trade Secret:	false
Chemical Name:	Used Oil Filters (Drained)					
Common Name Inventory:	Used Oil Filters (Drained)					
ID:	309525				Permit Status:	Permit Renewed
Child Record ID:	DEH2020-HWAST-0234213				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	07/15/2020 02:35:24 AM				Trade Secret:	false
Chemical Name:	Used Oil Filters (Drained)					
Common Name Inventory:	Used Oil Filters (Drained)					
ID:	380905				Permit Status:	Permit Renewed
Child Record ID:	DEH2021-HWAST-0254000				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	06/11/2022 02:33:10 AM				Trade Secret:	false
Chemical Name:	Used Oil Filters (Drained)					
Common Name Inventory:	Used Oil Filters (Drained)					
ID:	518555				Permit Status:	Permit Renewed
Child Record ID:	DEH2022-HWAST-0309057				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	01/05/2023 02:51:51 AM				Trade Secret:	false
Chemical Name:	Used Oil Filters (Drained)					
Common Name Inventory:	Used Oil Filters (Drained)					
ID:	546219				Permit Status:	Permit Renewed
Child Record ID:	DEH2023-HWAST-0322881				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	06/22/2023 02:33:04 AM				Trade Secret:	false
Chemical Name:	Used Oil Filters (Drained)					
Common Name Inventory:	Used Oil Filters (Drained)					
ID:	21702				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0110715				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	03/02/2017 12:57:35 AM				Trade Secret:	false
Chemical Name:	WASTE MOTOR OIL					
Common Name Inventory:	WASTE MOTOR OIL					
ID:	86162				Permit Status:	Permit Renewed
Child Record ID:	DEH2017-HWAST-0120061				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	12/12/2017 01:48:04 AM				Trade Secret:	false
Chemical Name:	WASTE MOTOR OIL					
Common Name Inventory:	WASTE MOTOR OIL					
ID:	134746				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0144347				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	02/21/2018 01:32:56 AM				Trade Secret:	false
Chemical Name:	WASTE MOTOR OIL					
Common Name Inventory:	WASTE MOTOR OIL					
ID:	150261				Permit Status:	Permit Renewed
Child Record ID:	DEH2018-HWAST-0150291				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	08/22/2018 04:17:41 AM				Trade Secret:	false
Chemical Name:	WASTE MOTOR OIL					
Common Name Inventory:	WASTE MOTOR OIL					
ID:	197920				Permit Status:	Permit Renewed
Child Record ID:	DEH2019-HWAST-0177687				Active Permit:	true
CAS No:					Haz Material Type:	
Last Updated:	08/24/2019 03:15:14 AM				Trade Secret:	false
Chemical Name:	WASTE MOTOR OIL					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Common Name Inventory:		WASTE MOTOR OIL				
ID:	269539			Permit Status:	Permit Renewed	
Child Record ID:	DEH2020-HCHEM-0244596			Active Permit:	true	
CAS No:	25155-30-0			Haz Material Type:	Mixture	
Last Updated:	01/31/2020 01:09:38 AM			Trade Secret:	false	
Chemical Name:	WINDSHIELD WASHER FLUID					
Common Name Inventory:	WASHER FLUID					
ID:	309521			Permit Status:	Permit Renewed	
Child Record ID:	DEH2020-HCHEM-0263589			Active Permit:	true	
CAS No:	25155-30-0			Haz Material Type:	Mixture	
Last Updated:	07/15/2020 02:35:24 AM			Trade Secret:	false	
Chemical Name:	WINDSHIELD WASHER FLUID					
Common Name Inventory:	WASHER FLUID					
ID:	380901			Permit Status:	Permit Renewed	
Child Record ID:	DEH2021-HCHEM-0285468			Active Permit:	true	
CAS No:	25155-30-0			Haz Material Type:	Mixture	
Last Updated:	06/11/2022 02:33:10 AM			Trade Secret:	false	
Chemical Name:	WINDSHIELD WASHER FLUID					
Common Name Inventory:	WASHER FLUID					
ID:	518551			Permit Status:	Permit Renewed	
Child Record ID:	DEH2022-HCHEM-0341796			Active Permit:	true	
CAS No:	25155-30-0			Haz Material Type:	Mixture	
Last Updated:	01/05/2023 02:51:51 AM			Trade Secret:	false	
Chemical Name:	WINDSHIELD WASHER FLUID					
Common Name Inventory:	WASHER FLUID					
ID:	546215			Permit Status:	Permit Renewed	
Child Record ID:	DEH2023-HCHEM-0354538			Active Permit:	true	
CAS No:	25155-30-0			Haz Material Type:	Mixture	
Last Updated:	06/22/2023 02:33:04 AM			Trade Secret:	false	
Chemical Name:	WINDSHIELD WASHER FLUID					
Common Name Inventory:	WASHER FLUID					
ID:	601521			Permit Status:	Permit Renewed	
Child Record ID:	DEH2023-HCHEM-0380186			Active Permit:	true	
CAS No:	25155-30-0			Haz Material Type:	Mixture	
Last Updated:	09/02/2023 12:48:44 AM			Trade Secret:	false	
Chemical Name:	WINDSHIELD WASHER FLUID					
Common Name Inventory:	WASHER FLUID					
ID:	607897			Permit Status:	Permit Renewed	
Child Record ID:	DEH2023-HCHEM-0382159			Active Permit:	true	
CAS No:	25155-30-0			Haz Material Type:	Mixture	
Last Updated:	09/26/2023 12:48:58 AM			Trade Secret:	false	
Chemical Name:	WINDSHIELD WASHER FLUID					
Common Name Inventory:	WASHER FLUID					
<u>Hazardous Materials Inspection Violations</u>						
Container Tank ID:	37-000-135285			Inspection No:	5660084	
Facility ID No:	11876			Inspection Type:	Routine	
ID:	05/02/2017 04:29:00 PM			Inspection Date:		
UST ID:				Compliance Date:	05/05/2017 12:00:00 AM	
Permit Status:	Permit Renewed			Last Updated:	09/26/2023 12:48:55 AM	
Active Permit:	true			NOV:	false	
Program Element:	Aboveground Petroleum Storage Act					
Violation Code:	4010021 Failed to address in SPCC plan/maintain complete records of: inspections, tests/procedures for 3 years. (40 CFR 112.7(e), 112.8(c)(6).) HSC 25270.4.5(a)					
Violation Classification:	Minor					
Container Tank ID:	37-000-135285			Inspection No:	5660084	
Facility ID No:	11877			Inspection Type:	Routine	
ID:	05/02/2017 04:29:00 PM			Inspection Date:		
UST ID:				Compliance Date:	05/11/2017 12:00:00 AM	

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Permit Status:	Permit Renewed				Last Updated:	09/26/2023 12:48:55 AM
Active Permit:	true				NOV:	false
Program Element:	Hazardous Materials Release Response Plans					
Violation Code:	1010004 Chemical inventory incomplete or not submitted in CERS. HSC 25505(a)(1); 25506; 25507; and 25508(a)(1)(A)					
Violation Classification:	Minor					

HMD Permits Map Data

Epa ID:	CAL000123149	Opened Dt:	2002-05-04T00:00:00
Cers ID:	10055608	Expiration Dt:	2024-07-31T00:00:00
Sitemap:	MAP_135285.pdf	Rpt Name:	HMBP135285.pdf
Record Status:	Permit Renewed	Hirt Flag:	N
Er Contact1:	Mike Martinez	Billing Code1:	Base + CUPA
Er Title1:	Regional Manager	St No:	1809
Er Phone1:	(619) 315-9486	St No End:	
Er Altphone:	(619) 315-9486	St Name:	MAIN
Er Contact2:	Kevin Treder	St Dir:	
Er Title2:	Territory Manager	St Type:	ST
Er Phone2:	(707) 334-0353	St Unit:	
Er Altphone2:	(707) 334-0353	Insp Dist Geoinfo:	HE020
Biz Apn:	282-130-67-00		
Biz Phone:	(925) 734-5800		
Biz Email:	ap@oilchangers.com		
Biz Owner:	Oil Changer, Inc. dba Oil Changers		
Biz Type:	Auto Repair, General - Waste USTs Only		
Facility Subject To Calarp:			
Plating Shop Metal Finishing:			
Chemical Supplier Wholesale:			
Pesticide Applicator Fumigatio:			
Chem Gas Paint Manufacture:			
Resin Site With 6 Items:			
Petroleum Propane Fuel Supp:			
Site With Gt20 Inventory Items:			
Apsa Stor Tank Gt10000 Gal:			
Apsa Stor Tank Chem Gt999ga:			
Ust Stor Tank Fuel Gt30k Ga:			
Cryogas Gt20kcft200gal1200lb:			
Gases Gt20kCft 208 Gal 1666 L:			
Prop Gt185kCft5k Gal 2100:			
Extreme Haz Gt20 Cft 54 Gal 5:			

18	5 of 5	NE	0.25 / 1,302.09	1,421.84 / 4	OIL CHANGERS #619 1809 MAIN STREET RAMONA CA 92065-0000	RCRA NON GEN

Handler ID:	CAL000123149
Generator Status:	N
Recycler Activity?:	NO
Recycler Activity Note:	This facility has not been identified as a Recycler Facility from both the RCRA Handler and Biennial Report Modules.

Violation/Evaluation Summary

Note:	NO RECORDS: As of Nov 2025, there are no Compliance Monitoring and Enforcement (violation) records associated with this facility (EPA ID).

Handler Summary

Importer:	No	Used Oil Transpor:	No
Mixed Waste Gen:	No	Used Oil Trans Fac:	No
Transporter:	No	Used Oil Processor:	No
Transfer Facility:	No	Used Oil Refiner:	No
Recycler:	No	Used Oil Burner:	No
Onsite Burner Exem:	No	Commercial TSD:	No

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Furnace Exemption:	No				Recycl Nonstorage:	No
Underground Injec:	No					
Used Oil Market Burner:		No				
Used Oil Spec Marketer:		No				
<u>Additional Handler Summary Details</u>						
Source Type:	I			NAIC 1:	4884	
Seq No:	1			NAIC 2:	811198	
Non Notifier:				NAIC 3:		
Receive Date:	19950123			NAIC 4:		
Active Site:	H----			State:	CA	
Land Type:				Location Latitude:	33.034955	
In Handler Univ:	Y			Location Longitude:	-116.880987	
In A Universe:	Y			Loc GIS Primary:	N	
Gen Status:	N			Loc GIS Origin:	AG	
Report Cycle:				State District Owner:		
Accessibility:				State District:		
Region:	09					
Fed Waste Gen Owner:		HQ				
State Waste Generator Owner:		CA				
State Waste Generator:		2				
Short Term Generator:		N				
Uni Waste:		Y				
Universal Waste Dest Facility:		Y				
Federal Universal Waste:		N				
As Federally Regulated Tsdf:		-----				
As Converter Tsdf:		-----				
As State Regulated Tsdf:		-----				
As State Regulated Handler:		---				
Federal Indicator:		---				
Hsm:		N				
Subpart K:		---				
GPRA Permit:		N				
GPRA Renewal:		N				
Permit Renewal Wrkld:		-----				
Permwrk ID:		-----				
Perm Prog:		-----				
Pcwrkld:		-----				
Closwrkld:		-----				
GPRA Ca:		N				
Cawrkld:		N				
Subjca Tsd Discretion:		N				
NCAPS:		N				
EC Indicator:		N				
Ca725 Indicator:		N				
Ca750 Indicator:		N				
Operating Tsdf:		-----				
Full Enforcement:		-----				
Snc:		N				
Unaddressed Snc:		N				
Addressed Snc:		N				
Snc With Comp Sched:		N				
Fa Required:		-----				
Hhandler Last Change:		20180905				
Recognized Trader Importer:		N				
Recognized Trader Exporter:		N				
Slab Importer:		N				
Slab Exporter:		N				
Manifest Broker:		N				
Subpart P:		N				
Contact Language:		EN				
Handler Name:		OIL CHANGERS #619				
Location Street No:						
Location Street1:		1809 MAIN STREET				
Location Street2:						
Location City:		RAMONA				
Location State:		CA				

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Location Zip:		92065-0000				
Location County Code:		CA073				
Location County Name:		SAN DIEGO				
Location Country:		US				
Contact Name:		JOHN DENHOLM				
Contact Street No:						
Contact Street1:		4511 WILLOW ROAD STE 1				
Contact Street2:						
Contact City:		PLEASANTON				
Contact State:		CA				
Contact Zip:		94588				
Contact Country:						
Contact Phone & Ext:		925-734-5816				
Contact Fax:		925-734-5858				
Contact Email Address:		COMPLIANCE@OILCHANGERINC.COM				
Contact Title:						
Owner Name:		OIL CHANGER INC				
Owner Type:		O				
Owner Seq:		1				
Operator Name:		JOHN DENHOLM				
Operator Type:		O				
Operator Seq:		2				
Public Notes:						

Contact DTSC for information.

Hazardous Waste Handler Details

Seq No: 1
Receive Date: 19950123
Handler Name: OIL CHANGERS #619
Fed Waste Generator: N
Generator Code Description: Not a Generator, Verified
Source Type: Implementer
TSD Activity: N

Owner/Operator Details

Owner/Operator Ind:	Current Operator	Street No:	
Type:	Other	Street1:	4511 WILLOW ROAD STE 1
Name:	JOHN DENHOLM	Street2:	
Dt Became Current:		City:	PLEASANTON
Dt Ended Current:		State:	CA
Phone:	925-734-5816	Country:	
Source Type:	Implementer	Zip:	94588

Owner/Operator Ind:	Current Owner	Street No:	
Type:	Other	Street1:	4511 WILLOW RD STE 1
Name:	OIL CHANGER INC	Street2:	
Dt Became Current:		City:	PLEASANTON
Dt Ended Current:		State:	CA
Phone:	925-734-5800	Country:	
Source Type:	Implementer	Zip:	94588-0000

19	1 of 1	W	0.28 / 1,500.50	1,410.72 / -7	WILLIAM SMITH 2230 TOUB ST RAMONA CA 92065	RCRA TSD

Handler ID: CAC003006712
Generator Status: N
Recycler Activity?: NO
Recycler Activity Note: This facility has not been identified as a Recycler Facility from both the RCRA Handler and Biennial Report Modules.

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Violation/Evaluation Summary

Note: NO RECORDS: As of Nov 2025, there are no Compliance Monitoring and Enforcement (violation) records associated with this facility (EPA ID).

Handler Summary

Importer:	No	Used Oil Transpor:	No
Mixed Waste Gen:	No	Used Oil Trans Fac:	No
Transporter:	No	Used Oil Processor:	No
Transfer Facility:	No	Used Oil Refiner:	No
Recycler:	No	Used Oil Burner:	No
Onsite Burner Exem:	No	Commercial TSD:	No
Furnace Exemption:	No	Recycl Nonstorage:	No
Underground Injec:	No		
Used Oil Market Burner:	No		
Used Oil Spec Marketer:	No		

Additional Handler Summary Details

Source Type:	I	NAIC 1:	56299
Seq No:	1	NAIC 2:	
Non Notifier:		NAIC 3:	
Receive Date:	20190321	NAIC 4:	
Active Site:	H----	State:	CA
Land Type:		Location Latitude:	33.03181
In Handler Univ:	Y	Location Longitude:	-116.891042
In A Universe:	Y	Loc GIS Primary:	N
Gen Status:	N	Loc GIS Origin:	AG
Report Cycle:		State District Owner:	
Accessibility:		State District:	
Region:	09		
Fed Waste Gen Owner:	HQ		
State Waste Generator Owner:	CA		
State Waste Generator:	2		
Short Term Generator:	N		
Uni Waste:	Y		
Universal Waste Dest Facility:	Y		
Federal Universal Waste:	N		
As Federally Regulated Tsdf:	-----		
As Converter Tsdf:	-----		
As State Regulated Tsdf:	-----		
As State Regulated Handler:	---		
Federal Indicator:	---		
Hsm:	N		
Subpart K:	----		
GPRA Permit:	N		
GPRA Renewal:	N		
Permit Renewal Wrkld:	-----		
Permwrk ID:	-----		
Perm Prog:	-----		
Pcwrkld:	-----		
Closwrkld:	-----		
GPRA Ca:	N		
Cawrkld:	N		
Subjca Tsd Discretion:	N		
NCAPS:	N		
EC Indicator:	N		
Ca725 Indicator:	N		
Ca750 Indicator:	N		
Operating Tsdf:	-----		
Full Enforcement:	-----		
Snc:	N		
Unaddressed Snc:	N		
Addressed Snc:	N		
Snc With Comp Sched:	N		

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Fa Required:		----				
Hhandler Last Change:		20190626				
Recognized Trader Importer:		N				
Recognized Trader Exporter:		N				
Slab Importer:		N				
Slab Exporter:		N				
Manifest Broker:		N				
Subpart P:		N				
Contact Language:		EN				
Handler Name:		WILLIAM SMITH				
Location Street No:						
Location Street1:		2230 TOUB ST				
Location Street2:						
Location City:		RAMONA				
Location State:		CA				
Location Zip:		92065				
Location County Code:		CA073				
Location County Name:		SAN DIEGO				
Location Country:		US				
Contact Name:		WILLIAM SMITH				
Contact Street No:						
Contact Street1:		2230 TOUB ST				
Contact Street2:						
Contact City:		RAMONA				
Contact State:		CA				
Contact Zip:		92065				
Contact Country:						
Contact Phone & Ext:		760-213-0873				
Contact Fax:						
Contact Email Address:		KERRIEP@CVECORG.COM				
Contact Title:						
Owner Name:		WILLIAM SMITH				
Owner Type:		O				
Owner Seq:		1				
Operator Name:		WILLIAM SMITH				
Operator Type:		O				
Operator Seq:		2				
Public Notes:						

Contact DTSC for information.

Hazardous Waste Handler Details

Seq No: 1
Receive Date: 20190321
Handler Name: WILLIAM SMITH
Fed Waste Generator: N
Generator Code Description: Not a Generator, Verified
Tsd Activity: Y
Source Type: Implementer

Owner/Operator Details

Owner/Operator Ind:	Current Operator	Street No:	
Type:	Other	Street1:	2230 TOUB ST
Name:	WILLIAM SMITH	Street2:	
Dt Became Current:		City:	RAMONA
Dt Ended Current:		State:	CA
Phone:	760-213-0873	Country:	
Source Type:	Implementer	Zip:	92065

Owner/Operator Ind:	Current Owner	Street No:	
Type:	Other	Street1:	2230 TOUB ST
Name:	WILLIAM SMITH	Street2:	
Dt Became Current:		City:	RAMONA
Dt Ended Current:		State:	CA

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Phone: 760-213-0873				Country:		
Source Type: Implementer				Zip: 92065		
20	1 of 2	SW	0.32 / 1,674.75	1,402.52 / -15	MAIN STREET AUTO CARE 2317 MAIN ST STE A RAMONA CA 92065	C&D DEBRIS RECY
County: SAN DIEGO						
Activity Type: USED OIL COLLECTION						
Phone No:						
20	2 of 2	SW	0.32 / 1,674.75	1,402.52 / -15	RAMONA MOTOR WORKS, INC. 2317 MAIN ST STE D RAMONA CA 92065	C&D DEBRIS RECY
County: SAN DIEGO						
Activity Type: USED OIL COLLECTION						
Phone No:						
21	1 of 2	ENE	0.34 / 1,772.25	1,418.95 / 1	BIG BEAR MARKETS 405 RAMONA ST RAMONA CA 92065	CLEANUP SITES
Global ID: T0608106941				Site Facility Type: CLEANUP PROGRAM SITE		
Site Fac Type (SRCH): CLEANUP PROGRAM SITE				Case Type (DL): Cleanup Program Site		
Status (SRCH): COMPLETED - CASE CLOSED				RWQCB Region (DL): SAN DIEGO RWQCB (REGION 9)		
Status (DL): Completed - Case Closed				Census Tract (SRCH): 6073020806		
Status Date (DL): 8/5/1992				Latitude (DL): 33.034692		
Cleanup Status: COMPLETED - CASE CLOSED				Longitude (DL): -116.879588		
Site Facility Name (SRCH): BIG BEAR MARKETS						
Address (SRCH): 405 RAMONA ST						
City (SRCH): RAMONA						
Zip (SRCH): 92065						
County (SRCH): SAN DIEGO						
Street No (DL): 405						
Street Name (DL): RAMONA ST						
City (DL): RAMONA						
Zip (DL): 92065						
County (DL): San Diego						
State (DL): CA						
Site Facility Name : BIG BEAR MARKETS						
Address : 405 RAMONA ST						
City : RAMONA						
Zip : 92065						
County : SAN DIEGO						
Report Source: GeoTracker Search Results (SRCH); Cleanup Sites from GeoTracker Cleanup Sites Data Download; GeoTracker Search Results Report (as of 11 Aug 2025)						

GeoTracker Sites Data Download - Site Details

RB Case No:
Local Case No: H10713-001
Begin Date: 4/10/1991
Lead Agency: SAN DIEGO COUNTY
Local Agency: SAN DIEGO COUNTY
CUF Case:
CalEnvScreen Score:
EPA Region: 9
Qty Rlsd Gallons:
Potential COC: Waste Oil / Motor / Hydraulic / Lubricating
How Discovered:
Stop Method:
Stop Description:

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Case Worker:		NS				
Military DoD Site:		No				
Leak Reported Dt:		1991-09-20 00:00:00				
No Further Action Dt:		1992-08-05 00:00:00				
Potential Media of Concern:		Soil				
How Discovered Description:						
Calwater Watershed Name:		San Dieguito - Santa Maria Valley - Ramona (905.41)				
DWR GW Subbasin Name:		Santa Maria Valley (9-011)				
Disadvantaged Community:						
Coordinate Source:		Google Geocode				
Discharge Cause:						
Discharge Source:						
Facility Project Sub Type:						
Calenviroscreen 3 Score:		36-40%				
Calenviroscreen 4 Score:		25-30%				
File Location:		Local Agency				
Claim No:						
Claim Status:						
A2022 Assembly District:		75				
A2022 Congressional District:		48				
A2022 Senate District:		40				
Site History:						

GeoTracker Sites Data Download - Status History

Status: Completed - Case Closed
Status Date: 1992-08-05 00:00:00

Status: Open - Case Begin Date
Status Date: 1991-04-10 00:00:00

GeoTracker Sites Data Download - Regulatory Contacts

Contact Type: Local Agency Caseworker - Primary Caseworker
Contact Name: NASSER SIONIT
Organization Name: SAN DIEGO COUNTY
Address: P.O. Box 129261
City: San Diego
Email: nasser.sionit@sdcounty.ca.gov
Phone No:

GeoTracker Search - Facilities

Project Status:
Cuf Claim No:
CUF Priority Assign:
CUF Amount Paid:
Composting Method:
Facility Type:
WDR Place Type:
WDR File No:
WDR Order No:
File Location: LOCAL AGENCY
User Defined Beneficial Use:
Designated Beneficial Use: MUN, AGR, IND, PROC
Designated Beneficl Use Desc: Municipal and Domestic Supply, Agricultural Supply, Industrial Service Supply, Industrial Process Supply
Project Oversight Agencies:
Report Link: https://geotracker.waterboards.ca.gov/profile_report?global_id=T0608106941
Cleanup Status Detail: COMPLETED - CASE CLOSED AS OF 8/5/1992
Potential COC: WASTE OIL / MOTOR / HYDRAULIC / LUBRICATING
Potential Media of Concern: SOIL
Groundwater Monitoring Freq:
DWR GW Sub Basin: Santa Maria Valley (9-011)
CalWater Watershed Name: San Dieguito - Santa Maria Valley - Ramona (905.41)
Post Closure Site Management:

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Future Land Use:

Cleanup Oversight Agencies: SAN DIEGO COUNTY (LEAD) - CASE #: H10713-001
CASE MANAGER: NASSER SIONIT
SAN DIEGO RWQCB (REGION 9)

Cleanup History Link: https://geotracker.waterboards.ca.gov/profile_report_include?global_id=T0608106941&tabname=regulatoryhistory
Site History:

No site history available

GeoTracker Search - Regulatory Activities

Action Type: Other Regulatory Actions
Action: Closure/No Further Action Letter
Action Date: 8/5/1992
Received Issue Date: 8/5/1992
Doc Link: https://geotracker.waterboards.ca.gov/view_documents?global_id=T0608106941&enforcement_id=6375809&temptable=ENFORCEMENT

Title Description Comments:

H10713-001 Closure Documents

Action Type: Leak Action
Action: Leak Reported
Action Date: 9/20/1991
Received Issue Date:
Doc Link:
Title Description Comments:

Action Type: Notices
Action: Notice of Responsibility
Action Date: 9/20/1991
Received Issue Date: 9/20/1991
Doc Link:
Title Description Comments:

NOTICE OF REIMBURSEMENT / LOCAL

Action Type: Leak Action
Action: Leak Began
Action Date: 4/10/1991
Received Issue Date:
Doc Link:
Title Description Comments:

Action Type: Leak Action
Action: Leak Discovery
Action Date: 4/10/1991
Received Issue Date:
Doc Link:
Title Description Comments:

GeoTracker Search - Documents

Document Type:	Site Documents	Document Date:	8/5/1992
Type:	CLOSURE/NO FURTHER ACTION LETTER	Submitted:	
Submitted By:	DIANNE PELLEY (REGULATOR)		
Title:	H10713-001 CLOSURE DOCUMENTS		
Title Link:	https://geotracker.waterboards.ca.gov/view_documents?global_id=T0608106941&enforcement_id=6375809		

GeoTracker Search - Cleanup Status History

Map Key	Number of Records	Direction	Distance (mil/ft)	Elev/Diff (ft)	Site	DB
Status:		Completed - Case Closed				
Date:		8/5/1992				
Status:		Open - Case Begin Date				
Date:		4/10/1991				
21	2 of 2	ENE	0.34 / 1,772.25	1,418.95 / 1	BIG BEAR MARKETS 405 RAMONA ST RAMONA CA 92065	SAM SANDIEGO
Record ID:		DEH1991-LSAM-H10713-001		Agency Name:		COSD
Record ID (Map):		DEH1991-LSAM-H10713-001		Lead Agency:		DEH/SAM
Record Type (Map):		LUEG-DEH/LWQD/SAM Investigation/NA		Lead Agcy Date:		4/9/1991, 8:00 PM
ID:		2340		Object ID:		2338
ThomasBros Map Gd:		1152 F 7		SWRCB Global ID:		T0608106941
Jurisdiction:		UNINCORPORATED		Feature ID:		2822614300
Census Tract:		208.06		Parcel No:		282-261-43-00
Watershed Basin:		905.41		Case No:		H10713-001
GT Global ID:		T0608106941		H No:		H10713
GT RB Case No:				KIVA per Tp per No:		6SAM H10713
GT Status Date:		8/4/1992, 8:00 PM		Status:		Completed
GT Case Type:		Cleanup Program Site		Record Status:		Completed
GT CUF Case:		NO		Record Type:		SAM Investigation
GT County:		San Diego		Record Alias:		SAM Investigation
GT Latitude:		33.034692		Date:		09/20/1991
GT Longitude:		-116.879588		Per Type:		LWQD
Latitude GS84:		33.0346582		Primary Parcel:		Yes
Longitude GS84:		-116.8795492		Primary Address:		Yes
Point X:		-116.87943204887742		Address Type:		ALIAS
Point Y:		33.034714156392454		Community:		Ramona
X:		6368714.867		Zip Code:		92065
Y:		1956832.177		Zip Community:		92065
BOS District:		2		Gt Stat Dt:		1992-08-05 00:00:00 UTC
Lead Agc Dt:		1991-04-10 00:00:00 UTC		Opened Dt:		1991-09-20 00:00:00 UTC
Edited Dt:						
Project Name:		BIG BEAR MARKETS				
Address:		405 RAMONA ST, RAMONA CA 92065				
Street String:		405 RAMONA ST				
City:		RAMONA				
Record Name (Map):		BIG BEAR MARKETS				
Address (Map):		405 RAMONA ST, RAMONA, CA 92065				
GT Lead Agency:		SAN DIEGO COUNTY LOP				
GT Status:		Completed - Case Closed				
DEH Permit Owner:						
Water Purveyor:		RAMONA MUNICIPAL WATER DISTRICT				
Case Type:		VAP - Voluntary Assistance Program				
Geo SRC:		Mapped to XY from previous SAM Layer				
Historical Name:		BIG BEAR MARKETS				
Fire Agency:		RAMONA MUNI WATER DIST				
Funding:		V - Private - VAP				
Short Notes:						
Source File:		Citizen Access DEH Site Assessment and Mitigation Investigation Sites (as of 26 Oct 2025); San Diego Site Assessment and Mitigation Investigation Sites (Map) (as of 1 Nov 2016)				
22	1 of 1	SW	0.36 / 1,918.32	1,401.61 / -16	DWZ VENTURES LLC RAMONA CA	PFAS IND
Status:		Inactive		Fac Fips Code:		06073
Fac Indian Cntry Flg:		No		Compliance Status:		No Violation Identified
Fac Derived Huc:		-		EPA Programs:		RCRA
Fac Derived Wbd:		180703040203		Federal Facility:		No
Fac Derived Cd113:		-		Federal Agency:		-
Fac Derived Cb2010:		-		Fac Snc Flg:		No
Fac Informal Count:		0		AIR Flag:		No
Last Informal Action:		-		NPDES Flag:		No

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Formal Action Count:	0				SDWIS Flag:	No
Last Formal Action:	-				RCRAFlag:	Yes
Fac Total Penalties:	0				TRI Flag:	No
Fac Penalty Count:	-				GHG Flag:	No
Date Last Penalty:	-				TRI IDs:	-
Last Penalty Amt:	0				TRI Releases Trnsfrs:	-
Fac Qtrs With Nc:	0				TRI on Site Releases:	-
Programs With Snc:	0				TRI off Site Trnsfrs:	-
Fac Percent Minority:	-				TRI Reporter:	-
Fac Pop Den:	-				Fac Imp Water Flg:	-
Count:	1				Fac Major Flag:	-
Fac County:	SAN DIEGO				Fac Active Flag:	-
State Other:					Fac Inspection Count:	0
Region:	09				Date Last Inspection:	-
Latitude:	33.027817				Days Last Inspection:	-
Longitude:	-116.889864					
Fac Derived Tribes:	Capitan Grande Band of Diegueno Mission Indians of California: Barona Group of Capitan Grande Band of Mission Indians of the Barona Reservation, California - 4 mile(s), Capitan Grande Band of Diegueno Mission Indians of California (Barona Group of Capitan Grande Band of Mission Indians of the Barona Reservation, California; Viejas (Baron Long) Group of Capitan Grande Band of Mission Indians of the Viejas Reservation, California) - 8 mile(s), Mesa Grande Band of Diegueno Mission Indians of the Mesa Grande Reservation, California - 9 mile(s), Iipay Nation of Santa Ysabel, California - 10 mile(s), San Pasqual Band of Diegueno Mission Indians of California - 12 mile(s), Inaja Band of Diegueno Mission Indians of the Inaja and Cosmit Reservation, California - 14 mile(s), La Jolla Band of Luiseno Indians, California - 16 mile(s), Capitan Grande Band of Diegueno Mission Indians of California: Viejas (Baron Long) Group of Capitan Grande Band of Mission Indians of the Viejas Reservation, California - 16 mile(s), Rincon Band of Luiseno Mission Indians of Rincon Reservation, California - 16 mile(s), Ewiiapaayp Band of Kumeyaay Indians, California - 17 mile(s), Sycuan Band of the Kumeyaay Nation - 17 mile(s), Pauma Band of Luiseno Mission Indians of the Pauma & Yuima Reservation, California - 20 mile(s), Pala Band of Mission Indians - 22 mile(s), Jamul Indian Village of California - 23 mile(s), Los Coyotes Band of Cahuilla and Cupeno Indians, California - 24 mile(s)					
AIR IDs:	-					
CAA Permit Types:	-					
CAA NAICS:	-					
CAA SICS:	-					
NPDES IDs:	-					
CWA Permit Types:	-					
CWA NAICS:	-					
CWA SICS:	-					
RCRA IDs:	CAC003147190					
RCRA Permit Types:	Other					
RCRA NAICS:	332999					
SDWA IDs:	-					
SDWA System Types:	-					
SDWA Compliance Status:	-					
SDWA Snc Flag:	No					
Fac Collection Meth:	GDT-ADDRESS MATCHING (GEOCODING)					
ECHO Facility Report:	https://echo.epa.gov/detailed-facility-report?fid=110071188286					
Details						
Industry:	Metal Machinery Mfg					

23	1 of 1	NE	0.40 / 2,100.18	1,422.13 / 4	Jamal Habib Trust Site Discharge to San Diego Fairy Shrimp Vernal Pools 1703 Main Street Ramona CA 92065	LDS
Global ID:	T10000020693				RWQCB Region:	SAN DIEGO RWQCB (REGION 9)
Facility ID:	T10000020693				Longitude:	-116.87973
Cleanup Status:	OPEN - OPERATING				Latitude:	33.03637
Site Facility Type:	LAND DISPOSAL SITE				Site Fac Type (SRCH):	LAND DISPOSAL SITE
Census Tract (SRCH):	6073020806					
Address:	1703 Main Street					
City:	Ramona					
County:	San Diego					
State:	CA					

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Zip:		92065				

GeoTracker Sites Data Download – Site Details

RB Case No:
Loc Case No:
Status: Open - Operating
Status Date: 11/3/2022
Begin Date: 11/3/2022
Case Type: Land Disposal Site
Cal Enviroscreen:
Qty Released Gallons:
CUF Case:
EPA Region: 9
Lead Agency: SAN DIEGO RWQCB (REGION 9)
Case Worker: FTM
Local Agency:
File Location:
Potential COC:
Military DoD Site: No
Leak Reported Dt:
No Further Action Dt:
Potential Media of Concern:
How Discovered:
How Discovered Description:
Stop Method:
Stop Description:
Calwater Watershed Name:
DWR GW Subbasin Name:
Disadvantaged Community: Severely Disadvantaged Community
Discharge Cause:
Coordinate Source:
Discharge Source:
Facility Project Sub Type: Illegal Disposal Site
Calenviroscreen 3 Score: 26-30%
Calenviroscreen 4 Score: 25-30%
Claim No:
Claim Status:
Site History:

GeoTracker Sites Data Download - Regulatory Contacts

Contact Type: Regional Board Caseworker - Primary Caseworker
Contact Name: FRANK MELBOURN
Organization Name: SAN DIEGO RWQCB (REGION 9)
Address: 2375 NORTHSIDE DRIVE, SUITE 100
City: SAN DIEGO
Email: frank.melbourn@waterboards.ca.gov
Phone No: 6195213372

GeoTracker Sites Data Download - Status History

Status: Open - Case Begin Date
Status Date: 2022-11-03 00:00:00

Status: Open - Operating
Status Date: 2022-11-03 00:00:00

GeoTracker Search - Facilities

Site Facility Name: JAMAL HABIB TRUST SITE DISCHARGE TO SAN DIEGO FAIRY SHRIMP VERNAL POOLS
Site Facility Type: LAND DISPOSAL SITE
Cleanup Status: OPEN - OPERATING

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Project Status:						
Potential COC:		NONE SPECIFIED				
WDR Place Type:						
Wdr File No:						
Wdr Order No:						
Address:		1703 MAIN STREET				
City:		RAMONA				
Zip:		92065				
County:		SAN DIEGO				
Cuf Claim No:						
CUF Priority Assig:						
CUF Amount Paid:						
Designated Beneficial Use:		MUN, AGR, IND, PROC				
Designated Beneficl Use Desc:		Municipal and Domestic Supply, Agricultural Supply, Industrial Service Supply, Industrial Process Supply				
Project Oversight Agencies:						
Report Link:		https://geotracker.waterboards.ca.gov/profile_report?global_id=T10000020693				
Cleanup Status Detail:		OPEN - OPERATING AS OF 11/3/2022				
Cleanup History Link:		https://geotracker.waterboards.ca.gov/profile_report_include?global_id=T10000020693&tabname=regulatoryhistory				
Potential Media of Concern:		NONE SPECIFIED				
User Defined Beneficial Use:						
DWR GW Sub Basin:						
Calwater Watershed Name:						
Post Closure Site Management:						
Future Land Use:						
Facility Type:		ILLEGAL DISPOSAL SITE				
Composting Method:						
Gndwater Monitoring Frequen:						
Cleanup Oversight Agencies:		SAN DIEGO RWQCB (REGION 9) (LEAD) CASE MANAGER: FRANK MELBOURN				
File Location:						
Site History:						

No site history available

GeoTracker Search - Cleanup Status History

Status:	Open - Case Begin Date
Date:	11/3/2022
Status:	Open - Operating
Date:	11/3/2022

24

1 of 1

ESE

0.43 / 2,288.72

1,422.58 / 5

JMPCO LAND DEVELOPMENT

CA

SAM SANDIEGO

Record ID:

Record ID (Map):

Record Type (Map):

ID:

ThomasBros Map Gd:

Jurisdiction:

Census Tract:

Watershed Basin:

GT Global ID:

GT RB Case No:

GT Status Date:

GT Case Type:

GT CUF Case:

GT County:

GT Latitude:

GT Longitude:

Latitude GS84:

Longitude GS84:

Point X:

DEH1989-LSAM-H29566-001

DEH1989-LSAM-H29566-001

LUEG-DEH/LWQD/SAM Investigation/NA

1704

T0607300375

9UT1556

10/24/1989, 8:00 PM

LUST Cleanup Site

NO

San Diego

33.028641

-116.878173

-116.87866947811267

Agency Name:

Lead Agency:

Lead Agcy Date:

Object ID:

SWRCB Global ID:

Feature ID:

Parcel No:

Case No:

H No:

KIVA per Tp per No:

Status:

Record Status:

Record Type:

Record Alias:

Date:

Per Type:

Primary Parcel:

Primary Address:

Address Type:

COSD

DEH/SAM

10/24/1989, 8:00 PM

1703

T0607300375

H29566-001

H29566

6SAM H29566

Completed

Completed

SAM Investigation

SAM Investigation

10/25/1989

LWQD

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Point Y:	33.02823498157848				Community:	
X:					Zip Code:	
Y:					Zip Community:	
BOS District:					Gt Stat Dt:	1989-10-25 00:00:00 UTC
Lead Agc Dt:	1989-10-25 00:00:00 UTC				Opened Dt:	1989-10-25 00:00:00 UTC
Edited Dt:						
Project Name:	JMPCO LAND DEVELOPMENT					
Address:						
Street String:						
City:						
Record Name (Map):	JMPCO LAND DEVELOPMENT					
Address (Map):						
GT Lead Agency:	SAN DIEGO COUNTY LOP					
GT Status:	Completed - Case Closed					
DEH Permit Owner:						
Water Purveyor:						
Case Type:	LOP - Local Oversight Program					
Geo SRC:	Mapped to XY from previous SAM Layer					
Historical Name:	JMPCO LAND DEVELOP					
Fire Agency:						
Funding:	S - LOP State Fund					
Short Notes:						
Source File:	Citizen Access DEH Site Assessment and Mitigation Investigation Sites (as of 26 Oct 2025); San Diego Site Assessment and Mitigation Investigation Sites (Map) (as of 1 Nov 2016)					

25	1 of 1	ESE	0.44 / 2,323.60	1,422.59 / 5	JMPCO LAND DEVELOPMENT 1839 RAMSEY LN RAMONA CA 92065	LUST

Global ID:	T0607300375	Case Type (DL):	LUST Cleanup Site
Site Facility Type:	LUST CLEANUP SITE	Oil Field (SRCH):	
Site Fac Type (SRCH):	LUST CLEANUP SITE	Oil Field Oper (SRCH):	
Status:		Census Tract (SRCH):	6073020806
Status (SRCH):	COMPLETED - CASE CLOSED	Latitude (DL):	33.028641
Status (DL):	Completed - Case Closed	Longitude (DL):	-116.878173
Status Date (DL):	10/25/1989	RWQCB Region (DL):	SAN DIEGO RWQCB (REGION 9)
Cleanup Status:	COMPLETED - CASE CLOSED		
Site Facility Name (SRCH):	JMPCO LAND DEVELOPMENT		
Address (SRCH):	1839 RAMSEY LN		
City (SRCH):	RAMONA		
Zip (SRCH):	92065		
County (SRCH):	SAN DIEGO		
Street No (DL):	1839		
Street Name (DL):	RAMSEY LN		
City (DL):	RAMONA		
Zip (DL):	92065		
County (DL):	San Diego		
State (DL):	CA		
Business Name (DL):	JMPCO LAND DEVELOPMENT		
Site Facility Name:	JMPCO LAND DEVELOPMENT		
Address :	1839 RAMSEY LN		
City :	RAMONA		
Zip :	92065		
County :	SAN DIEGO		
Report Source:	LUST Cleanup Sites & Military UST Site from GeoTracker Project Search Results Export; LUST Cleanup Sites & Military UST Site from GeoTracker Cleanup Sites Data Download; LUST Cleanup Sites from GeoTracker Search		

GeoTracker Sites Data Download - Site Details

CUF Case:	
Lead Agency:	SAN DIEGO COUNTY
Case Worker:	
Local Agency:	
RB Case No:	9UT1556
Local Case No:	H29566-001
File Location:	Local Agency

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Potential COC:		Diesel				
Potential Media of Concern:		Soil				
Begin Date:		10/25/1989				
How Discovered:						
How Discovered Description:						
Stop Method:						
Stop Description:						
Calwater Watershed Name:		San Dieguito - Santa Maria Valley - Ramona (905.41)				
DWR GW Subbasin Name:		Santa Maria Valley (9-011)				
Disadvantaged Community:						
CalEnvScreen Score:						
Coordinate Source:		Google Geocode				
Discharge Cause:						
Discharge Source:						
EPA Region:		9				
Leak Reported Dt:		1989-10-25 00:00:00				
Military DoD Site:		No				
No Further Action Dt:		1989-10-25 00:00:00				
Qty Rlsd Gallons:						
Facility Project Sub Type:						
Calenviroscreen 3 Score:		36-40%				
Calenviroscreen 4 Score:		25-30%				
Claim No:						
Claim Status:						
A2022 Assembly District:		75				
A2022 Congressional District:		48				
A2022 Senate District:		40				
Site History:						

GeoTracker Sites Data Download - Status History

Status: Completed - Case Closed
Status Date: 10/25/1989

Status: Open - Case Begin Date
Status Date: 10/25/1989

GeoTracker Search - Regulatory Profile

Site Facility Name: JMPCO LAND DEVELOPMENT
Site Facility Type: LUST CLEANUP SITE
Cleanup Status: COMPLETED - CASE CLOSED
Address: 1839 RAMSEY LN
City: RAMONA
Zip: 92065
County: SAN DIEGO
Report Link: https://geotracker.waterboards.ca.gov/profile_report?global_id=T0607300375
Cleanup Status Detail: COMPLETED - CASE CLOSED AS OF 10/25/1989
Project Status:
Cleanup History Link: https://geotracker.waterboards.ca.gov/profile_report_include?global_id=T0607300375&tabname=regulatoryhistory
Potential COC: DIESEL
Potential Media of Concern: SOIL
File Location: LOCAL AGENCY
User Defined Beneficial Use:
Designated Beneficial Use: MUN, AGR, IND, PROC
DWR GW Sub Basin: Santa Maria Valley (9-011)
Calwater Watershed Name: San Dieguito - Santa Maria Valley - Ramona (905.41)
Post Closure Site Management:
Future Land Use:
Cleanup Oversight Agencies: SAN DIEGO COUNTY (LEAD) - CASE #: H29566-001
SAN DIEGO RWQCB (REGION 9) - CASE #: 9UT1556
CUF Claim No:
CUF Priority Assig:
CUF Amount Paid:
WDR Place Type:
WDR File No:

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

WDR Order No:
Project Oversight Agencies:
Facility Type:
Composting Method:
Grndwtr Monitoring Frequency:
Designated Beneficial Use
Desc:
Site History:

Municipal and Domestic Supply, Agricultural Supply, Industrial Service Supply, Industrial Process Supply

No site history available

GeoTracker Search - Cleanup Status History

Status:

Date :

Open - Case Begin Date

10/25/1989

Status:

Date :

Completed - Case Closed

10/25/1989

GeoTracker Search - Regulatory Activities

Action Type:

Action:

Action Date:

Received Issue Date:

Doc Link:

Title Description Comments:

Leak Action

Leak Reported

10/25/1989

Action Type:

Action:

Action Date:

Received Issue Date:

Doc Link:

Title Description Comments:

Leak Action

Leak Stopped

10/25/1989

Action Type:

Action:

Action Date:

Received Issue Date:

Doc Link:

Title Description Comments:

Leak Action

Leak Discovery

10/25/1989

Action Type:

Action:

Action Date:

Received Issue Date:

Doc Link:

Title Description Comments:

Leak Action

Leak Began

10/25/1989

26	1 of1	ESE	0.81 / 4,302.67	1,431.32 / 14	OLIVE PIERCE MIDDLE SCHOOL 1521 Hanson Lane Ramona CA 92065	SCH

Envirostor ID:

Site History:

37820022

The existing middle school has occupied the Site since 1983. Prior to school construction, the Phase I indicates the site was occupied by a residence. Although, based on DTSC's review of an aerial, agricultural activities may have occurred onsite.

Facilities Details

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Estor/EPA ID:	37820022	Site Code:	404465
Program Type:	SCHOOL EVALUATION	Apn:	NONE SPECIFIED
Program Type1:		Assembly District:	75
Status:	NO ACTION REQUIRED	Census Tract:	6073020806
Site Facility Name:	OLIVE PIERCE MIDDLE SCHOOL	Funding:	SCHOOL DISTRICT
Site Type:	SCHOOL	Office:	SOUTHERN CALIFORNIA SCHOOLS & BROWNFIELDS OUTREACH
Address Description:	1521 HANSON LANE	Project Manager:	
City:	RAMONA	Special Program:	
County:	SAN DIEGO	Supervisor:	SHAHIR HADDAD
Zip:	92065	Senate District:	40
Acres:	20 ACRES		
Public Participation Specialis:			
CalEnviroScreen Score:	25-30%		
National Priorities List:	NO		
Past Use that Caused Contam:	EDUCATIONAL SERVICES		
Permit Renewal Lead:			
Cleanup Oversight Agencies:	DTSC - SITE CLEANUP PROGRAM - LEAD AGENCY		
Cleanup Status:	NO ACTION REQUIRED AS OF 8/28/2003		
Potential Cont of Conc:	NO CONTAMINANTS FOUND		
Potential Media Affected:	NO MEDIA AFFECTED		
School District:	RAMONA UNIFIED SCHOOL DISTRICT		
Summary Link:	https://www.envirostor.dtsc.ca.gov/public/profile_report?global_id=37820022		

Completed Activities

Title:	Phase 1
Title Link:	https://www.envirostor.dtsc.ca.gov/public/final_documents2?global_id=37820022&doc_id=6005534
Area Name:	
Area Link:	
Sub Area:	
Sub Area Link:	
Document Type:	Phase 1
Date Completed:	8/28/2003
Comments:	
Activity Type:	Completed Activities
Title:	* Site Visit - Site Inspections/visit
Title Link:	
Area Name:	
Area Link:	
Sub Area:	
Sub Area Link:	
Document Type:	Site Inspections/Visit (Non LUR)
Date Completed:	8/28/2003
Comments:	
Activity Type:	Completed Activities
Title:	Refund Letter
Title Link:	https://www.envirostor.dtsc.ca.gov/public/final_documents2?global_id=37820022&enforcement_id=60330216
Area Name:	
Area Link:	
Sub Area:	
Sub Area Link:	
Document Type:	Correspondence
Date Completed:	12/10/2003
Comments:	Refund letter for portion of advanced payment remaining after work complete.
Activity Type:	Completed Activities

Search Results Details

Program Type:	SCHOOL INVESTIGATION
Site Code:	404465
Status:	NO ACTION REQUIRED
Status Date:	8/28/2003
Calenviroscreen Score:	25-30%

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
Office:		Southern California Schools & Brownfields Outreach				
Pm:						
Supervisor:		Shahir Haddad				
Branch Chief:		Benjamin Stanphill				
Address Description:		1521 HANSON LANE				
Site Facility Name:		OLIVE PIERCE MIDDLE SCHOOL				
City:		RAMONA				
County:		SAN DIEGO				
Zip:		92065				
Latitude:		33.0257454				
Longitude:		-116.8713322				

Sites Details

Status:	No Action Required	Assembly:	75
Status Date:	8/28/2003	Division Branch:	Southern California Schools & Brownfields Outreach
Site Code:	404465	Funding:	School District
Site Type:	School Investigation	Lead Agency:	SMBRP
Site Type Detailed:	School	Project Manager:	
Special Program:		Supervisor:	Shahir Haddad
City:	Ramona	Restricted Use:	NO
County:	SAN DIEGO	Senate:	40
Congress Dis:	48	Site Mgmt Req:	NONE SPECIFIED
State:	CA	Acres:	20
Latitude:	33.0257454	Zip:	92065
Longitude:	-116.8713322		
Address:	1521 Hanson Lane		
National Priorities List:	NO		
APN:	NONE SPECIFIED		
Confirmed Coc:	NONE SPECIFIED		
Past Uses:	* EDUCATIONAL SERVICES		
Potential Coc:	NONE SPECIFIED,31000		
Potential Media Affected:	NMA		
Project Name:	OLIVE PIERCE MIDDLE SCHOOL		
Regulatory Agencies Involved:	SMBRP		

27	1 of 1	NE	0.87 / 4,617.21	1,414.17 / -3	HATFIELD CREEK CLAIM SAN DIEGO COUNTY RAMONA CA 92065	MRDS
Dep ID:	10214055	I1:	38			
Dev Status:	UNKNOWN	Latitude:	33.041687			
Code List:	GEM_D	Longitude:	-116.87439			
Url:	http://mrdata.usgs.gov/mrds/show-mrds.php?dep_id=10214055					

Commodity

I1:	24	Line:	1
Code:	GEM_D	Inserted By:	MAS migration
Commodity:	Diamond	Insert Date:	29-OCT-2002 09:00:24
Commodity Type:	Non-metallic	Updated By:	USGS
Commodity Group:	Gemstones	Update Date:	29-OCT-2002 09:01:57
Importance:	Primary		

Names

I1:	14	Inserted By:	MAS migration
Status:	Current	Insert Date:	29-OCT-02
Site Name:	Hatfield Creek Claim	Updated By:	USGS
Line:	1	Update Date:	29-OCT-02

28	1 of 1	ESE	0.95 / 5,010.71	1,436.68 / 19	RAMONA HIGH SCHOOL 1401 Hanson Lane	SCH

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Ramona CA 92065

Envirostor ID: 60000007
Site History:

The 37 acre school has been occupied by the existing school since 1983. Prior to school construction the site was vacant. An automotive shop, welding shop, auto body shop and photo lab are on the site. Also a chemistry lab. However the district resubmitted the Phase I to redefine boundaries to only 3 acres for the new construction project.

Facilities Details

Estor/EPA ID:	60000007	Site Code:	404466
Program Type:	SCHOOL EVALUATION	Apn:	NONE SPECIFIED
Program Type1:		Assembly District:	75
Status:	NO ACTION REQUIRED	Census Tract:	6073020806
Site Facility Name:	RAMONA HIGH SCHOOL	Funding:	SCHOOL DISTRICT
Site Type:	SCHOOL	Office:	SOUTHERN CALIFORNIA SCHOOLS & BROWNFIELDS OUTREACH
Address Description:	1401 HANSON LANE	Project Manager:	
City:	RAMONA	Special Program:	
County:	SAN DIEGO	Supervisor:	YOLANDA GARZA
Zip:	92065	Senate District:	40
Acres:	3 ACRES		
Public Participation Specialis:			
CalEnviroScreen Score:	25-30%		
National Priorities List:	NO		
Past Use that Caused Contam:	EDUCATIONAL SERVICES		
Permit Renewal Lead:			
Cleanup Oversight Agencies:	DTSC - SITE CLEANUP PROGRAM - LEAD AGENCY		
Cleanup Status:	NO ACTION REQUIRED AS OF 12/21/2005		
Potential Cont of Conc:	NO CONTAMINANTS FOUND		
Potential Media Affected:	NO MEDIA AFFECTED		
School District:	RAMONA UNIFIED SCHOOL DISTRICT		
Summary Link:	https://www.envirostor.dtsc.ca.gov/public/profile_report?global_id=60000007		

Completed Activities

Title: Inactive letter for Phase I, dated Dec. 2004.
Title Link:
Area Name:
Area Link:
Sub Area:
Sub Area Link:
Document Type: Inactive Status Letter
Date Completed: 5/5/2004
Comments:
Activity Type: Completed Activities

Title: Phase I Inactive Status Letter
Title Link:
Area Name:
Area Link:
Sub Area:
Sub Area Link:
Document Type: Inactive Status Letter
Date Completed: 12/6/2005
Comments:
Activity Type: Completed Activities

Title: Phase I Enviromental Assessment (Essentia), dated July 19, 2003 Revised 12/2005
Title Link: https://www.envirostor.dtsc.ca.gov/public/final_documents2?global_id=60000007&doc_id=6008895
Area Name:
Area Link:
Sub Area:
Sub Area Link:

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

Document Type: Phase 1
 Date Completed: 12/21/2005
 Comments: No Action
 Activity Type: Completed Activities

Search Results Details

Program Type: SCHOOL INVESTIGATION
 Site Code: 404466
 Status: NO ACTION REQUIRED
 Status Date: 12/21/2005
 Calenviroscreen Score: 25-30%
 Office: Southern California Schools & Brownfields Outreach
 Pm:
 Supervisor: * Yolanda Garza
 Branch Chief:
 Address Description: 1401 HANSON LANE
 Site Facility Name: RAMONA HIGH SCHOOL
 City: RAMONA
 County: SAN DIEGO
 Zip: 92065
 Latitude: 33.0257
 Longitude: -116.8687

Sites Details

Status:	No Action Required	Assembly:	75
Status Date:	12/21/2005	Division Branch:	Southern California Schools & Brownfields Outreach
Site Code:	404466	Funding:	School District
Site Type:	School Investigation	Lead Agency:	SMBRP
Site Type Detailed:	School	Project Manager:	
Special Program:		Supervisor:	* Yolanda Garza
City:	Ramona	Restricted Use:	NO
County:	SAN DIEGO	Senate:	40
Congress Dis:	48	Site Mgmt Req:	NONE SPECIFIED
State:	CA	Acres:	3
Latitude:	33.0257	Zip:	92065
Longitude:	-116.8687		
Address:	1401 Hanson Lane		
National Priorities List:	NO		
APN:	NONE SPECIFIED		
Confirmed Coc:	NONE SPECIFIED		
Past Uses:	* EDUCATIONAL SERVICES		
Potential Coc:	NONE SPECIFIED,31000		
Potential Media Affected:	NMA		
Project Name:	RAMONA HIGH SCHOOL		
Regulatory Agencies Involved:	SMBRP		

29	1 of1	WNW	0.95 / 5,019.93	1,392.53 / -25	RAMONA BOMBING TARGET/EMERGENY	FUDS
RAMONA CA						

FUDS Property No: J09CA1069
 EMS Map Link: https://fudsportal.usace.army.mil/ems/inventory/map?id=53621
 FUDS INST ID: CA99799F596400
 Status: Properties with projects
 SDS ID:
 NPL Status Code: Not Listed
 Eligibility: Eligible
 Site Eligib: Eligible
 Current Owner: Local Government
 Has Project: Yes
 DOD FUDS Pro:
 Project Required:

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB
No Further Action:						
Congressional District:		48				
Congressional Dist 117:		50				
Media ID:						
Metadata ID:						
Feature Desc:						
EPA Region:		09				
County:		SAN DIEGO				
Latitude:		33.03833333				
Longitude:		-116.9125				
Fiscal year:		2020				
USACE Division:		spd				
USACE District:		spl				
Centroid Lat:						
Centroid Long:						
Se Anno Cad Data:						
Shape Length:		0.0645062542620831				
Shape Area:		0.000159726320968836				
Shape Len:		.06450625				
X:						
Y:						
Data Source:		U.S. Army Corps of Engineers Geospatial Open Data				
Property History:						

By 1944, the Department of the Navy acquired 326.54 acres from private parties via a Declaration of Taking (or, condemnation). Reported improvements to the property included a small civilian-type hanger and a single runway (250 feet wide by 4,000 feet long). In December 1956, the field was conveyed to the County of San Diego and the name was changed to Ramona Airport. Today, there are over 200 aircraft based at this facility. As a general aviation airport, Ramona accommodates a high percentage of training facilities. The California Department of Forestry Service and the United States Forest Service have joint use of approximately 7 acres of airport land for fire suppression activities. They have maintained a continuous presence at the Ramona Airport for nearly 30 years and currently provide fire suppression services for southern California area.

Feature Description:

By 1944, the Department of the Navy acquired 326.54 acres from private parties via a Declaration of Taking (or, condemnation). Reported improvements to the property included a small civilian-type hanger and a single runway (250 feet wide by 4,000 feet long). In December 1956, the field was conveyed to the County of San Diego and the name was changed to Ramona Airport. Today, there are over 200 aircraft based at this facility. As a general aviation airport, Ramona accommodates a high percentage of training facilities. The California Department of Forestry Service and the United States Forest Service have joint use of approximately 7 acres of airport land for fire suppression activities. They have maintained a continuous presence at the Ramona Airport for nearly 30 years and currently provide fire suppression services for southern California area.

30	1 of 1	NE	0.97 / 5,135.25	1,439.03 / 21	COUNTY OF SAN DIEGO RAMONA PHHWCF 324 MAPLE ST RAMONA CA 92065	INSP COMP ENF
EPA ID:	CAH111000846			County:	SAN DIEGO	
Geotracker Address:				Geotracker Lat:		
Geotracker City:				Geotracker Long:		
Report URL:	https://www.envirostor.dtsc.ca.gov/public/eeerp_profile_report?global_id=3001911					

EnviroStor Site / Facility Export - Inspection Details

Inspection Type:	Focused Compliance Inspection - Mercury Thermostat	Return to Complnc:	6/14/2023
Violations:	Minor	City:	RAMONA
Inspection Date:	6/14/2023	County:	SAN DIEGO
Report Sent Date:	6/14/2023	Zip:	92065
Address:	324 MAPLE ST		
Project Name:	COUNTY OF SAN DIEGO RAMONA PHHWCF		

Inspection, Compliance and Enforcement Download - Site Details

Envirostor ID:	3001911	Status:	No Action
Site Type:	INSPECTION		

Map Key	Number of Records	Direction	Distance (mi/ft)	Elev/Diff (ft)	Site	DB

EnviroStor Site / Facility Search - Inspection Information (As of Dec 19, 2025)

Violations:	Minor
Inspection Type:	Focused Compliance Inspection - Mercury Thermostat
Inspection Date:	6/14/2023
Report Sent Date:	6/14/2023
Return To Compliance Date:	6/14/2023

Unplottable Summary

Total: 7 Unplottable sites

DB	Company Name/Site Name	Address	City	Zip	ERIS ID
FINDS/FRS	HAZARD CONSTRUCTION COMPANY	12211 HWY 67 <i>Registry ID: 110071387767</i>	RAMONA CA	92065	920737923
HAZ GEN	HAZARD CONSTRUCTION COMPANY	12211 HWY 67	RAMONA CA	92065	925165894
HAZNET	CALTRANS D-11/EA11-261204	RTE 67 PM 18.5-24.0	RAMONA CA	92065	826405832
LOP SANDIEGO	SOUTHWEST MARINE	0 MAIN ST, SAN DIEGO, CA 92113-3640 <i>Record ID Record Status: DEH1991-LSAM-H22821-001 Completed</i>	SAN DIEGO CA		858653105
RCRA NON GEN	HAZARD CONSTRUCTION COMPANY	12211 HWY 67 <i>Handler ID Recycler Activity?: CAC003207627 NO</i>	RAMONA CA	92065	917309391
SAM SANDIEGO	SOUTHWEST MARINE	0 MAIN ST	SAN DIEGO CA	92113-3640	820132918
SAM SANDIEGO	BOULDER OAKS	0 HIGHWAY 67	RAMONA CA	92065	820134753

Unplottable Report

Site: HAZARD CONSTRUCTION COMPANY
12211 HWY 67 RAMONA CA 92065

FINDS/FRS

Registry ID: 110071387767
FIPS Code: 06073
HUC Code:
Site Type Name: STATIONARY
Location Description:
Supplemental Location:
Create Date: 03-MAR-23
Update Date:
Interest Types: UNSPECIFIED UNIVERSE
SIC Codes:
SIC Code Descriptions:
NAICS Codes: 237310
NAICS Code Descriptions: HIGHWAY, STREET, AND BRIDGE CONSTRUCTION.
Conveyor:
Federal Facility Code:
Federal Agency Name:
Tribal Land Code:
Tribal Land Name:
Congressional Dist No:
Census Block Code:
EPA Region Code: 09
County Name: SAN DIEGO
US/Mexico Border Ind:
Latitude:
Longitude:
Reference Point:
Coord Collection Method:
Accuracy Value:
Datum: NAD83
Source:
Frs Facility Detail Report URL: https://ofmpub.epa.gov/frs_public2/fii_query_detail.disp_program_facility?p_registry_id=110071387767
Program Acronyms:

RCRAINFO:CAC003207627

Site: HAZARD CONSTRUCTION COMPANY
12211 HWY 67 RAMONA CA 92065

HAZ GEN

EPA ID: CAC003207627
Address 2:
Details DTSC HWTS:
Handler Profile URL: <https://hwts.dtsc.ca.gov/facility/CAC003207627>
Facility County: SAN DIEGO
County:

Tanner Details

Waste Category Code: 343
Waste Category: Unspecified organic liquid mixture
Yearly Totals:

2022: 0.0068

Waste Category Code: 352
Waste Category: Other organic solids
Yearly Totals:

2022: 0.35

Waste Category Code: 491
Waste Category: Unspecified sludge waste
Yearly Totals:

2022: 0.0417

Contact Details

Contact Name: DAVID M PRESCOTT
Mailing Street: 10529 VINE STREET
Mailing City: 10529 VINE STREET
Mailing Zip: 92040
Contact Phone: 8588646607
Year: 2022

Site: CALTRANS D-11/EA11-261204
RTE 67 PM 18.5-24.0 RAMONA CA 92065

HAZNET

EPA ID:	CAC002642524	Mailing City:	SAN DIEGO
NAICS Code:		Mailing State:	CA
SIC Code:		Mailing Zip:	92110
Create Date:	5/21/2009	Region Code:	4
Fac Act Ind:	No	Owner Name:	CALTRANS
Inact Date:	11/18/2009	Owner Addr 1:	1120 N ST
County:	37	Owner Addr 2:	
County Name:	San Diego	Owner City:	SACRAMENTO
County:		Owner State:	CA
Mail Name:		Owner Zip:	95814
Mailing Addr 1:	4050 TAYLOR ST	Owner Phone:	0000000000
Mailing Addr 2:	MS 310	Owner Fax:	

Site: SOUTHWEST MARINE
0 MAIN ST, SAN DIEGO, CA 92113-3640 SAN DIEGO CA

LOP SANDIEGO

SWRCB Global ID:	T0607300692	Parcel No:	538-790-12-00
Record ID:	DEH1991-LSAM-H22821-001	Census Tract:	50.00
Record Status:	Completed	Zip Code 2:	92113
Opened Date:	1/31/1991	Community:	San Diego
Case Type:	LOP - Local Oversight Program	Jurisdiction:	SAN DIEGO
Historical Name:	SOUTHWEST MARINE	Watershed Basin No:	908.22
Lead Agency:	DEH/SAM	Latitude GS 84:	32.6947277
Lead Agency Date:	2/8/1991	Longitude GS 84:	-117.1409895
Funding:	F - LOP Federal Fund	X Map Coord:	6287547.434
Fire Agency:	SAN DIEGO	Y Map Coord:	1833725.747
Water Purveyor:	SAN DIEGO		
File Case Type:	CLOSED OR TRANSFERRED LOP CASES		

Site: HAZARD CONSTRUCTION COMPANY
12211 HWY 67 RAMONA CA 92065

RCRA NON GEN

Handler ID: CAC003207627
Generator Status: N
Recycler Activity?: NO
Recycler Activity Note: This facility has not been identified as a Recycler Facility from both the RCRA Handler and Biennial Report Modules.

Violation/Evaluation Summary

Note: NO RECORDS: As of Nov 2025, there are no Compliance Monitoring and Enforcement (violation) records associated with this facility (EPA ID).

Handler Summary

Importer:	No	Used Oil Transpor:	No
Mixed Waste Gen:	No	Used Oil Trans Fac:	No
Transporter:	No	Used Oil Processor:	No
Transfer Facility:	No	Used Oil Refiner:	No
Recycler:	No	Used Oil Burner:	No
Onsite Burner Exem:	No	Commercial TSD:	No
Furnace Exemption:	No	Recycl Nonstorage:	No
Underground Injec:	No		
Used Oil Market Burner:	No		
Used Oil Spec Marketer:	No		

Additional Handler Summary Details

Source Type:	I	NAIC 1:	237310
Seq No:	1	NAIC 2:	
Non Notifier:		NAIC 3:	
Receive Date:	20221208	NAIC 4:	
Active Site:	----	State:	CA
Land Type:		Location Latitude:	
In Handler Univ:	N	Location Longitude:	
In A Universe:	N	Loc GIS Primary:	N
Gen Status:	N	Loc GIS Origin:	
Report Cycle:		State District Owner:	
Accessibility:		State District:	
Region:	09		
Fed Waste Gen Owner:	HQ		
State Waste Generator Owner:	CA		
State Waste Generator:	2		
Short Term Generator:	N		
Uni Waste:	N		
Universal Waste Dest Facility:	N		
Federal Universal Waste:	N		
As Federally Regulated Tsdf:	-----		
As Converter Tsdf:	-----		
As State Regulated Tsdf:	-----		
As State Regulated Handler:	---		
Federal Indicator:	---		
Hsm:	N		
Subpart K:	----		
GPRA Permit:	N		
GPRA Renewal:	N		
Permit Renewal Wrkld:	-----		
Permwrk ID:	-----		
Perm Prog:	-----		
Pcwrkld:	-----		
Closwrkld:	-----		
GPRA Ca:	N		
Cawrkld:	N		
Subjca Tsd Discretion:	N		
NCAPS:	N		
EC Indicator:	N		
Ca725 Indicator:	N		
Ca750 Indicator:	N		
Operating Tsdf:	-----		
Full Enforcement:	-----		
Snc:	N		
Unaddressed Snc:	N		
Addressed Snc:	N		
Snc With Comp Sched:	N		
Fa Required:	----		
Hhandler Last Change:	20221213		
Recognized Trader Importer:	N		
Recognized Trader Exporter:	N		
Slab Importer:	N		
Slab Exporter:	N		
Manifest Broker:	N		
Subpart P:	N		

Contact Language: EN
Handler Name: HAZARD CONSTRUCTION COMPANY
Location Street No:
Location Street1: 12211 HWY 67
Location Street2:
Location City: RAMONA
Location State: CA
Location Zip: 92065
Location County Code: CA073
Location County Name: SAN DIEGO
Location Country: US
Contact Name: DAVID M PRESCOTT
Contact Street No:
Contact Street1: 10529 VINE STREET
Contact Street2:
Contact City: LAKESIDE
Contact State: CA
Contact Zip: 92040
Contact Country:
Contact Phone & Ext: 858-864-6607
Contact Fax:
Contact Email Address: DPRESGOTT@HAZARDCON.COM
Contact Title:
Owner Name: DAVID M PRESCOTT
Owner Type: O
Owner Seq: 1
Operator Name: DAVID M PRESCOTT
Operator Type: O
Operator Seq: 2
Public Notes:

Contact DTSC for information.

Hazardous Waste Handler Details

Seq No: 1
Receive Date: 20221208
Handler Name: HAZARD CONSTRUCTION COMPANY
Fed Waste Generator: N
Generator Code Description: Not a Generator, Verified
Source Type: Implementer
TSD Activity: N

Owner/Operator Details

Owner/Operator Ind: Current Owner
Type: Other
Name: DAVID M PRESCOTT
Dt Became Current:
Dt Ended Current:
Phone: 858-864-6607
Source Type: Implementer

Street No:
Street1: 10529 VINE STREET
Street2:
City: LAKESIDE
State: CA
Country:
Zip: 92040

Owner/Operator Ind: Current Operator
Type: Other
Name: DAVID M PRESCOTT
Dt Became Current:
Dt Ended Current:
Phone: 858-864-6607
Source Type: Implementer

Street No:
Street1: 10529 VINE STREET
Street2:
City: LAKESIDE
State: CA
Country:
Zip: 92040

Site: SOUTHWEST MARINE
0 MAIN ST SAN DIEGO CA 92113-3640

SAM SANDIEGO

Record ID: DEH1991-LSAM-H22821-001
Record ID (Map): DEH1991-LSAM-H22821-001
Record Type (Map): LUEG-DEH/LWQD/SAM Investigation/NA
ID: 2471

Agency Name: COSD
Lead Agency: DEH/SAM
Lead Agcy Date: 2/7/1991, 7:00 PM
Object ID: 2469

ThomasBros Map Gd: 1289 D 6
Jurisdiction: SAN DIEGO
Census Tract: 50.00
Watershed Basin: 908.22
GT Global ID: T0607300692
GT RB Case No: 9UT1912
GT Status Date: 11/2/1998, 7:00 PM
GT Case Type: LUST Cleanup Site
GT CUF Case: NO
GT County: San Diego
GT Latitude: 32.69447845
GT Longitude: -117.14081563
Latitude GS84: 32.6947277
Longitude GS84: -117.1409895
Point X: -117.14138869823951
Point Y: 32.6950334789905
X: 6287547.434
Y: 1833725.747
BOS District: 1
Lead Agc Dt: 1991-02-08 00:00:00 UTC
Edited Dt:

Project Name: SOUTHWEST MARINE
Address: 0 MAIN ST, SAN DIEGO CA 921133640
Street String: 0 MAIN ST
City: SAN DIEGO
Record Name (Map): SOUTHWEST MARINE
Address (Map): 0 MAIN ST, SAN DIEGO, CA 92113-3640
GT Lead Agency: SAN DIEGO COUNTY LOP
GT Status: Completed - Case Closed
DEH Permit Owner:
Water Purveyor: SAN DIEGO
Case Type: LOP - Local Oversight Program
Geo SRC: Mapped to XY from previous SAM Layer
Historical Name: SOUTHWEST MARINE
Fire Agency: SAN DIEGO
Funding: F - LOP Federal Fund
Short Notes:
Source File:

SWRCB Global ID: T0607300692
Feature ID: 5387901200
Parcel No: 538-790-12-00
Case No: H22821-001
H No: H22821
KIVA per Tp per No: 6SAM H22821
Status: Completed
Record Status: Completed
Record Type: SAM Investigation
Record Alias: SAM Investigation
Date: 01/31/1991
Per Type: LWQD
Primary Parcel: Yes
Primary Address: Yes
Address Type: ALIAS
Community: San Diego
Zip Code: 92113-3640
Zip Community: 92113
Gt Stat Dt: 1998-11-03 00:00:00 UTC
Opened Dt: 1991-01-31 00:00:00 UTC

Site: **BOULDER OAKS**
0 HIGHWAY 67 RAMONA CA 92065

SAM SANDIEGO

Record ID: DEH2003-LSAM-TS-2003-03
Record ID (Map): DEH2003-LSAM-TS-2003-03
Record Type (Map): LUEG-DEH/LWQD/SAM Investigation/NA
ID: 5465
ThomasBros Map Gd: 1191 H 1
Jurisdiction: UNINCORPORATED
Census Tract: 208.01
Watershed Basin: 907.21
GT Global ID:
GT RB Case No:
GT Status Date:
GT Case Type:
GT CUF Case:
GT County:
GT Latitude:
GT Longitude:
Latitude GS84: 32.9797904
Longitude GS84: -116.9382677
Point X: -116.93827005059902
Point Y: 32.98000743823761
X: 6350599.655
Y: 1937049.292
BOS District: 2
Lead Agc Dt: 2003-03-13 00:00:00 UTC
Edited Dt:
Project Name: BOULDER OAKS

Agency Name: COSD
Lead Agency: DEH/SAM
Lead Agcy Date: 3/12/2003, 7:00 PM
Object ID: 5461
SWRCB Global ID:
Feature ID: 3220310100
Parcel No: 322-031-01-00
Case No:
H No: TS-2003-03
KIVA per Tp per No: 6SAM TS-2003-03
Status: Completed
Record Status: Completed
Record Type: SAM Investigation
Record Alias: SAM Investigation
Date: 03/13/2003
Per Type: LWQD
Primary Parcel: Yes
Primary Address: Yes
Address Type: ALIAS
Community: Ramona
Zip Code: 92065
Zip Community: 92065
Gt Stat Dt:
Opened Dt: 2003-03-13 00:00:00 UTC

Address: 0 HIGHWAY 67, RAMONA CA 92065
Street String: 0 HIGHWAY 67
City: RAMONA
Record Name (Map): BOULDER OAKS
Address (Map): 0 HIGHWAY 67, RAMONA, CA 92065
GT Lead Agency:
GT Status:
DEH Permit Owner:
Water Purveyor: UNINCORPORATED
Case Type: TSP - Transaction Screening Program
Geo SRC: Mapped to parcel centroid using AA XY
Historical Name: BOULDER OAKS
Fire Agency: UNINCORPORATED
Funding: C - County Site
Short Notes:
Source File: Citizen Access DEH Site Assessment and Mitigation Investigation Sites (as of 26 Oct 2025); San Diego Site Assessment and Mitigation Investigation Sites (Map) (as of 1 Nov 2016)

Appendix: Database Descriptions

Environmental Risk Information Services (ERIS) can search the following databases. The extent of historical information varies with each database and current information is determined by what is publicly available to ERIS at the time of update. ERIS updates databases as set out in ASTM Standard E1527-13 and E1527-21, Section 8.1.8 Sources of Standard Source Information:

"Government information from nongovernmental sources may be considered current if the source updates the information at least every 90 days, or, for information that is updated less frequently than quarterly by the government agency, within 90 days of the date the government agency makes the information available to the public."

Standard Environmental Record Sources

Federal

National Priority List:

NPL

The U.S. Environmental Protection Agency (EPA)'s National Priorities List (NPL) includes the most serious uncontrolled or abandoned hazardous waste sites identified for possible long-term remedial action under the Superfund program, based primarily on the score a site receives from EPA's Hazard Ranking System. A site must be on the NPL to receive money from the Superfund Trust Fund for remedial action. This data includes NPL sites represented as polygons, where available, that can be sourced from the EPA NPL Superfund Site Boundaries dataset, refreshed by the Shared Enterprise Geodata and Services (SEGS), and is limited to those sites where the NPL Status reflects the site is 'Currently on the Final NPL (F)' and/or the 'Site is Part of NPL Site (A)'. These site boundaries represent the footprint of a whole site, the sum of all the Operable Units (OUs) and the current understanding of the full extent of contamination; for Federal Facility sites, the total site polygon may be the Facility boundary. As site investigation and remediation progress, OUs may be added, modified or refined. Data provided by external parties is not independently verified by EPA. This boundary data is made available to the public strictly for informational purposes. Where there is no polygon boundary data available for a given site, the site is represented as a point.

Government Publication Date: Jan 18, 2026

National Priority List - Proposed:

PROPOSED NPL

Sites proposed by the U.S. Environmental Protection Agency (EPA), the state agency, or concerned citizens for addition to the National Priorities List (NPL) due to contamination by hazardous waste and identified by the EPA as a candidate for cleanup because it poses a risk to human health and/or the environment. Sites represented as polygons, where available, can be sourced from the EPA NPL Superfund Site Boundaries dataset, refreshed by the Shared Enterprise Geodata and Services (SEGS). These site boundaries represent the footprint of a whole site, the sum of all the Operable Units (OUs) and the current understanding of the full extent of contamination; for Federal Facility sites, the total site polygon may be the Facility boundary. Data provided by external parties is not independently verified by EPA. This boundary data is made available to the public strictly for informational purposes. Where there is no polygon boundary data available for a given site, the site is represented as a point.

Government Publication Date: Jan 18, 2026

Deleted NPL:

DELETED NPL

Sites deleted from the U.S. Environmental Protection Agency (EPA)'s National Priorities List (NPL). The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425(e), sites may be deleted from the NPL where no further response is appropriate. Sites represented as polygons, where available, can be sourced from the EPA NPL Superfund Site Boundaries dataset, refreshed by the Shared Enterprise Geodata and Services (SEGS). These site boundaries represent the footprint of a whole site, the sum of all the Operable Units (OUs) and the current understanding of the full extent of contamination; for Federal Facility sites, the total site polygon may be the Facility boundary. Data provided by external parties is not independently verified by EPA. This boundary data is made available to the public strictly for informational purposes. Where there is no polygon boundary data available for a given site, the site is represented as a point.

Government Publication Date: Jan 18, 2026

SEMS List 8R Active Site Inventory:

SEMS

The U.S. Environmental Protection Agency's (EPA) Superfund Program has deployed the Superfund Enterprise Management System (SEMS), which integrates multiple legacy systems into a comprehensive tracking and reporting tool. This inventory contains active sites evaluated by the Superfund program that are either proposed to be or are on the National Priorities List (NPL) as well as sites that are in the screening and assessment phase for possible inclusion on the NPL. The Active Site Inventory Report displays site and location information at active SEMS sites. An active site is one at which site assessment, removal, remedial, enforcement, cost recovery, or oversight activities are being planned or conducted. This data includes SEMS sites from the List 8R Active file as well as applicable sites from the EPA's Facility Registry Service map tool. This data may also include applicable sites represented as polygons sourced from the EPA NPL Superfund Site Boundaries dataset, refreshed by the Shared Enterprise Geodata and Services (SEGS), and is limited to those sites where the NPL Status reflects the site is 'Not on the NPL (N)', 'Removed from Proposed (R)', and/or 'Pre-Proposal Site (S)'. Data provided by external parties is not independently verified by EPA. This boundary data is made available to the public strictly for informational purposes. Where there is no polygon boundary data available for a given site, the site is represented as a point.

Government Publication Date: Aug 27, 2025**Inventory of Open Dumps, June 1985:**

ODI

The Resource Conservation and Recovery Act (RCRA) provides for publication of an inventory of open dumps. The Act defines "open dumps" as facilities which do not comply with EPA's "Criteria for Classification of Solid Waste Disposal Facilities and Practices" (40 CFR 257).

Government Publication Date: Jun 1985**SEMS List 8R Archive Sites:**

SEMS ARCHIVE

The U.S. Environmental Protection Agency's (EPA) Superfund Enterprise Management System (SEMS) Archived Site Inventory displays site and location information at sites archived from SEMS. An archived site is one at which EPA has determined that assessment has been completed and no further remedial action is planned under the Superfund program at this time. This data includes sites from the List 8R Archived site file. This data may also include applicable sites represented as polygons sourced from the EPA NPL Superfund Site Boundaries dataset, refreshed by the Shared Enterprise Geodata and Services (SEGS), and is limited to those sites where the NPL Status reflects the site is 'Not on the NPL (N)', 'Removed from Proposed (R)', and/or 'Pre-Proposal Site (S)'. Data provided by external parties is not independently verified by EPA. This boundary data is made available to the public strictly for informational purposes. Where there is no polygon boundary data available for a given site, the site is represented as a point.

Government Publication Date: Aug 27, 2025**Comprehensive Environmental Response, Compensation and Liability Information System -**

CERCLIS

CERCLIS:

Superfund is a program administered by the United States Environmental Protection Agency (EPA) to locate, investigate, and clean up the worst hazardous waste sites throughout the United States. CERCLIS is a database of potential and confirmed hazardous waste sites at which the EPA Superfund program has some involvement. It contains sites that are either proposed to be or are on the National Priorities List (NPL) as well as sites that are in the screening and assessment phase for possible inclusion on the NPL. The EPA administers the Superfund program in cooperation with individual states and tribal governments; this database is made available by the EPA.

Government Publication Date: Oct 25, 2013**EPA Report on the Status of Open Dumps on Indian Lands:**

IODI

Public Law 103-399, The Indian Lands Open Dump Cleanup Act of 1994, enacted October 22, 1994, identified congressional concerns that solid waste open dump sites located on American Indian or Alaska Native (AI/AN) lands threaten the health and safety of residents of those lands and contiguous areas. The purpose of the Act is to identify the location of open dumps on Indian lands, assess the relative health and environment hazards posed by those sites, and provide financial and technical assistance to Indian tribal governments to close such dumps in compliance with Federal standards and regulations or standards promulgated by Indian Tribal governments or Alaska Native entities.

Government Publication Date: Dec 31, 1998**CERCLIS - No Further Remedial Action Planned:**

CERCLIS NFRAP

An archived site is one at which EPA has determined that assessment has been completed and no further remedial action is planned under the Superfund program at this time. The Archive designation means that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list this site on the National Priorities List (NPL). This decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be a potential NPL site.

Government Publication Date: Oct 25, 2013**CERCLIS Liens:**

CERCLIS LIENS

A Federal Superfund lien exists at any property where EPA has incurred Superfund costs to address contamination ("Superfund site") and has provided notice of liability to the property owner. A Federal CERCLA ("Superfund") lien can exist by operation of law at any site or property at which EPA has spent Superfund monies. This database is made available by the United States Environmental Protection Agency (EPA). This database was provided by the United States Environmental Protection Agency (EPA). Refer to SEMS LIEN as the current data source for Superfund Liens.

Government Publication Date: Jan 30, 2014

RCRA CORRACTS-Corrective Action:[RCRA CORRACTS](#)

RCRA Info is the U.S. Environmental Protection Agency's (EPA) comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. At these sites, the Corrective Action Program ensures that cleanups occur. EPA and state regulators work with facilities and communities to design remedies based on the contamination, geology, and anticipated use unique to each site.

Government Publication Date: Nov 30, 2025

RCRA non-CORRACTS TSD Facilities:[RCRA TSD](#)

RCRA Info is the U.S. Environmental Protection Agency's (EPA) comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. This database includes Non-Corrective Action sites that have indicated engagement in the treatment, storage, or disposal of hazardous waste which requires a RCRA hazardous waste permit.

Government Publication Date: Nov 30, 2025

RCRA Generator List:[RCRA LQG](#)

RCRA Info is the U.S. Environmental Protection Agency's (EPA) comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. RCRA Info replaces the data recording and reporting abilities of the Resource Conservation and Recovery Information System (RCRIS) and the Biennial Reporting System (BRS). A hazardous waste generator is any person or site whose processes and actions create hazardous waste (see 40 CFR 260.10). Large Quantity Generators (LQGs) generate 1,000 kilograms per month or more of hazardous waste or more than one kilogram per month of acutely hazardous waste. This list also includes RCRAInfo sites that have notified as LQGs that do not have a registered Site Manager or Certifier in RCRAInfo.

Government Publication Date: Nov 30, 2025

RCRA Small Quantity Generators List:[RCRA SQG](#)

RCRA Info is the U.S. Environmental Protection Agency's (EPA) comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. RCRA Info replaces the data recording and reporting abilities of the Resource Conservation and Recovery Information System (RCRIS) and the Biennial Reporting System (BRS). A hazardous waste generator is any person or site whose processes and actions create hazardous waste (see 40 CFR 260.10). Small Quantity Generators (SQGs) generate more than 100 kilograms, but less than 1,000 kilograms, of hazardous waste per month. This list also includes RCRAInfo sites that have notified as SQGs that do not have a registered Site Manager or Certifier in RCRAInfo.

Government Publication Date: Nov 30, 2025

RCRA Very Small Quantity Generators List:[RCRA VSQG](#)

RCRA Info is the U.S. Environmental Protection Agency's (EPA) comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. A hazardous waste generator is any person or site whose processes and actions create hazardous waste (see 40 CFR 260.10). Very Small Quantity Generators (VSQG) generate 100 kilograms or less per month of hazardous waste, or one kilogram or less per month of acutely hazardous waste. Additionally, VSQG may not accumulate more than 1,000 kilograms of hazardous waste at any time.

Government Publication Date: Nov 30, 2025

RCRA Non-Generators:[RCRA NON GEN](#)

RCRA Info is the U.S. Environmental Protection Agency's (EPA) comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. RCRA Info replaces the data recording and reporting abilities of the Resource Conservation and Recovery Information System (RCRIS) and the Biennial Reporting System (BRS). A hazardous waste generator is any person or site whose processes and actions create hazardous waste (see 40 CFR 260.10). Non-Generators do not presently generate hazardous waste.

Government Publication Date: Nov 30, 2025

RCRA Sites with Controls:[RCRA CONTROLS](#)

List of Resource Conservation and Recovery Act (RCRA) facilities with institutional controls in place. RCRA gives the U.S. Environmental Protection Agency (EPA) the authority to control hazardous waste from the "cradle-to-grave." This includes the generation, transportation, treatment, storage, and disposal of hazardous waste. RCRA also set forth a framework for the management of non-hazardous solid wastes. The 1986 amendments to RCRA enabled EPA to address environmental problems that could result from underground tanks storing petroleum and other hazardous substances.

Government Publication Date: Nov 30, 2025

Federal Engineering Controls-ECs:

FED ENG

List of Engineering controls (ECs) made available by the United States Environmental Protection Agency (EPA). ECs encompass a variety of engineered and constructed physical barriers (e.g., soil capping, sub-surface venting systems, mitigation barriers, fences) to contain and/or prevent exposure to contamination on a property. The EC listing includes remedy component data from Superfund decision documents for applicable sites on the final or deleted on the National Priorities List (NPL); and sites with a Superfund Alternative Approach (SAA) Agreement in place. The only sites included that are not on the NPL; proposed for NPL; or removed from proposed NPL, are those with an SAA Agreement in place.

Government Publication Date: Jan 30, 2026

Federal Institutional Controls- ICs:

FED INST

List of Institutional controls (ICs) made available by the United States Environmental Protection Agency (EPA). ICs are non-engineered instruments, such as administrative and legal controls, that help minimize the potential for human exposure to contamination and/or protect the integrity of the remedy. Although it is EPA's expectation that treatment or engineering controls will be used to address principal threat wastes and that groundwater will be returned to its beneficial use whenever practicable, ICs play an important role in site remedies because they reduce exposure to contamination by limiting land or resource use and guide human behavior at a site. The IC listing includes remedy component data from Superfund decision documents for applicable sites on the final or deleted on the National Priorities List (NPL); and sites with a Superfund Alternative Approach (SAA) Agreement in place. The only sites included that are not on the NPL; proposed for NPL; or removed from proposed NPL, are those with an SAA Agreement in place.

Government Publication Date: Jan 30, 2026

Land Use Controls Information System:

LUCIS

The Land Use Controls Information System (LUCIS) database is sourced from the U.S. Department of the Navy (DON). This data contains information for former Base Realignment and Closure (BRAC) properties across the United States. DON's BRAC office was tasked with tracking certain base closures while requiring the prevention of risks to human health and the environment of those properties with LUCs in place. Regarding currently available LUC Sites data, the sites listing is limited to centroid point locations for the overall installation property boundaries. Formerly obtained LUC Sites data may reflect site details that applied previously for a BRAC property.

Government Publication Date: Jun 13, 2024

Institutional Control Boundaries at NPL sites:

NPL IC

These boundaries of Institutional Control areas at sites on the U.S. Environmental Protection Agency's (EPA) National Priorities List (NPL), or as Proposed or Deleted, are sourced from the EPA NPL Superfund Site Boundaries dataset, refreshed by the Shared Enterprise Geodata and Services (SEGS). The EPA's NPL includes the most serious uncontrolled or abandoned hazardous waste sites identified for possible long-term remedial action under the Superfund program. Institutional controls are non-engineered instruments such as administrative and legal controls that help minimize the potential for human exposure to contamination and/or protect the integrity of the remedy. Data provided by external parties is not independently verified by EPA. This boundary data is made available to the public strictly for informational purposes.

Government Publication Date: Jan 18, 2026

Emergency Response Notification System:

ERNS 1982 TO 1986

Database of oil and hazardous substances spill reports controlled by the National Response Center. The primary function of the National Response Center is to serve as the sole national point of contact for reporting oil, chemical, radiological, biological, and etiological discharges into the environment anywhere in the United States and its territories.

Government Publication Date: 1982-1986

Emergency Response Notification System:

ERNS 1987 TO 1989

Database of oil and hazardous substances spill reports controlled by the National Response Center. The primary function of the National Response Center is to serve as the sole national point of contact for reporting oil, chemical, radiological, biological, and etiological discharges into the environment anywhere in the United States and its territories.

Government Publication Date: 1987-1989

Emergency Response Notification System:

ERNS

Database of oil and hazardous substances spill reports made available by the United States Coast Guard National Response Center (NRC). The NRC fields initial reports for pollution and railroad incidents and forwards that information to appropriate federal/state agencies for response. These data contain initial incident data that has not been validated or investigated by a federal/state response agency.

Government Publication Date: Nov 30, 2025

The Assessment, Cleanup and Redevelopment Exchange System (ACRES) Brownfield Database:

FED BROWNFIELDS

Brownfields are real property, the expansion, redevelopment, or reuse of which may be complicated by the presence or potential presence of a hazardous substance, pollutant, or contaminant. Cleaning up and reinvesting in these properties protects the environment, reduces blight, and takes development pressures off greenspaces and working lands. This data is provided by the United States Environmental Protection Agency (EPA) and includes Brownfield sites from the Cleanups in My Community (CIMC) web application.

Government Publication Date: Sep 8, 2025

FEMA Underground Storage Tank Listing:

FEMA UST

The Federal Emergency Management Agency (FEMA) of the Department of Homeland Security maintains a list of FEMA owned underground storage tanks.

Government Publication Date: Dec 31, 2017

Facility Response Plan:

FRP

This listing contains facilities that have submitted Facility Response Plans (FRPs) to the U.S. Environmental Protection Agency (EPA). Facilities that could reasonably be expected to cause "substantial harm" to the environment by discharging oil into or on navigable waters are required to prepare and submit FRPs. Harm is determined based on total oil storage capacity, secondary containment and age of tanks, oil transfer activities, history of discharges, proximity to a public drinking water intake or sensitive environments. The list includes FRP facilities sourced from the EPA FOIA office and from previously available Homeland Infrastructure Foundation-Level Data (HIFLD) file/s. Disclaimer: Per the EPA FOIA Office, the verification process for current requested FRP data is undergoing review and revision, and any similar reporting will be made public in Fiscal Year 2026. For this reason, the latest available FOIA file may be incomplete.

Government Publication Date: Jun 1, 2025

Delisted Facility Response Plans:

DELISTED FRP

Facilities that once appeared in - and have since been removed from - the list of facilities that have submitted Facility Response Plans (FRP) to EPA. Facilities that could reasonably be expected to cause "substantial harm" to the environment by discharging oil into or on navigable waters are required to prepare and submit Facility Response Plans (FRPs). Harm is determined based on total oil storage capacity, secondary containment and age of tanks, oil transfer activities, history of discharges, proximity to a public drinking water intake or sensitive environments.

Government Publication Date: Jun 1, 2025

Historical Gas Stations:

HIST GAS STATIONS

This historic directory of service stations is provided by the Cities Service Company. The directory includes Cities Service filling stations that were located throughout the United States in 1930.

Government Publication Date: Jul 1, 1930

Petroleum Refineries:

REFN

This list of petroleum refineries is sourced from the U.S. Energy Information Administration (EIA), Refinery Capacity Report. The listing includes operating and idle petroleum refineries (including new refineries under construction) and refineries shut down during the previous year. The geographic area the report covers is the 50 States, the District of Columbia, Puerto Rico, the U.S. Virgin Islands, Guam, and other U.S. possessions. Per the EIA, the facility location data represents the approximate location based on research of publicly available information from sources such as Federal agencies, company websites, and satellite images on public websites.

Government Publication Date: Oct 31, 2024

Petroleum Product and Crude Oil Rail Terminals:

BULK TERMINAL

A list of petroleum product and crude oil rail terminals from the U.S. Energy Information Administration (EIA), as well as petroleum terminals sourced from Oak Ridge National Laboratory hosted by the Homeland Infrastructure Foundation-Level Database. Data includes operable bulk petroleum product terminals with a total bulk shell storage capacity of 50,000 barrels or more, and/or the ability to receive volumes from tanker, barge, or pipeline; also rail terminals handling the loading and unloading of crude oil with activity between 2017 and 2018. EIA petroleum product terminal data comes from the EIA-815 Bulk Terminal and Blender Report, which includes working, shell in operation, and shell idle for several major product groupings.

Government Publication Date: Jun 5, 2025

LIEN on Property:

SEMS LIEN

The U.S. Environmental Protection Agency's (EPA) Superfund Enterprise Management System (SEMS) provides Lien details on applicable properties, such as the Superfund lien on property activity, the lien property information, and the parties associated with the lien.

Government Publication Date: Aug 27, 2025

Superfund Decision Documents:

SUPERFUND ROD

This database contains a list of decision documents for Superfund sites. Decision documents serve to provide the reasoning for the choice of (or) changes to a Superfund Site cleanup plan. The decision documents include completed Records of Decision (ROD), ROD Amendments, Explanations of Significant Differences (ESD) for active and archived sites stored in the Superfund Enterprise Management System (SEMS), along with other associated memos and files. This information is maintained and made available by the U.S. Environmental Protection Agency.

Government Publication Date: Jan 30, 2026

State

State Response Sites:

RESPONSE

A list of identified confirmed release sites where the Department of Toxic Substances Control (DTSC) is involved in remediation, either in a lead or oversight capacity. These confirmed release sites are generally high-priority and high potential risk. This database serves a purpose similar to that of the federal NPL, functioning as a state-level counterpart for prioritizing cleanup efforts at hazardous substance release sites.

Government Publication Date: Oct 2, 2025

EnviroStor Database:

ENVIROSTOR

The EnviroStor Data Management System is made available by the Department of Toxic Substances Control (DTSC). Includes Corrective Action sites, Tiered Permit sites, Historical Sites and Evaluation/Investigation sites. This database serves a purpose similar to that of the federal Superfund Enterprise Management System (SEMS), functioning as a state-level counterpart for tracking potential hazardous substance release sites.

Government Publication Date: Oct 2, 2025

Delisted State Response Sites:

DELISTED ENVS

Sites removed from the list of State Response Sites made available by the EnviroStor Data Management System, Department of Toxic Substances Control (DTSC).

Government Publication Date: Oct 2, 2025

Solid Waste Information System (SWIS):

SWF/LF

The Solid Waste Information System (SWIS) database made available by the Department of Resources Recycling and Recovery (CalRecycle) contains information on solid waste facilities, operations, and disposal sites throughout the State of California. The types of facilities found in this database include landfills, transfer stations, material recovery facilities, composting sites, transformation facilities, waste tire sites, and closed disposal sites.

Government Publication Date: Feb 20, 2026

Solid Waste Disposal Sites with Waste Constituents Above Hazardous Waste Levels:

SWRCB SWF

This is a list of solid waste disposal sites identified by California State Water Resources Control Board with waste constituents above hazardous waste levels outside the waste management unit.

Government Publication Date: Sep 20, 2006

Waste Management Unit Database:

WMUD

The Waste Management Unit Database System tracks and inventories waste management units. CCR Title 27 contains criteria stating that Waste Management Units are classified according to their ability to contain wastes. Containment shall be determined by geology, hydrology, topography, climatology, and other factors relating to the ability of the Unit to protect water quality. Water Code Section 13273.1 requires that operators submit a water quality solid waste assessment test (SWAT) report to address leak status. The WMUDS was last updated by the State Water Resources control board in 2000.

Government Publication Date: Jan 1, 2000

EnviroStor Hazardous Waste Facilities:

HWP

A list of hazardous waste facilities including permitted, post-closure and historical facilities found in the Department of Toxic Substances Control (DTSC) EnviroStor database.

Government Publication Date: Oct 2, 2025

Sites Listed in the Solid Waste Assessment Test (SWAT) Program Report:

SWAT

In a 1993 Memorandum of Understanding, the State Water Resources Control Board (SWRCB) agreed to submit a comprehensive report on the Solid Waste Assessment Test (SWAT) Program to the California Integrated Waste Management Board (CIWMB). This report summarizes the work completed to date on the SWAT Program, and addresses both the impacts that leakage from solid waste disposal sites (SWDS) may have upon waters of the State and the actions taken to address such leakage.

Government Publication Date: Dec 31, 1995

Construction and Demolition Debris Recyclers:

C&D DEBRIS RECY

This listing of Construction and Demolition Debris Recyclers is maintained by the California Integrated Waste Management Board-common C&D materials include lumber, drywall, metals, masonry (brick, concrete, etc.), carpet, plastic, pipe, rocks, dirt, paper, cardboard, or green waste related to land development.

Government Publication Date: Jun 20, 2018

Recycling Centers:

RECYCLING

This list of Certified Recycling Centers that are operating under the state of California's Beverage Container Recycling Program is maintained by the California Department of Resources Recycling and Recovery.

Government Publication Date: Feb 10, 2026

Listing of Certified Processors:**PROCESSORS**

This list of Certified Processors that are operating under the state of California's Beverage Container Recycling Program is maintained by the California Department of Resources Recycling and Recovery.

Government Publication Date: Feb 20, 2026

Listing of Certified Dropoff, Collection, and Community Service Programs:**CONTAINER RECY**

This list of Certified Dropoff, Collection, and Community Service Programs (non-buyback) operating under the state of California's Beverage Container Recycling Program is maintained by the California Department of Resources Recycling and Recovery.

Government Publication Date: Jul 18, 2025

Land Disposal Sites:**LDS**

Land Disposal Sites in GeoTracker, the State Water Resources Control Board (SWRCB)'s data management system. The Land Disposal program regulates of waste discharge to land for treatment, storage and disposal in waste management units. Waste management units include waste piles, surface impoundments, and landfills.

Government Publication Date: Aug 11, 2025

Leaking Underground Fuel Tank Reports:**LUST**

List of Leaking Underground Storage Tanks within the Cleanup Sites data in GeoTracker database. GeoTracker is the State Water Resources Control Board's (SWRCB) data management system for managing sites that impact groundwater, especially those that require groundwater cleanup (Underground Storage Tanks, Department of Defense and Site Cleanup Program) as well as permitted facilities such as operating Underground Storage Tanks. The Leak Prevention Program that overlooks LUST sites is the SWRCB in California's Environmental Protection Agency.

Government Publication Date: Sep 14, 2025

Delisted Leaking Storage Tanks:**DELISTED LST**

List of Leaking Underground Storage Tanks (LUST) cleanup sites removed from GeoTracker, the State Water Resources Control Board (SWRCB)'s database system, as well as sites removed from the SWRCB's list of UST Case closures.

Government Publication Date: Jan 27, 2026

Permitted Underground Storage Tank (UST) in GeoTracker:**UST**

List of Permitted Underground Storage Tank (UST) sites made available by the State Water Resources Control Board (SWRCB) in California's Environmental Protection Agency (EPA).

Government Publication Date: Nov 16, 2025

Proposed Closure of Underground Storage Tank Cases:**UST CLOSURE**

This listing includes Proposed Closure of Underground Storage Tank (UST) Cases which are being considered for closure by either the State Water Resources Control Board at a Future Board Meeting or the Executive Director that have been posted for a 60-day public comment period, and Closure of UST Cases with Closure Denials and Approved Orders. The lists are provided by the California Water Boards.

Government Publication Date: Jan 27, 2026

Historical Hazardous Substance Storage Information Database:**HHSS**

The Historical Hazardous Substance Storage database contains information collected in the 1980s from facilities that stored hazardous substances. The information was originally collected on paper forms, was later transferred to microfiche, and recently indexed as a searchable database. When using this database, please be aware that it is based upon self-reported information submitted by facilities which has not been independently verified. It is unlikely that every facility responded to the survey and the database should not be expected to be a complete inventory of all facilities that were operating at that time. This database is maintained by the California State Water Resources Control Board's (SWRCB) Geotracker.

Government Publication Date: Aug 27, 2015

Statewide Environmental Evaluation and Planning System:**UST SWEEPS**

The Statewide Environmental Evaluation and Planning System (SWEEPS) is a historical listing of active and inactive underground storage tanks made available by the California State Water Resources Control Board (SWRCB).

Government Publication Date: Oct 1, 1994

Aboveground Storage Tanks:**AST**

A statewide list from 2009 of aboveground storage tanks (ASTs) made available by the Cal FIRE Office of the State Fire Marshal (OSFM). This list is no longer maintained or updated by the Cal FIRE OSFM.

Government Publication Date: Aug 31, 2009

SWRCB Historical Aboveground Storage Tanks:[AST SWRCB](#)

A list of aboveground storage tanks made available by the California State Water Resources Control Board (SWRCB). Effective January 1, 2008, the Certified Unified Program Agencies (CUPAs) are vested with the responsibility and authority to implement the Aboveground Petroleum Storage Act (APSA).

Government Publication Date: Dec 1, 2007

Oil and Gas Facility Tanks:[TANK OIL GAS](#)

Locations of oil and gas tanks that fall under the jurisdiction of the Geologic Energy Management Division of the California Department of Conservation (CalGEM) (CCR 1760). CalGEM was formerly the Division of Oil, Gas, and Geothermal Resources (DOGGR).

Government Publication Date: Jan 16, 2026

Delisted Storage Tanks:[DELISTED TNK](#)

This database contains a list of storage tank sites that were removed by the State Water Resources Control Board (SWRCB) in California's Environmental Protection Agency (EPA) and the Cal FIRE Office of State Fire Marshal (OSFM).

Government Publication Date: Jan 16, 2026

California Environmental Reporting System (CERS) Tanks:[CERS TANK](#)

List of sites in the California Environmental Protection Agency (CalEPA) Regulated Site Portal which fall under the Aboveground Petroleum Storage and Underground Storage Tank regulatory programs. The CalEPA oversees the statewide implementation of the Unified Program which applies regulatory standards to protect Californians from hazardous waste and materials. This data also includes military underground storage tank sites sourced from the CalEPA's Water Boards' GeoTracker system.

Government Publication Date: Jan 12, 2026

Delisted California Environmental Reporting System (CERS) Tanks:[DELISTED CTNK](#)

This database contains a list of Aboveground Petroleum Storage and Underground Storage Tank sites that were removed from in the California Environmental Protection Agency (CalEPA) Regulated Site Portal.

Government Publication Date: Jan 12, 2026

Historical Hazardous Substance Storage Container Information - Facility Summary:[HIST TANK](#)

The State Water Resources Control Board maintained the Hazardous Substance Storage Containers listing and inventory in the 1980s. This facility summary lists historic tank sites where the following container types were present: farm motor vehicle fuel tanks; waste tanks; sumps; pits, ponds, lagoons, and others; and all other product tanks. This set, published in May 1988, lists facility and owner information, as well as the number of containers. This data is historic and will not be updated.

Government Publication Date: May 27, 1988

Site Mitigation and Brownfields Reuse Program Facility Sites with Land Use Restrictions:[LUR](#)

The Department of Toxic Substances Control (DTSC) Site Mitigation and Brownfields Reuse Program (SMBRP) list includes sites cleaned up under the program's oversight and generally does not include current or former hazardous waste facilities that required a hazardous waste facility permit. The list represents land use restrictions that are active. Some sites have multiple land use restrictions.

Government Publication Date: Oct 2, 2025

CALSITES Database:[CALSITES](#)

This historical database was maintained by the Department of Toxic Substance Control (DTSC) for more than a decade. CALSITES contains information on Brownfield properties with confirmed or potential hazardous contamination. In 2006, DTSC introduced EnviroStor as the latest Brownfields site database.

Government Publication Date: May 1, 2004

Hazardous Waste Management Program Facility Sites with Deed / Land Use Restrictions:[HLUR](#)

The Department of Toxic Substances Control (DTSC) Hazardous Waste Management Program (HWMP) has developed a list of current or former hazardous waste facilities that have a recorded land use restriction at the local county recorder's office. The land use restrictions on this list were required by the DTSC HWMP as a result of the presence of hazardous substances that remain on site after the facility (or part of the facility) has been closed or cleaned up. The types of land use restriction include deed notice, deed restriction, or a land use restriction that binds current and future owners.

Government Publication Date: Feb 18, 2021

Deed Restrictions and Land Use Restrictions:[DEED](#)

List of Deed Restrictions, Land Use Restrictions and Covenants in GeoTracker made available by the State Water Resources Control Board (SWRCB) in California's Environmental Protection Agency. A deed restriction (land use covenant) may be required to facilitate the remediation of past environmental contamination and to protect human health and the environment by reducing the risk of exposure to residual hazardous materials.

Voluntary Cleanup Program:

VCP

List of sites in the Voluntary Cleanup Program made available by the Department of Toxic Substances and Control (DTSC). The Voluntary Cleanup Program was designed to respond to lower priority sites. Under the Voluntary Cleanup Program, DTSC enters site-specific agreements with project proponents for DTSC oversight of site assessment, investigation, and/or removal or remediation activities, and the project proponents agree to pay DTSC's reasonable costs for those services.

Government Publication Date: Oct 2, 2025

GeoTracker Cleanup Program Sites:

CLEANUP SITES

A list of Cleanup Program sites in the state of California made available by The State Water Resources Control Board (SWRCB) of the California Environmental Protection Agency (EPA). SWRCB tracks leaking underground storage tank cleanups as well as other water board cleanups.

Government Publication Date: Aug 11, 2025

Delisted Cleanup Program Sites:

DELISTED CLEANUP

A list of Cleanup Program sites which were once included - and have since been removed from - the list of Cleanup Program Sites in GeoTracker. GeoTracker is the State Water Resource Control Boards' data management system for sites that impact, or have the potential to impact, water quality in California, with emphasis on groundwater.

Government Publication Date: Sep 13, 2025

Delisted County Records:

DELISTED COUNTY

Records removed from county or CUPA databases. Records may be removed from the county lists made available by the respective county departments because they are inactive, or because they have been deemed to be below reportable thresholds.

Government Publication Date: Jan 12, 2026

Delisted County Tanks:

DELISTED COUNTY TANK

Storage Tank records removed from county or CUPA databases. Records may be removed from the county lists made available by the respective county departments because they are inactive, or because they have been deemed to be below reportable thresholds.

Government Publication Date: Dec 23, 2025

Delisted County Leaking Tanks:

DELISTED COUNTY LTANK

Leaking Storage tank records removed from county or CUPA databases.

Government Publication Date: Dec 3, 2025

Tribal

Leaking Underground Storage Tanks on Tribal/Indian Lands:

INDIAN LUST

This list of leaking underground storage tanks (LUSTs) on Tribal/Indian Lands in Region 9, which includes California, is made available by the United States Environmental Protection Agency (EPA).

Government Publication Date: Nov 21, 2025

Underground Storage Tanks on Tribal/Indian Lands:

INDIAN UST

This list of underground storage tanks (USTs) on Tribal/Indian Lands in Region 9, which includes California, is made available by the United States Environmental Protection Agency (EPA).

Government Publication Date: Nov 21, 2025

Delisted Tribal Leaking Storage Tanks:

DELISTED INDIAN LST

Leaking Underground Storage Tank (LUST) facilities which once appeared on - and have since been removed from - the Regional Tribal/Indian LUST lists made available by the United States Environmental Protection Agency (EPA).

Government Publication Date: Nov 21, 2025

Delisted Tribal Underground Storage Tanks:

DELISTED INDIAN UST

Underground Storage Tank (UST) facilities which once appeared on - and have since been removed from - the Regional Tribal/Indian UST lists made available by the United States Environmental Protection Agency (EPA).

Government Publication Date: Nov 21, 2025

County

San Diego County - Solid Waste Facility List:

[SWF SANDIEGO](#)

This list of open and closed Solid Waste Facilities is made available by the County of San Diego Department of Environmental Health and Quality's (DEHQ) agency files and map service. The County of San Diego DEHQ Solid Waste Local Enforcement Agency (LEA) is certified by the California Department of Resources Recycling and Recovery to enforce state solid waste laws and regulations in San Diego County, excluding the City of San Diego.

Government Publication Date: May 10, 2025

San Diego County - Local Oversight Program List:

[LOP SANDIEGO](#)

A list of Underground Storage Tank (UST) release sites in the County of San Diego. This list is made available by San Diego County Department of Environmental Health.

Government Publication Date: Jun 15, 2020

San Diego County - Hazardous Materials Management Division Database:

[HAZ SANDIEGO](#)

A list of facilities with Unified Program Facility Permit in San Diego County. This list has been made available by County of San Diego Environmental Health.

Government Publication Date: Jul 19, 2024

San Diego County - UST List:

[UST SANDIEGO](#)

A list of registered Underground Storage Tanks in the County of San Diego. The list is made available by the San Diego County Hazardous Materials Division.

Government Publication Date: Nov 27, 2025

San Diego County - Site Assessment and Mitigation Investigation Sites:

[SAM SANDIEGO](#)

List of sites which have undergone a Site Assessment and Mitigation investigation. This list is made available by the County of San Diego Department of Environmental Health.

Government Publication Date: Oct 26, 2025

Additional Environmental Record Sources

Federal

PFAS Greenhouse Gas Emissions Data:

[PFAS GHG](#)

The U.S. Environmental Protection Agency's (EPA) Greenhouse Gas Reporting Program (GHGRP) collects Greenhouse Gas (GHG) data from large emitting facilities (25,000 metric tons of carbon dioxide equivalent (CO₂e) per year), and suppliers of fossil fuels and industrial gases that results in GHG emissions when used. This dataset is sourced from the EPA's PFAS Analytic Tools, and it includes GHG emissions data for facilities that emit or have emitted since 2010 chemicals identified as PFAS based on EPA's CompTox Chemicals Dashboard lists of PFAS with defined and undefined structures. PFAS emissions data has been identified for facilities engaged in the following industrial processes: Aluminum Production (GHGRP Subpart F), HCFC-22 Production and HFC-23 Destruction (Subpart O), Electronics Manufacturing (Subpart I), Fluorinated Gas Production (Subpart L), Magnesium Production (Subpart T), Electrical Transmission and Distribution Equipment Use (Subpart DD), and Manufacture of Electric Transmission and Distribution Equipment (Subpart SS). Over time, other industrial processes with required GHGRP reporting may include PFAS emissions data and the list of reportable gases may change over time. Note that some regulatory programs have specified chemical structure requirements that define PFAS differently than the lists in EPA's CompTox Chemicals Dashboard.

Government Publication Date: Dec 2, 2025

On-Scene Coordinator Response Sites:

[OSC RESPONSE](#)

This list of On-Scene Coordinator (OSC) Response Sites is provided by the U.S. Environmental Protection Agency (EPA). OSCs are the federal officials responsible for monitoring or directing responses to all oil spills and hazardous substance releases reported to the federal government. OSCs coordinate all federal efforts with, and provide support and information to local, state, and regional response communities. An OSC is an agent of either EPA or the U.S. Coast Guard (USCG), depending on where the incident occurs. EPA's OSCs have primary responsibility for spills and releases to inland areas and waters. USCG OSCs have responsibility for coastal waters and the Great Lakes. In general, an OSC has the following key responsibilities during and after a response: Assessment, Monitoring, Response Assistance, and Evaluation.

Government Publication Date: Oct 8, 2025

Facility Registry Service/Facility Index:

FINDS/FRS

The Facility Registry Service (FRS) is a centrally managed database that identifies facilities, sites, or places subject to environmental regulations or of environmental interest. FRS creates high-quality, accurate, and authoritative facility identification records through rigorous verification and management procedures that incorporate information from program national systems, state master facility records, and data collected from EPA's Central Data Exchange registrations and data management personnel. This list is made available by the U.S. Environmental Protection Agency (EPA).

Government Publication Date: Jan 1, 2026

Toxics Release Inventory (TRI) Program:

TRIS

The U.S. Environmental Protection Agency's Toxics Release Inventory (TRI) is a database containing data on disposal or other releases of toxic chemicals from U.S. facilities and information about how facilities manage those chemicals through recycling, energy recovery, and treatment. There are currently 770 individually listed chemicals and 33 chemical categories covered by the TRI Program. Facilities that manufacture, process or otherwise use these chemicals in amounts above established levels must submit annual reporting forms for each chemical. Note that the TRI chemical list does not include all toxic chemicals used in the U.S. One of TRI's primary purposes is to inform communities about toxic chemical releases to the environment. This database includes TRI Reporting Data for calendar years 1987 through 2021 and Preliminary Data for 2022.

Government Publication Date: Sep 20, 2023

PFOA/PFOS Contaminated Sites:

PFAS NPL

This list of Superfund Sites with Per- and Polyfluoroalkyl Substances (PFAS) detections is made available by the U.S. Environmental Protection Agency (EPA) in their PFAS Analytic Tools data, previously the list was obtained by EPA FOIA requests. EPA's Office of Land and Emergency Management and EPA Regional Offices maintain what is known about site investigations, contamination, and remedial actions under the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA) where PFAS is present in the environment. Limitations: Detections of PFAS at National Priorities List (NPL) sites do not mean that people are at risk from PFAS, are exposed to PFAS, or that the site is the source of the PFAS. The information in the Superfund NPL and Superfund Alternative Agreement (SAA) PFAS detection site list is years old and may not be accurate today. Site information such as site name, site ID, and location has been confirmed for accuracy; however, PFAS-related information such as media sampled, drinking water being above the health advisory, or mitigation efforts has not been verified. For Federal Facilities data, the other Federal agencies (OFA) are the lead agency for their data and provided them to EPA.

Government Publication Date: Dec 29, 2025

Federal Agency Locations with Known or Suspected PFAS Detections:

PFAS FED SITES

This list of federal agency locations with known or suspected detections of Per- and Polyfluoroalkyl Substances (PFAS) is made available by the U.S. Environmental Protection Agency's (EPA) PFAS Analytic Tools data. The EPA outlines that these data are gathered from several federal entities, such as the federal Superfund program, Department of Defense (DOD), National Aeronautics and Space Administration (NASA), Department of Transportation (DOT), and Department of Energy (DOE). The dates this data was extracted for the PFAS Analytic Tools range from 2022 to 2025 per agency entity dataset. Sites on this list do not necessarily reflect the source/s of PFAS contamination and detections do not indicate level of risk or human exposure at the site. Agricultural notifications in this data are limited to DOD sites only. At this time, the EPA is aware that this list is not comprehensive of all Federal agencies.

Government Publication Date: May 30, 2025

SSEHRI PFAS Contamination Sites:

PFAS SSEHRI

This PFAS Contamination Site Tracker database is compiled by the PFAS Project Lab, part of the Social Science Environmental Health Research Institute (SSEHRI) at Northeastern University. According to the SSEHRI, the database records qualitative and quantitative data from each known site of PFAS contamination, including timeline of discovery, sources, levels, health impacts, community response, and government response. The goal of this database is to compile information and support public understanding of the rapidly unfolding issue of PFAS contamination. All data presented was extracted from government websites, news articles, or publicly available documents. Locations for the Known PFAS Contamination Sites are sourced from the PFAS Sites and Community Resources Map by the PFAS-REACH team, credited to PFAS Project Lab, Silent Spring Institute, and PFAS Exchange. Disclaimer: The source conveys the data undergoes regular updates as new information becomes available, some sites may be missing and/or contain information that is incorrect or outdated, as well as their information represents all contamination sites SSEHRI is aware of, not all possible contamination sites. This data is not intended to be used for legal purposes. Access the following source link for the most current information: <https://pfasproject.com/pfas-sites-and-community-resources/>

Government Publication Date: Aug 1, 2025

National Response Center PFAS Spills:

PFAS ERNS

This Per- and Poly-Fluoroalkyl Substances (PFAS) Spills dataset is made available via the U.S. Environmental Protection Agency's (EPA) PFAS Analytic Tools. The National Response Center (NRC), operated by the U.S. Coast Guard, is the designated federal point of contact for reporting all oil, chemical, and other discharges into the environment, for the United States and its territories. This dataset contains NRC spill information from 1990 to the present that is restricted to records associated with PFAS and PFAS-containing materials. Incidents are filtered to include only records with a "Material Involved" or "Incident Description" related to Aqueous Film Forming Foam (AFFF). The keywords used to filter the data included "AFFF," "Fire Fighting Foam," "Aqueous Film Forming Foam," "Fire Suppressant Foam," "PFAS," "PERFL," "PFOA," "PFOS," and "Genx." Limitations: The data from the NRC website contains initial incident data that has not been validated or investigated by a federal/state response agency. Keyword searches may misidentify some incident reports that do not contain PFAS. This dataset should also not be considered to be exhaustive of all PFAS spills/release incidents.

Government Publication Date: Feb 16, 2026

PFAS NPDES Discharge Monitoring:

[PFAS NPDES](#)

This list of National Pollutant Discharge Elimination System (NPDES) permitted facilities with required monitoring for Per- and Polyfluoroalkyl (PFAS) Substances is made available via the U.S. Environmental Protection Agency (EPA)'s PFAS Analytic Tools. Any point-source wastewater discharger to waters of the United States must have a NPDES permit, which defines a set of parameters for pollutants and monitoring to ensure that the discharge does not degrade water quality or impair human health. This list includes NPDES permitted facilities associated with permits that monitor for Per- and Polyfluoroalkyl Substances (PFAS), limited to the years 2007 - present. EPA further advises the following regarding these data: currently, fewer than half of states have required PFAS monitoring for at least one of their permittees, and fewer states have established PFAS effluent limits for permittees. For states that may have required monitoring, some reporting and data transfer issues may exist on a state-by-state basis.

Government Publication Date: Dec 16, 2024

Perfluorinated Alkyl Substances (PFAS) from Toxic Release Inventory:

[PFAS TRI](#)

List of Toxics Release Inventory (TRI) facilities at which the reported chemical is a per- or polyfluoroalkyl (PFAS) substance included in the U.S. Environmental Protection Agency's (EPA) consolidated PFAS Master List of PFAS Substances. Encompasses Toxics Release Inventory records included in the EPA PFAS Analytic Tools. The EPA's TRI database currently tracks information on disposal or releases of 770 individually listed toxic chemicals and 33 chemical categories from thousands of U.S. facilities and details about how facilities manage those chemicals through recycling, energy recovery, and treatment. This listing includes TRI Reporting Data for calendar years 1987 through 2021 and Preliminary Data for 2022.

Government Publication Date: Sep 20, 2023

PFAS Water Quality Portal Sampling Data:

[PFAS WATER](#)

This Per- and Poly-Fluoroalkyl Substances (PFAS) Environmental Media Sampling Data is made available via the U.S. Environmental Protection Agency's (EPA) PFAS Analytic Tools. The Water Quality Portal (WQP), as a cooperative service sponsored by the United States Geological Survey, the EPA, and the National Water Quality Monitoring Council, is part of a modernized repository storing ambient sampling data for all environmental media and tissue samples. A wide range of federal, state, tribal and local governments, academic and non-governmental organizations, and individuals submit project details and sampling results to this public repository. Limitations: EPA did not carry out the sampling or testing of a majority of the data in the WQP PFAS dataset. EPA can only speak to the accuracy and completeness of the data from projects like the National Aquatic Resource Surveys for which EPA is the data owner/organization. Data may exist within the file on Quality Assurance Project Plans (QAPPs) and the approving agency of the QAPP, if a QAPP is entered.

Government Publication Date: Jul 21, 2025

PFAS TSCA Manufacture and Import Facilities:

[PFAS TSCA](#)

The U.S. Environmental Protection Agency (EPA) issued the Chemical Data Reporting (CDR) Rule under the Toxic Substances Control Act (TSCA) and requires chemical manufacturers and facilities that manufacture or import chemical substances to report data to EPA. This list is specific only to TSCA Manufacture and Import Facilities with reported per- and poly-fluoroalkyl (PFAS) substances. Data file is sourced from EPA's PFAS Analytic Tools TSCA dataset which includes CDR/Inventory Update Reporting data from 1998 up to 2020. Disclaimer: This data file includes production and importation data for chemicals identified in EPA's CompTox Chemicals Dashboard list of PFAS without explicit structures and list of PFAS structures in DSSTox. Note that some regulations have specific chemical structure requirements that define PFAS differently than the lists in EPA's CompTox Chemicals Dashboard. Reporting information on manufactured or imported chemical substance amounts should not be compared between facilities, as some companies claim Chemical Data Reporting Rule data fields for PFAS information as Confidential Business Information.

Government Publication Date: Jan 5, 2023

PFAS Waste Transfers from RCRA e-Manifest:

[PFAS E-MANIFEST](#)

This Per- and Poly-Fluoroalkyl Substances (PFAS) Waste Transfers dataset is made available via the U.S. Environmental Protection Agency's (EPA) PFAS Analytic Tools. Every shipment of hazardous waste in the U.S. must be accompanied by a shipment manifest, which is a critical component of the cradle-to-grave tracking of wastes mandated by the Resource Conservation and Recovery Act (RCRA). According to the EPA, currently no Federal Waste Code exists for any PFAS compounds. To work around the lack of PFAS waste codes in the RCRA database, EPA developed the PFAS Transfers dataset by mining e-Manifest records containing at least one of these common PFAS keywords: • PFAS • PFOA • PFOS • PERFL • AFFF • GENX • GEN-X (plus the Vermont state-specific waste codes). Limitations: Amount or concentration of PFAS being transferred cannot be determined from the manifest information. Keyword searches may misidentify some manifest records that do not contain PFAS. This dataset should also not be considered to be exhaustive of all PFAS waste transfers.

PFAS Industry Sectors:

[PFAS IND](#)

This Per- and Poly-Fluoroalkyl Substances (PFAS) Industry Sectors dataset is made available via the U.S. Environmental Protection Agency's (EPA) PFAS Analytic Tools. The dataset was developed from various sources that show which industries may be handling PFAS including: EPA's Enforcement and Compliance History Online (ECHO) records restricted to potential PFAS-handling industry sectors, based on the North American Industry Classification System (NAICS) Codes and Standard Industrial Classification (SIC) Codes associated federal regulatory programs (e.g., Clean Water Act, Clean Air Act, and Resource Conservation and Recovery Act) at the facility level; ECHO records for Fire Training Sites identified where fire-fighting foam may have been used in training exercises; and 14 CFR Part 139 Airports compiled from historic and current records from the FAA Airport Data and Information Portal. Since July 2006, all certificated Part 139 Airports are required to have fire-fighting foam onsite that meet certain military specifications, which to date have been fluorinated (Aqueous Film Forming Foam). Limitations: Inclusion in this dataset does not indicate that PFAS are being manufactured, processed, used, or released by the facility. Listed facilities potentially handle PFAS based on their industrial profile but are unconfirmed by the EPA. Keyword searches in ECHO for Fire Training sites may misidentify some facilities and should not be considered to be an exhaustive list of fire training facilities in the U.S.

Government Publication Date: Feb 16, 2026

Hazardous Materials Information Reporting System:

[HMIRS](#)

The Hazardous Materials Incident Reporting System (HMIRS) database contains unintentional hazardous materials release information reported to the U.S. Department of Transportation, Pipeline and Hazardous Materials Safety Administration.

Government Publication Date: May 28, 2025

National Clandestine Drug Labs:

[NCDL](#)

The U.S. Department of Justice ("the Department"), Drug Enforcement Administration (DEA), provides this data as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy.

Government Publication Date: Nov 30, 2023

Toxic Substances Control Act:

[TSCA](#)

The U.S. Environmental Protection Agency (EPA) is amending the Toxic Substances Control Act (TSCA) section 8(a) Inventory Update Reporting (IUR) rule and changing its name to the Chemical Data Reporting (CDR) rule. The CDR enables EPA to collect and publish information on the manufacturing, processing, and use of commercial chemical substances and mixtures (referred to hereafter as chemical substances) on the TSCA Chemical Substance Inventory (TSCA Inventory). This includes current information on chemical substance production volumes, manufacturing sites, and how the chemical substances are used. This information helps the Agency determine whether people or the environment are potentially exposed to reported chemical substances. EPA publishes submitted CDR data that is not Confidential Business Information (CBI). EPA CDR collections occur approximately every four years and reporting requirements change per collection.

Government Publication Date: May 12, 2022

Hist TSCA:

[HIST TSCA](#)

The Environmental Protection Agency (EPA) is amending the Toxic Substances Control Act (TSCA) section 8(a) Inventory Update Reporting (IUR) rule and changing its name to the Chemical Data Reporting (CDR) rule.

The 2006 IUR data summary report includes information about chemicals manufactured or imported in quantities of 25,000 pounds or more at a single site during calendar year 2005. In addition to the basic manufacturing information collected in previous reporting cycles, the 2006 cycle is the first time EPA collected information to characterize exposure during manufacturing, processing and use of organic chemicals. The 2006 cycle also is the first time manufacturers of inorganic chemicals were required to report basic manufacturing information.

Government Publication Date: Dec 31, 2006

FTTS Administrative Case Listing:

[FTTS ADMIN](#)

An administrative case listing from the Federal Insecticide, Fungicide, & Rodenticide Act (FIFRA) and Toxic Substances Control Act (TSCA), together known as FTTS. This database was obtained from the Environmental Protection Agency's (EPA) National Compliance Database (NCDB). The FTTS and NCDB was shut down in 2006.

Government Publication Date: Jan 19, 2007

FTTS Inspection Case Listing:

[FTTS INSP](#)

An inspection case listing from the Federal Insecticide, Fungicide, & Rodenticide Act (FIFRA) and Toxic Substances Control Act (TSCA), together known as FTTS. This database was obtained from the Environmental Protection Agency's (EPA) National Compliance Database (NCDB). The FTTS and NCDB was shut down in 2006.

Government Publication Date: Jan 19, 2007

Potentially Responsible Parties List:

PRP

Early in the site cleanup process, the U.S. Environmental Protection Agency (EPA) conducts a search to find the Potentially Responsible Parties (PRPs). The EPA looks for evidence to determine liability by matching wastes found at the site with parties that may have contributed wastes to the site. This listing contains PRPs, Noticed Parties, at sites in the EPA's Superfund Enterprise Management System (SEMS).

Government Publication Date: Dec 26, 2025

State Coalition for Remediation of Drycleaners Listing:

SCRD DRYCLEANER

The State Coalition for Remediation of Drycleaners (SCRD) was established in 1998, with support from the U.S. Environmental Protection Agency (EPA) Office of Superfund Remediation and Technology Innovation. Coalition members are states with mandated programs and funding for drycleaner site remediation. Current members are Alabama, Connecticut, Florida, Illinois, Kansas, Minnesota, Missouri, North Carolina, Oregon, South Carolina, Tennessee, Texas, and Wisconsin. Since 2017, the SCRD no longer maintains this data, refer to applicable state source data where available.

Government Publication Date: Nov 08, 2017

Integrated Compliance Information System (ICIS):

ICIS

The Integrated Compliance Information System (ICIS) database contains integrated enforcement and compliance information across most of U.S. Environmental Protection Agency's (EPA) programs. The vision for ICIS is to replace EPA's independent databases that contain enforcement data with a single repository for that information. Currently, ICIS contains all Federal Administrative and Judicial enforcement actions and a subset of the Permit Compliance System (PCS), which supports the National Pollutant Discharge Elimination System (NPDES). This information is maintained by the EPA Headquarters and at the Regional offices. A future release of ICIS will completely replace PCS and will integrate that information with Federal actions already in the system. ICIS also has the capability to track other activities that support compliance and enforcement programs, including incident tracking, compliance assistance, and compliance monitoring.

Government Publication Date: Oct 18, 2025

Drycleaner Facilities:

FED DRYCLEANERS

A list of drycleaner facilities from Enforcement and Compliance History Online (ECHO) data as made available by the U.S. Environmental Protection Agency (EPA), sourced from the ECHO Exporter file. This EPA source file tracks facilities that possess NAICS and SIC codes that classify businesses as drycleaner establishments.

Government Publication Date: Jan 24, 2026

Delisted Drycleaner Facilities:

DELISTED FED DRY

List of sites which once appeared on - and have since been removed from - the list of drycleaner facilities included in Enforcement and Compliance History Online (ECHO) data as made available by the U.S. Environmental Protection Agency (EPA), sourced from the ECHO Exporter file. This EPA source file tracks facilities that possess NAICS and SIC codes that classify businesses as drycleaner establishments.

Government Publication Date: Jan 24, 2026

Formerly Used Defense Sites:

FUDS

Formerly Used Defense Sites (FUDS) are properties that were formerly owned by, leased to, or otherwise possessed by and under the jurisdiction of the Secretary of Defense prior to October 1986, where the Department of Defense (DOD) is responsible for an environmental restoration. The FUDS Annual Report to Congress (ARC) is published by the U.S. Army Corps of Engineers (USACE). This data is compiled from the USACE's Geospatial FUDS data layers and Homeland Infrastructure Foundation-Level Data (HIFLD) FUDS dataset which applies to the Fiscal Year 2021 FUDS Inventory.

Government Publication Date: May 15, 2023

FUDS Munitions Response Sites:

FUDS MRS

Boundaries of Munitions Response Sites (MRS), published with the Formerly Used Defense Sites (FUDS) Annual Report to Congress (ARC) by the U.S. Army Corps of Engineers (USACE). An MRS is a discrete location within a Munitions response area (MRA) that is known to require a munitions response. An MRA means any area on a defense site that is known or suspected to contain unexploded ordnance (UXO), discarded military munitions (DMM), or munitions constituents (MC). This data is compiled from the USACE's Geospatial MRS data layers and Homeland Infrastructure Foundation-Level Data (HIFLD) MRS dataset.

Government Publication Date: May 15, 2023

Former Military Nike Missile Sites:

FORMER NIKE

This information was taken from report DRXTH-AS-IA-83A016 (Historical Overview of the Nike Missile System, 12/1984) which was performed by Environmental Science and Engineering, Inc. for the U.S. Army Toxic and Hazardous Materials Agency Assessment Division. The Nike system was deployed between 1954 and the mid-1970's. Among the substances used or stored on Nike sites were liquid missile fuel (JP-4); starter fluids (UDKH, aniline, and furfuryl alcohol); oxidizer (IRFNA); hydrocarbons (motor oil, hydraulic fluid, diesel fuel, gasoline, heating oil); solvents (carbon tetrachloride, trichloroethylene, trichloroethane, stoddard solvent); and battery electrolyte. The quantities of material a disposed of and procedures for disposal are not documented in published reports. Virtually all information concerning the potential for contamination at Nike sites is confined to personnel who were assigned to Nike sites. During deactivation most hardware was shipped to depot-level supply points. There were reportedly instances where excess materials were disposed of on or near the site itself at closure. There was reportedly no routine site decontamination.

PHMSA Pipeline Safety Flagged Incidents:

[PIPELINE INCIDENT](#)

This list of flagged pipeline incidents is made available by the U.S. Department of Transportation (US DOT) Pipeline and Hazardous Materials Safety Administration (PHMSA). PHMSA regulations require incident and accident reports for five different pipeline system types. Accidents reported on hazardous liquid gravity lines (§195.13) and reporting-regulated-only hazardous liquid gathering lines (§195.15) and incidents reported on Type R gas gathering (§192.8(c)) are not included in the flagged incident file data.

Government Publication Date: Jul 10, 2025

Material Licensing Tracking System (MLTS):

[MLTS](#)

A list of sites that store radioactive material subject to the Nuclear Regulatory Commission (NRC) licensing requirements. This list is maintained by the NRC. As of September 2016, the NRC no longer releases location information for sites. Site locations were last received in July 2016.

Government Publication Date: May 11, 2021

Historic Material Licensing Tracking System (MLTS) sites:

[HIST MLTS](#)

A historic list of sites that have inactive licenses and/or removed from the Material Licensing Tracking System (MLTS). In some cases, a site is removed from the MLTS when the state becomes an "Agreement State". An Agreement State is a State that has signed an agreement with the Nuclear Regulatory Commission (NRC) authorizing the State to regulate certain uses of radioactive materials within the State.

Government Publication Date: Jan 31, 2010

Mines Master Index File:

[MINES](#)

The Master Index File (MIF) is provided by the United States Department of Labor, Mine Safety and Health Administration (MSHA). This file, which was originally created in the 1970's, contained many Mine-IDs that were invalid. MSHA removes invalid IDs from the MIF upon discovery. MSHA applicable data includes the following: all Coal and Metal/Non-Metal mines under MSHA's jurisdiction since 1/1/1970; mine addresses for all mines in the database except for Abandoned mines prior to 1998 from MSHA's legacy system (addresses may or may not correspond with the physical location of the mine itself); violations that have been assessed penalties as a result of MSHA inspections beginning on 1/1/2000; and violations issued as a result of MSHA inspections conducted beginning on 1/1/2000.

Government Publication Date: Aug 8, 2025

Surface Mining Control and Reclamation Act Sites:

[SMCRA](#)

This inventory of land and water impacted by past mining (primarily legacy coal mining operations) is maintained by the U.S. Department of the Interior's Office of Surface Mining Reclamation and Enforcement (OSMRE), as it provides information needed to implement the Surface Mining Control and Reclamation Act of 1977 (SMCRA). This inventory contains information on the type and extent of Abandoned Mine Land (AML) Problems, as well as information on the cost associated with the reclamation of those problems. The data is based upon field surveys by State, Tribal, and OSMRE program officials. It is dynamic to the extent that it is modified as new problems are identified and existing problems are reclaimed. Disclaimer: Per the OSMRE, States and tribes who enter their data into e-AMLIS (AML Inventory System) may truncate their latitude and longitude so the precise location of usually dangerous AMLs is not revealed in an effort to protect the public from searching for these AMLs, most of which are on private property. If more precise location information is needed, please contact the applicable state/tribe of interest.

Government Publication Date: Oct 30, 2025

Mineral Resource Data System:

[MRDS](#)

The Mineral Resource Data System (MRDS) is a collection of reports describing metallic and nonmetallic mineral resources throughout the world. Included are deposit name, location, commodity, deposit description, geologic characteristics, production, reserves, resources, and references. This database contains the records previously provided in the Mineral Resource Data System (MRDS) of USGS and the Mineral Availability System/Mineral Industry Locator System (MAS/MILS) originated in the U.S. Bureau of Mines, which is now part of USGS. The USGS has ceased systematic updates of the MRDS database with their focus more recently on deposits of critical minerals while providing a well-documented baseline of historical mine locations from USGS topographic maps.

Government Publication Date: Mar 15, 2016

DOE Legacy Management Sites:

[LM SITES](#)

The U.S. Department of Energy (DOE) Office of Legacy Management (LM) currently manages radioactive and chemical waste, environmental contamination, and hazardous material at over 100 sites across the U.S. The LM manages sites with diverse regulatory drivers (statutes or programs that direct cleanup and management requirements at DOE sites) or as part of internal DOE or congressionally-recognized programs, such as but not limited to: Formerly Utilized Sites Remedial Action Program (FUSRAP), Uranium Mill Tailings Radiation Control Act (UMTRCA Title I, Title II), Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA), Resource Conservation and Recovery Act (RCRA), Decontamination and Decommissioning (D&D), Nuclear Waste Policy Act (NWPA). The intent of the site location is to provide a general reference point to the site on a national scale. The coordinates of each site point can be the location of a site monument, the centroid of the site boundary, or a general location of the site. This site listing includes data exported from the DOE Office of LM's Geospatial Environmental Mapping System (GEMS). GEMS Data disclaimer: The DOE Office of LM makes no representation or warranty, expressed or implied, regarding the use, accuracy, availability, or completeness of the data presented herein.

Alternative Fueling Stations:

[ALT FUELS](#)

This list of alternative fueling stations is sourced from the U.S. Department of Energy's (DOE) Alternative Fuels Data Center (AFDC) and National Renewable Energy Laboratory (NREL). The DOE's Office of Energy Efficiency & Renewable Energy launched the AFDC in 1991 as a repository for alternative fuel vehicle performance data, which provides a wealth of information and data on alternative and renewable fuels, advanced vehicles, fuel-saving strategies, and emerging transportation technologies. The data includes Biodiesel (B20 and above), Compressed Natural Gas (CNG), Electric, Ethanol (E85), Hydrogen, Liquefied Natural Gas (LNG), Propane (LPG), and Renewable Diesel (R20 and above) fuel type locations.

Government Publication Date: Dec 16, 2025

Superfunds Consent Decrees:

[CONSENT DECREES](#)

This list of Superfund consent decrees is provided by the Department of Justice, Environment & Natural Resources Division (ENRD) through a Freedom of Information Act (FOIA) applicable file. This listing includes Cases filed since 2010 limited to the following: Consent Decrees for CERCLA or Superfund Sites filed and/or as proposed within the ENRD's Case Management System (CMS); and applicable ENRD's Environmental Defense Section (EDS) CERCLA Cases with "Consent" in History Note. CMS may not reflect the latest developments in a case, nor can the agency guarantee the accuracy of the data. ENRD Disclaimer: Congress excluded three discrete categories of law enforcement and national security records from the requirements of the FOIA; response is limited to those records that are subject to the requirements of the FOIA; however, this should not be taken as an indication that excluded records do, or do not, exist.

Government Publication Date: Dec 30, 2025

Air Facility System:

[AFS](#)

This EPA retired Air Facility System (AFS) dataset contains emissions, compliance, and enforcement data on stationary sources of air pollution. Regulated sources cover a wide spectrum; from large industrial facilities to relatively small operations such as dry cleaners. AFS does not contain data on facilities that are solely asbestos demolition and/or renovation contractors, or landfills. ECHO Clean Air Act data from AFS are frozen and reflect data as of October 17, 2014; the EPA retired this system for Clean Air Act stationary sources and transitioned to ICIS-Air.

Government Publication Date: Oct 17, 2014

Registered Pesticide Establishments:

[SSTS](#)

This national list of active EPA-registered foreign and domestic pesticide and/or device-producing establishments is based on data from the Section Seven Tracking System (SSTS). The Federal Insecticide, Fungicide, and Rodenticide Act (FIFRA) Section 7 requires that each producing establishment must place its EPA establishment number on the label or immediate container of each pesticide, active ingredient or device produced. An EPA establishment number on a pesticide product label identifies the EPA registered location where the product was produced. The list of establishments is made available by the U.S. Environmental Protection Agency (EPA).

Government Publication Date: Sep 26, 2025

Polychlorinated Biphenyl (PCB) Transformers:

[PCBT](#)

Locations of Transformers Containing Polychlorinated Biphenyls (PCBs) registered with the United States Environmental Protection Agency. PCB transformer owners must register their transformer(s) with EPA. Although not required, PCB transformer owners who have removed and properly disposed of a registered PCB transformer may notify EPA to have their PCB transformer de-registered. Data made available by EPA.

Government Publication Date: Oct 15, 2019

Polychlorinated Biphenyl (PCB) Notifiers:

[PCB](#)

Facilities included in the national list of facilities that have notified the United States Environmental Protection Agency (EPA) of Polychlorinated Biphenyl (PCB) activities. Any company or person storing, transporting or disposing of PCBs or conducting PCB research and development must notify the EPA and receive an identification number.

Government Publication Date: Aug 12, 2025

Power Plants:

[POWER PLANTS](#)

This list of power plants is provided by the U.S. Energy Information Administration (EIA). The listing includes operable electric generating plants in the United States by energy source, originating from the EIA-860, Annual Electric Generator Report; EIA-860M, Monthly Update to the Annual Electric Generator Report; and EIA-923, Power Plant Operations Report. It includes all operable plants by energy source with a combined nameplate capacity of 1 megawatt or more that are operating, are on standby, or out of service for short- or long-term.

Government Publication Date: Jun 5, 2025

Historical Business Activity Risk:

[HIST RISK](#)

Proprietary list of sites identified as potentially having engaged in business activity that poses a higher-than-normal risk of contamination. Records originate from historical city directories, and are included in this list based on broad business categories Potentially Hazardous Chemical Users and Fuel and Automotive, including but not limited to Dry Cleaners and Fuel Stations, Garages, etc. Inclusion in this listing does not indicate that there is or ever has been contamination; rather, sites are included in this list due to their potential for having engaged in a business activity presenting an elevated risk of contamination. The list was compiled from various city directories including Polks, Millers, Mullin Kille, Interstate Directory, and State Directory Co; spanning roughly 1920s through 1960 depending on information available by city.

Government Publication Date: Jan 1, 1960

NPDES Biosolids Program Permit Holders:

[NPDES BIOSOLIDS](#)

This Water National Pollutant Discharge Elimination System (NPDES) Biosolids Permits list is sourced from the U.S. Environmental Protection Agency's (EPA) Enforcement and Compliance History Online data. EPA's Integrated Compliance Information System (ICIS) for NPDES includes facility and compliance information for NPDES permits in the ECHO Biosolids facility universe. Per the EPA, when sewage from households and businesses (and sometimes wastewater from industrial dischargers) is sent to a wastewater treatment plant, the liquids are separated from the solids, producing a semi-solid, nutrient-rich product known as "sewage sludge" or "biosolids". The EPA typically uses the term "biosolids" to mean sewage sludge that has been treated to meet the agency's regulatory requirements and is intended to be land applied as a soil conditioner or fertilizer.

Government Publication Date: Feb 7, 2026

State

PFAS Sampling Locations:

[PFAS SAMPLING](#)

This data is sourced from the State Water Board's GeoTracker Per- and Polyfluoroalkyl Substances (PFAS) Map tool which contains individual sampling points (i.e., soil boring, groundwater monitoring well, drinking water well for municipal drinking water systems, etc.) or a site location with PFAS analytical data. Includes analytical results that are finalized and submitted electronically by the Responsible Parties via GeoTracker's Electronic Submittal of Information Portal, and after it's accepted by a Regional Water Quality Control Board.

Government Publication Date: Dec 21, 2025

Dry Cleaning Facilities:

[DRYCLEANERS](#)

A list of drycleaner related facilities that have EPA ID numbers. These are facilities with certain SIC codes: power laundries, family and commercial, linen supply, commercial laundry, dry cleaning and pressing machines - Coin Operated Laundry and Dry Cleaning. This is provided by the Department of Toxic Substance Control.

Government Publication Date: Dec 20, 2021

Delisted Drycleaners:

[DELISTED DRYCLEANERS](#)

Sites removed from the list of drycleaner related facilities that have EPA ID numbers, made available by the California Department of Toxic Substance Control.

Government Publication Date: Aug 3, 2023

Non-Toxic Dry Cleaning Incentive Program:

[DRYC GRANT](#)

This list of past Non-Toxic Dry Cleaning Incentive Program grant award recipients is provided by the California Air Resources Board (CARB). The program provided grants to eligible dry cleaning businesses to assist them in transitioning away from perchloroethylene (Perc) machines to alternative non-toxic and non-smog forming technologies such as water-based and CO2 cleaning systems. Per the CARB, this program ended in January 2023 and the information is historical.

Government Publication Date: Aug 3, 2023

PFAS GeoTracker Cleanup Sites:

[PFAS GT CLEANUPS](#)

A list of applicable cleanup sites from the State Water Resources Control Board's (SWRCB) GeoTracker data management system where one or more of the potential contaminants of concern are identified in the PFAS Structure List and/or PFAS Chemicals Without Explicit Structure List made available by the United States Environmental Protection Agency (US EPA).

Government Publication Date: Sep 13, 2025

PFOA/PFOS Groundwater:

[PFAS GW](#)

A list of water wells from the Groundwater Ambient Monitoring and Assessment Program (GAMA) Groundwater Information System with the groundwater chemical perfluorooctanoic acid (PFOA) (NL = 0.014 UG/L) or perfluorooctanoic sulfonate (PFOS) (NL = 0.013 UG/L). The GAMA Groundwater Information System search is made available by California Water Boards.

Government Publication Date: Feb 21, 2026

PFAS Investigations:

[PFAS INVEST](#)

This list of potential Per- and Polyfluoroalkyl Substance (PFAS) sites is compiled from the California State Water Resources Control Board's (SWRCB) PFAS Investigations Map tool. The SWRCB issued investigative orders, per California Water Code (CWC) Section 13267 and/or 13383, to these sites. Orders were also issued to the public water systems to sample wells in the vicinity of these locations. Military facilities have been identified by the Department of Defense (DOD) as part of their efforts to investigate PFAS per the Defense Environmental Restoration Program (DERP) under the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). The data includes locations for Airports, Chrome Plating Facilities, Landfills, Publicly Owned Treatment Works, Refineries and Bulk Terminals, DOD Facilities, and Monitored Drinking Water Wells being investigated for potential PFAS.

Government Publication Date: Jan 23, 2024

Hazardous Waste and Substances Site List - Site Cleanup:

[HWSS CLEANUP](#)

The Hazardous Waste and Substances Sites (Cortese) List is a planning document used by the State, local agencies and developers to comply with the California Environmental Quality Act requirements in providing information about the location of hazardous materials release sites. This list is published by California Department of Toxic Substance Control.

Government Publication Date: Mar 15, 2023

Toxic Pit Cleanup Act Sites:

[TOXIC PITS](#)

The Toxic Pits Cleanup Act (TPCA) list identifies sites suspected of containing hazardous substances where cleanup has not yet been completed. This list was maintained by the State Water Resources Control Board (SWRCB), is not longer maintained, and updates are not planned.

Government Publication Date: Jul 1, 1995

List of Hazardous Waste Facilities Subject to Corrective Action:

[DTSC HWF](#)

This is a list of hazardous waste facilities identified in Health and Safety Code (HSC) § 25187.5. These facilities are those where Department of Toxic Substances Control (DTSC) has taken or contracted for corrective action because a facility owner/operator has failed to comply with a date for taking corrective action in an order issued under HSC § 25187, or because DTSC determined that immediate corrective action was necessary to abate an imminent or substantial endangerment.

Government Publication Date: Jul 18, 2016

EnviroStor Inspection, Compliance, and Enforcement:

[INSP COMP ENF](#)

A list of permitted facilities with inspections and enforcements tracked by the California Department of Toxic Substance Control's (DTSC) EnviroStor data management system.

Government Publication Date: Feb 9, 2026

School Property Evaluation Program Sites:

[SCH](#)

A list of sites registered with The Department of Toxic Substances Control (DTSC) School Property Evaluation and Cleanup (SPEC) Division. SPEC is responsible for assessing, investigating and cleaning up proposed school sites. The Division ensures that selected properties are free of contamination or, if the properties were previously contaminated, that they have been cleaned up to a level that protects the students and staff who will occupy the new school.

Government Publication Date: Oct 2, 2025

California Hazardous Material Incident Report System (CHMIRS):

[CHMIRS](#)

A list of reported hazardous material incidents, spills, and releases from the California Hazardous Material Incident Report System (CHMIRS). This listing has been made available by the California Governor's Office of Emergency Services (Cal OES).

Government Publication Date: Jul 11, 2025

Historical California Hazardous Material Incident Report System (CHMIRS):

[HIST CHMIRS](#)

A list of reported hazardous material incidents, spills, and releases from the California Hazardous Material Incident Report System (CHMIRS) prior to 1993. This list has been made available by the California Office of Emergency Services (OES).

Government Publication Date: Jan 1, 1993

Handlers from Hazardous Waste Manifest Data:

[HAZNET](#)

A list of handlers not otherwise classified as Treatment, Storage, Disposal facilities (TSDF) or generators from the facilities and manifests data made available by the California Department of Toxic Substances Control (DTSC) in their Hazardous Waste Tracking System (HWTS).

Government Publication Date: Feb 20, 2025

Generators from Hazardous Waste Manifest Data:

[HAZ GEN](#)

List of handlers listed as having generated waste from the facilities and manifests data made available by the California Department of Toxic Substances Control (DTSC) in their Hazardous Waste Tracking System (HWTS).

Government Publication Date: Feb 20, 2025

TSDF from Hazardous Waste Manifest Data:[HAZ TSD](#)

List of Treatment, Storage, and Disposal Facilities (TSDFs) from the facilities and manifests data made available by the California Department of Toxic Substances Control (DTSC) in their Hazardous Waste Tracking System (HWTS).

Government Publication Date: Feb 20, 2025

Historical Hazardous Waste Manifest Data:[HIST MANIFEST](#)

A list of historic hazardous waste manifests received by the Department of Toxic Substances Control (DTSC) from year the 1980 to 1992. The volume of manifests is typically 900,000 - 1,000,000 annually, representing approximately 450,000 - 500,000 shipments.

Government Publication Date: Dec 31, 1992

DTSC Registered Hazardous Waste Transporters:[HW TRANSPORT](#)

The California Department of Toxic Substances Control (DTSC) maintains this list of Registered Hazardous Waste Transporters.

Government Publication Date: Feb 20, 2026

Registered Waste Tire Haulers:[WASTE TIRE](#)

This list of registered waste tire haulers is maintained by the California Department of Resources Recycling and Recovery.

Government Publication Date: Jan 11, 2026

California Medical Waste Management Program Facility List:[MEDICAL WASTE](#)

This list of Medical Waste Management Program Facilities is maintained by the California Department of Public Health. The Medical Waste Management Program (MWMP) regulates the generation, handling, storage, treatment, and disposal of medical waste by providing oversight for the implementation of the Medical Waste Management Act (MWMA). The MWMP permits and inspects all medical waste off-site treatment facilities, medical waste transporters, and medical waste transfer stations. This list contains transporters, treatment, and transfer facilities.

Government Publication Date: Jan 20, 2026

Historical Cortese List:[HIST CORTESE](#)

List of sites which were once included on the Cortese list. The Hazardous Waste and Substances Sites (Cortese) List is a planning document used by the State, local agencies and developers to comply with the California Environmental Quality Act requirements for providing information about the location of hazardous sites.

Government Publication Date: Nov 13, 2008

Cease and Desist Orders and Cleanup and Abatement Orders:[CDO/CAO](#)

The California Environment Protection Agency "Cortese List" of active Cease and Desist Orders (CDO) and Cleanup and Abatement Orders (CAO). This list contains many CDOs and CAOs that do NOT concern the discharge of wastes that are hazardous materials. Many of the listed orders concern, as examples, discharges of domestic sewage, food processing wastes, or sediment that do not contain hazardous materials, but the Water Boards' database does not distinguish between these types of orders.

Government Publication Date: Dec 6, 2021

California Environmental Reporting System (CERS) Hazardous Waste Sites:[CERS HAZ](#)

List of sites in the California Environmental Protection Agency (CalEPA) Regulated Site Portal which fall under the following regulatory programs: Hazardous Chemical Management, Hazardous Waste Onsite Treatment, Household Hazardous Waste Collection, Hazardous Waste Generator, RCRA LQ HW Generator. The CalEPA oversees the statewide implementation of the Unified Program which applies regulatory standards to protect Californians from hazardous waste and materials.

Government Publication Date: Jan 12, 2026

Delisted Environmental Reporting System (CERS) Hazardous Waste Sites:[DELISTED HAZ](#)

This database contains a list of sites that were removed from the California Environmental Protection Agency (CalEPA) in the following regulatory programs: Hazardous Chemical Management, Hazardous Waste Onsite Treatment, Household Hazardous Waste Collection, Hazardous Waste Generator, RCRA LQ HW Generator.

Government Publication Date: Nov 29, 2018

Sites in GeoTracker:[GEOTRACKER](#)

GeoTracker is the State Water Resource Control Boards' data management system for sites that impact, or have the potential to impact, water quality in California, with emphasis on groundwater. This is a list of sites in GeoTracker that aren't otherwise categorized as LUST, Land Disposal Sites (LDS), Cleanup Sites, or sites having Waste Discharge Requirements (WDR). This listing includes program types such as Underground Injection Control (UIC), Confined Animal Facilities (CAF), Irrigated Lands Regulatory Program, plans, and non-case information.

Government Publication Date: Aug 11, 2025

Mines Listing:[MINE](#)

This list includes mine site locations extracted from the Mines Online database, maintained by the California Department of Conservation. Mines Online (MOL) is an interactive web map designed with GIS features that provide information such as the mine name, mine status, commodity sold, location, and other mine specific data. Please note: Mine location information is provided to assist experts in determining the location of mine operators in accordance with California Civil Code section 1103.4 and reflects information reported by mine operators in annual reports provided under Public Resources Code section 2207. While the Division of Mine Reclamation (DMR) attempts to populate MOL with accurate location information, the DMR cannot guarantee the accuracy of operator reported location information.

Government Publication Date: Oct 25, 2025

Recorded Environmental Cleanup Liens:[LIEN](#)

The California Department of Toxic Substance Control (DTSC) maintains this list of liens placed upon real properties. A lien is utilized by the DTSC to obtain reimbursement from responsible parties for costs associated with the remediation of contaminated properties.

Government Publication Date: Feb 5, 2026

Waste Discharge Requirements:[WASTE DISCHG](#)

List of sites in California State Water Resources Control Board (SWRCB) Waste Discharge Requirements (WDRs) Program in California, made available by the SWRCB via GeoTracker. The WDR program regulates point discharges that are exempt pursuant to Subsection 20090 of Title 27 and not subject to the Federal Water Pollution Control Act. The scope of the WDRs Program also includes the discharge of wastes classified as inert, pursuant to section 20230 of Title 27.

Government Publication Date: Aug 11, 2025

Toxic Pollutant Emissions Facilities:[EMISSIONS](#)

A list of criteria and toxic pollutant emissions data for facilities in California made available by the California Environmental Protection Agency - Air Resources Board (ARB). Risk data may be based on previous inventory submittals. The toxics data are submitted to the ARB by the local air districts as requirement of the Air Toxics "Hot Spots" Program.

Government Publication Date: Dec 31, 2021

Clandestine Drug Lab Sites:[CDL](#)

The Department of Toxic Substances Control (DTSC) maintains a listing of drug lab sites. DTSC is responsible for removal and disposal of hazardous substances discovered by law enforcement officials while investigating illegal/ clandestine drug laboratories.

Government Publication Date: Dec 13, 2024

Tribal

No Tribal additional environmental record sources available for this State.

County

Definitions

Database Descriptions: This section provides a detailed explanation for each database including: source, information available, time coverage, and acronyms used. They are listed in alphabetic order.

Detail Report: This is the section of the report which provides the most detail for each individual record. Records are summarized by location, starting with the project property followed by records in closest proximity.

Distance: The distance value is the distance between plotted points, not necessarily the distance between the sites' boundaries. All values are an approximation.

Direction: The direction value is the compass direction of the site in respect to the project property and/or center point of the report.

Elevation: The elevation value is taken from the location at which the records for the site address have been plotted. All values are an approximation. Source: Google Elevation API.

Executive Summary: This portion of the report is divided into 3 sections:

'Report Summary'- Displays a chart indicating how many records fall on the project property and, within the report search radii.

'Site Report Summary'-Project Property'- This section lists all the records which fall on the project property. For more details, see the 'Detail Report' section.

'Site Report Summary-Surrounding Properties'- This section summarizes all records on adjacent properties, listing them in order of proximity from the project property. For more details, see the 'Detail Report' section.

Map Key: The map key number is assigned according to closest proximity from the project property. Map Key numbers always start at #1. The project property will always have a map key of '1' if records are available. If there is a number in brackets beside the main number, this will indicate the number of records on that specific property. If there is no number in brackets, there is only one record for that property.

The symbol and colour used indicates 'elevation': the red inverted triangle will dictate 'ERIS Sites with Lower Elevation', the yellow triangle will dictate 'ERIS Sites with Higher Elevation' and the orange square will dictate 'ERIS Sites with Same Elevation.'

Unplottables: These are records that could not be mapped due to various reasons, including limited geographic information. These records may or may not be in your study area, and are included as reference.

APPENDIX B
REGULATORY AGENCY RECORDS



NEWDOC

DEH APN FILE TARGET SHEET
ARCHIVE RECORD
Pre-KIVA & Existing APN Records

Document Name: LARC _____
(LARC_KIVA Per Num_APN)

Document Type: Legacy Septic System Documents

APN(s) 282 141 33

Number of Pages: 5

Document Prepared by: DESIREE HOGERVORST

Document Preparation Date: JUN 11 2009

Office Source: El Cajon

45544

COUNTY OF SAN DIEGO DEPARTMENT OF PUBLIC HEALTH
SEPTIC TANK INSTALLATION REPORT
SOIL CONDITIONS OF TRENCH OR SEEPAGE PIT
PERCOLATION TEST

DEPARTMENT USE ONLY	
Remarks:	APPROVED
Sanitarian:	G. QUICK/K. Olson
Date:	8-17-77

Date **August 15, 1977**

OWNER'S NAME **Herbert Pool** ADDRESS **P. O. Box 243, San Marcos, CA 92069**

CONTRACTOR _____ ADDRESS _____

Legal Location **Portion ROS 1502 known as Lot 18 of Ramona, Acres** Lot _____ Block _____

Test Location **Northwesterly side Hwy 67, 250' +/- Southerly of Letton Street**
(NUMBER, STREET AND TOWN)

THIS REPORT WILL NOT BE REVIEWED UNTIL THE FOLLOWING INFORMATION IS ATTACHED:

1. Lot Location (locate by street)	4. Lot Grade	7. Test Holes
2. Existing and Proposed Structures	5. Wells	8. Sub-Surface Disposal System
3. Surfaced Areas	6. Utility Water Lines	9. Cuts and Fill

SUB-SURFACE DRAINAGE

PERCOLATION TEST	TEST	DEPTH OF HOLE	TIME FOR H ₂ O	SAFETY FACTOR	TIME/INCH	AVE. TIME/IN.
Last two readings shall not vary more than 10%	1	48"	210	1.0	35	30
	2	"	200	"	34	
	3	"	225	"	38	
	4	"	90	"	15	

LEACHING SEEPAGE PITS

DEPTH	COARSE SAND OR GRAVEL	FINE SAND	SANDY LOAM OR SANDY CLAY	CLAY WITH CONSIDERABLE SAND OR GRAVEL	EFFECTIVE ABSORP. AREA

TYPE OF SOIL: Give specific information (clay-adobe-decomposed granite, etc.)

Surface: **Weeds**

1 ft. below surface: **0' - 2' D.G. & brown clay**

2 ft. below surface: **2' - 6-1/2' D.G. w/traces of brown clay**

3 ft. below surface: **6-1/2' - 8' D.G. lt. brown**


8 to 10 ft. below surface: _____

Depth of water table _____

Proposed structure: No. **1**, Type **Commerical (Garages)**

No. of bedrooms: _____, and/or maximum capacity: _____

Similar all Holes

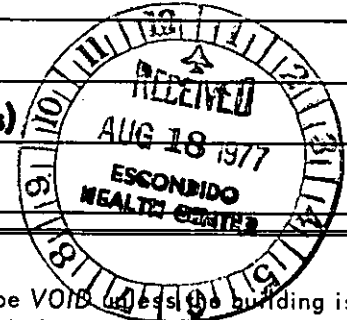

RECOMMENDATIONS:

Drainage tile **250** ft.

Trench width **18** in.

Trench depth **48** in.

Seepage pit width _____ ft.

Seepage pit depth _____ ft.

This percolation test will be VOID unless the building is located as shown and the tile lines or seepage pit are located as shown on the attached plans. Any proposed change shall be approved by the Department of Public Health before construction starts.

Vernon Lee Leming
REGISTERED ENGINEER
VERNON LEE LEMING

RCE #19816

(REG. NO.)

ARN: 282-141-33

POOL, HERBERT

I. SUB-SURFACE DISPOSAL SYSTEM:

A. ☐ DisapprovedB. ☒ Approved method:

1. ☒ Septic tank and drainage tile (per sections II and III)
2. ☐ Septic tank and seepage pit (per sections II and III)
3. ☐ Other (per section III)

II. SEPTIC TANK AND LEACHING SYSTEM AND/OR SEEPAGE PIT:

A. 1000 gallons. Minimum capacity of septic tank

1. 8 ft. Minimum distance from all buildings or structures
2. 5 ft. Minimum distance from all property lines (10 feet for F.H.A. approval)

B. Sub-surface tile system:

1. 250 ft. Minimum total length of disposal trenches
2. 18 in. Minimum trench width (18 in. minimum)
3. 48 in. Maximum trench depth
4. 100 ft. Maximum length of each trench
5. 10 ft. Minimum distance between laterals
6. 5 ft. Minimum distance from all property lines
7. 8 ft. Minimum distance from buildings and structures
8. 4 in. Diameter of drainage tile
9. 1/4 in. Joints with upper half covered with untreated building paper
10. 2 in. Fall of laterals per 100 foot
11. 1 to 1 1/2 in. Commercial grade of crushed rock (12" below and 4 in. above tile line)

C. Seepage Pit

1. 4 ft. Minimum diameter
2. 8 ft. Minimum distance from buildings or structures & all property lines (F.H.A. requires a min. distance of 10-ft. from property lines and 20 ft. from foundation walls.)
3. Fill the void between the sidewall and the cribbing with pea gravel
4. Two or more seepage pits shall be connected to a distribution box
5. 20 ft. Minimum distance between pits.

III. RECOMMENDATIONS:

A. ☐ Subject to the engineer submitting an acceptable capacity percolation report upon the one or more completed seepage pits. The proposed installation shall absorb a quantity of clear water in a twenty-four (24) hour period equal to at least five (5) times the liquid capacity of the septic tank.

B. ☒ Other: Provide 2' rock under pipe in trench.

G. QUICK/K. Olson

APPROVED _____

COUNTY OF SAN DIEGO DEPARTMENT OF PUBLIC HEALTH
1600 PACIFIC HIGHWAY, SAN DIEGO, CA 92101
PHONE: 236-2243

VERMONT STREET

126.26'

EXISTING 60' WIDE PRIVATE ROAD EASEMENT

SEPTIC SYSTEM LAYOUT:

HERBERT POOL

P.O. BOX 243

SAN MARCOS, CA. 92069

787-2237

LEGAL:


FOR ROS 1502, KNOWN AS LOT 18, OF RAMONA ACRES.

ASSESSOR'S NO.:

282-141-33

This percolation test will be VOID unless the building is located as shown and the tile lines or cesspool are located as shown on the attached plans. Any proposed change shall be approved by the Department of Public Health before construction starts.

1" = 40' NORTH

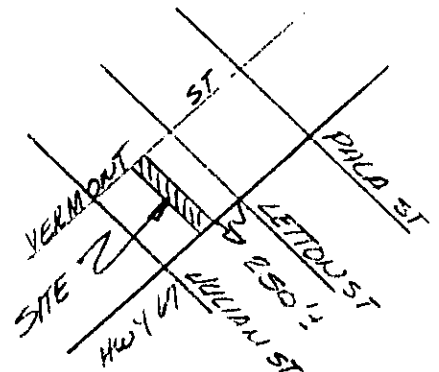

PROPOSED BUILDING PAD
EL. 100.5

345.00'

345.00'

5' MIN

5' MIN

EXISTING 30' WIDE PRIVATE ROAD EASEMENT

126.26'

MAIN STREET

LEMING & ASSOCIATES

CIVIL ENGINEERING-SURVEYING-PLANNING

321 HUNTER ST., RAMONA, CALIF. 92065

714-789-3070

22-919

LEMING AND ASSOCIATES

321 Hunter Street
RAMONA, CALIF. 92065
(714) 789-3070

JOB

27-269

SHEET NO.

CALCULATED BY

GDK

CHECKED BY

SCALE

OF

DATE

8-15-77

DATE

A- REFERENCE: "MANUAL OF SEPTIC-TANK PRACTICE" (1970)
DHEW PUBLICATIONS NO (HSM) 72-10020

B- ASSUMPTIONS:

1- NEW 4,000 S.F. GARAGE TO BE CONSTRUCTED W/ TWO BATHS
& ONE EXTRA SINK.

2- GARAGE TO BE USED ONE SHIFT DAILY.

C- LOAD FROM PROPOSED BUILDING:

1- OCCUPANCY - = 4

2- LOAD PER PERSON = 10 G.P.D. (TABLE 7)

3- SINK LOAD = $16\frac{1}{2}$ GPD (TABLE 8)

4- MAXIMUM LOAD = $20 \times 10 + 16\frac{1}{2} = 216.5$

5- FACTOR OF SAFETY = 1.5

6- DESIGN LOAD = $1.5 \times 216.5 = 324.75$



D- CAPACITY OF SYSTEM:

1- MAXIMUM RATE OF SEWAGE APPLICATION = 0.9
GAL/SF/DAY (TABLE 11)

2- CAPACITY = $245 \times 1.5 \times 0.9 = 300.6 \text{ G.P.D.} < 324.75 \text{ G.P.D.}$

$250 \times 1.5 \times 0.9 = 337.5 \text{ G.P.D.} > 324.75 \text{ G.P.D.} \Rightarrow \text{USE}$

CONCLUSION: ~~250~~ LF LEACH LINE IN AN 18" WIDE
TRENCH @ 48" DEEP.

County of San Diego
Department of Environmental Health & Quality
Land and Water Quality Division

PRE-APPLICATION CONFERENCE WORKSHEET

Date: March 1, 2022
Acella Permit: PDS2022-IC-22-021
Project Type: Initial Consultation
Project Name: Colonnade on Main
Owner / Applicant: Prime Time Development, LLC
Site Location: Highway 67, between Julian and Letton Street
APN: 282-141-32, 282-141-33, 282-141-34
DEHQ Reviewer: Scott Rosecrans
PDS Planner: Regina Ochoa

COMMENTS:

The Department of Environmental Health & Quality (DEHQ) has reviewed the proposed Initial Consultation, submitted to Planning and Development Services (PDS) on 2/25/22. The Project would consist of a 95-room hotel. The project would be provided potable water and sanitary sewer service by Ramona Municipal Water District. DEHQ has no objection to the submittal of the proposed project.

The following DEHQ items were noted during the review of the proposed project:

- A previous Site Assessment case (DEH1991-LSAM-H05399-001) was closed after removal of an underground storage tank. No impacts are expected for the proposed development from this prior action.
- Any septic tanks that may be discovered during development of the project would be required to be pumped clean by a permitted waste hauler and the tank(s) would be required to be collapsed and backfilled or removed from the site.
- DEHQ has no records of any wells on the site, but full access to the property was not available at the time of the site inspection. Any wells located on the property would need to be evaluated by DEHQ staff, should they be discovered, prior to or during development.

Please contact Scott Rosecrans if you have any questions: 619-208-0337 or scott.rosecrans@sdcounty.ca.gov

[Skip to main content](#)

County of San Diego

Request Visibility:  Unpublished

Request 26-1579 Open



Dates

Received

March 24, 2026 via web

Requester

 Milena LaBarbiera ml@weisenviro.com 1938 Kellogg Avenue, Suit
116, Carlsbad, CA, 92008 9083078205 Weis Environmental, LLC

Additional information

Timeframe for records search
(if applicable)*No data entered*

Request

Hello. We are seeking County of San Diego Department of Environmental Health (HMD and SAM) and Land and Water Quality records for the property located at 2019-2021 and 2037 Main Street in the community of Ramona, San Diego County, California. The property is identified as San Diego County APNs 282-141-32-00, -33-00, and -34-00. Thank you.

Timeline

Documents



Message to requester

Requester + Staff

Hello,

Thank you for requesting a record. Staff will review requests in the order they are received and will contact you if they need more information to provide the records requested.

Most County of San Diego records are already publicly available. You can find more information [here](#).

**Address/APN/Permit Number
(if applicable)***No data entered*

You can also visit the [County of San Diego Data Portal](#) to check if the record you're seeking is already available.

If you no longer need the information requested, please send us a message by visiting the link below and we will close your request.

March 24, 2026, 10:47am

Invoices

No invoices due

Staff assigned**Departments***No departments available***Point of contact**

Clerk of the Board

**Request opened**[Anyone with access to this request](#)

Request received via web

March 24, 2026, 10:47am by the requester

Helpful Suggestions**Help****Privacy****Terms****County of San Diego****CIVICPLUS****NextRequest**



Outlook

Your County of San Diego public records request #26-1579 has been closed.

From Public Records Act Unit County of San Diego <messages@nextrequest.com>

Date Wed 3/25/2026 10:57 AM

To ml@weisenviro.com <ml@weisenviro.com>

-- Attach a non-image file and/or reply ABOVE THIS LINE with a message, and it will be sent to staff on this request. --

County of San Diego Public Records

Record request #26-1579 has been closed. The closure reason supplied was:

Hello,

This is in response to your California Public Records Act request, which the County of San Diego received on **03/24/2026** and which states:

We are seeking County of San Diego Department of Environmental Health (HMD and SAM) and Land and Water Quality records for the property located at 2019-2021 and 2037 Main Street in the community of Ramona, San Diego County, California. The property is identified as San Diego County APNs 282-141-32-00, -33-00, and -34-00.

DEHQ does not have any records responsive to your request. Please note that 72 hours after you receive this message your request will become publicly available.

Thank you,
DEHQ- Hazardous Materials Division
County of San Diego

View Request 26-1579

<https://pra.sandiegocounty.gov/requests/26-1579>



Questions about your request? Reply to this email or sign in to contact staff at County of San Diego.

Technical support: See our [help page](#)

APPENDIX C
HISTORICAL RESOURCES



HISTORICAL AERIALS

Project Property: Proposed Hotel Ramona Phase I

2021 Main Street

Ramona CA 92065

Project No: 6025338

Requested By: NOVA Services, Inc.

Order No: 25121100452

Date Completed: December 15, 2025

Aerial Maps included in this report are produced by the sources listed above and are to be used for research purposes including a phase I report. Maps are not to be resold as commercial property. ERIS provides no warranty of accuracy or liability. The information contained in this report has been produced using aerial photos listed in above sources by ERIS Information Inc. (in the US) and ERIS Information Limited Partnership (in Canada), both doing business as 'ERIS'. The maps contained in this report do not purport to be and do not constitute a guarantee of the accuracy of the information contained herein. Although ERIS has endeavored to present information that is accurate, ERIS disclaims, any and all liability for any errors, omissions, or inaccuracies in such information and data, whether attributable to inadvertence, negligence or otherwise, and for any consequences arising therefrom. Liability on the part of ERIS is limited to the monetary value paid for this report.

Environmental Risk Information Services

A division of Glacier Media Inc.


1.866.517.5204 | info@erisinfo.com | erisinfo.com

Date	Source	Scale	Comments
2022	United States Department of Agriculture	1" = 500'	
2020	United States Department of Agriculture	1" = 500'	
2018	United States Department of Agriculture	1" = 500'	
2016	United States Department of Agriculture	1" = 500'	
2014	United States Department of Agriculture	1" = 500'	
2012	United States Department of Agriculture	1" = 500'	
2010	United States Department of Agriculture	1" = 500'	
2009	United States Department of Agriculture	1" = 500'	
2005	United States Department of Agriculture	1" = 500'	
2004	United States Department of Agriculture	1" = 500'	
2002	United States Geological Survey	1" = 500'	
1996	United States Geological Survey	1" = 500'	
1994	United States Geological Survey	1" = 500'	
1985	United States Geological Survey	1" = 500'	
1981	United States Geological Survey	1" = 500'	
1974	Private	1" = 500'	
1971	United States Geological Survey	1" = 500'	
1963	Cartwright Aerial Surveys	1" = 500'	
1953	Agricultural Stabilization & Conserv. Service	1" = 500'	
1949	Agricultural Stabilization & Conserv. Service	1" = 500'	
1939	Fairchild	1" = 500'	
1928	County of San Diego	1" = 500'	

Environmental Risk Information Services

A division of Glacier Media Inc.

1.866.517.5204 | info@erisinfo.com | erisinfo.com

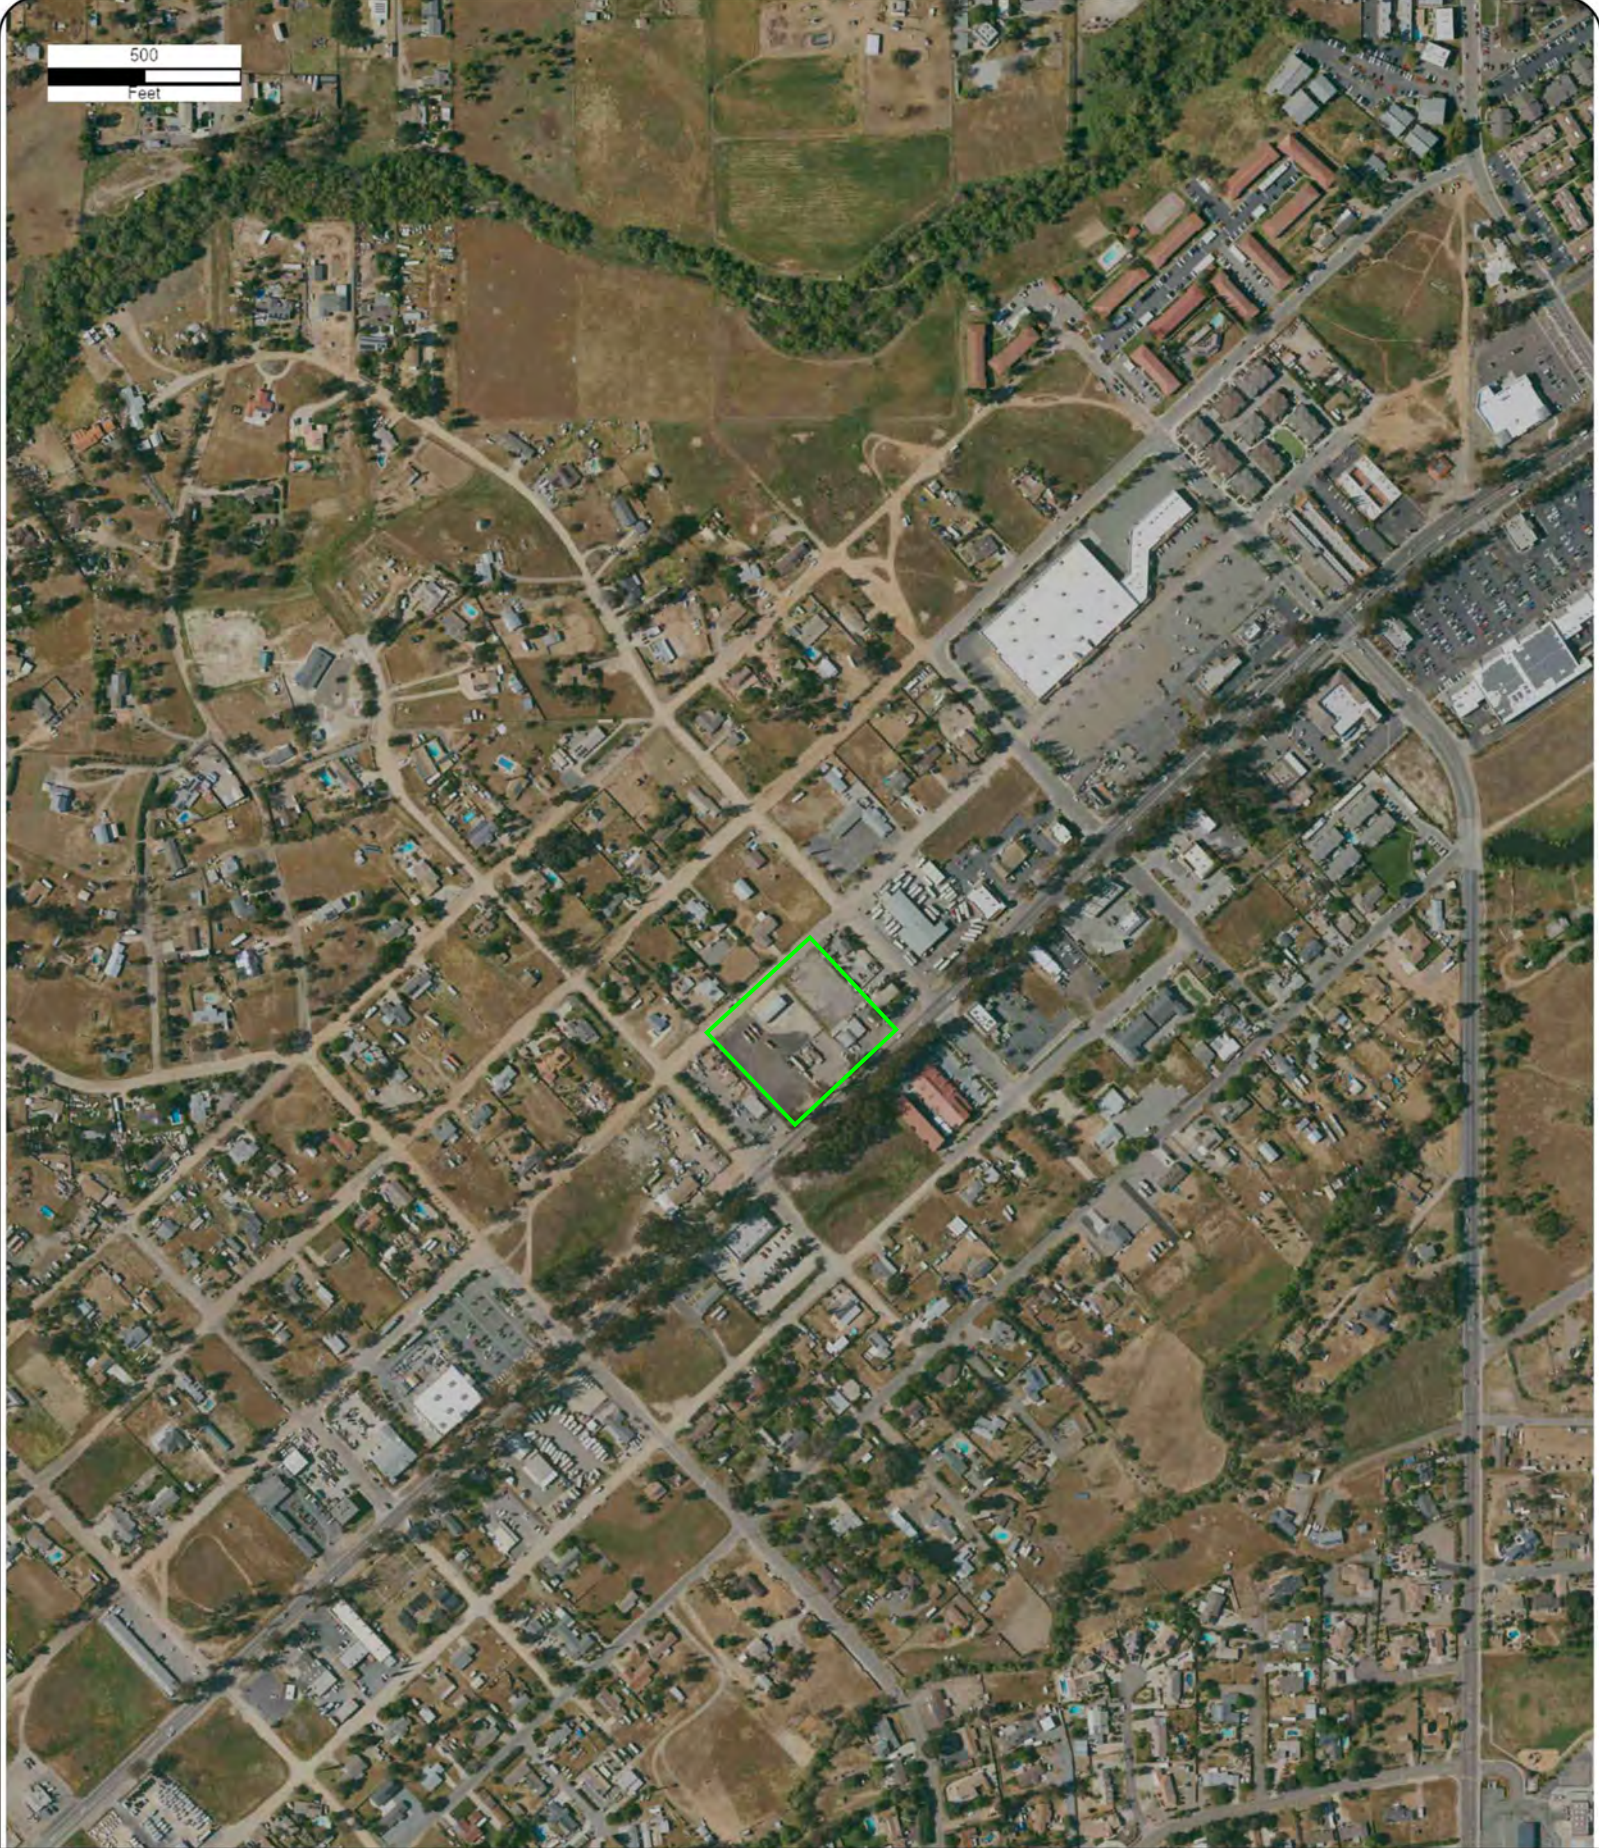


Year: 2022
Source: USDA
Scale: 1" = 500'
Comment:

Address: 2021 Main Street, Ramona, CA
Approx Center: -116.88530402,33.0321801

Order No: 25121100452



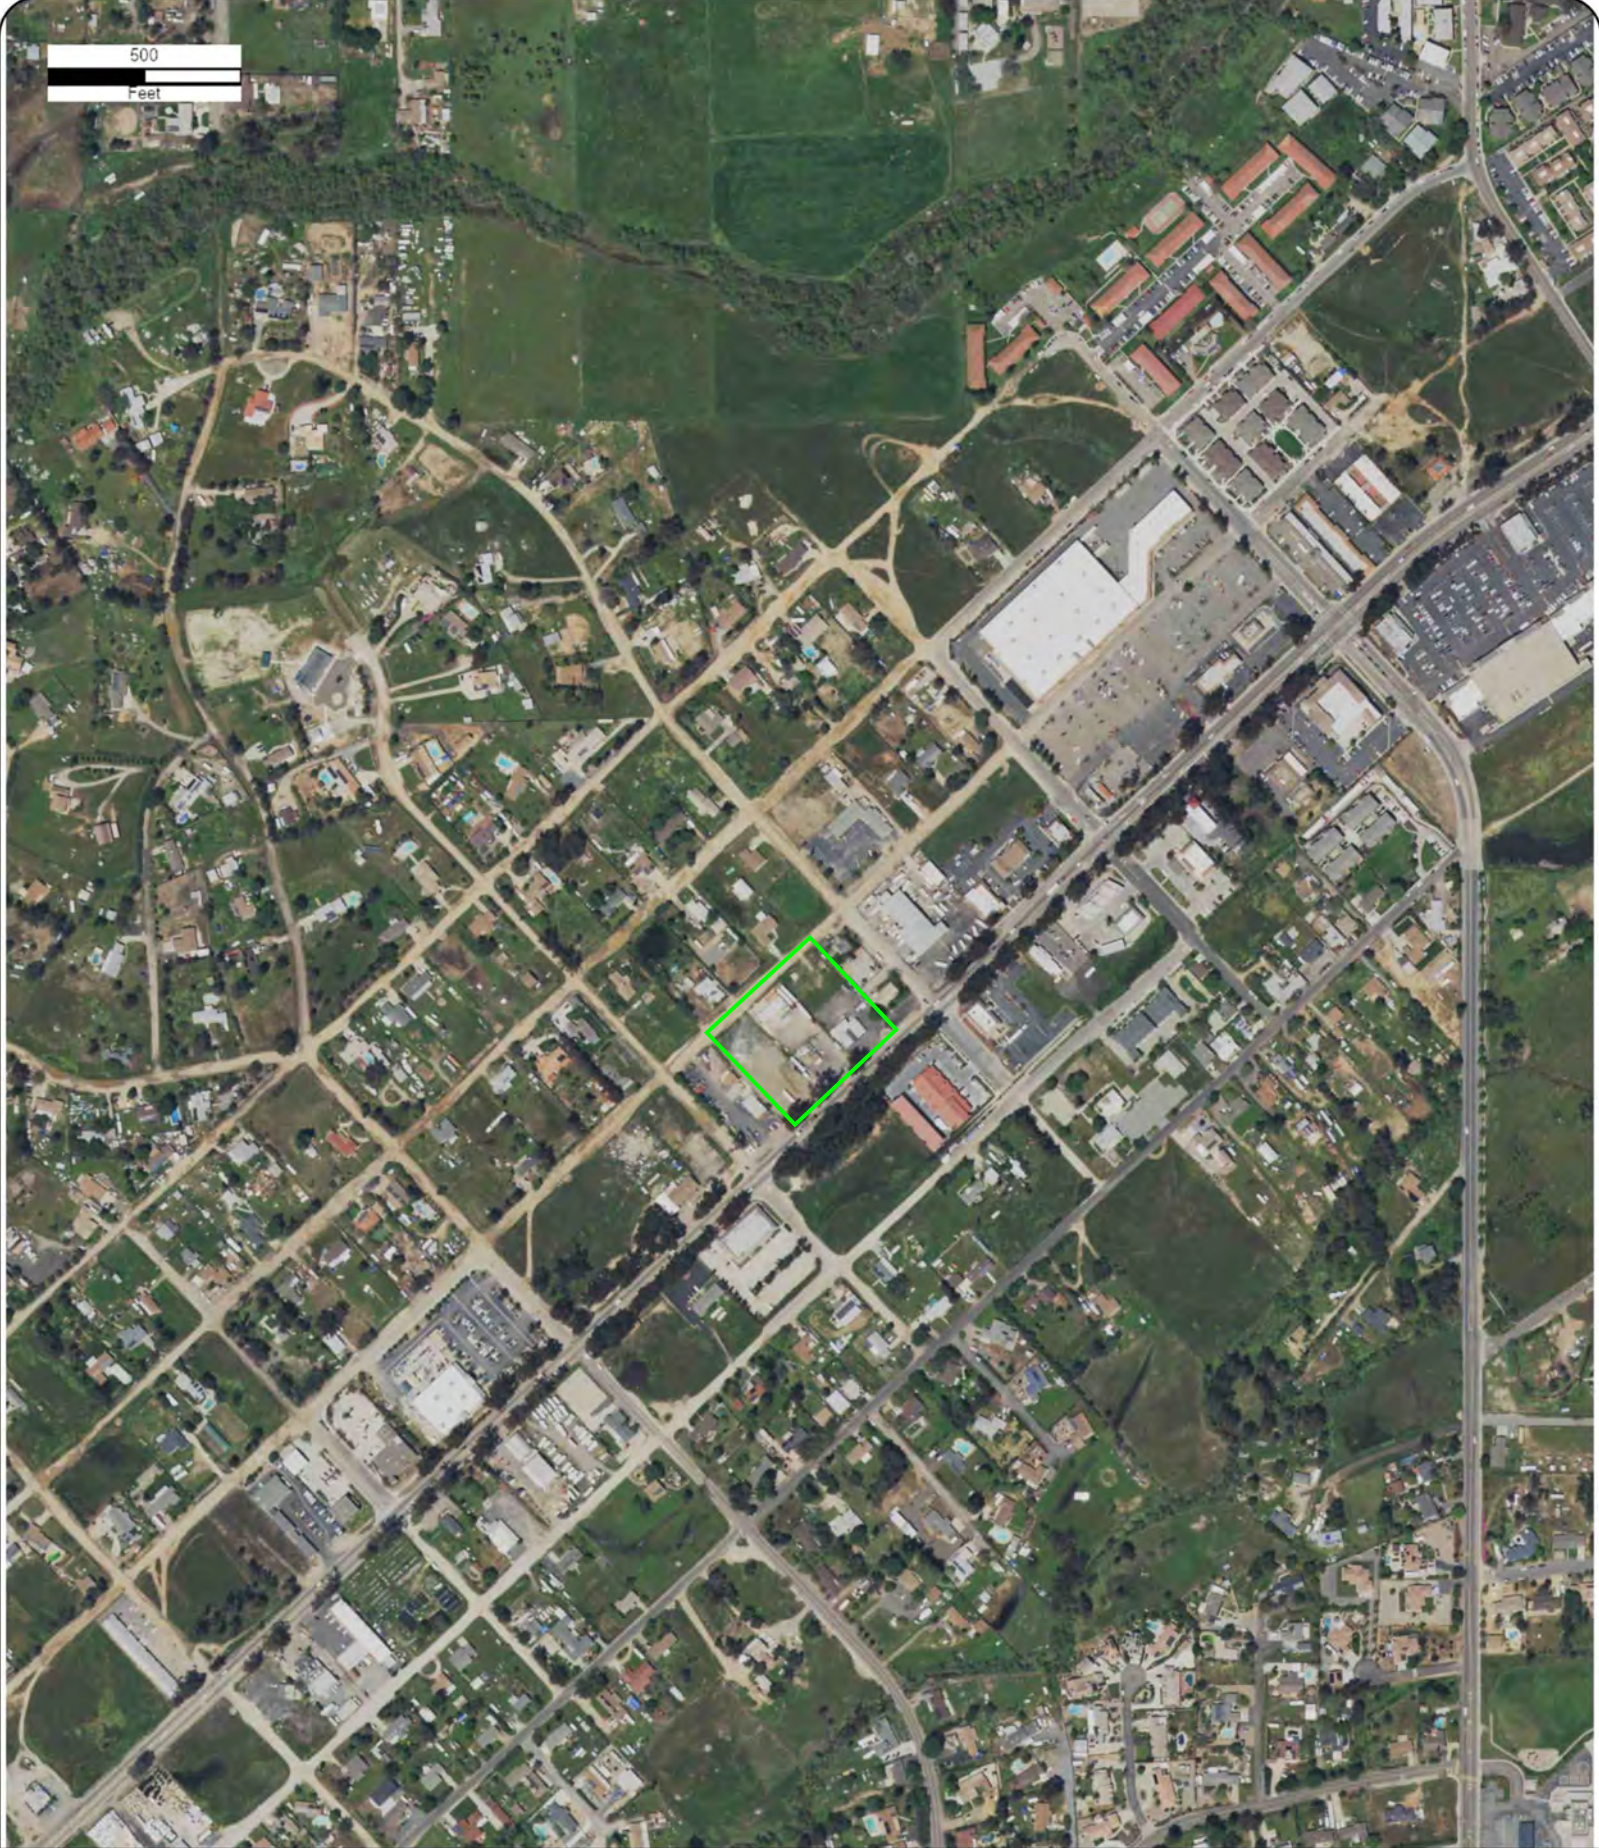

Year: 2020
Source: USDA
Scale: 1" = 500'
Comment:

Address: 2021 Main Street, Ramona, CA
Approx Center: -116.88530402,33.0321801

Order No: 25121100452






Year: 2018
Source: USDA
Scale: 1" = 500'
Comment:

Address: 2021 Main Street, Ramona, CA
Approx Center: -116.88530402,33.0321801

Order No: 25121100452



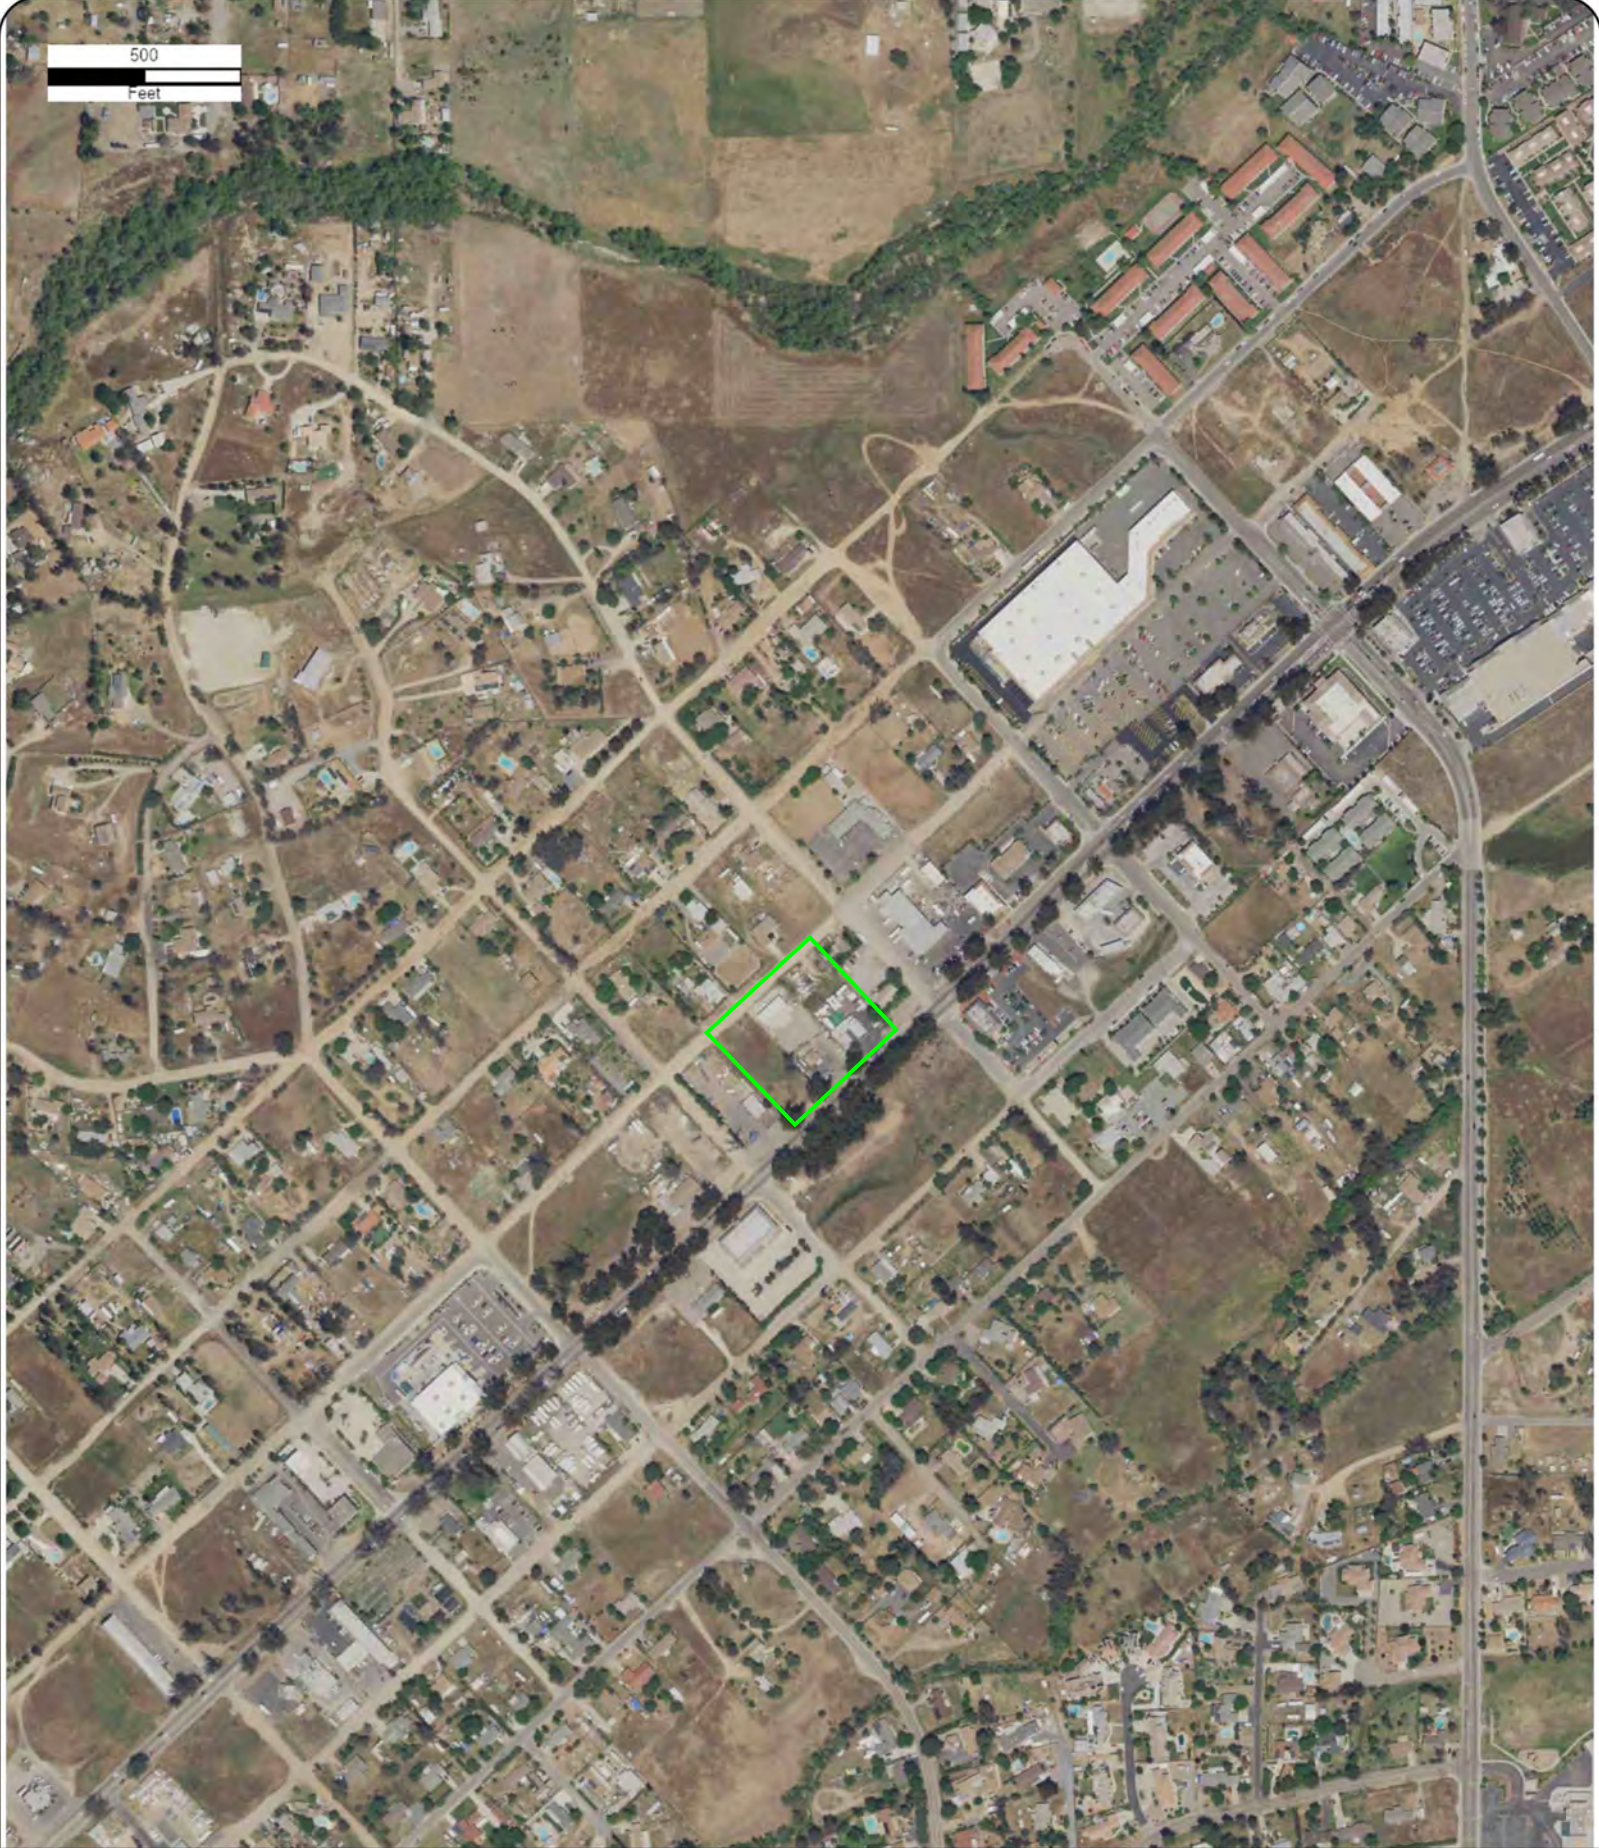


Year: 2016
Source: USDA
Scale: 1" = 500'
Comment:

Address: 2021 Main Street, Ramona, CA
Approx Center: -116.88530402,33.0321801

Order No: 25121100452



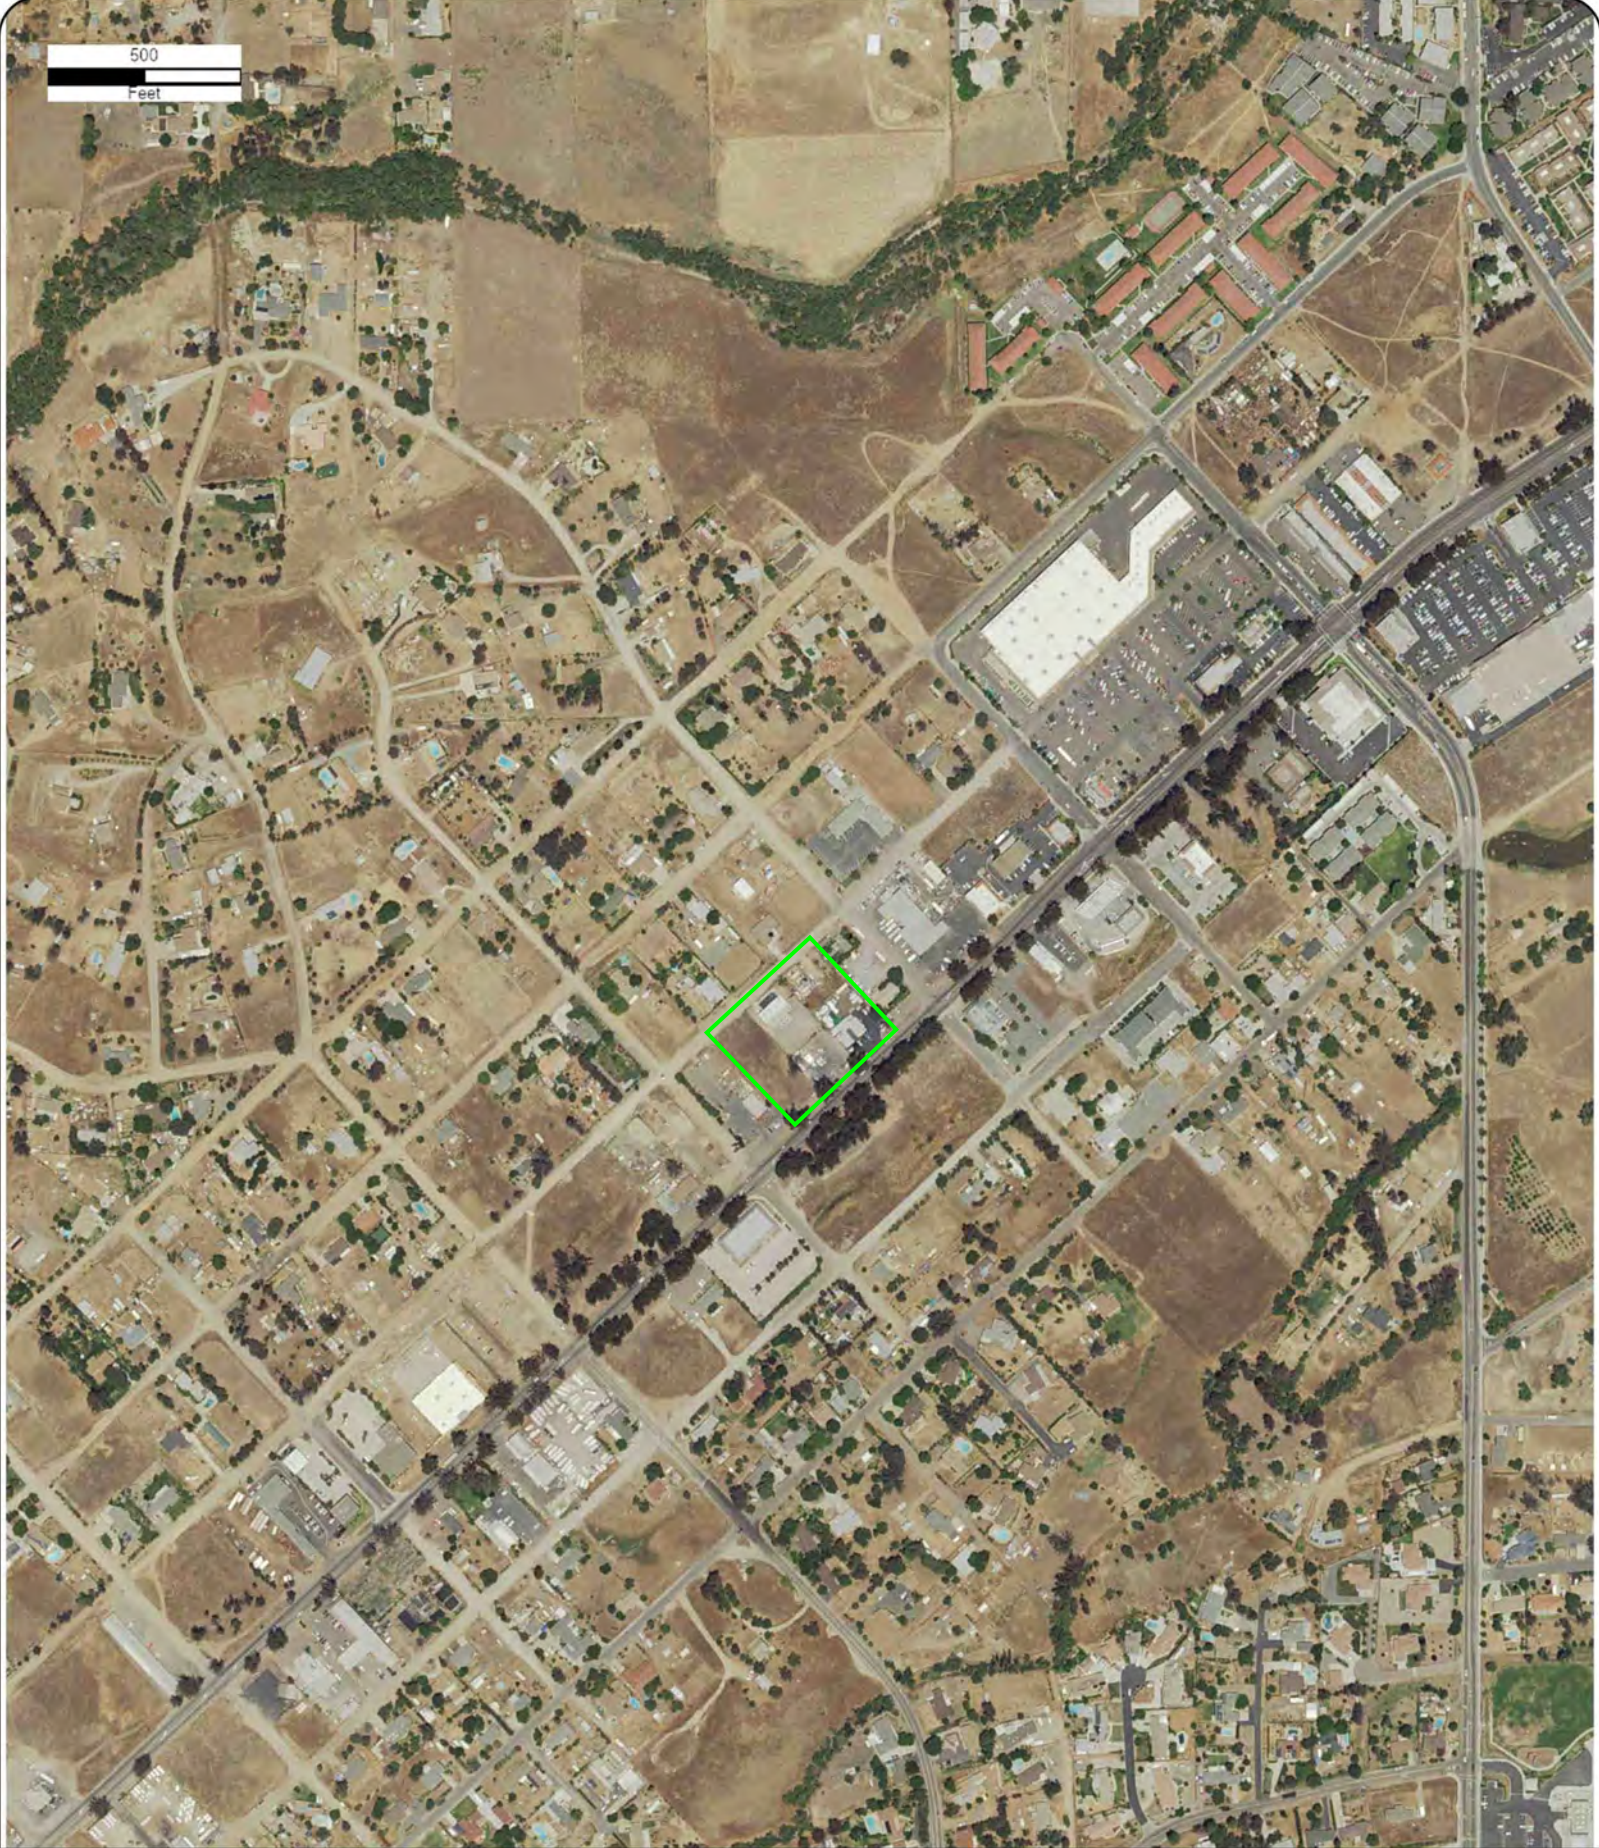

Year: 2014
Source: USDA
Scale: 1" = 500'
Comment:

Address: 2021 Main Street, Ramona, CA
Approx Center: -116.88530402,33.0321801

Order No: 25121100452






Year: 2012
Source: USDA
Scale: 1" = 500'
Comment:

Address: 2021 Main Street, Ramona, CA
Approx Center: -116.88530402,33.0321801

Order No: 25121100452



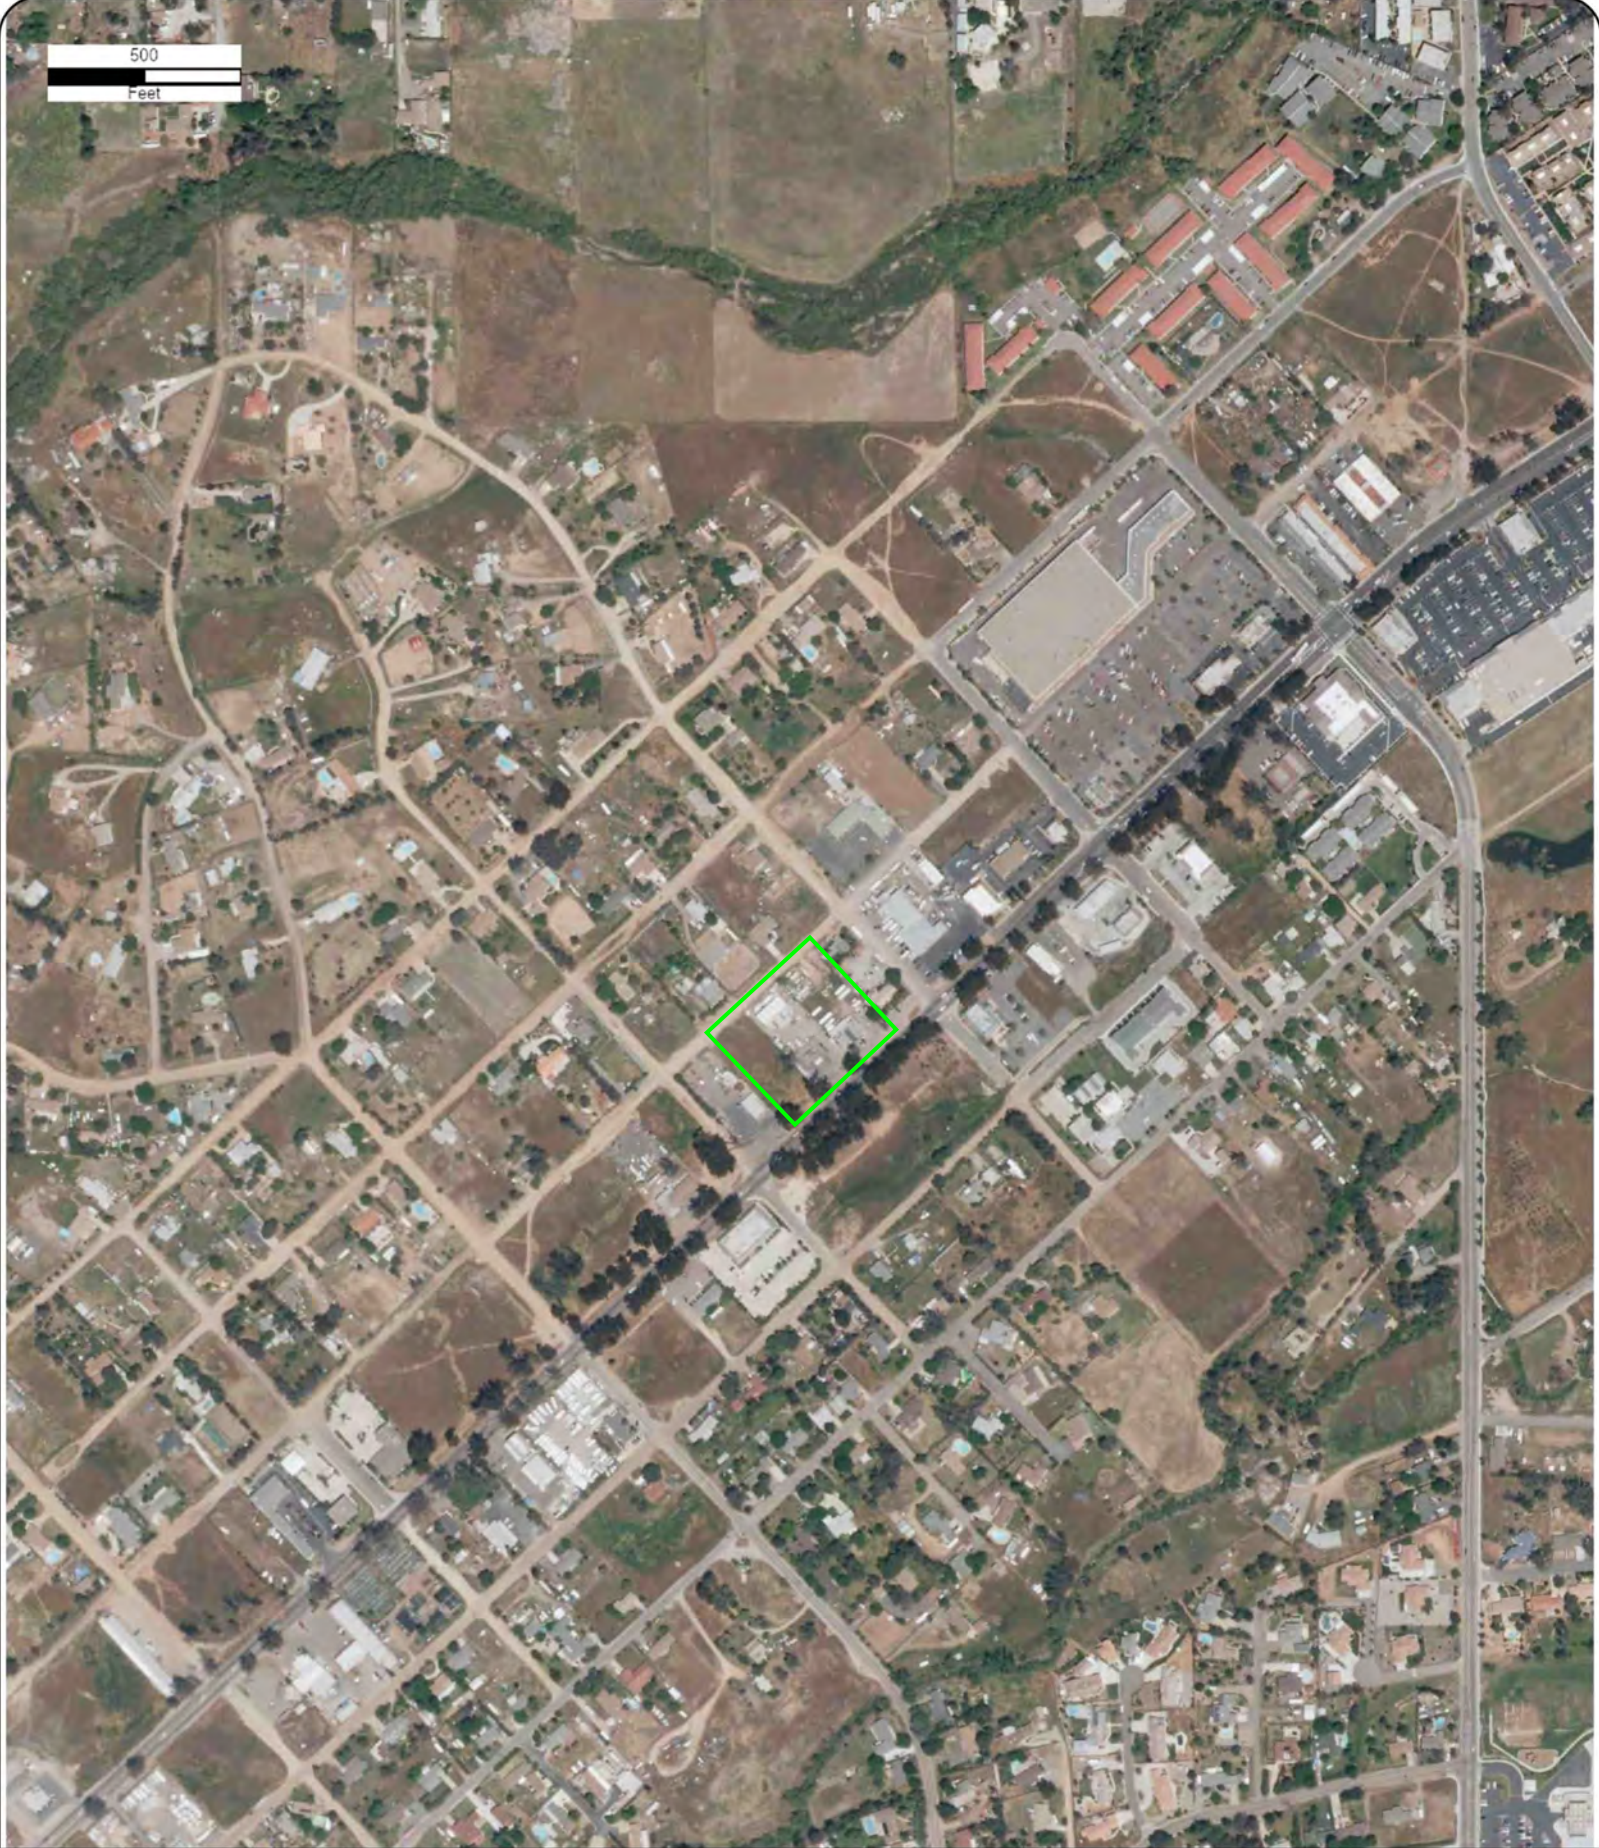

Year: 2010
Source: USDA
Scale: 1" = 500'
Comment:

Address: 2021 Main Street, Ramona, CA
Approx Center: -116.88530402,33.0321801

Order No: 25121100452






Year: 2009
Source: USDA
Scale: 1" = 500'
Comment:

Address: 2021 Main Street, Ramona, CA
Approx Center: -116.88530402,33.0321801

Order No: 25121100452



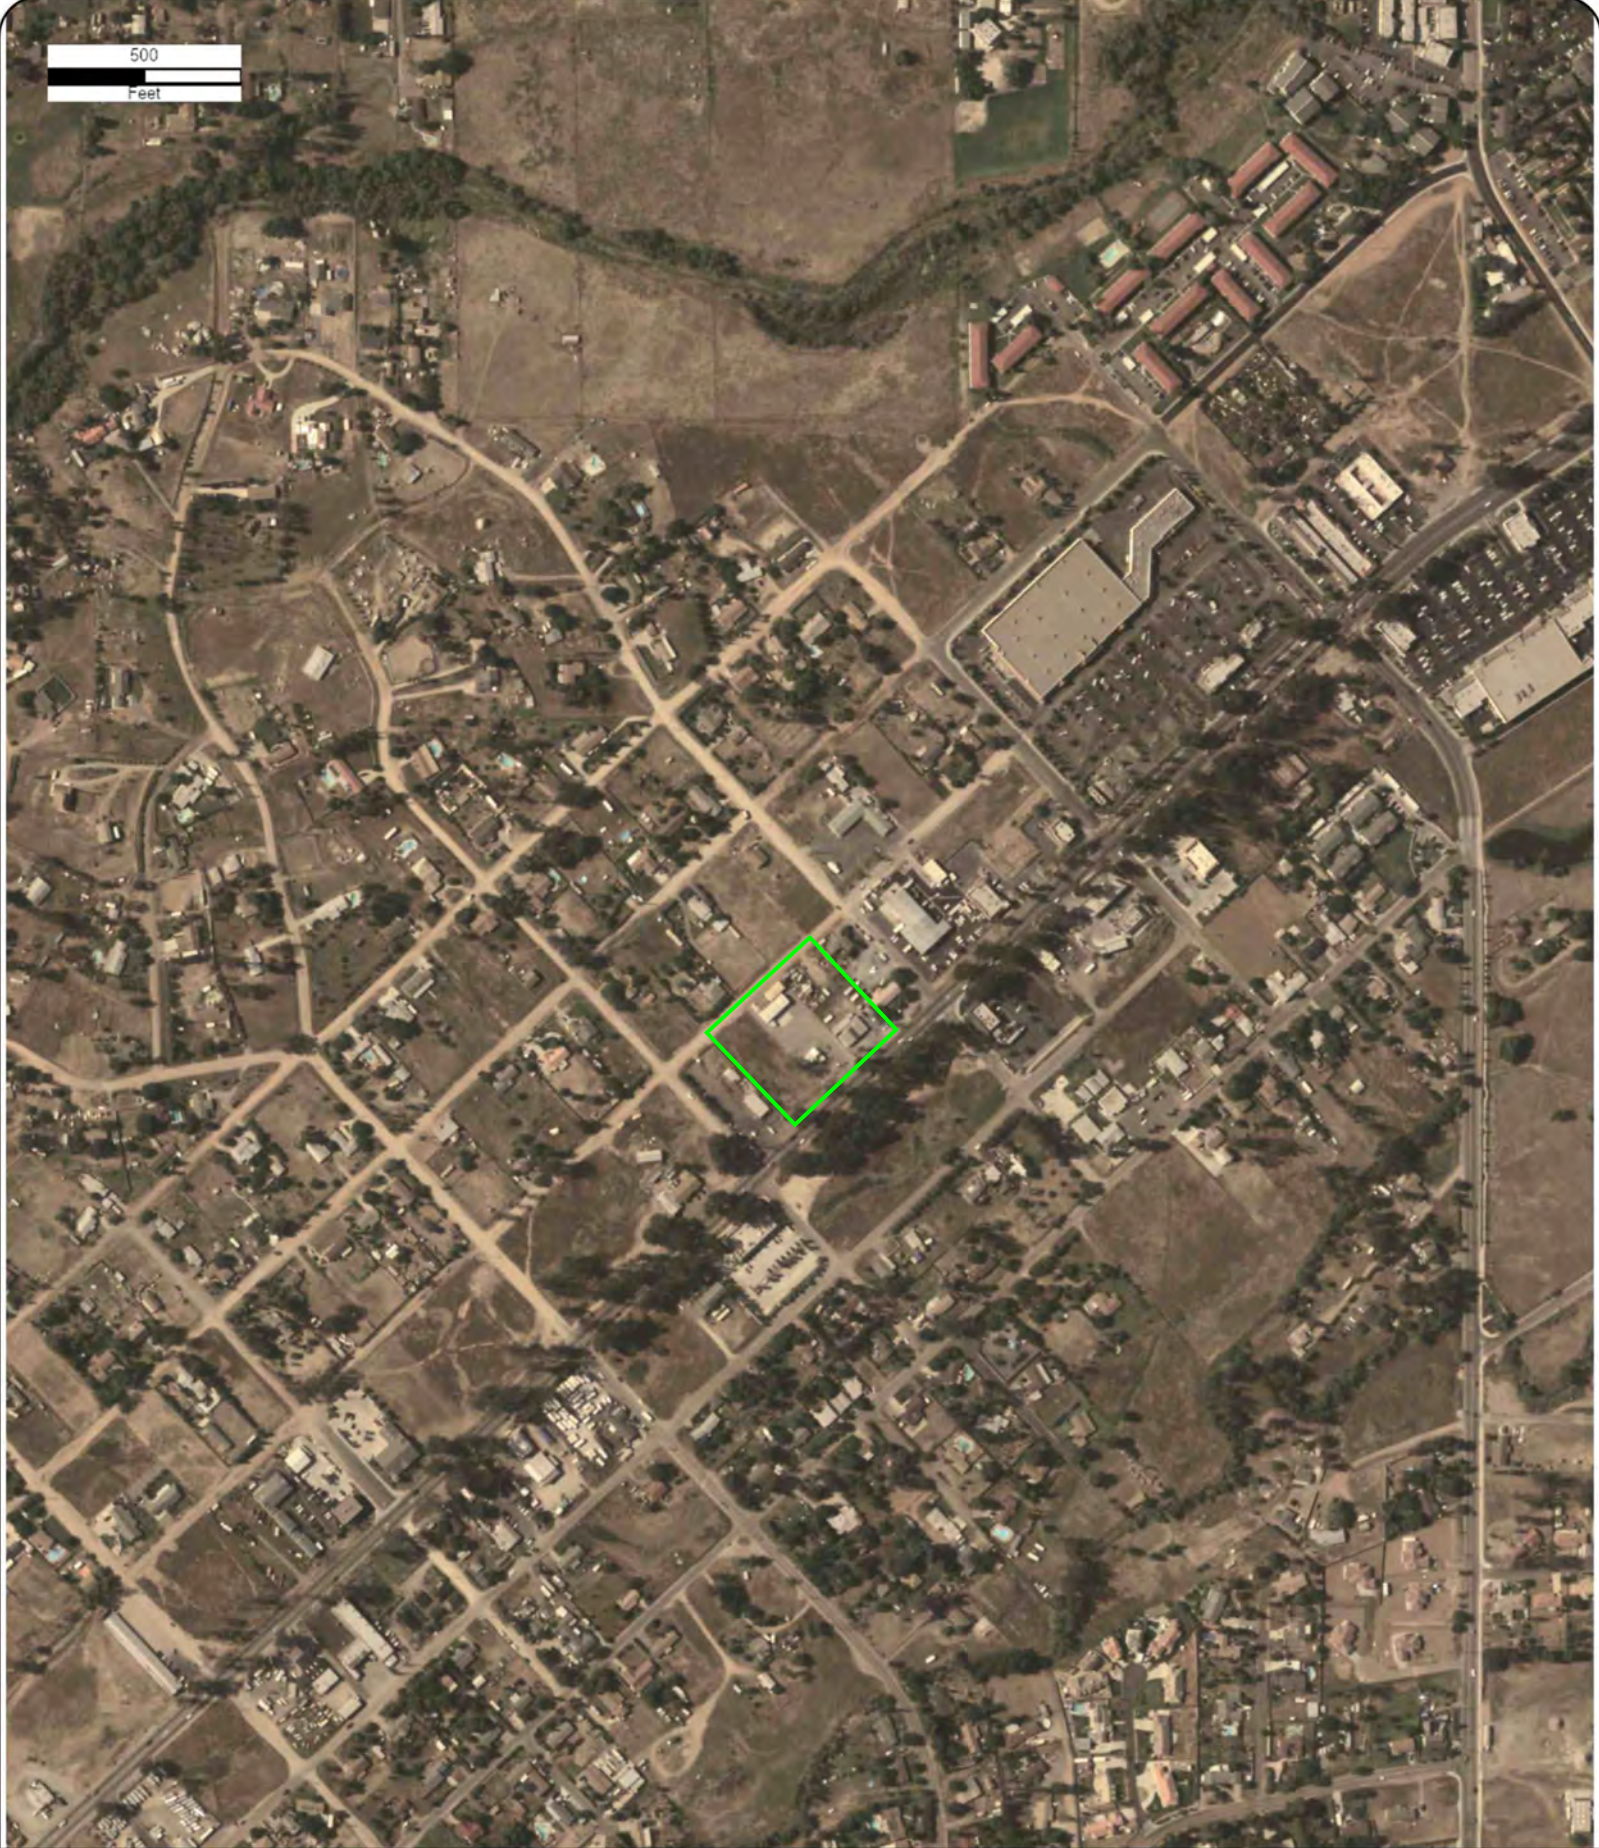


Year: 2005
Source: USDA
Scale: 1" = 500'
Comment:

Address: 2021 Main Street, Ramona, CA
Approx Center: -116.88530402,33.0321801

Order No: 25121100452



500
Feet

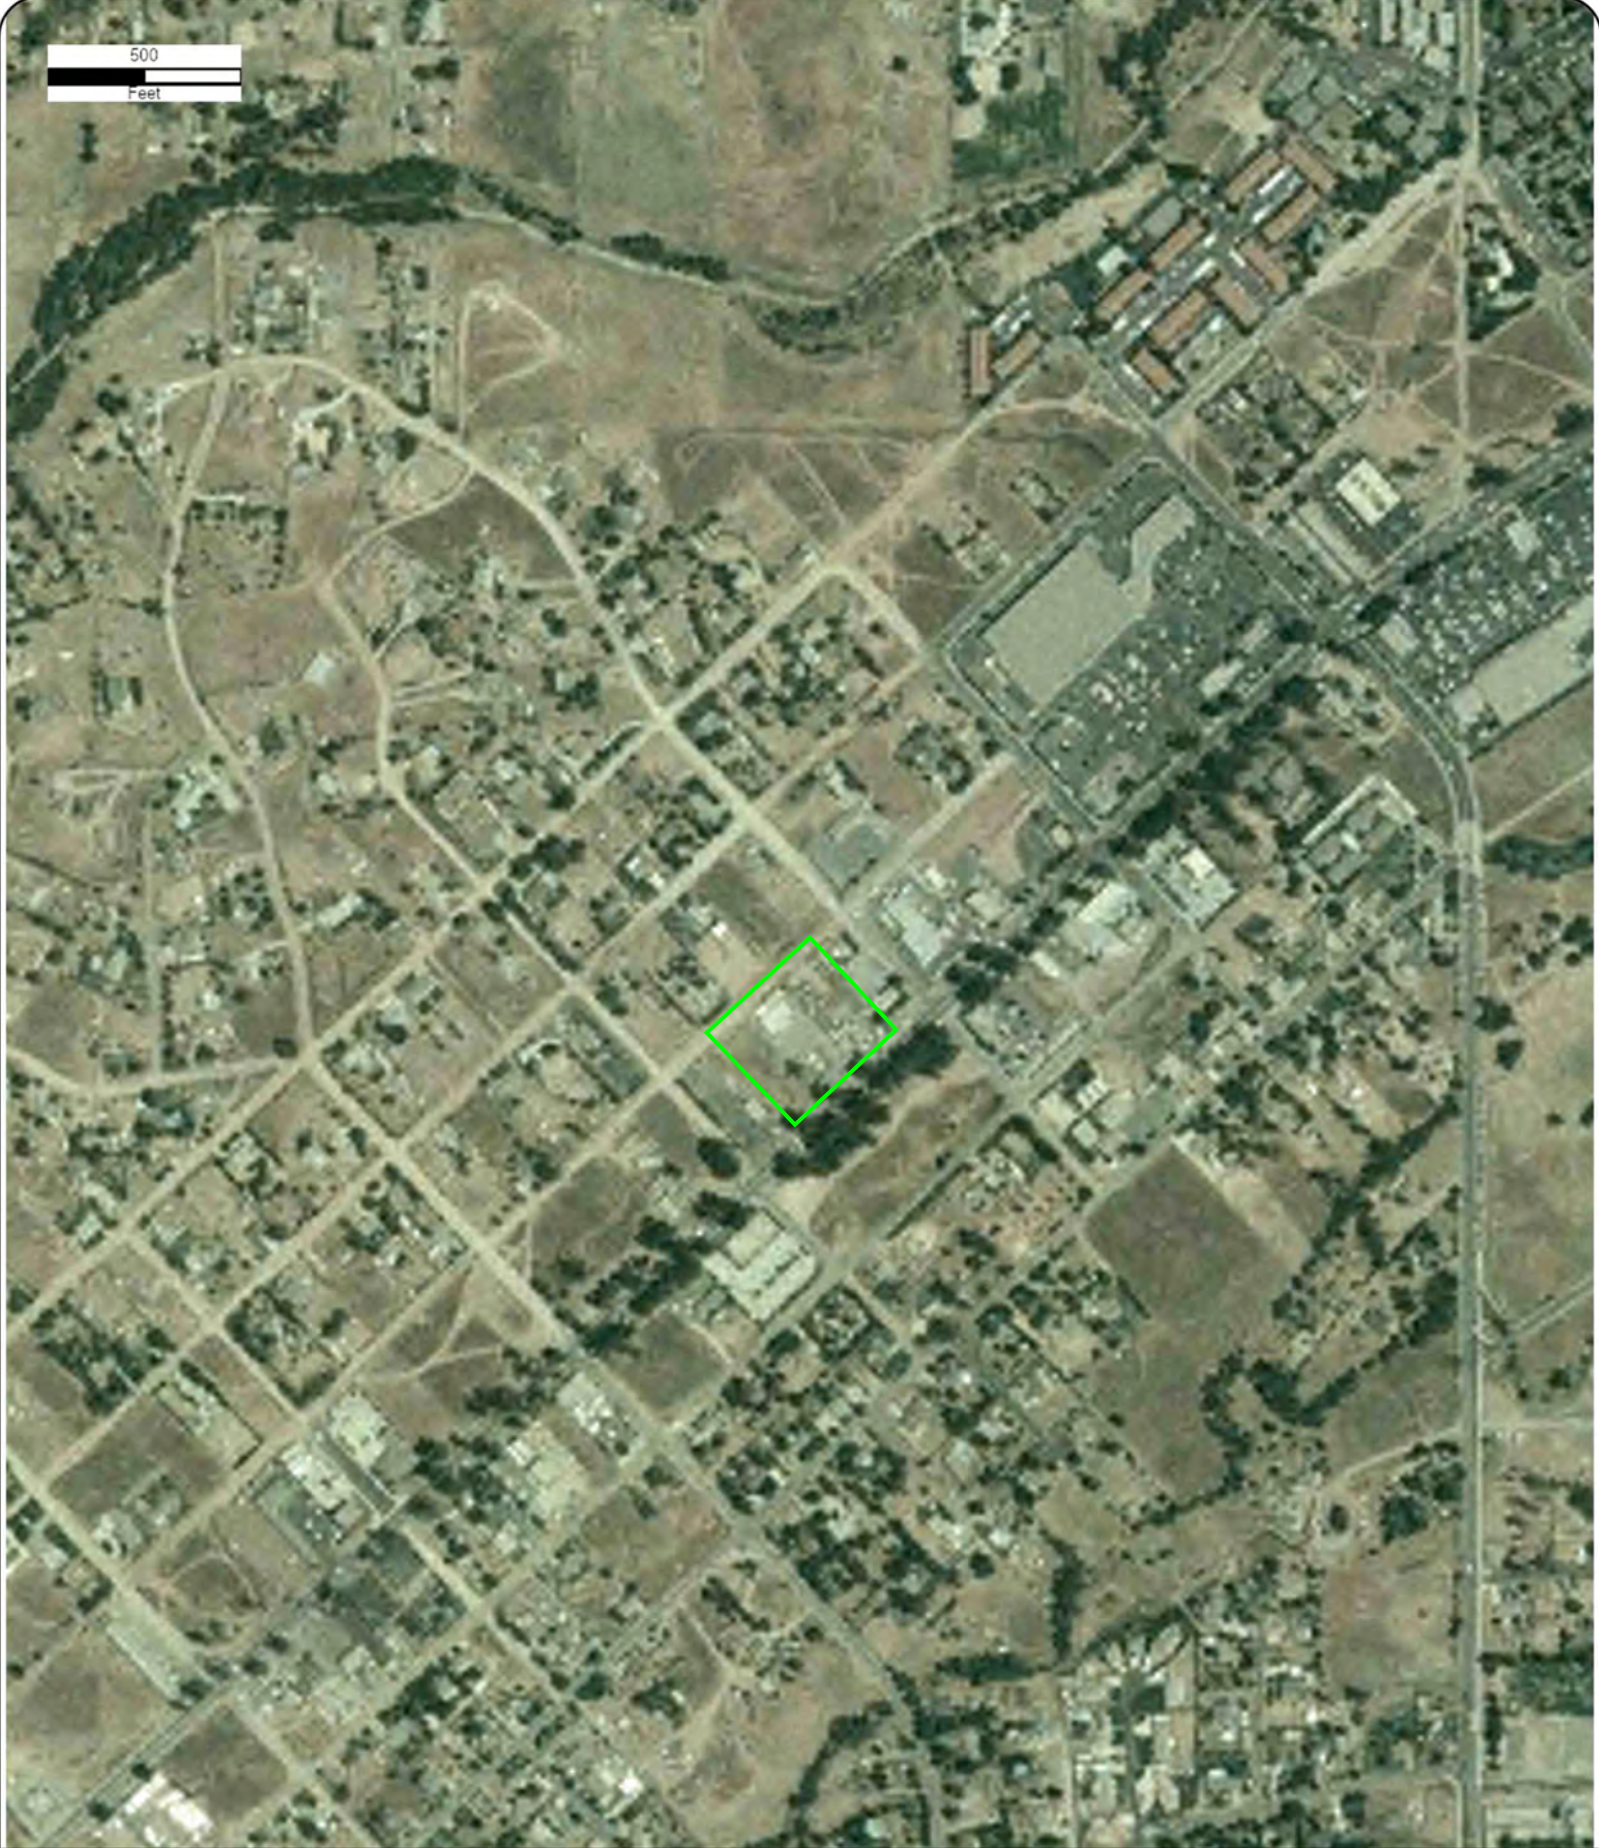

Year: 2004
Source: USDA
Scale: 1" = 500'
Comment:

Address: 2021 Main Street, Ramona, CA
Approx Center: -116.88530402,33.0321801

Order No: 25121100452



500
Feet



Year: 2002
Source: USGS
Scale: 1" = 500'
Comment:

Address: 2021 Main Street, Ramona, CA
Approx Center: -116.88530402,33.0321801

Order No: 25121100452





Year: 1996
Source: USGS
Scale: 1" = 500'
Comment:

Address: 2021 Main Street, Ramona, CA
Approx Center: -116.88530402,33.0321801

Order No: 25121100452





Year: 1994
Source: USGS
Scale: 1" = 500'
Comment:

Address: 2021 Main Street, Ramona, CA
Approx Center: -116.88530402,33.0321801

Order No: 25121100452






Year: 1985
Source: USGS
Scale: 1" = 500'
Comment:

Address: 2021 Main Street, Ramona, CA
Approx Center: -116.88530402,33.0321801

Order No: 25121100452



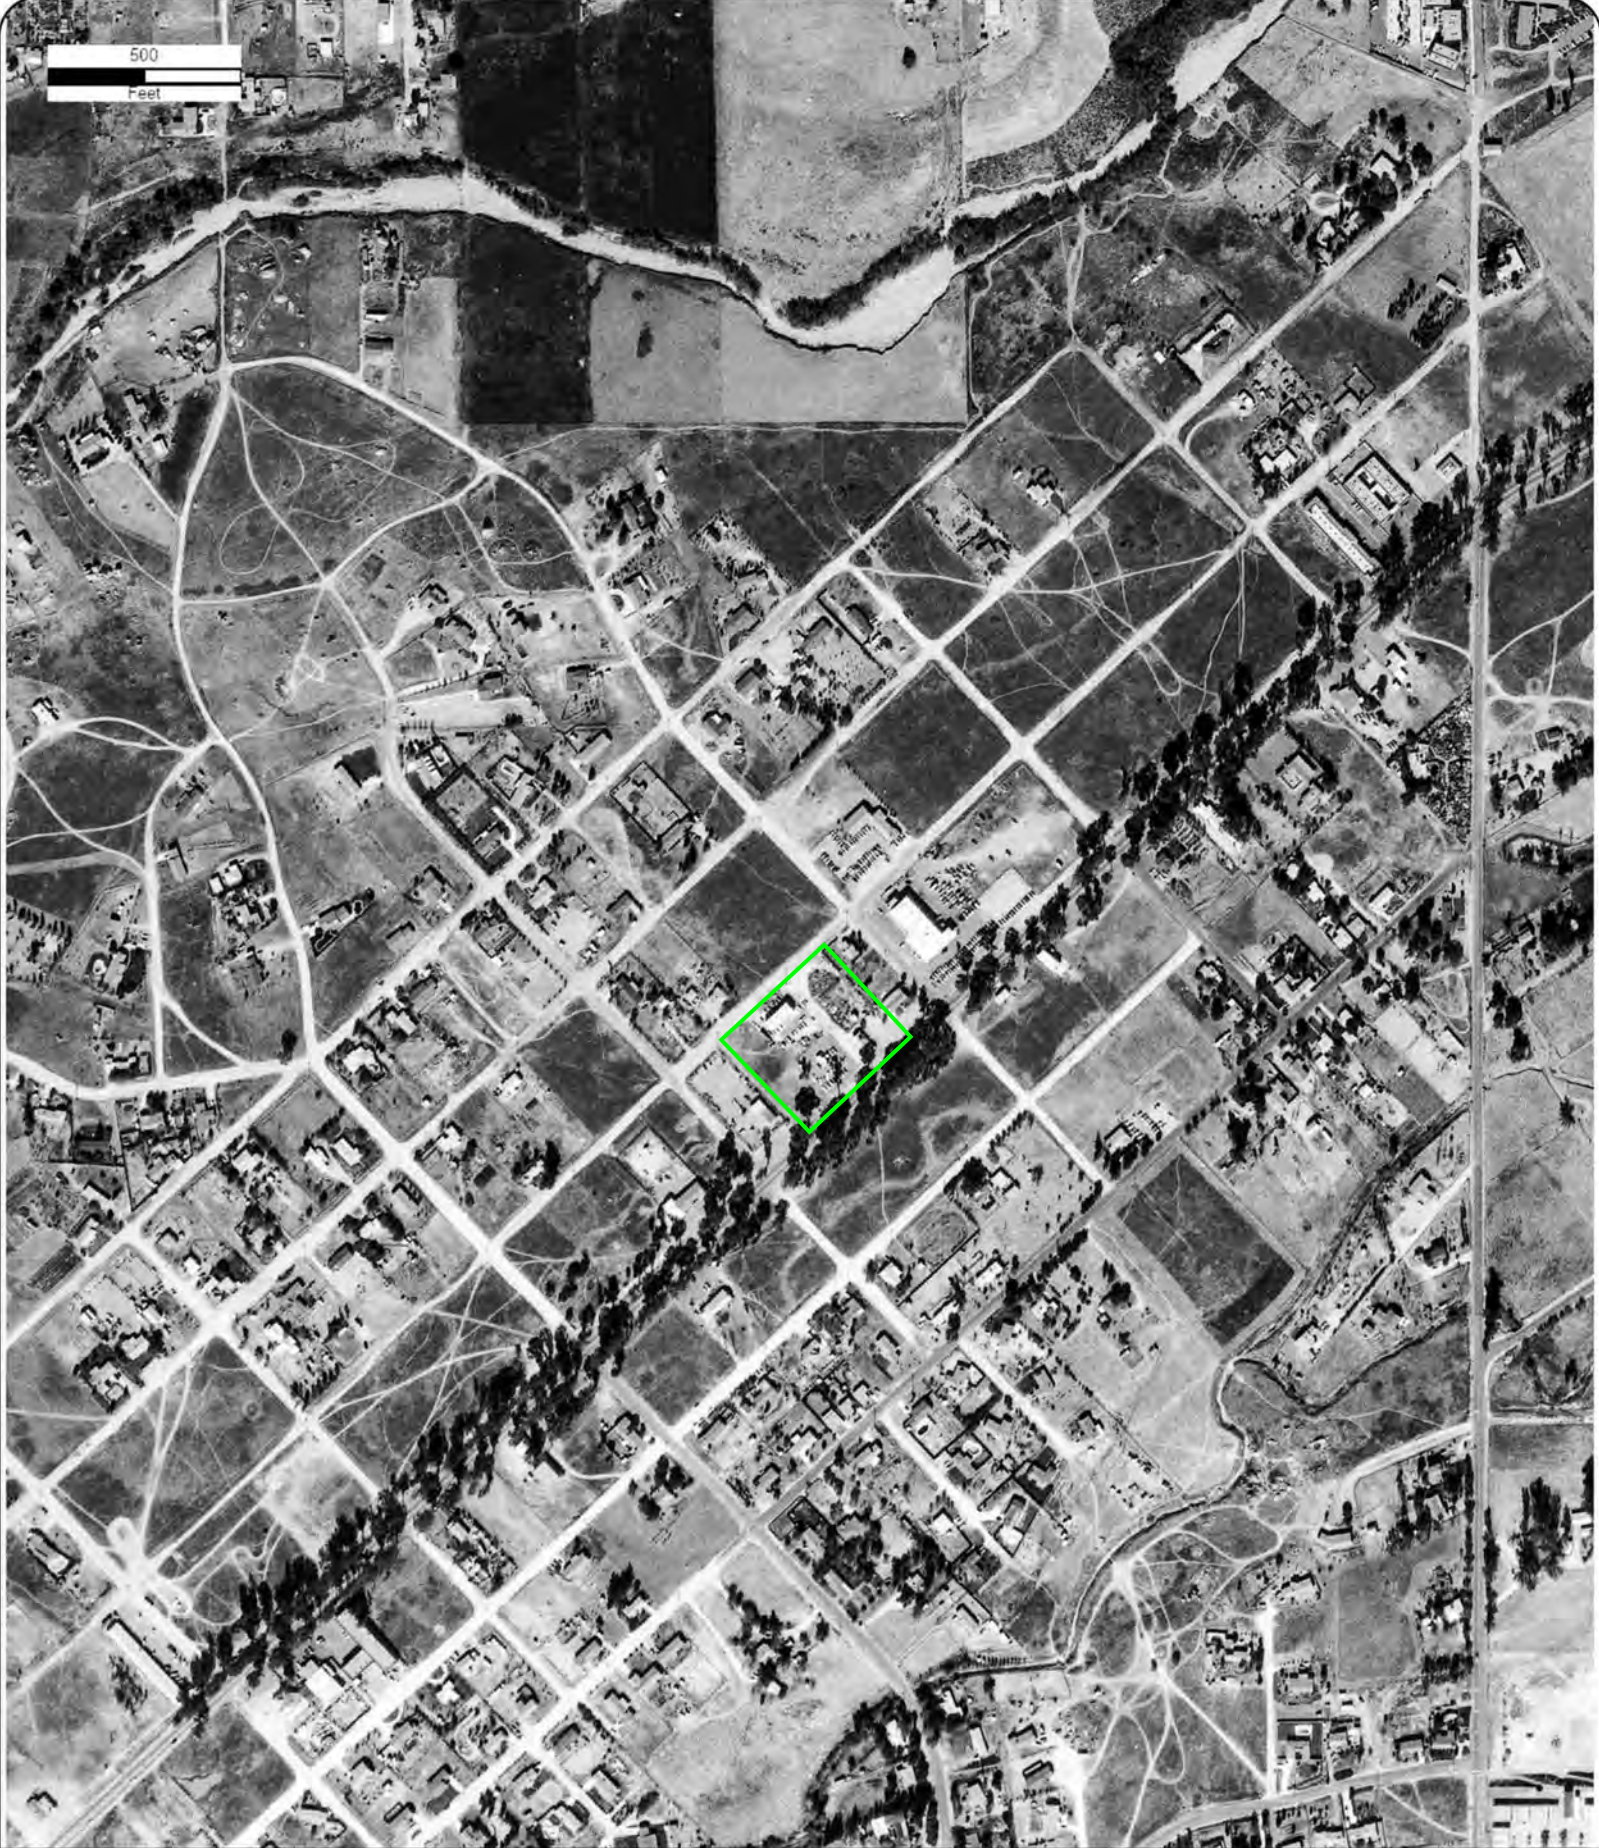

Year: 1981
Source: USGS
Scale: 1" = 500'
Comment:

Address: 2021 Main Street, Ramona, CA
Approx Center: -116.88530402,33.0321801

Order No: 25121100452






Year: 1974
Source: Private
Scale: 1" = 500'
Comment:

Address: 2021 Main Street, Ramona, CA
Approx Center: -116.88530402,33.0321801

Order No: 25121100452



500
Feet

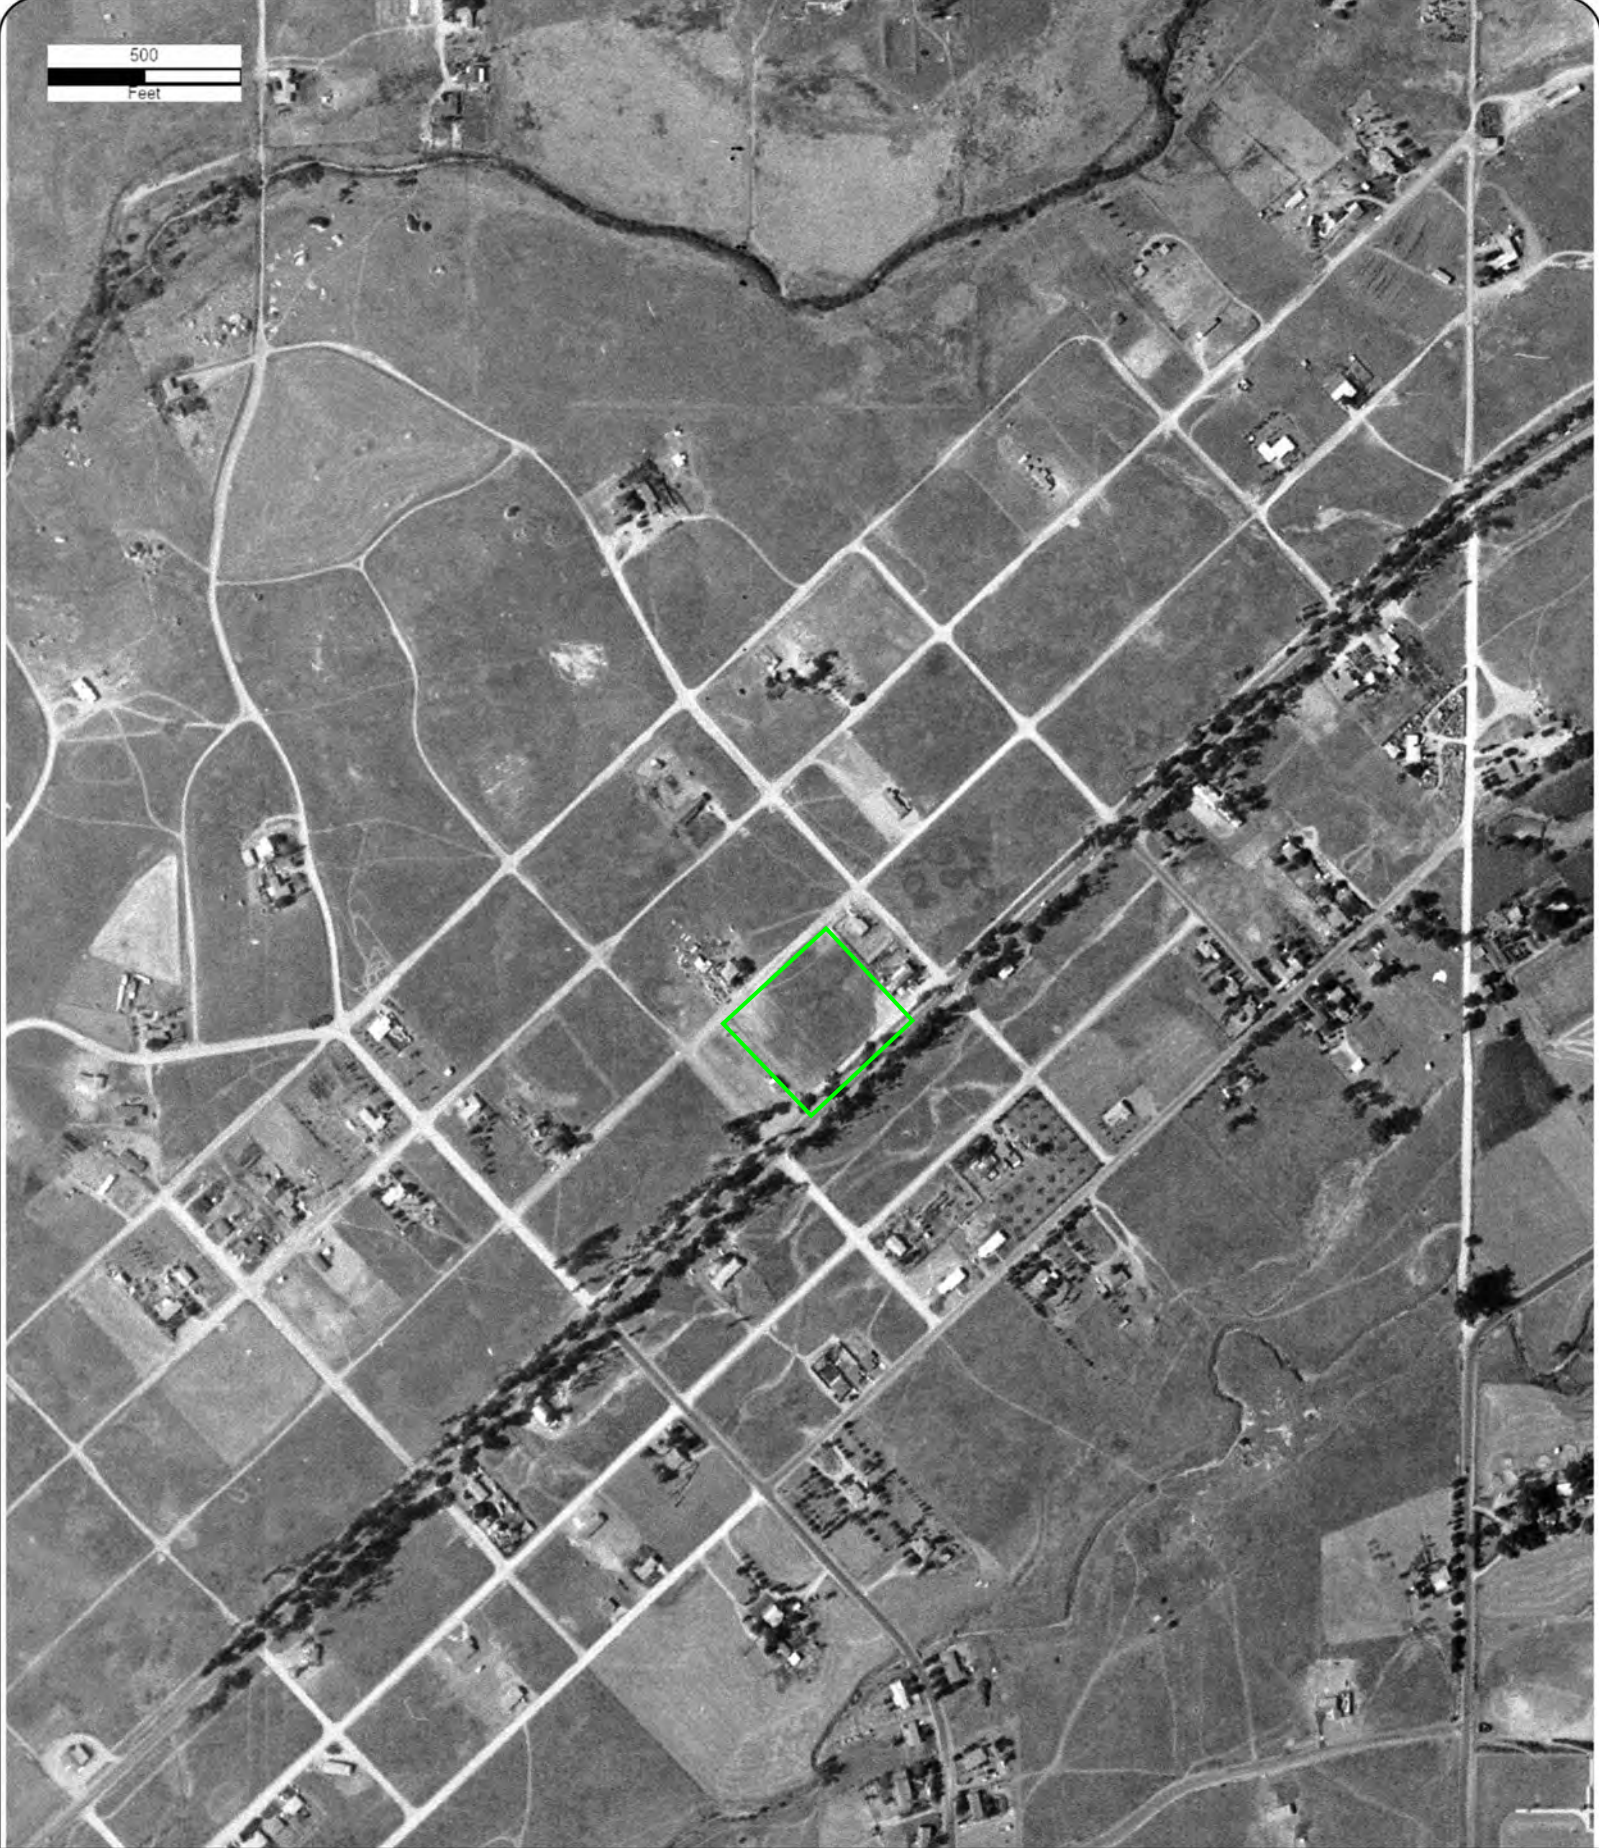

Year: 1971
Source: USGS
Scale: 1" = 500'
Comment:

Address: 2021 Main Street, Ramona, CA
Approx Center: -116.88530402,33.0321801

Order No: 25121100452





Year: 1963
Source: CAS
Scale: 1" = 500'
Comment:

Address: 2021 Main Street, Ramona, CA
Approx Center: -116.88530402,33.0321801

Order No: 25121100452






Year: 1953
Source: ASCS
Scale: 1" = 500'
Comment:

Address: 2021 Main Street, Ramona, CA
Approx Center: -116.88530402,33.0321801

Order No: 25121100452



500
Feet

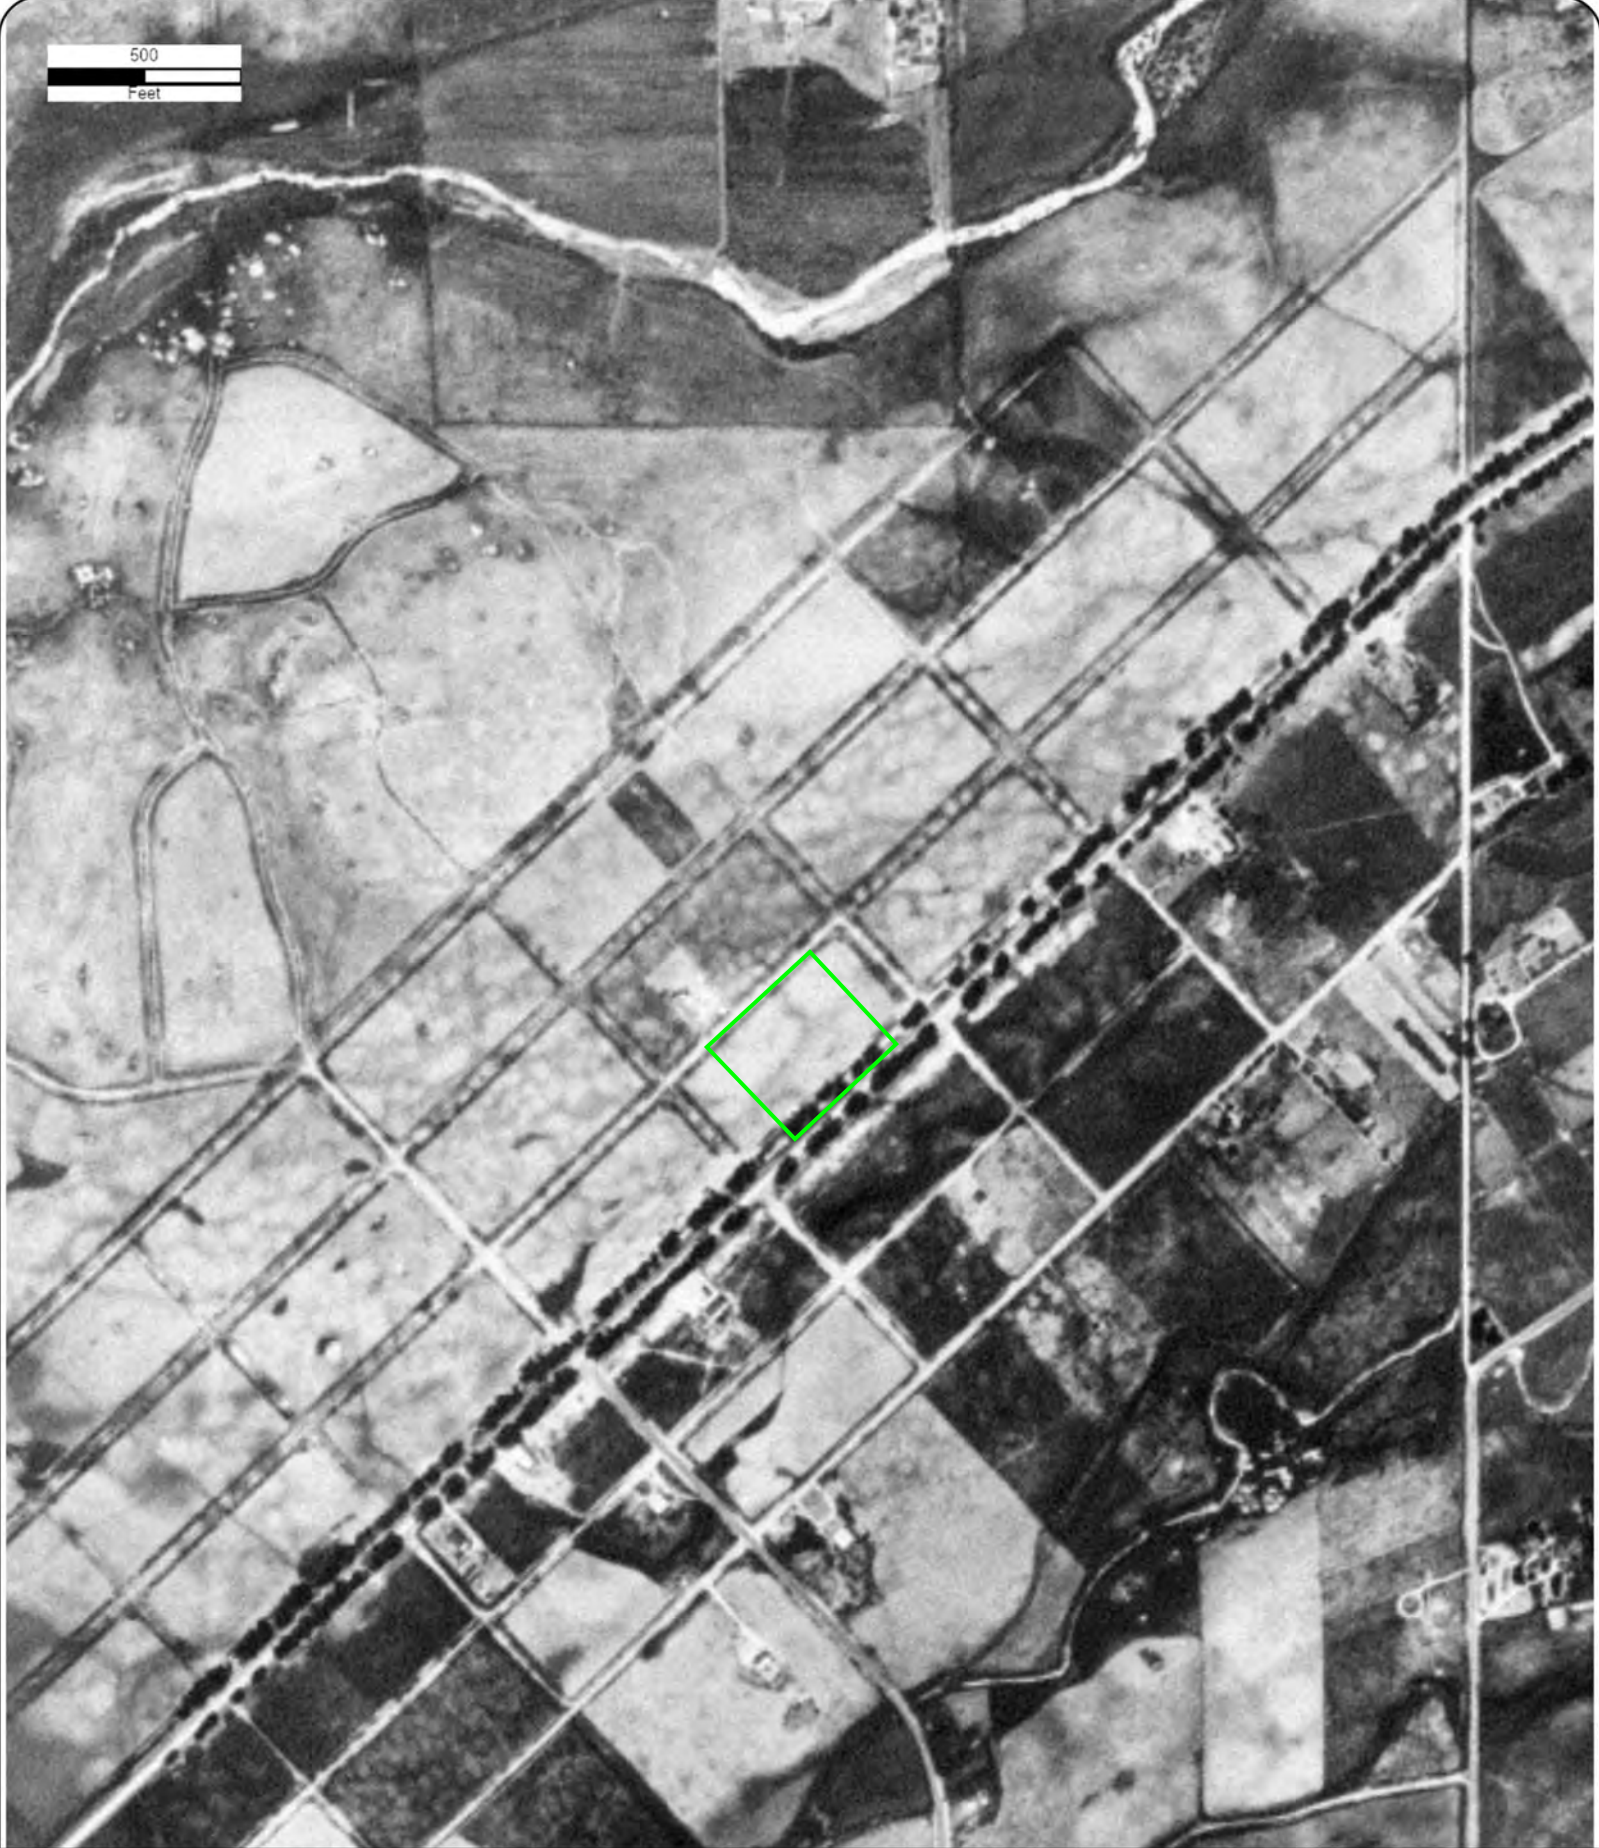


Year: 1949
Source: ASCS
Scale: 1" = 500'
Comment:

Address: 2021 Main Street, Ramona, CA
Approx Center: -116.88530402,33.0321801

Order No: 25121100452



500
Feet

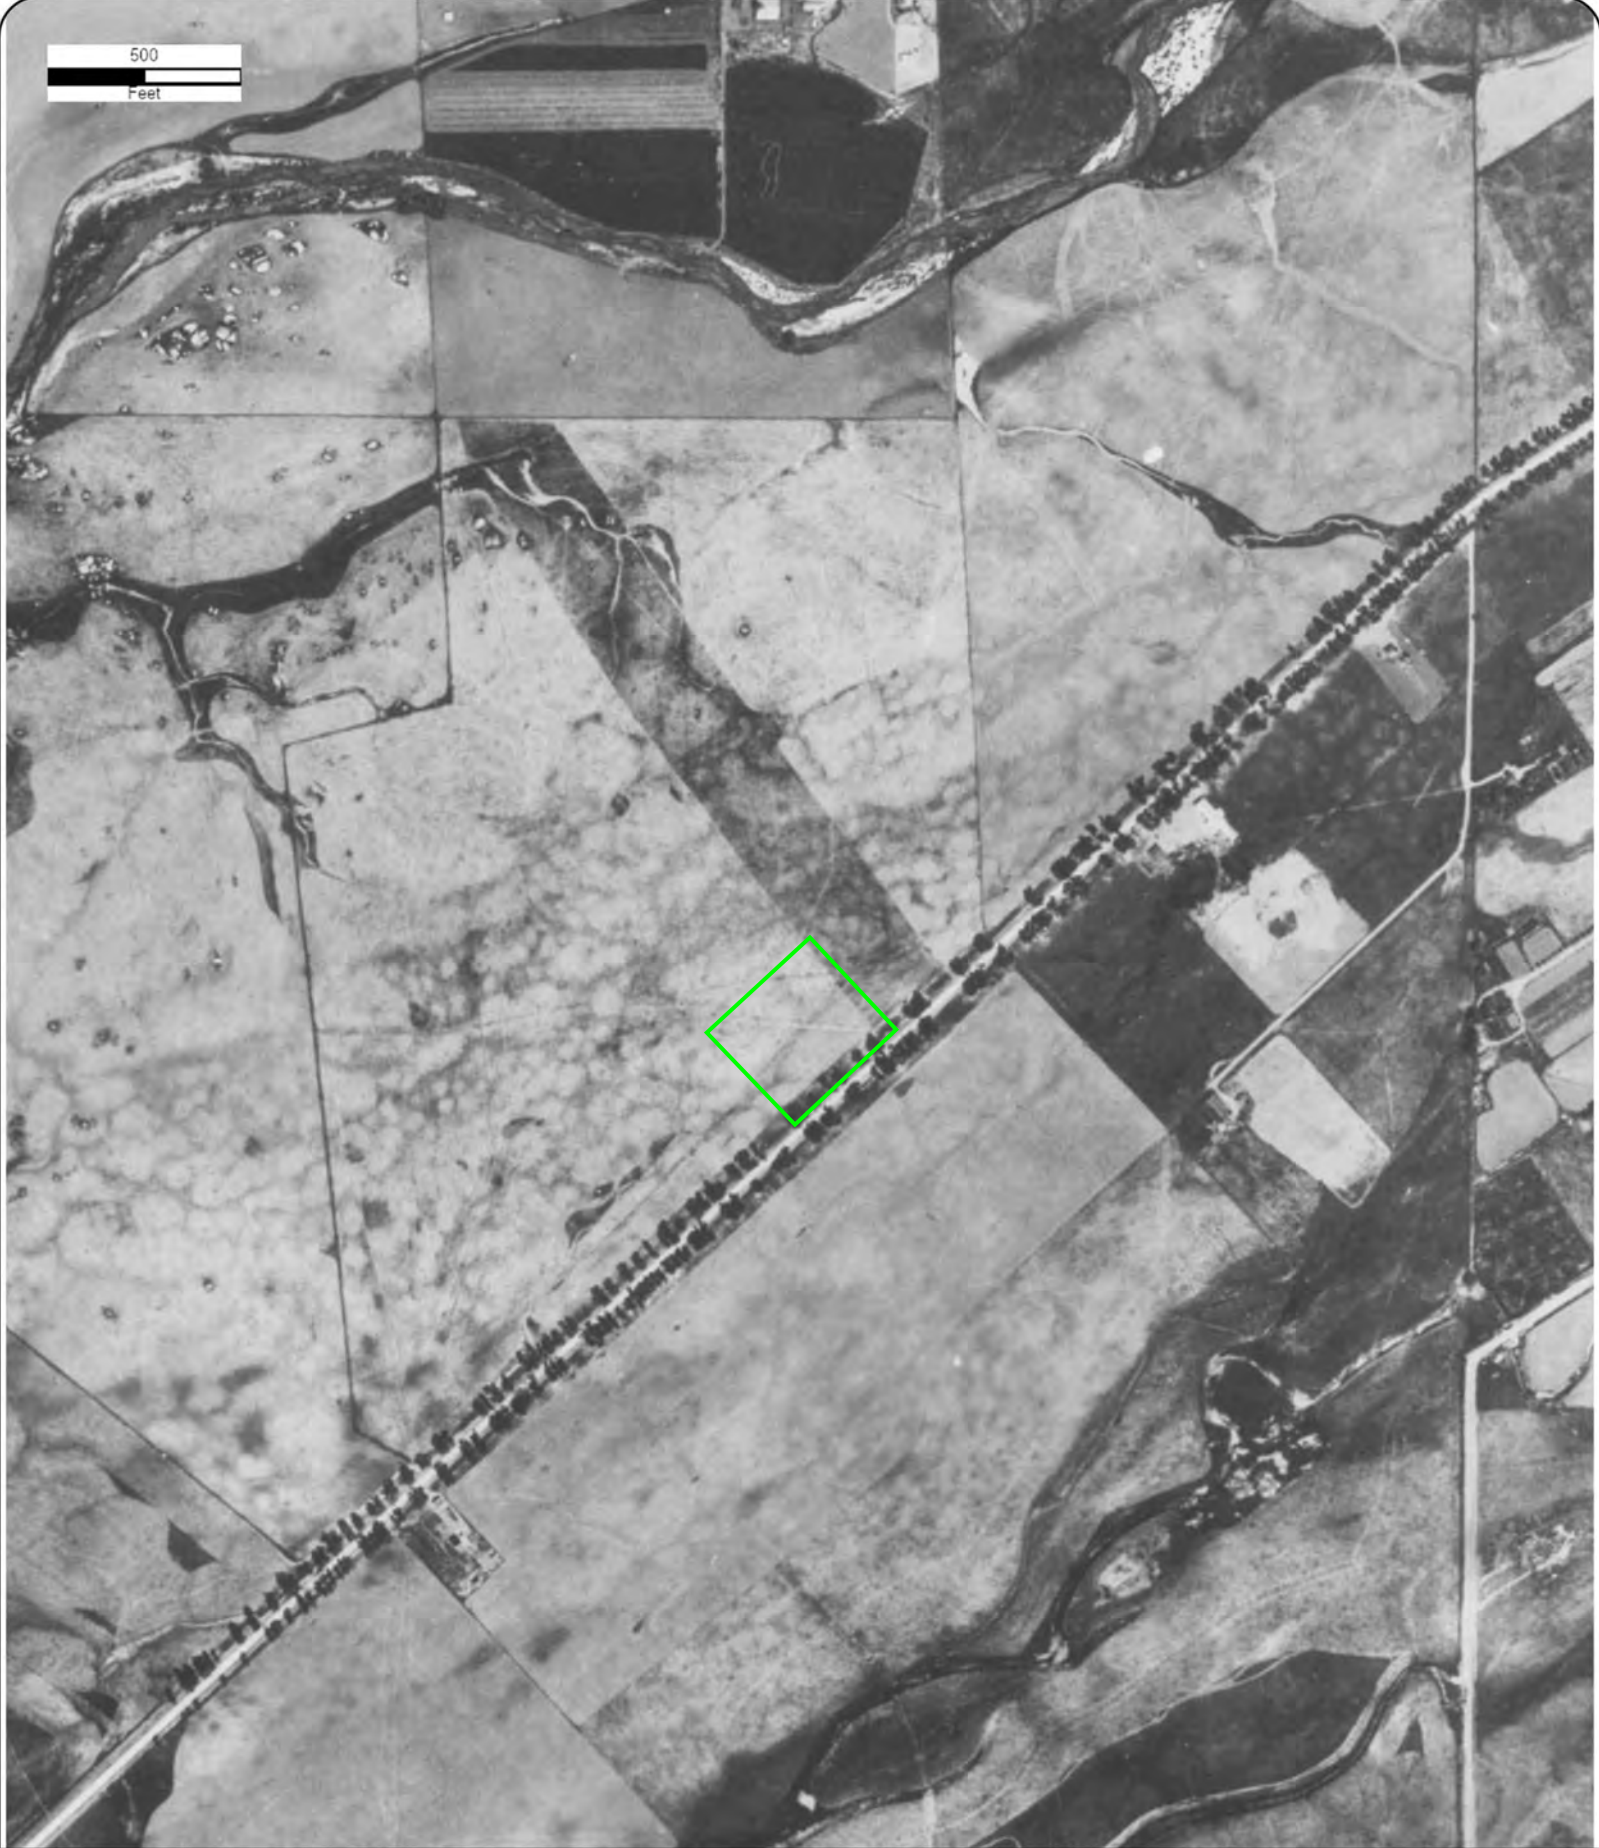


Year: 1939
Source: FAIRCHILD
Scale: 1" = 500'
Comment:

Address: 2021 Main Street, Ramona, CA
Approx Center: -116.88530402,33.0321801

Order No: 25121100452



500
Feet

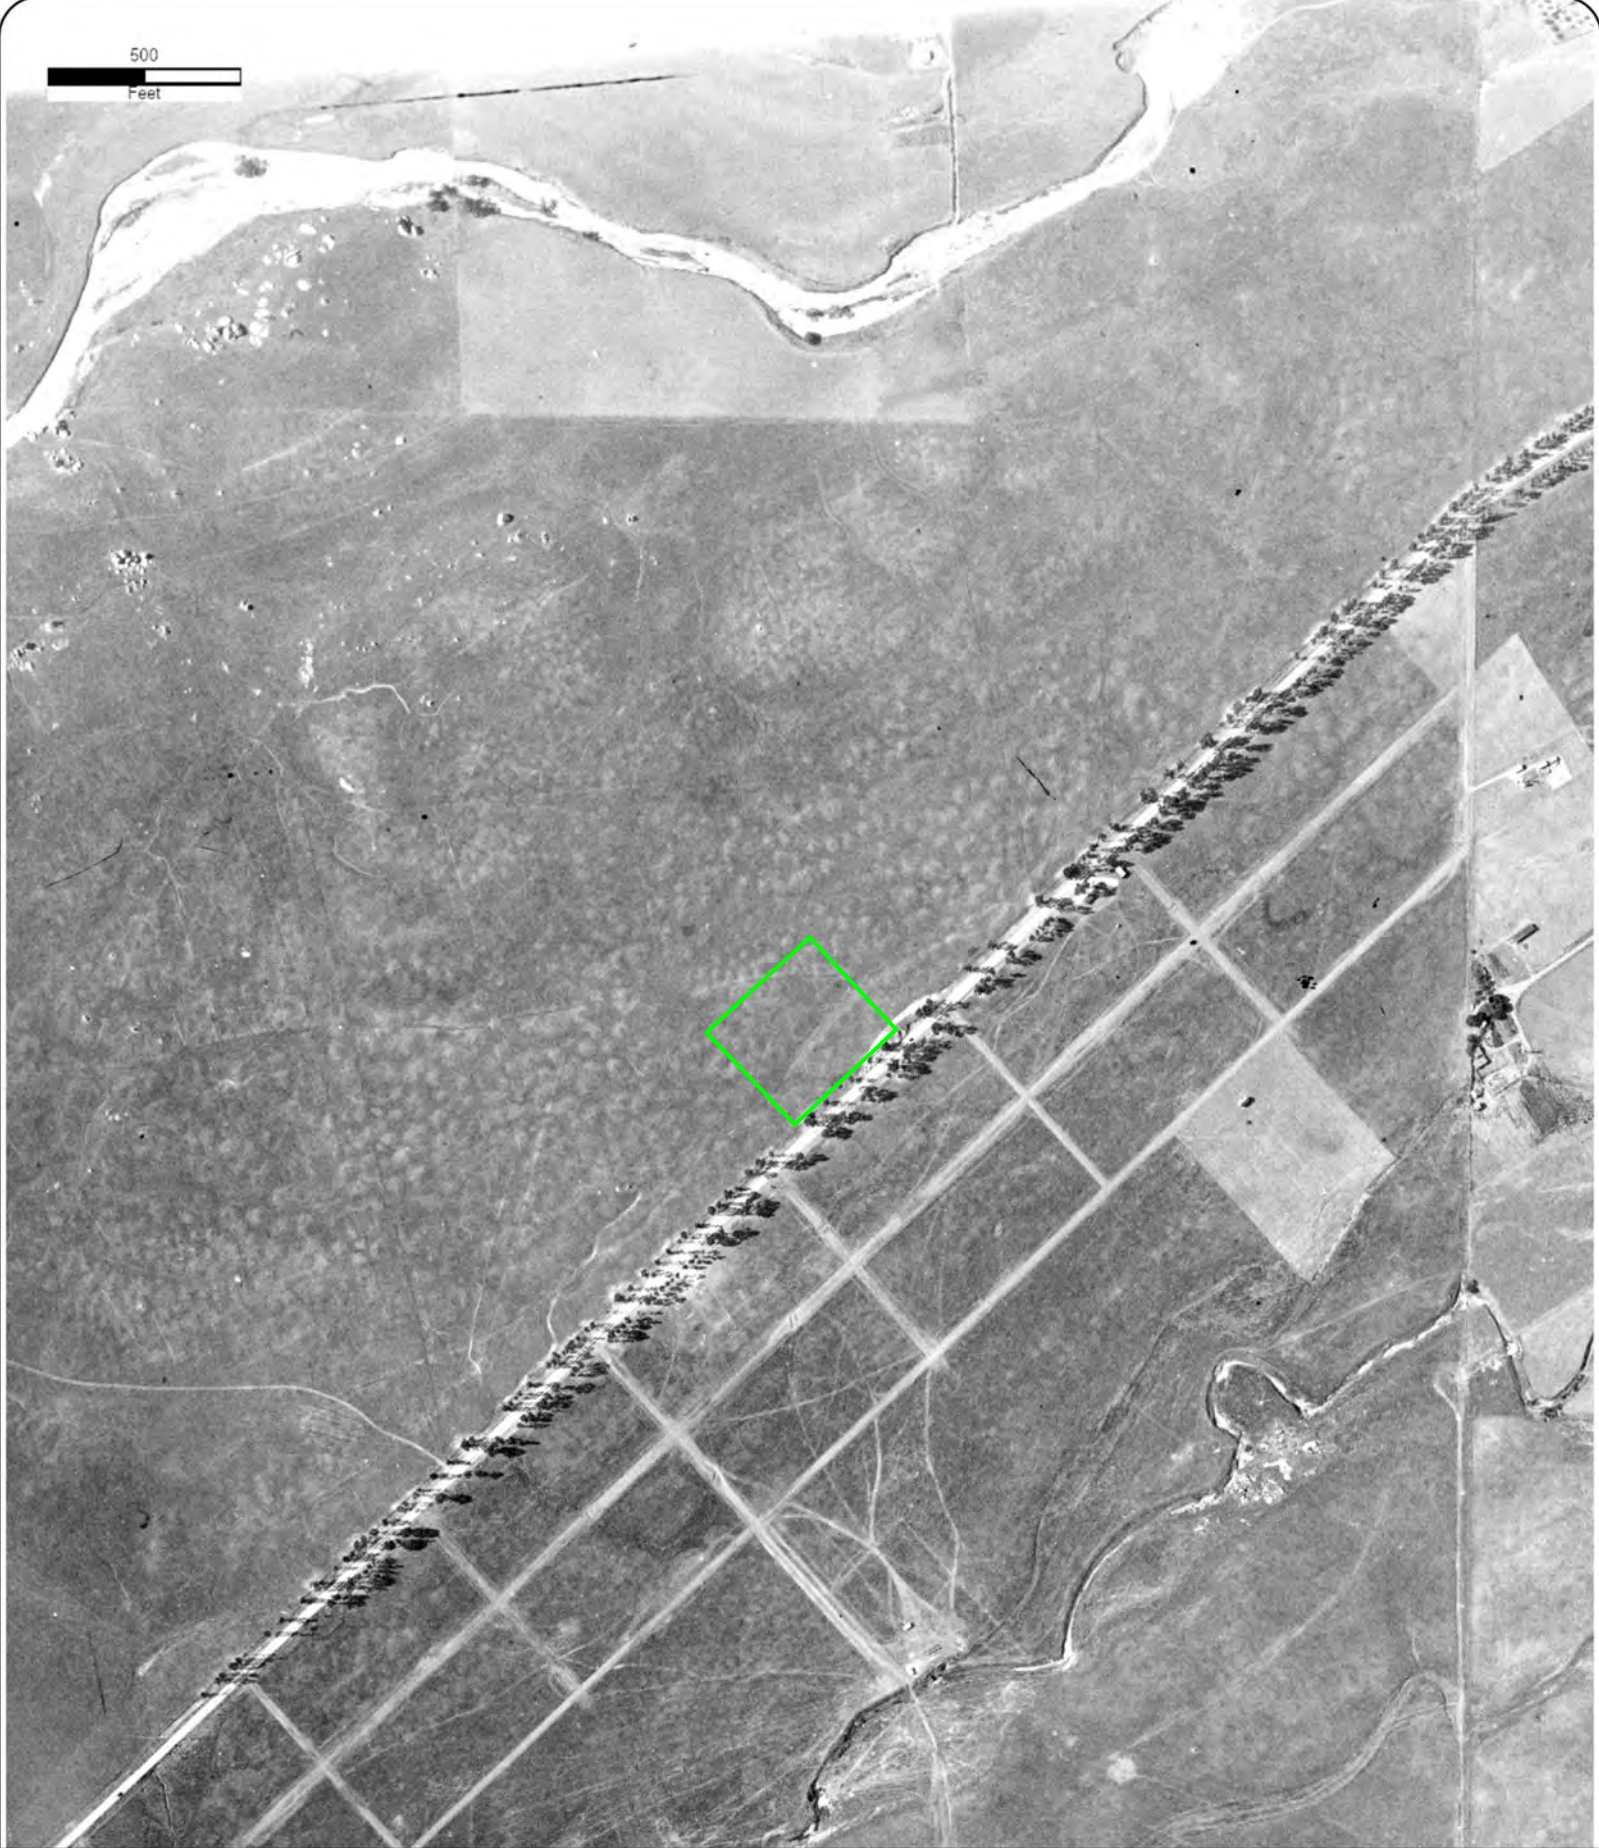

Year: 1928
Source: COSD
Scale: 1" = 500'
Comment:

Address: 2021 Main Street, Ramona, CA
Approx Center: -116.88530402,33.0321801

Order No: 25121100452





TOPOGRAPHIC MAPS

Project Property: Proposed Hotel Ramona Phase I

2021 Main Street
Ramona CA 92065

Project No: 6025338

Requested By: NOVA Services, Inc.

Order No: 25121100452

Date Completed: December 12, 2025

Environmental Risk Information Services

A division of Glacier Media Inc.

1.866.517.5204 | info@erisinfo.com | erisinfo.com

We have searched USGS collections of current topographic maps and historical topographic maps for the project property. Below is a list of maps found for the project property and adjacent area. Maps are from 7.5 and 15 minute topographic map series, if available.

Year	Map Series
2021	7.5
2018	7.5
2015	7.5
1997	7.5
1988	7.5
1982	7.5
1971	7.5
1954	7.5
1947	15
1942	15

Topographic Map Symbolology for the maps may be available in the following documents:

Pre-1947

[Page 223 of 1918 Topographic Instructions](#)

[Page 130 of 1928 Topographic Instructions](#)

1947-2009

[Topographic Map Symbols](#)

2009-present

[US Topo Map Symbols](#)


Topographic Maps included in this report are produced by the USGS and are to be used for research purposes including a phase I report. Maps are not to be resold as commercial property.

No warranty of Accuracy or Liability for ERIS: The information contained in this report has been produced by ERIS Information Inc.(in the US) and ERIS Information Limited Partnership (in Canada), both doing business as 'ERIS', using Topographic Maps produced by the USGS. This maps contained herein does not purport to be and does not constitute a guarantee of the accuracy of the information contained herein. Although ERIS has endeavored to present you with information that is accurate, ERIS disclaims, any and all liability for any errors, omissions, or inaccuracies in such information and data, whether attributable to inadvertence, negligence or otherwise, and for any consequences arising therefrom. Liability on the part of ERIS is limited to the monetary value paid for this report.

Environmental Risk Information Services

A division of Glacier Media Inc.


1.866.517.5204 | info@erisinfo.com | erisinfo.com

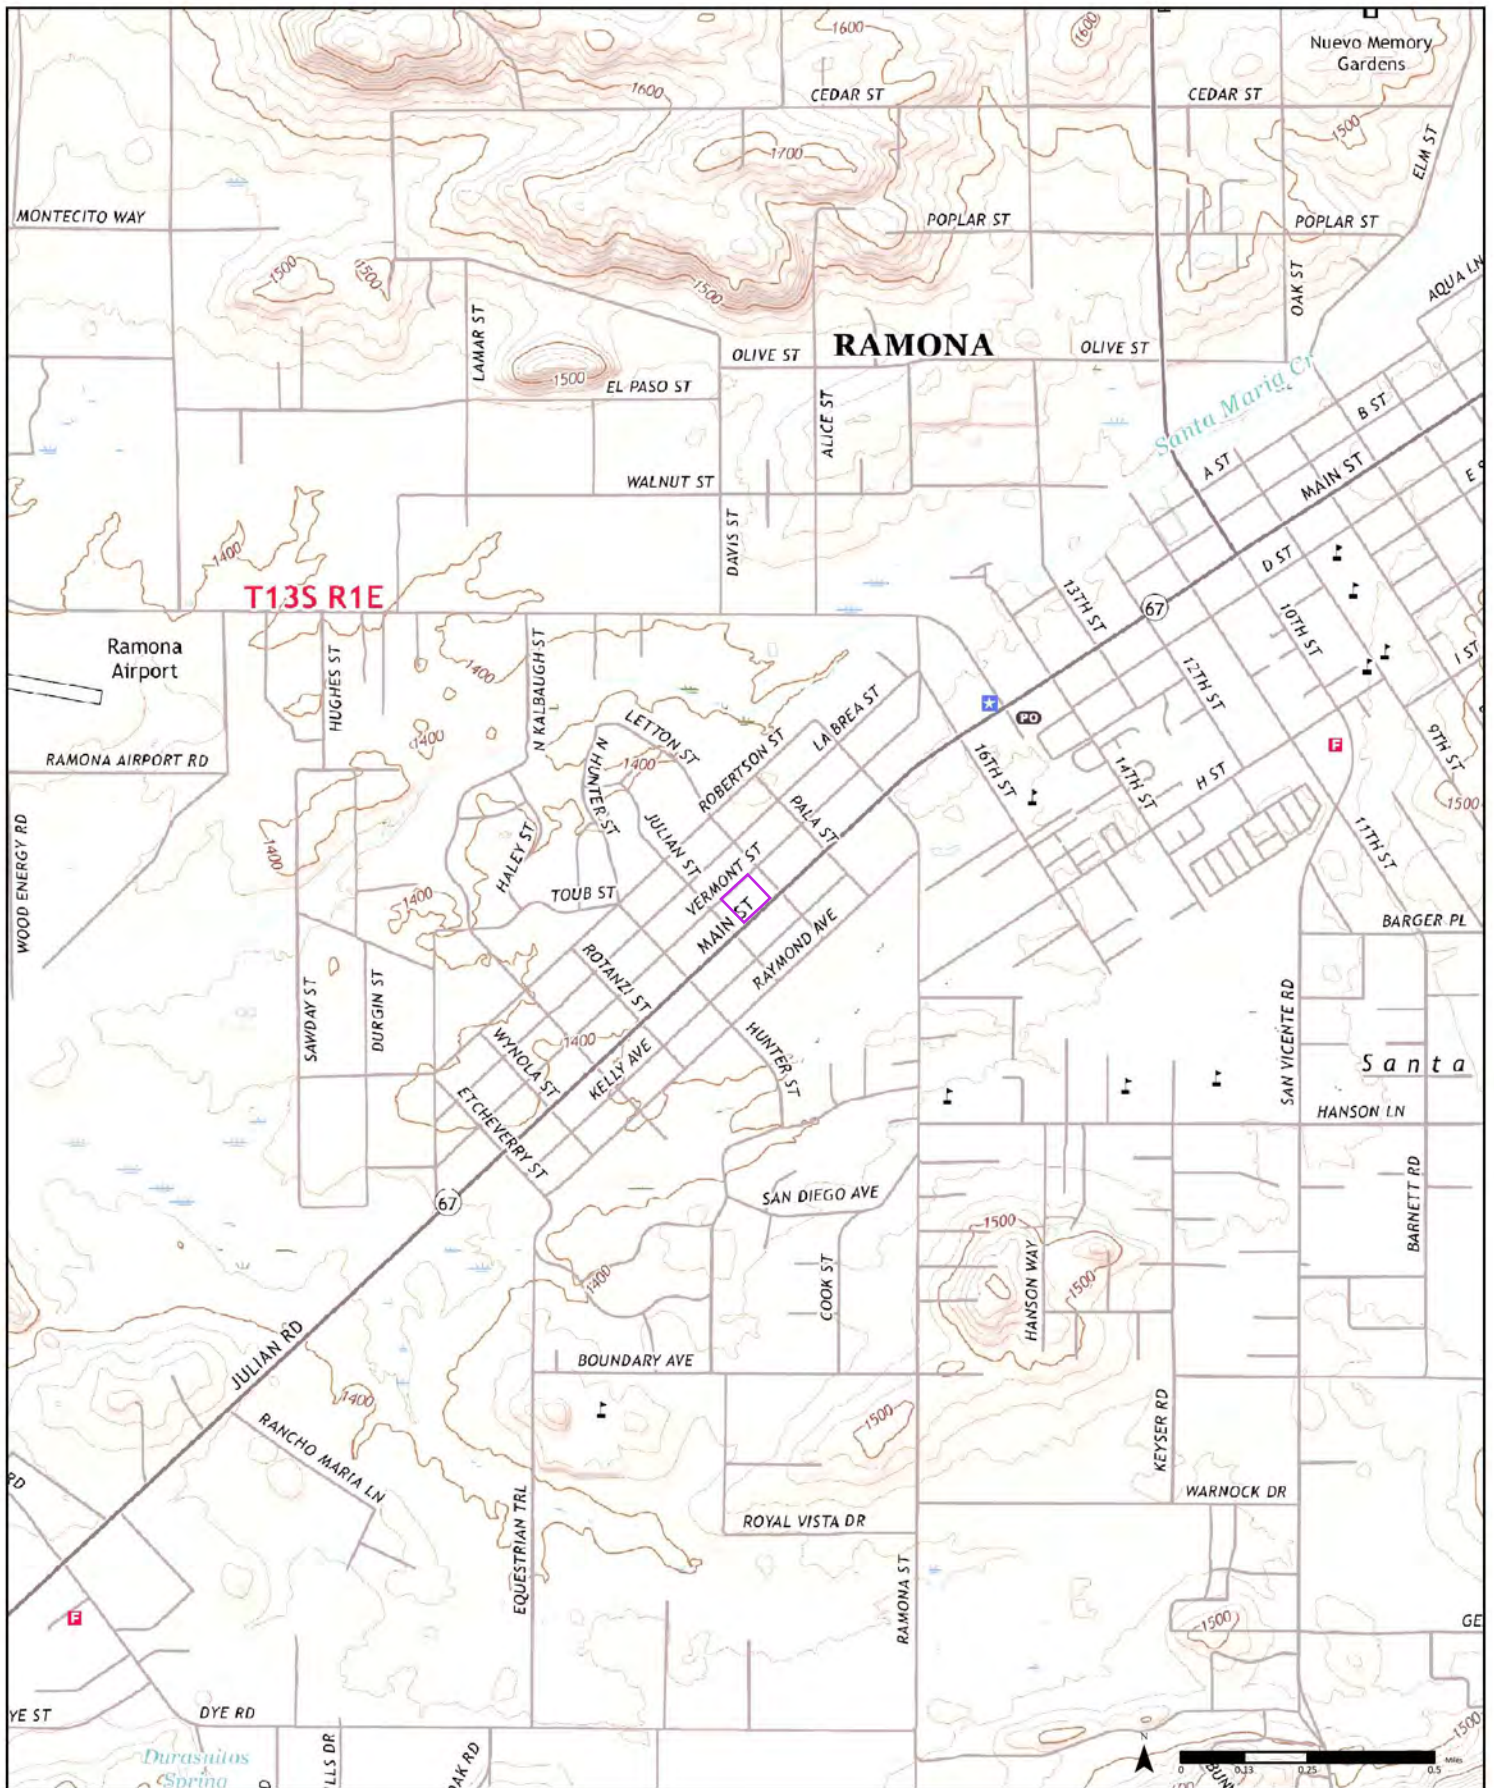

Available Quadrangle(s): San Pasqual, CA
Ramona, CA

Source: USGS 7.5 Minute Topographic Map



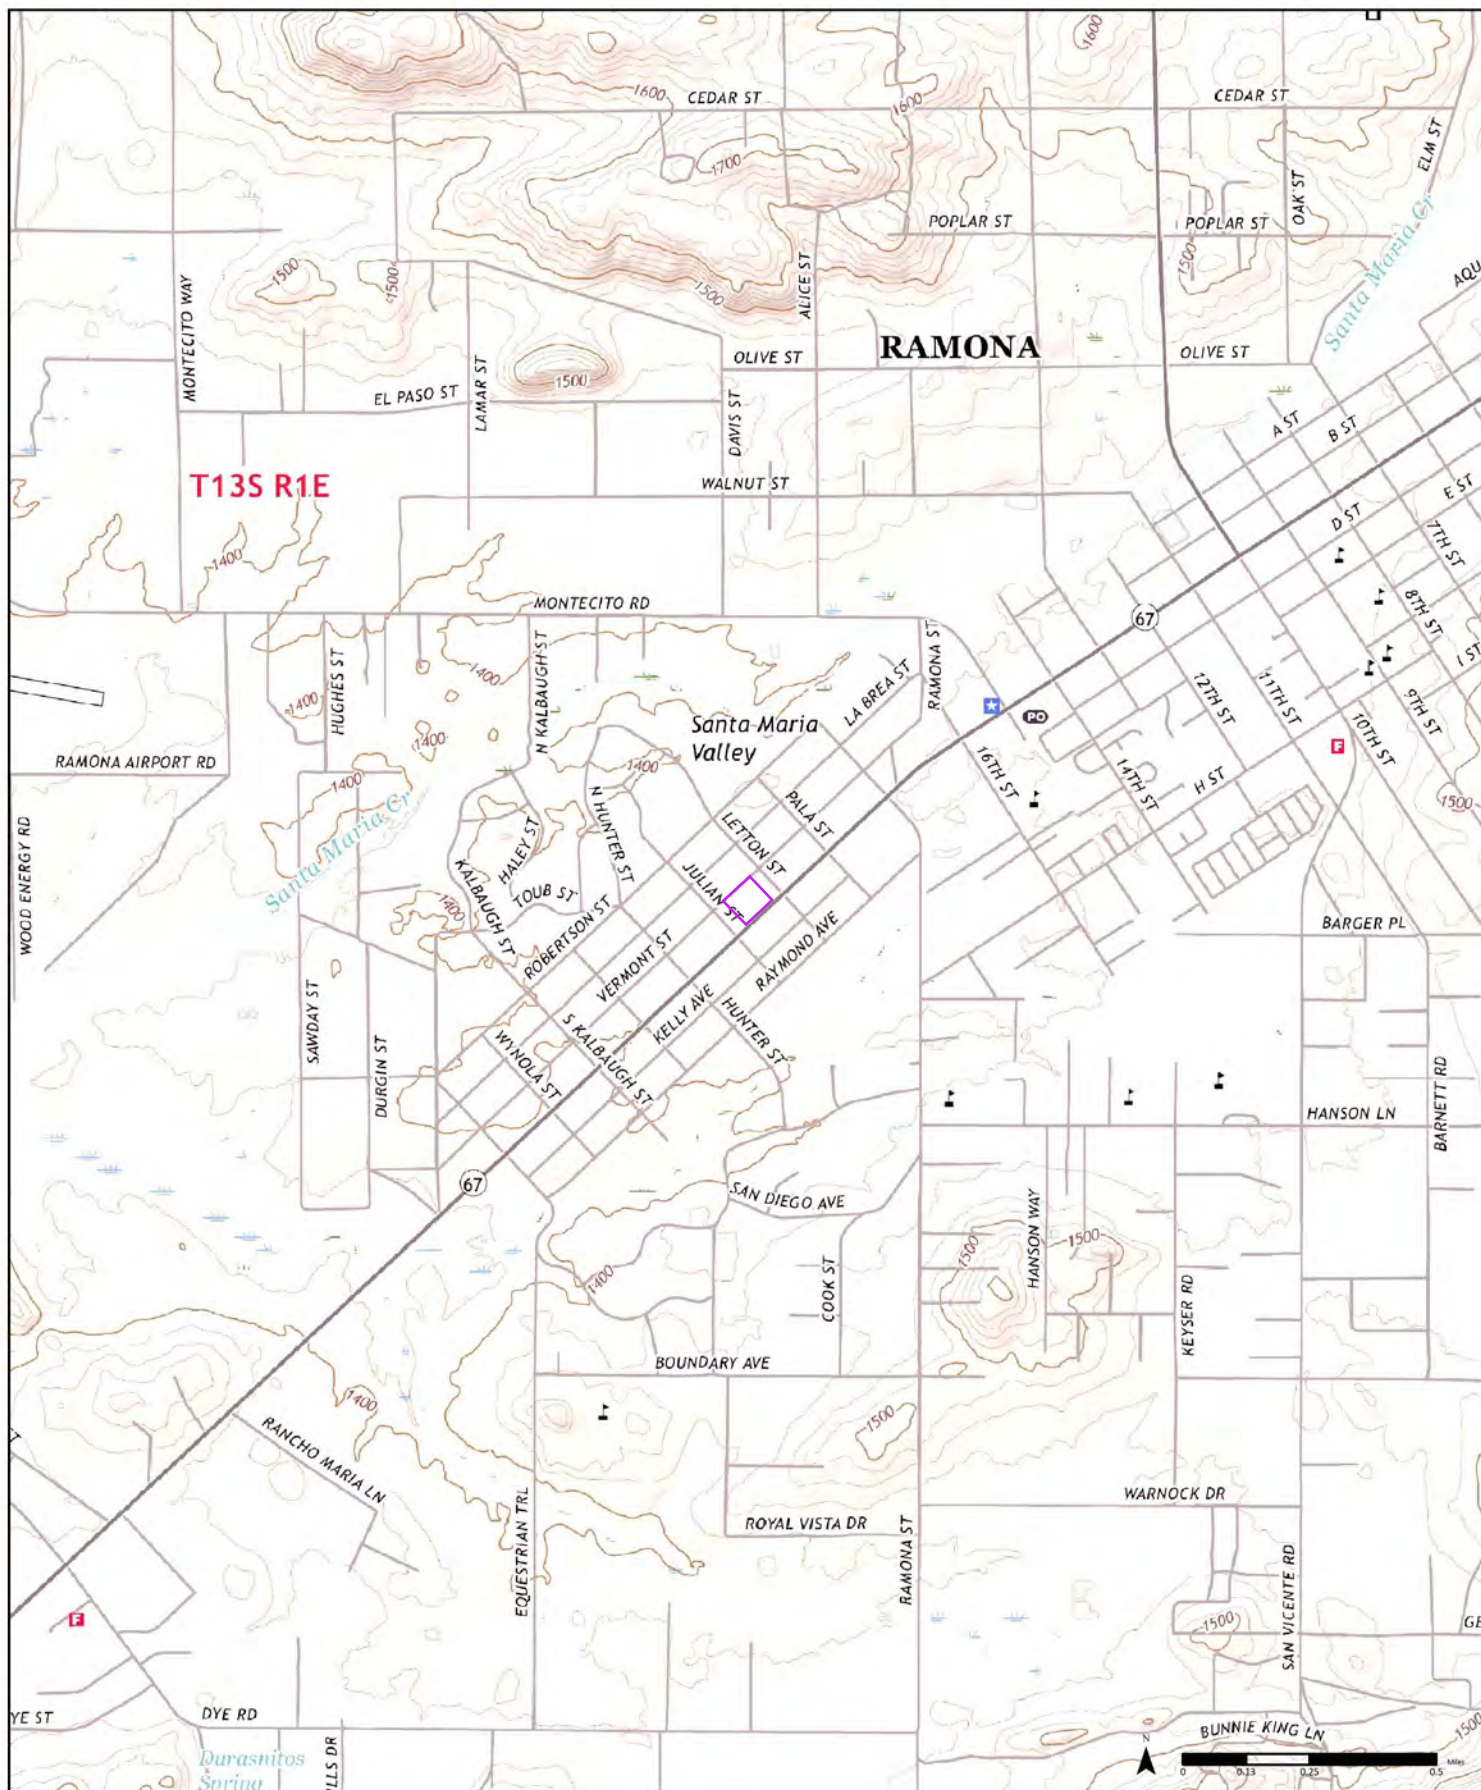

2018


Order No. 25121100452



Available Quadrangle(s): San Pasqual, CA
Ramona, CA

Source: USGS 7.5 Minute Topographic Map



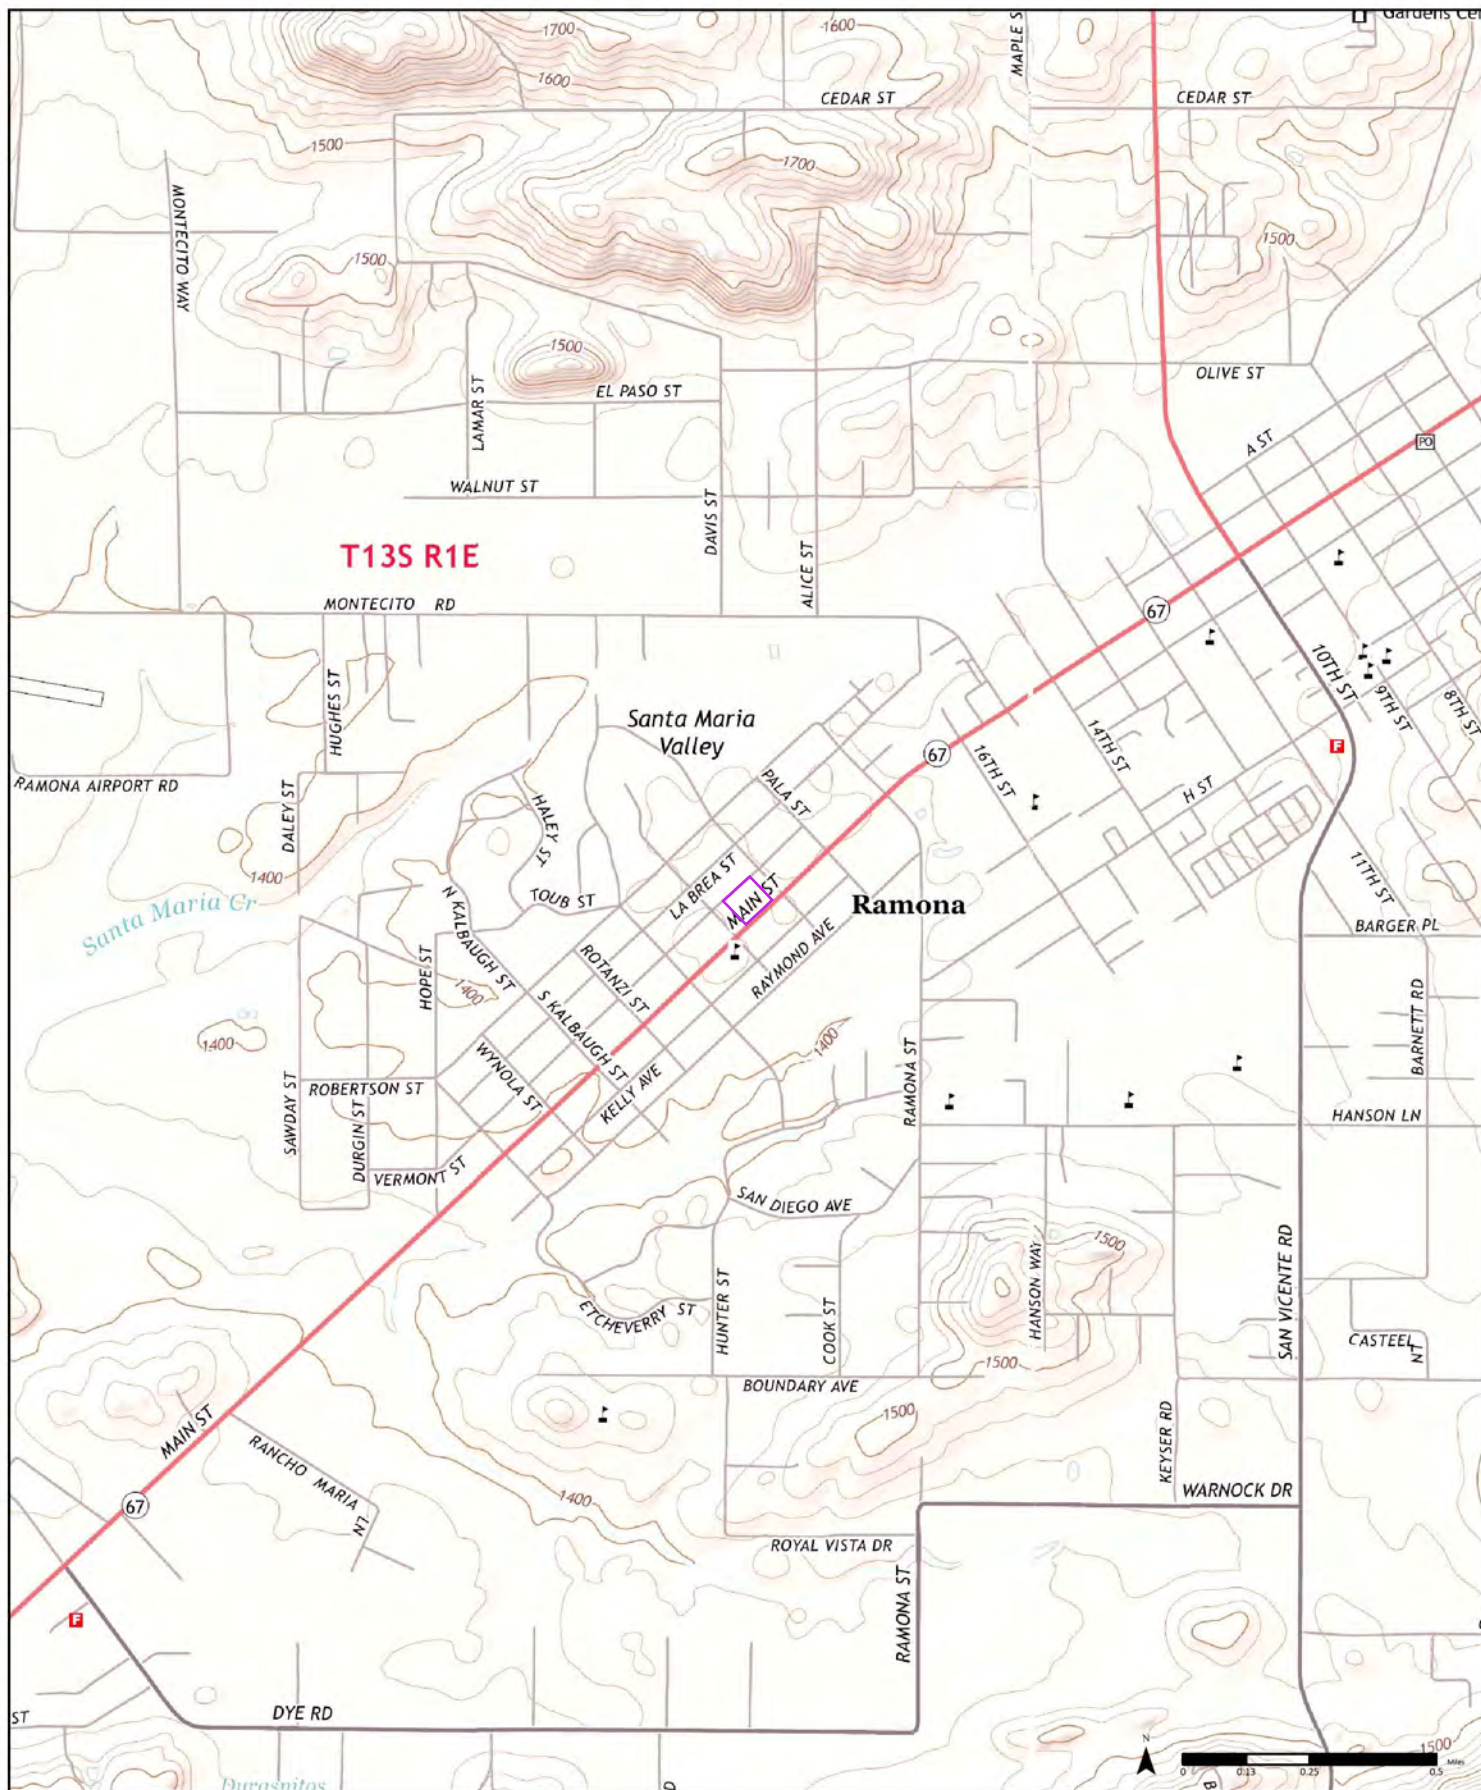

2015


Order No. 25121100452



Available Quadrangle(s): San Pasqual, CA
Ramona, CA

Source: USGS 7.5 Minute Topographic Map



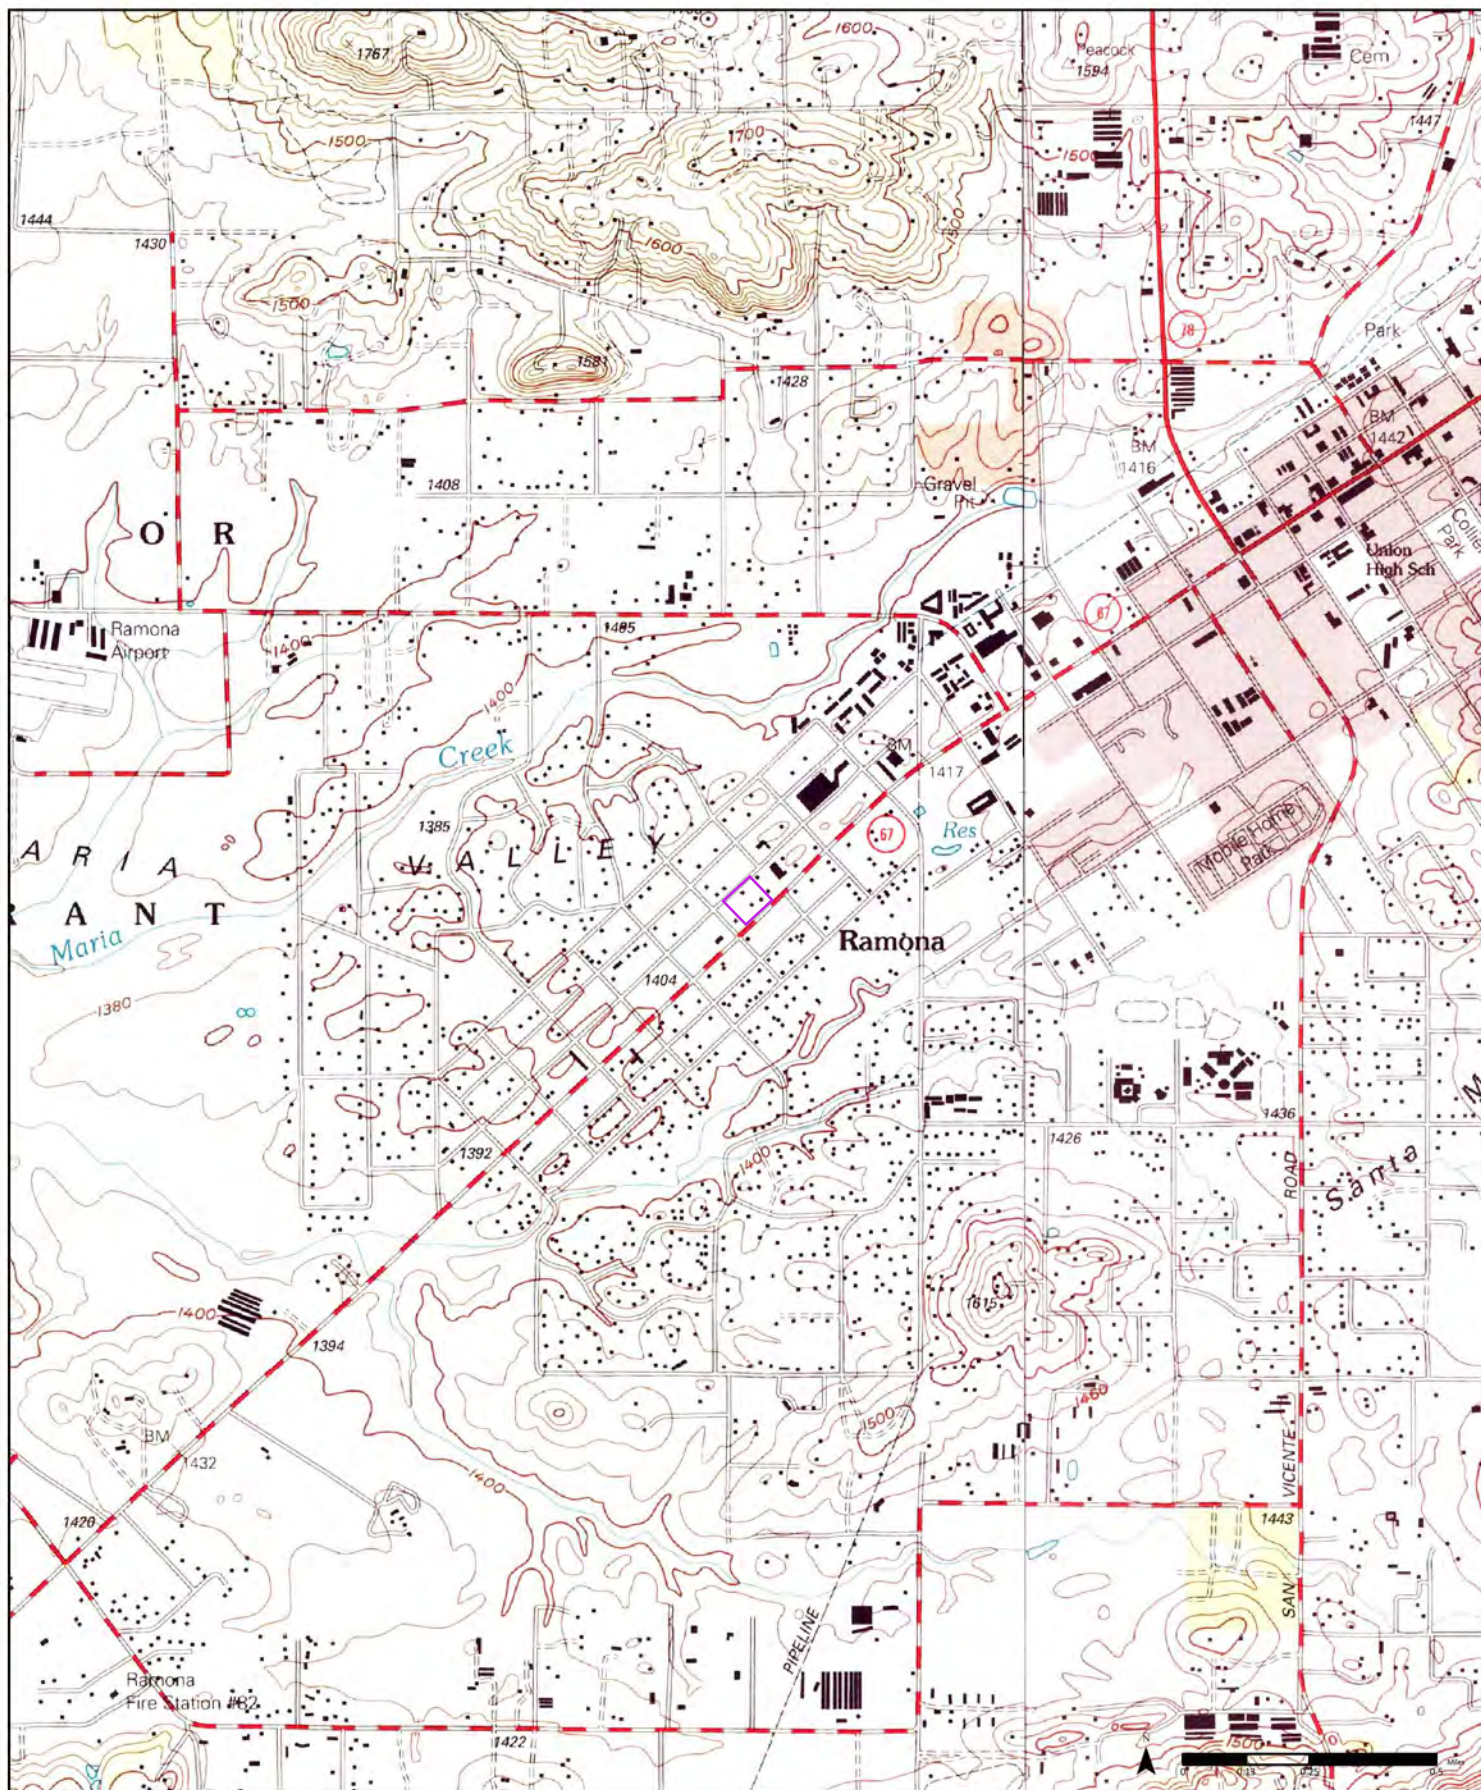

1997

(1-1997)
Aerial Photo Year: 1994

(2-1997)
Aerial Photo Year: 1994


Order No. 25121100452



Available Quadrangle(s): San Pasqual, CA(1-1997)
Ramona, CA(2-1997)

Source: USGS 7.5 Minute Topographic Map



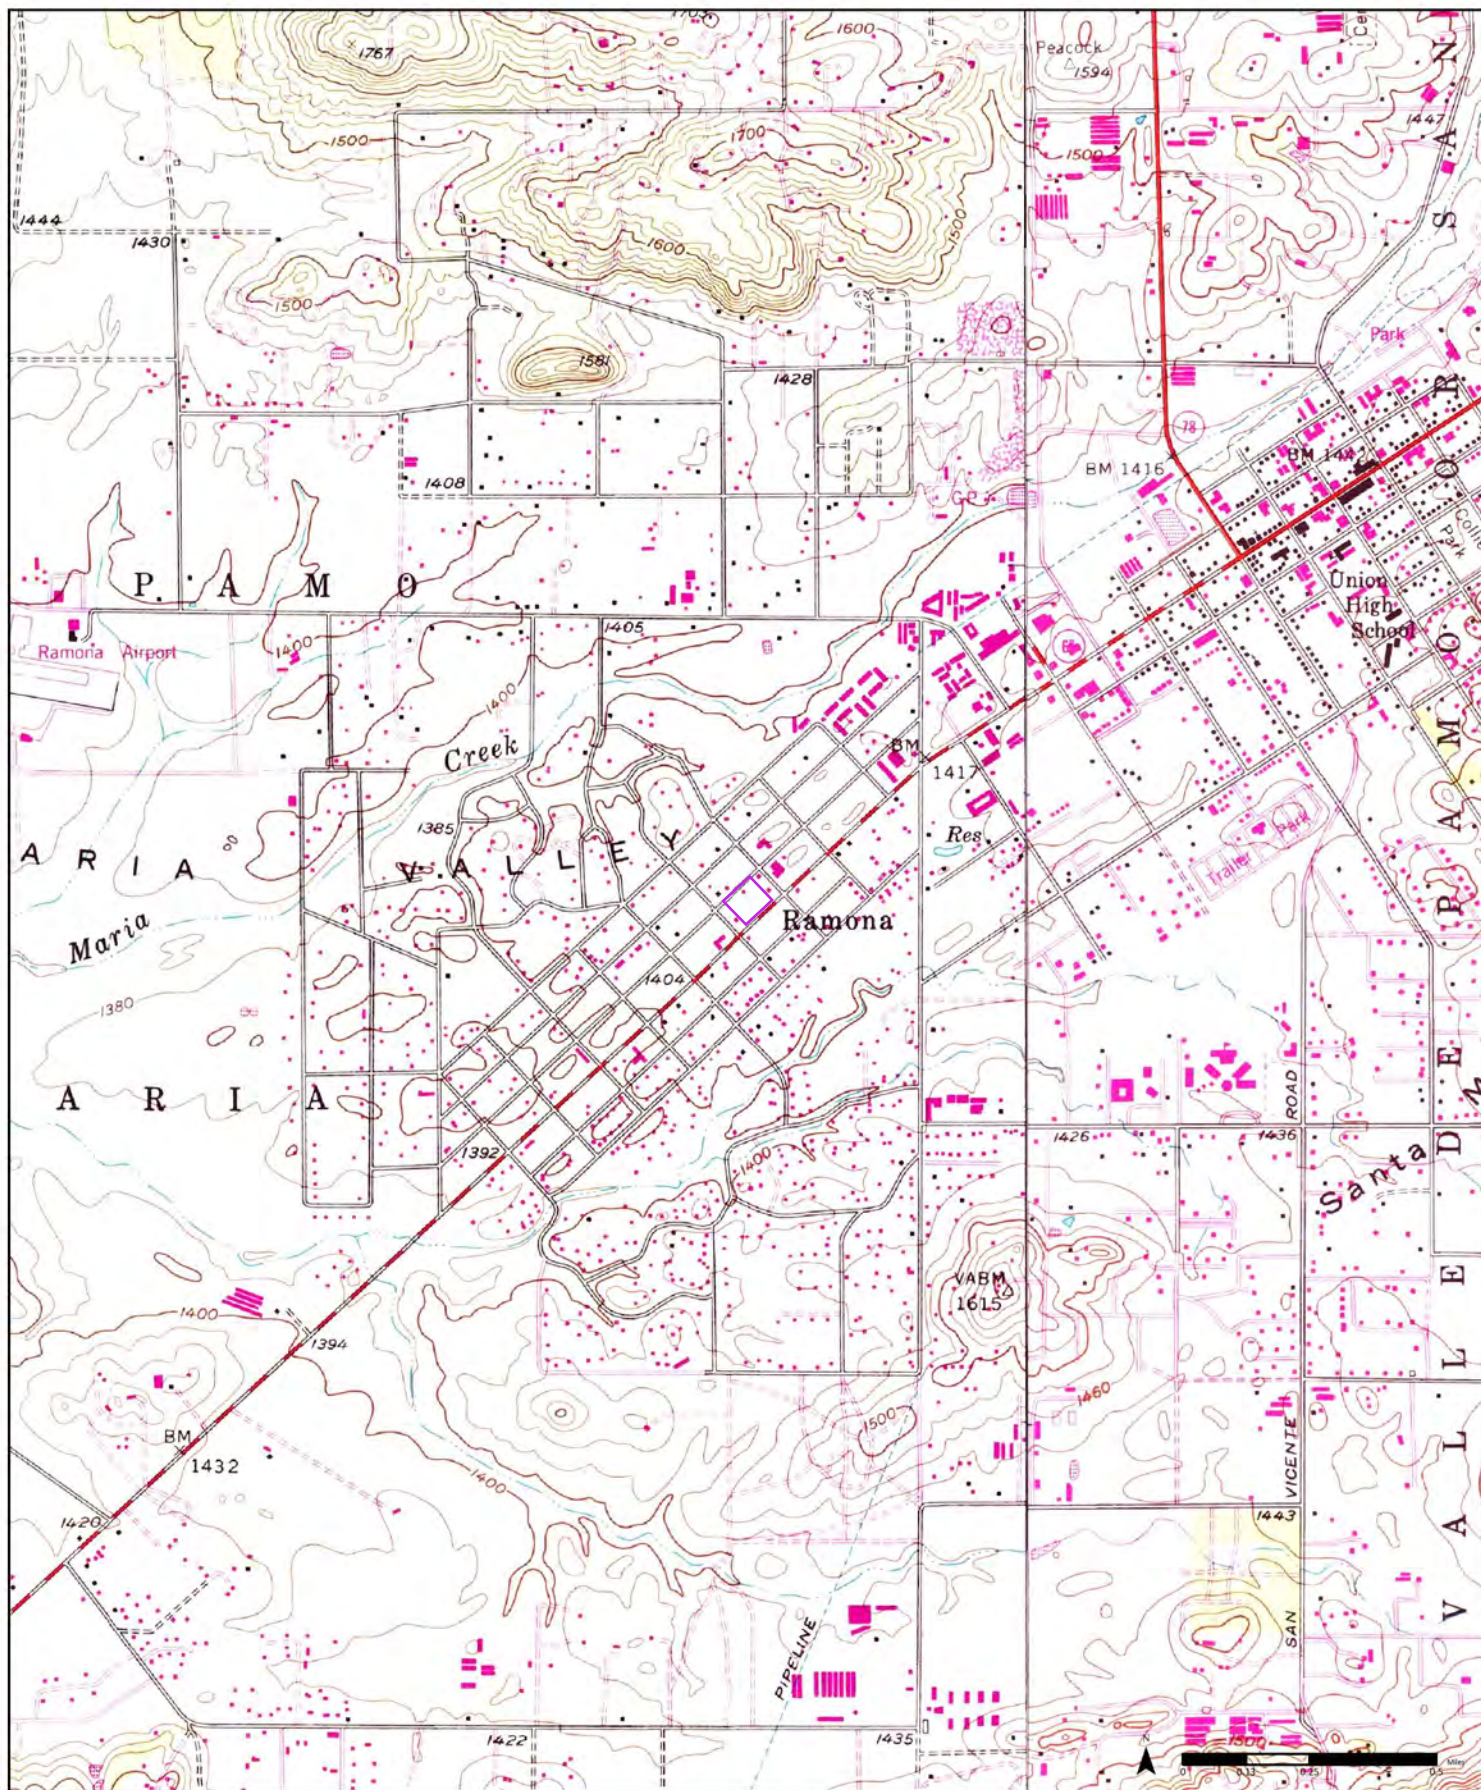

1988

(1-1988) Aerial Photo Year: 1985
Photo Revision Year: 1988

(2-1988) Aerial Photo Year: 1985
Photo Revision Year: 1988


Order No. 25121100452



Available Quadrangle(s): San Pasqual, CA(1-1988)
Ramona, CA(2-1988)

Source: USGS 7.5 Minute Topographic Map



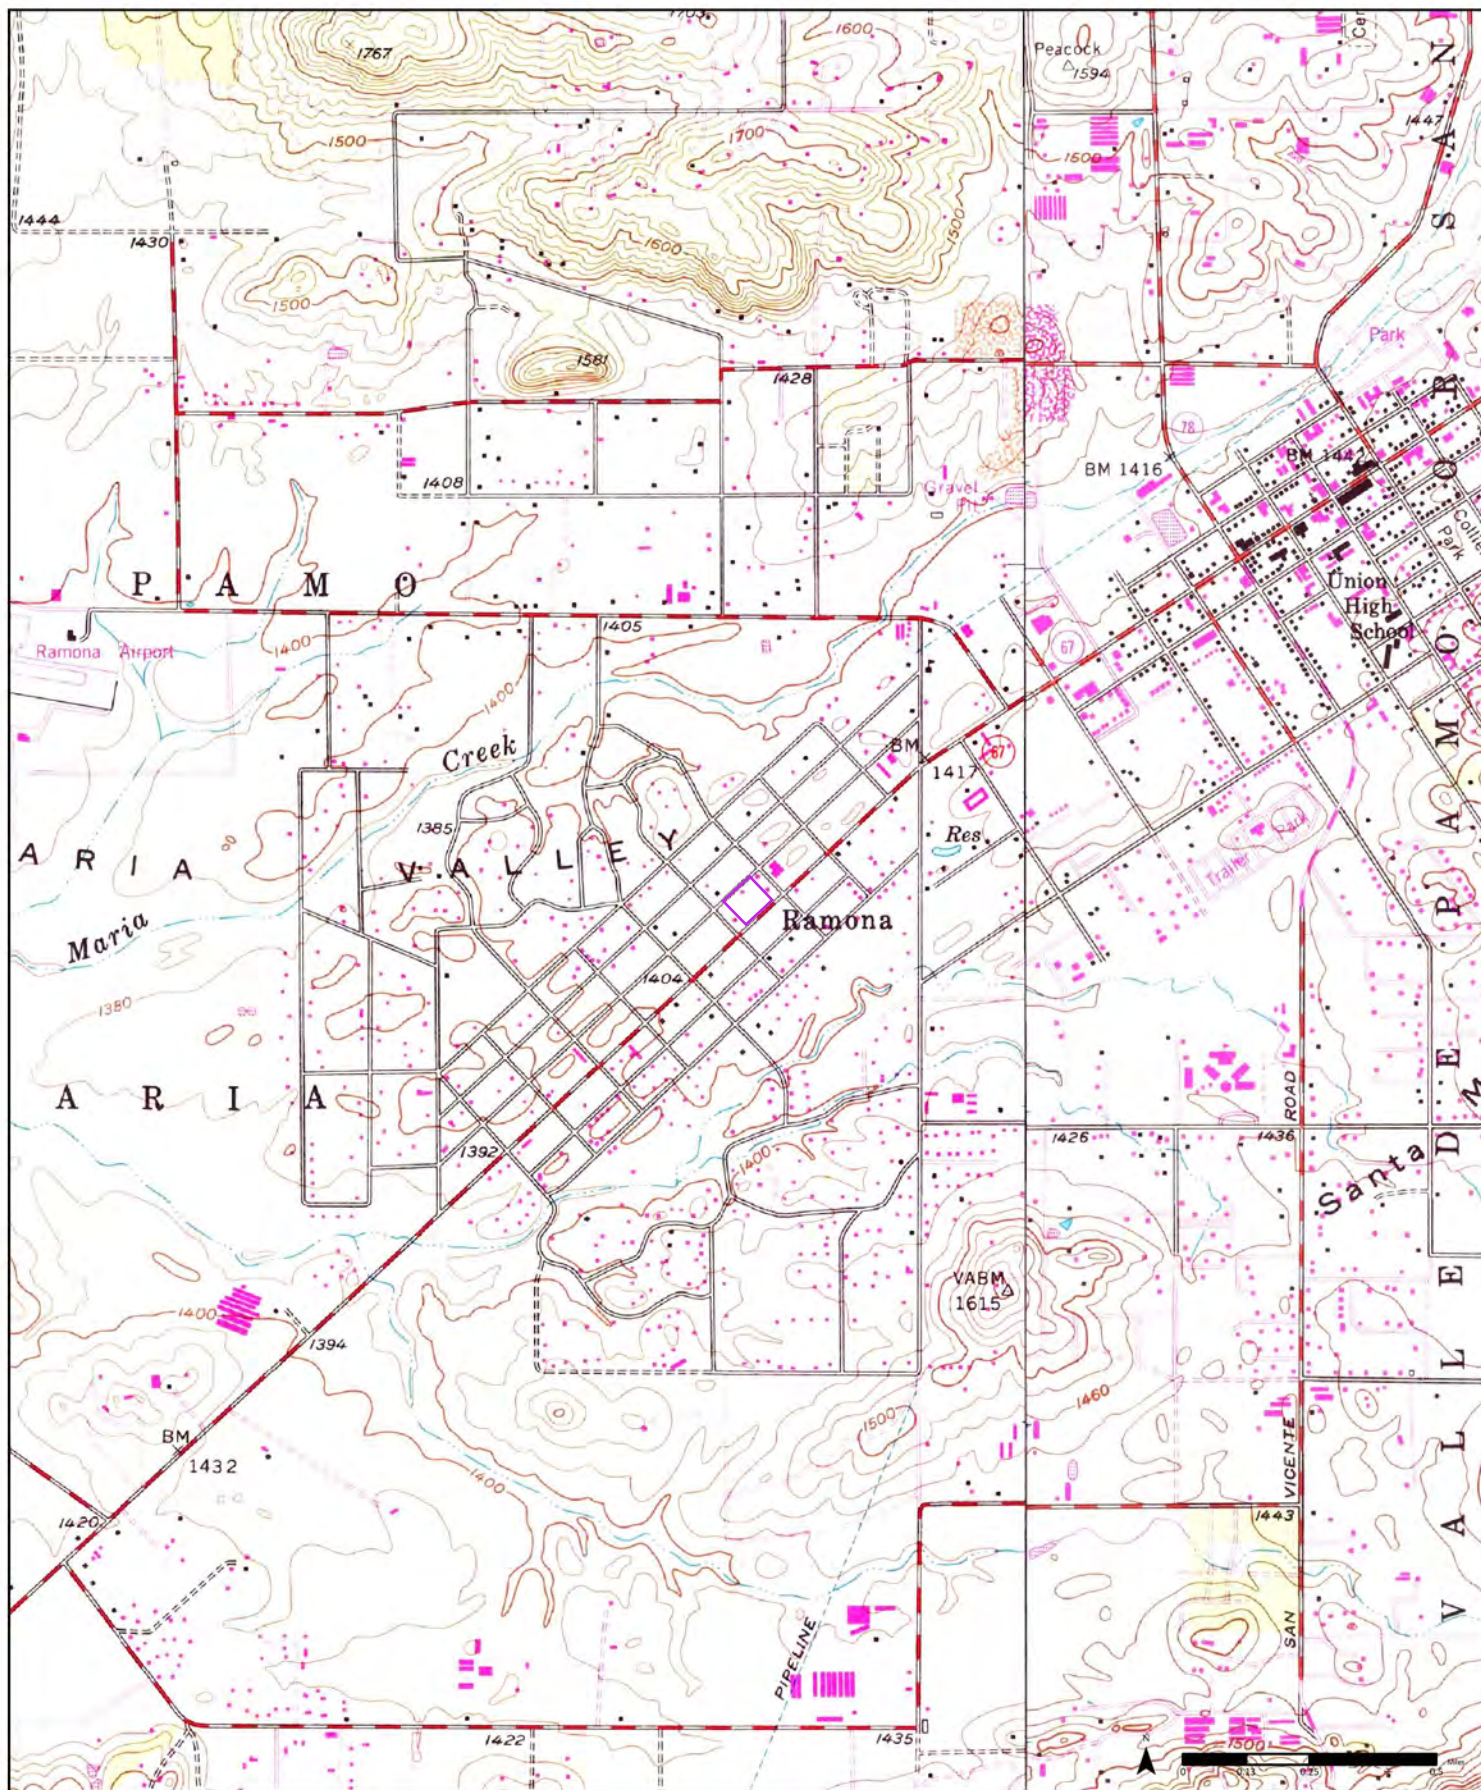

1982


(1-1982) Aerial Photo Year: 1980
Photo Revision Year: 1982

(2-1982) Aerial Photo Year: 1980
Photo Revision Year: 1982

Order No. 25121100452



Available Quadrangle(s): San Pasqual, CA(1-1982)
Ramona, CA(2-1982)

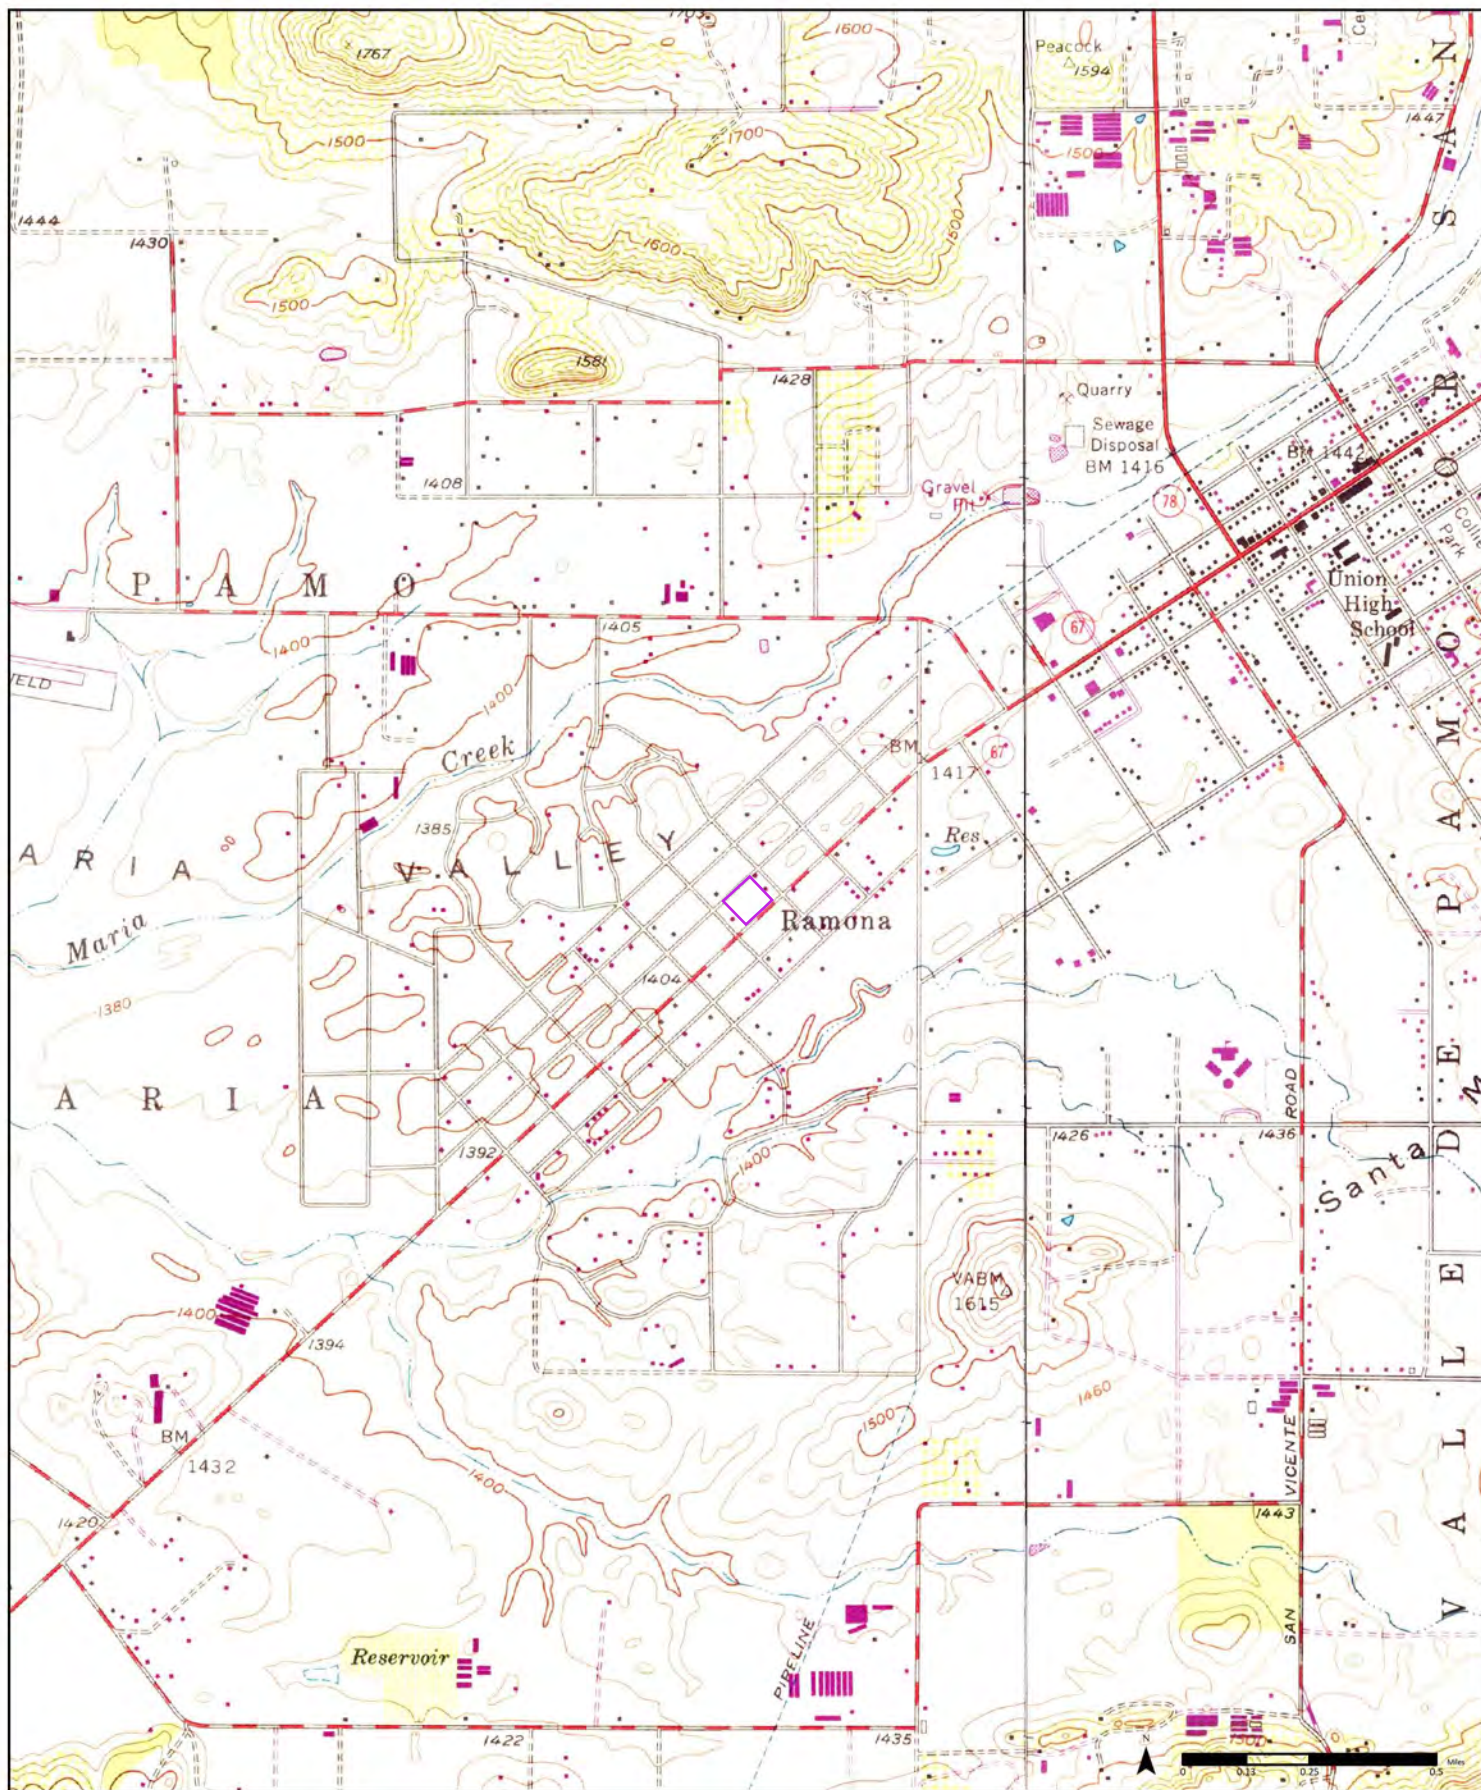


1971 (1-1971) Aerial Photo Year: 1971 (2-1971) Aerial Photo Year: 1971
 Photo Revision Year: 1971 Photo Revision Year: 1971

Order No. 25121100452



Available Quadrangle(s): San Pasqual, CA(1-1971)
 Ramona, CA(2-1971)

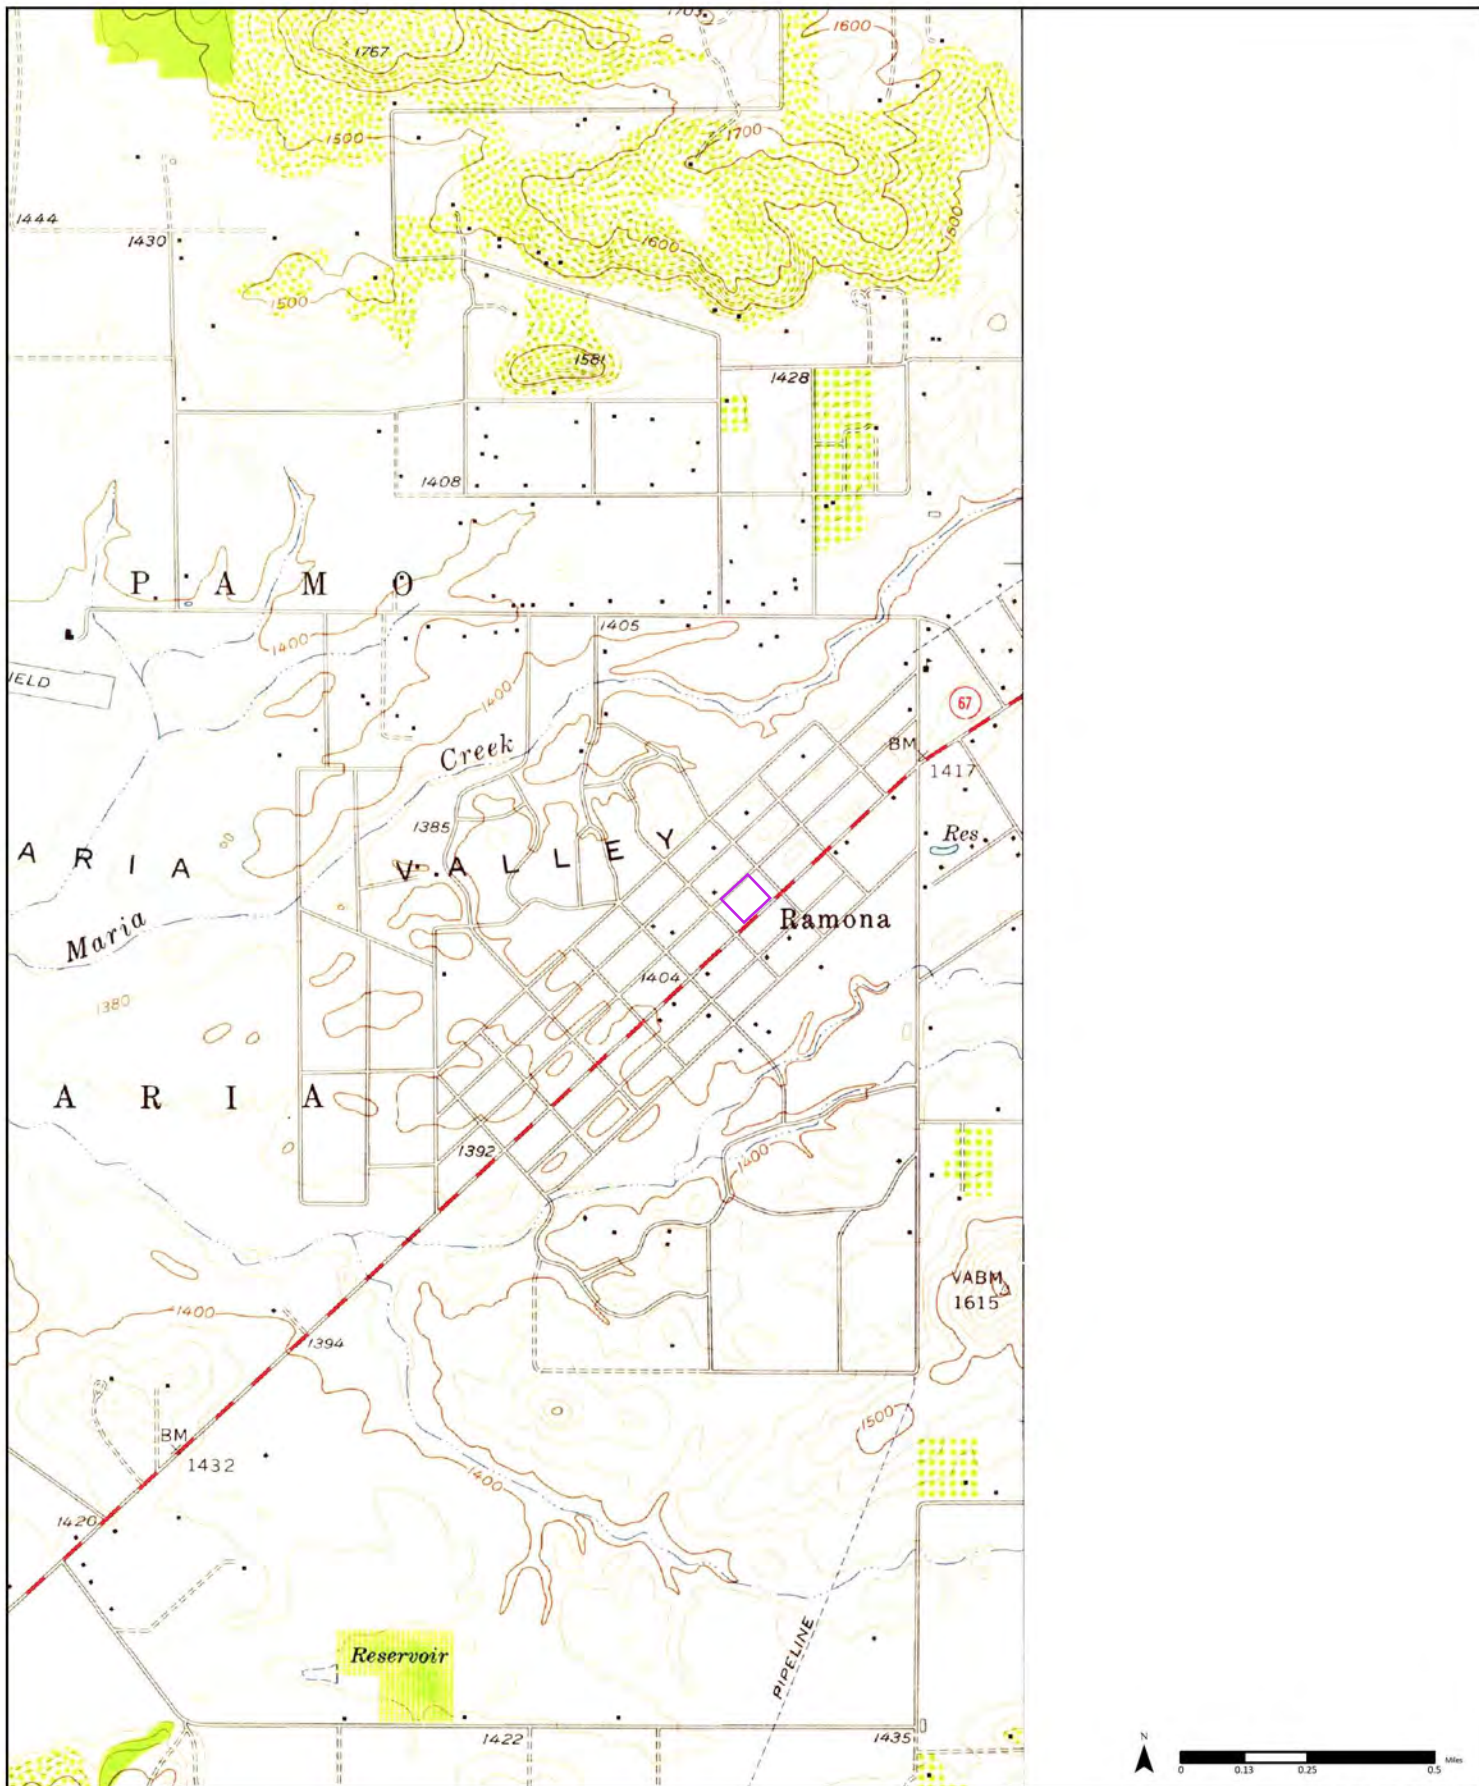

1954 (1-1954) Aerial Photo Year: 1949


Order No. 25121100452



Available Quadrangle(s): San Pasqual, CA(1-1954)

Source: USGS 7.5 Minute Topographic Map



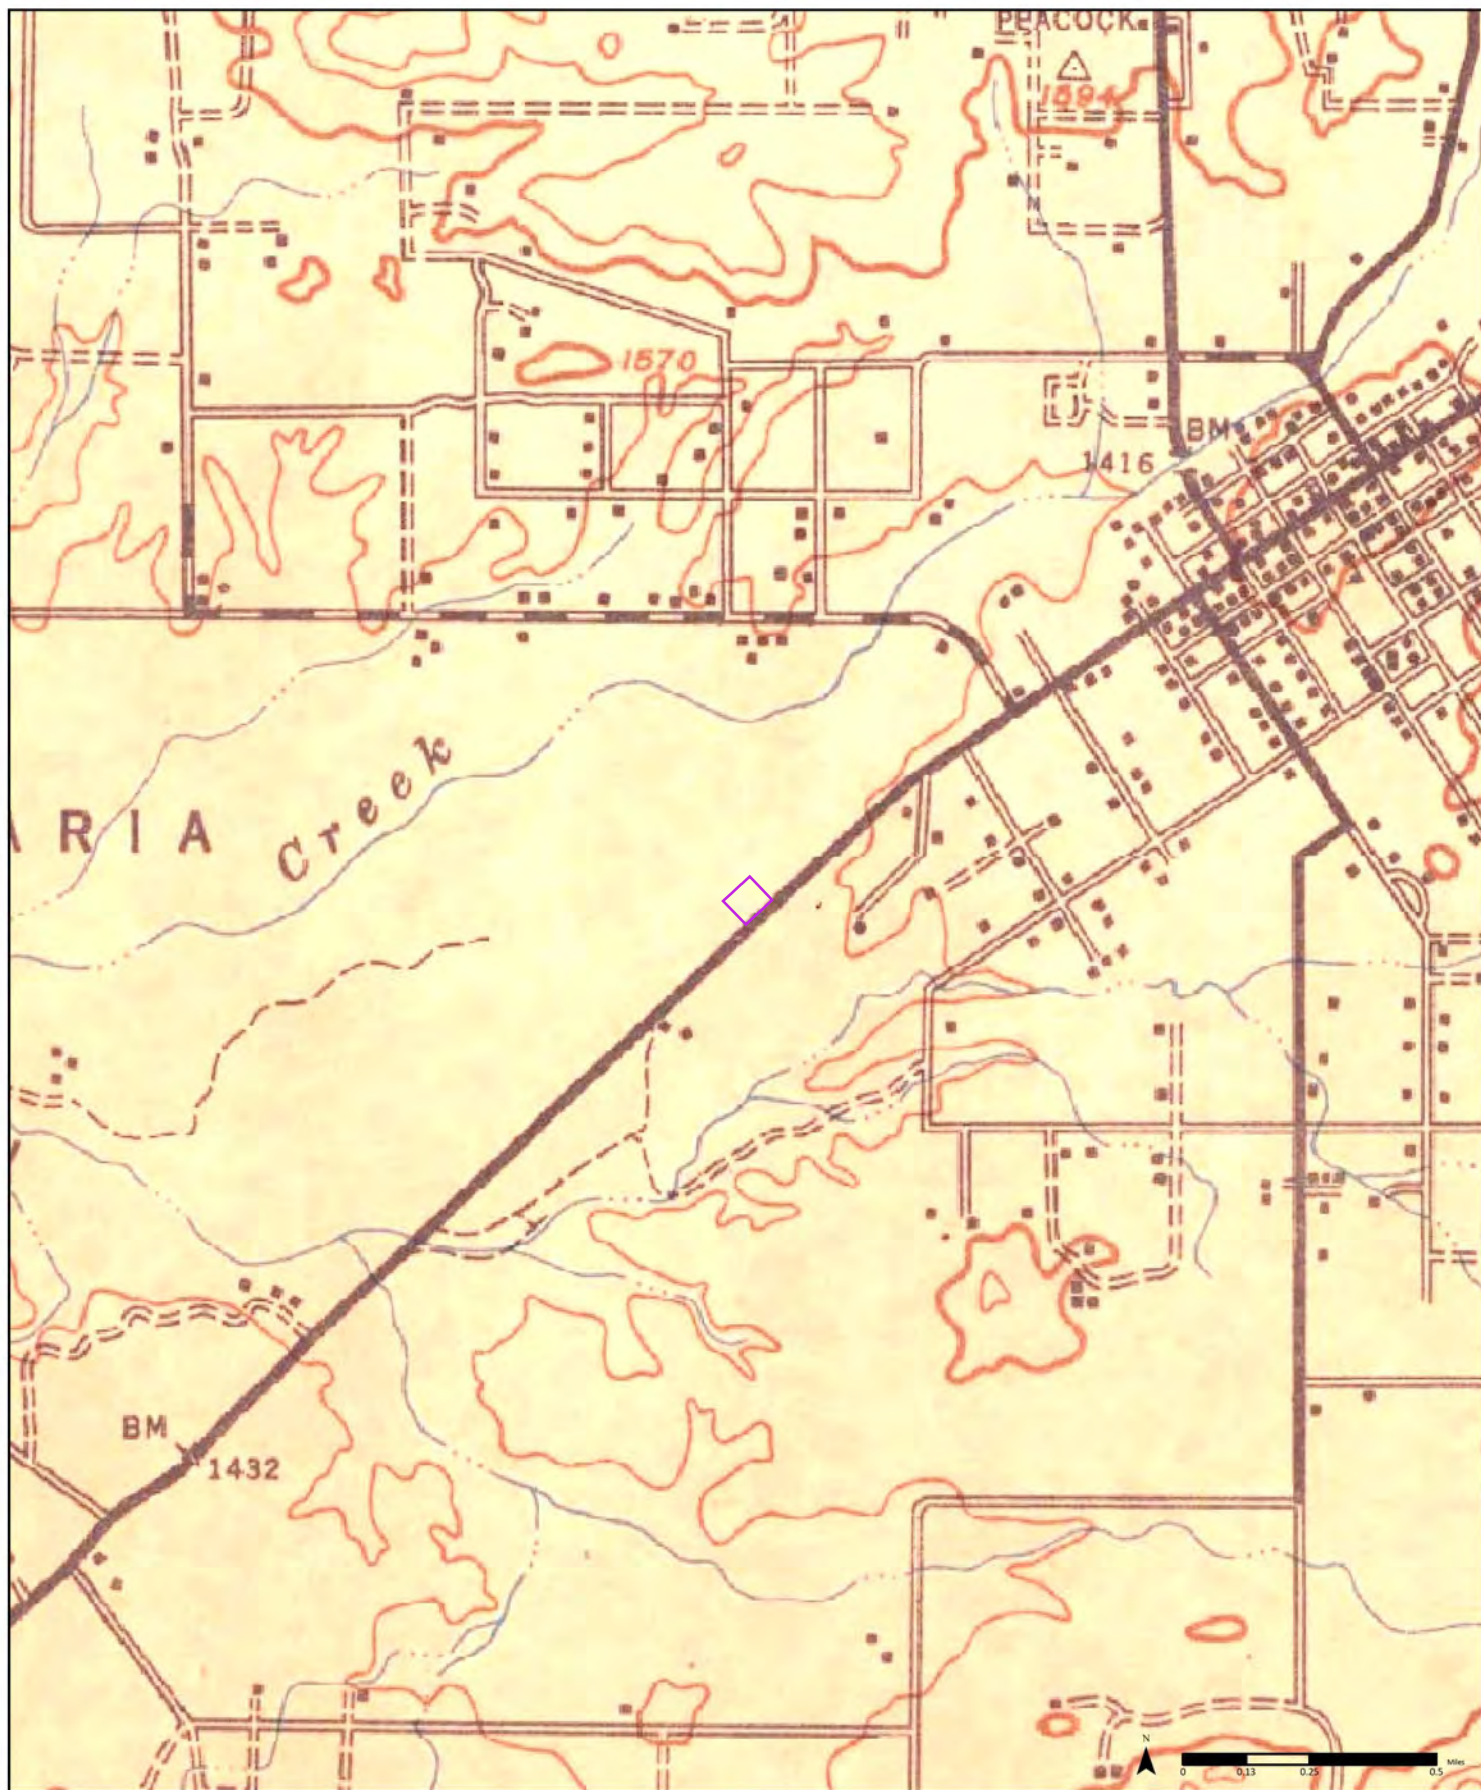

1947

(1-1947)
Aerial Photo Year: 1939


Order No. 25121100452



Available Quadrangle(s): Ramona, CA(1-1947)

Source: USGS 15 Minute Topographic Map



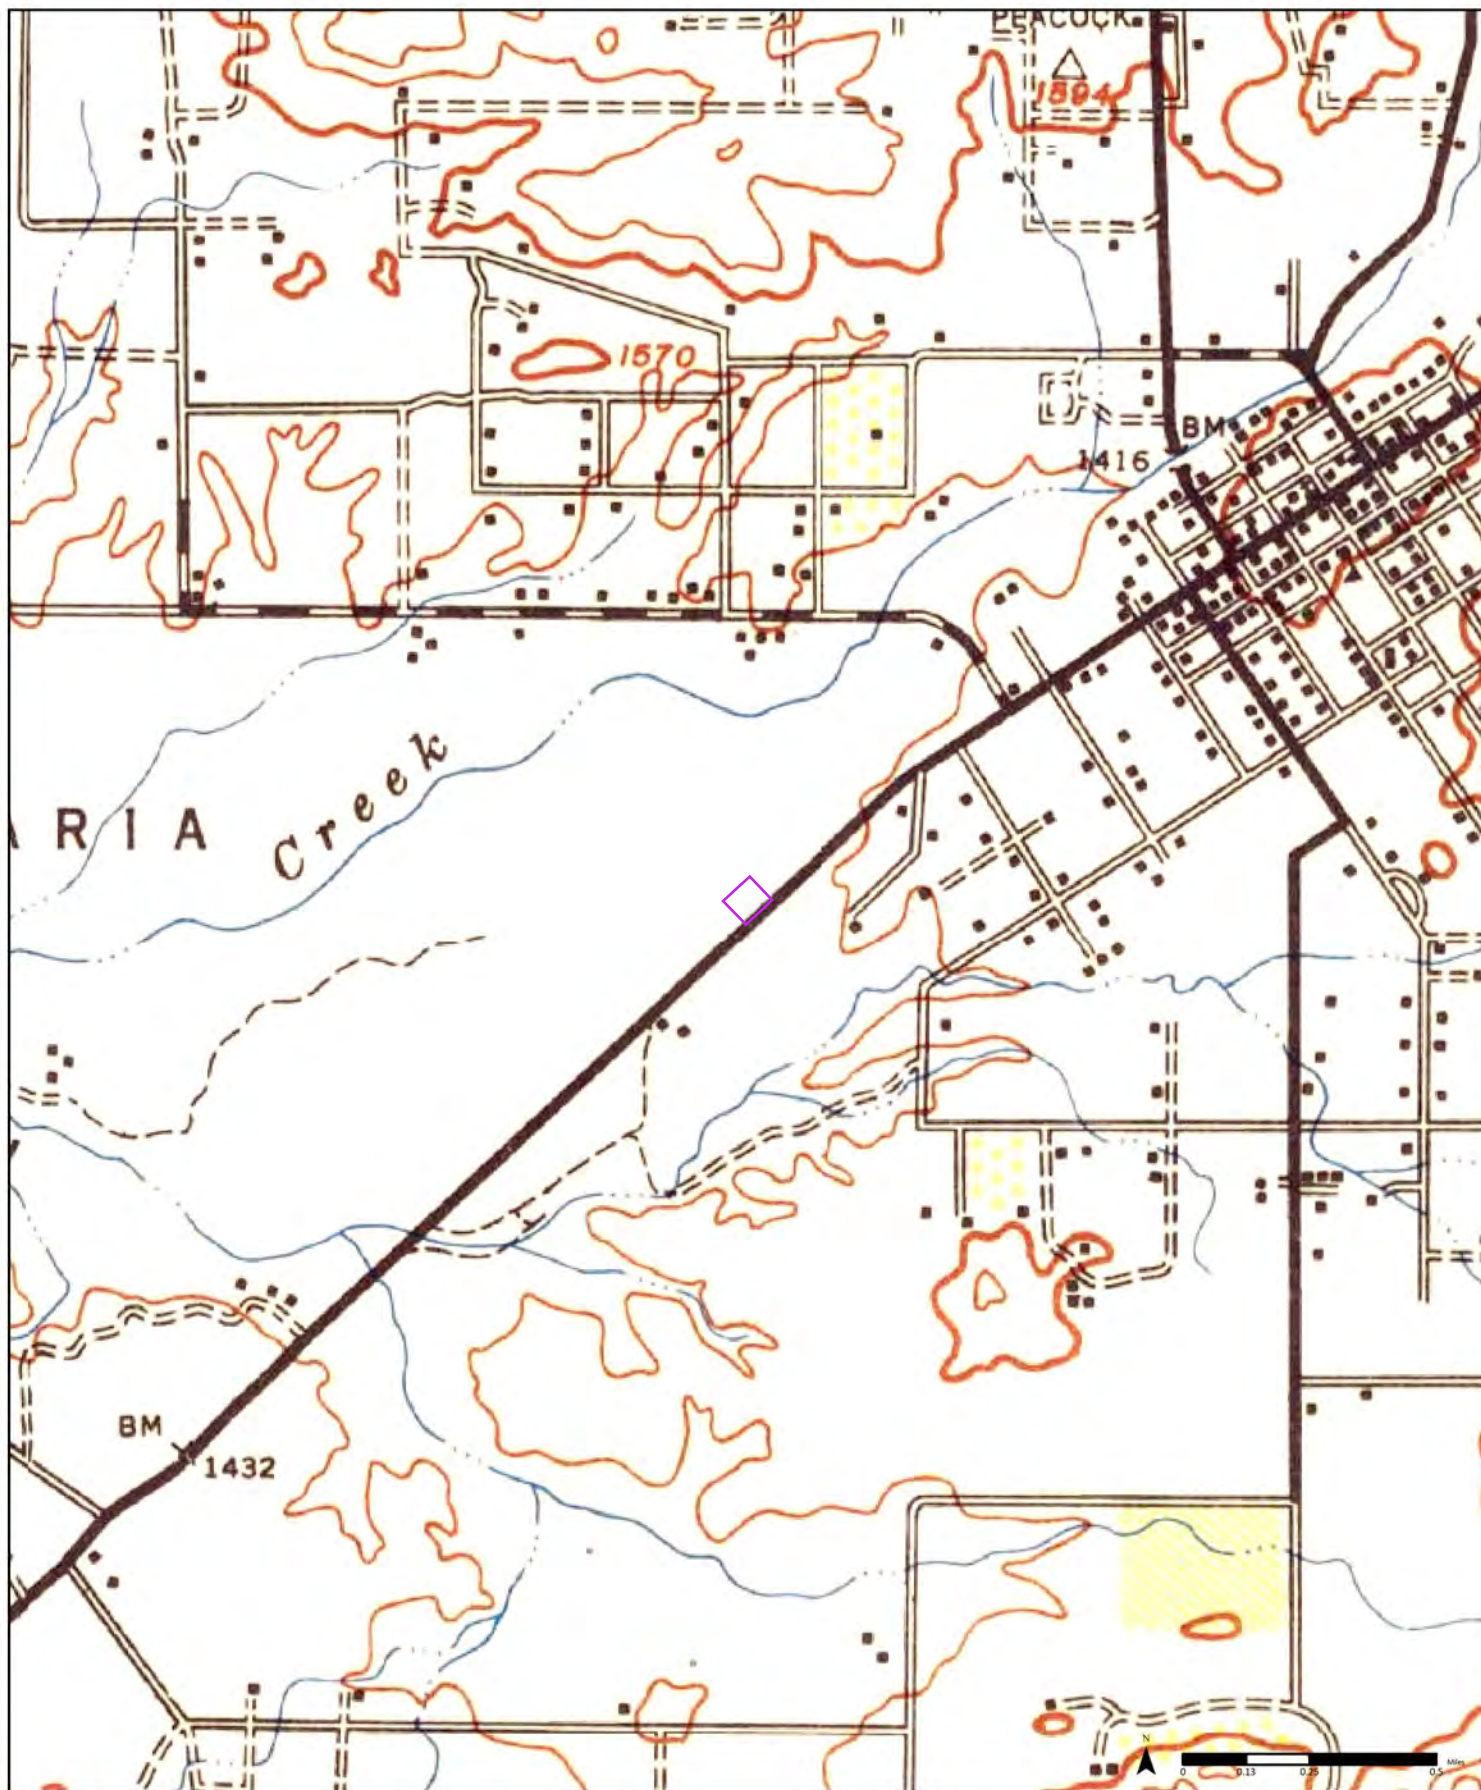

1942

(1-1942)
Aerial Photo Year: 1939

Order No. 25121100452



Available Quadrangle(s): Ramona, CA(1-1942)

Source: USGS 15 Minute Topographic Map





FIRE INSURANCE MAPS

Project Property: Proposed Hotel Ramona Phase I
2021 Main Street Ramona CA 92065

Project No: 6025338

Requested By: NOVA Services, Inc.

Order No: 25121100452

Date Completed: December 12, 2025

Please note that no information was found for your site or adjacent properties.

Environmental Risk Information Services

A division of Glacier Media Inc.

1.866.517.5204 | info@erisinfo.com | erisinfo.com



CITY DIRECTORY

Project Property: *Proposed Hotel Ramona Phase I*
2021 Main Street
Ramona, CA 92065

Project No: *6025338*

Requested By: *NOVA Services, Inc.*

Order No: *25121100452*

Date Completed: *December 17, 2025*

Environmental Risk Information Services

A division of Glacier Media Inc.

1.866.517.5204 | info@erisinfo.com | erisinfo.com

December 17, 2025
RE: CITY DIRECTORY RESEARCH
2021 Main Street
Ramona, CA 92065

Thank you for contacting ERIS for an City Directory Search for the site described above. Our staff has conducted a reverse listing City Directory search to determine prior occupants of the subject site and adjacent properties. We have provided the nearest addresses(s) when adjacent addresses are not listed. If we have searched a range of addresses, all addresses in that range found in the Directory are included.

Note: Reverse Listing Directories generally are focused on more highly developed areas. Newly developed areas may be covered in the more recent years, but the older directories will tend to cover only the "central" parts of the city. To complete the search, we have either utilized the ACPL, Library of Congress, State Archives, and/or a regional library or history center as well as multiple digitized directories. These do not claim to be a complete collection of all reverse listing city directories produced.

ERIS has made every effort to provide accurate and complete information but shall not be held liable for missing, incomplete or inaccurate information. To complete this search we used the general range(s) below to search for relevant findings. If you believe there are additional addresses or streets that require searching please contact us at 866-517-5204.

Search Criteria:

1900-2150 of Main St
All of Vermont St

Search Notes:

Search Results Summary

Date	Source	Comment
2023	DIGITAL BUSINESS DIRECTORY	
2020	DIGITAL BUSINESS DIRECTORY	
2016	DIGITAL BUSINESS DIRECTORY	
2012	DIGITAL BUSINESS DIRECTORY	
2008	DIGITAL BUSINESS DIRECTORY	
2003	DIGITAL BUSINESS DIRECTORY	
2001	HAINES	
1996	HAINES	
1991	HAINES	
1986	HAINES	
1980	HAINES	
1975	HAINES	
1970	HAINES	

Environmental Risk Information Services

A division of Glacier Media Inc.

1.866.517.5204 | info@erisinfo.com | erisinfo.com

1905 **LESLIE'S SWIMMING POOL SUPLS...**SWIMMING POOL EQUIPMENT & SUPLS-
RETAIL
1905 **LESLIE'S SWIMMING POOL SUPLS...**SWIMMING POOL EQUIPMENT & SUPLS
(WHLS)
1910 **1ST CHOICE GARAGE DOOR REPAIR...**GARAGE DOORS-REPAIRING
1910 **RAMONA MOBIL MART...**CONVENIENCE STORES
1910 **STARS...**ALTERNATIVE FUELS
1910 **STARS...**SERVICE STATIONS-GASOLINE & OIL
1925 **BIG APPLE BAGELS...**COFFEE & TEA
1925 **BIG APPLE BAGELS...**WEDDING BAKERIES
1925 **BIG APPLE BAGELS...**BAGELS
1925 **BIG APPLE BAGELS...**BAKERS-RETAIL
1925 **RAMONA APPLIANCE REPAIR MEN...**APPLIANCES-HOUSEHOLD-MAJOR-
REPAIRING
1925 **TACO BELL...**RESTAURANTS
1925 **VALENCIA'S CREM DE LA CREM...**NONCLASSIFIED ESTABLISHMENTS
1935 **O'REILLY AUTO PARTS...**BATTERIES-STORAGE-RETAIL
1935 **O'REILLY AUTO PARTS...**BATTERIESSTORAGEWHOLESALE
1935 **O'REILLY AUTO PARTS...**AUTOMOBILE REPAIRING & SERVICE
1935 **O'REILLY AUTO PARTS...**AUTOMOBILE PARTS & SUPPLIES-RETAIL-NEW
1936 **RAMONA AUTOMOTIVE...**AUTOMOBILE REPAIRING & SERVICE
1936 **RAMONA AUTOMOTIVE...**AUTOMOBILE REPAIR/SVC-EQUIP & SUPLS-MFRS
1936 **SMOG CHECK STATIONS...**AUTOMOBILE INSPECTION STATIONS-NEW/USED
1939 **BEAR AUTO VEHICLE REGISTRATION...**LICENSE SERVICES
1939 **BEAR AUTO VEHICLE REGISTRATION...**VEHICLE & DRIVERS LICENSING
SERVICES
1939 **FLIGHT TECHNOLOGY CORP...**ENGINEERS-AERONAUTICAL
1939 **LOW PRICE AUTO GLASS...**GLASS-AUTO PLATE & WINDOW & ETC
1939 **SUN VALLEY BODY & PAINT...**RECREATIONAL VEHICLES-REPAIRING & SVC
1939 **SUN VALLEY BODY & PAINT...**AUTOMOBILE BODY-REPAIRING & PAINTING
1939 **TANGUAY'S RAMONA TRUCK & AUTO...**AUTOMOBILE REPAIRING & SERVICE
1939 **U HAUL NEIGHBORHOOD DEALER...**TRUCK RENTING & LEASING
1946 **DENNY'S...**FOODS-CARRY OUT
1946 **DENNY'S...**RESTAURANTS
1946 **DENNY'S...**CAFES
2005 **HILL, JAMES L DDS...**DENTISTS
2019 **ALBERTOS...**RESTAURANTS
2019 **WEBB POOL & SPA...**SWIMMING POOL EQUIPMENT & SUPLS (WHLS)
2019 **WEBB POOL & SPA...**SWIMMING POOL EQUIPMENT & SUPPLIES-MFRS
2021 **FINEST BLENDS BARBERSHOP...**BARBERS
2037 **BRAND X METHOD POWERLIFTING...**EXERCISE & PHYSICAL FITNESS
PROGRAMS
2055 **BJ'S RENTALS...**RENTAL SERVICE-STORES & YARDS
2055 **BJ'S RENTALS...**CONTRACTORS-EQUIPMENT & SUPLS-RENTING
2102 **ABROMA HEALTH SYSTEMS LLC...**HEALTH SERVICES
2102 **CENTURY 21...**FEDERAL GOVERNMENT CONTRACTORS
2102 **CENTURY 21...**REAL ESTATE
2102 **CENTURY 21...**REAL ESTATE BUYERS & BROKERS
2102 **CENTURY 21...**REAL ESTATE INSPECTION
2102 **GUERRERO, PATTI...**REAL ESTATE
2102 **JIM ROY...**NONCLASSIFIED ESTABLISHMENTS
2102 **SAN VICENTE MORTGAGE...**LOANS
2102 **SAN VICENTE MORTGAGE...**REAL ESTATE LOANS
2102 **SANDERLING RENAL SVC...**SERVICES NEC
2117 **MEDICAL ASSISTANTS REGL SVC...**PHYSICIANS & SURGEONS EQUIP &
SUPLS-WHLS
2119 **MOM'S PIE HOUSE...**FOODSCARRY OUT
2119 **MOM'S PIE HOUSE...**RESTAURANTS
2119 **PRICE SERVICE VACUUM CTR...**VACUUM CLEANERS-REPAIRING & PARTS
2119 **PRICE SERVICE VACUUM CTR...**CLOCKS-REPAIRING & PARTS
2130 **COLDWELL BANKER...**REAL ESTATE
2130 **COLDWELL BANKER...**REAL ESTATE INSPECTION
2130 **SHARON QUISENBERRY...**NONCLASSIFIED ESTABLISHMENTS
2134 **MINER'S DINER...**RESTAURANTS
2134 **MINER'S DINER...**FOODSCARRY OUT

1709 **ALBERTO GARNICA...**RESIDENTIAL
1729 **HAROLD ROSSON...**RESIDENTIAL
1922 **JOSEPH LINN ROOFING...**ROOFING CONTRACTORS
1970 **FIRST CHRISTINA CHURCH RAMONA...**CHURCHES
2021 **ALEX DORNBACH...**RESIDENTIAL
2021 **GUY THRAP...**RESIDENTIAL
2144 **DANIEL CLAYCOMB...**RESIDENTIAL
2337 **LAMONT CLARK...**RESIDENTIAL
2337 **RESCUED PUP BOUTIQUE...**HUNTING & TRAPPING
2455 **MARK KIRKLAND...**RESIDENTIAL
2509 **DEE DOUGHERTY...**RESIDENTIAL
2509 **MICHAEL DOUGHERTY...**RESIDENTIAL
2531 **TYLER REESE...**RESIDENTIAL
2655 **LANI THORNTON...**RESIDENTIAL

1905 **LESLIE'S SWIMMING POOL SUPLS...**SWIMMING POOL EQUIPMENT & SUPLS (WHLS)
 1905 **LESLIE'S SWIMMING POOL SUPLS...**SWIMMING POOL EQUIPMENT & SUPLS-RETAIL
 1910 **1ST CHOICE GARAGE DOOR REPAIR...**GARAGE DOORS-REPAIRING
 1910 **RAMONA MOBIL MART...**CONVENIENCE STORES
 1910 **STARS...**ALTERNATIVE FUELS
 1910 **STARS...**SERVICE STATIONS-GASOLINE & OIL
 1925 **BIG APPLE BAGELS...**BAKERS-RETAIL
 1925 **BIG APPLE BAGELS...**BAGELS
 1925 **BIG APPLE BAGELS...**WEDDING BAKERIES
 1925 **BIG APPLE BAGELS...**COFFEE & TEA
 1925 **RAMONA APPLIANCE REPAIR MEN...**APPLIANCES-HOUSEHOLD-MAJOR-REPAIRING
 1925 **TACO BELL...**RESTAURANTS
 1935 **O'REILLY AUTO PARTS...**AUTOMOBILE PARTS & SUPPLIES-RETAIL-NEW
 1935 **O'REILLY AUTO PARTS...**BATTERIES-STORAGE-RETAIL
 1935 **O'REILLY AUTO PARTS...**BATTERIESSTORAGEWHOLESALE
 1935 **O'REILLY AUTO PARTS...**AUTOMOBILE REPAIRING & SERVICE
 1936 **RAMONA AUTOMOTIVE...**AUTOMOBILE REPAIR/SVC-EQUIP & SUPLS-MFRS
 1936 **RAMONA AUTOMOTIVE...**AUTOMOBILE REPAIRING & SERVICE
 1936 **SMOG CHECK STATIONS...**AUTOMOBILE INSPECTION STATIONS-NEW/USED
 1939 **BEAR AUTO-VEHICLE REGISTRATION...**VEHICLE & DRIVERS LICENSING SERVICES
 1939 **BEAR AUTO-VEHICLE REGISTRATION...**LICENSE SERVICES
 1939 **FLIGHT TECHNOLOGY CORP...**ENGINEERS-AERONAUTICAL
 1939 **LOW PRICE AUTO GLASS...**GLASS-AUTO PLATE & WINDOW & ETC
 1939 **SUN VALLEY BODY & PAINT...**RECREATIONAL VEHICLES-REPAIRING & SVC
 1939 **SUN VALLEY BODY & PAINT...**AUTOMOBILE BODY-REPAIRING & PAINTING
 1939 **TANGUAY'S RAMONA TRUCK & AUTO...**AUTOMOBILE REPAIRING & SERVICE
 1939 **U-HAUL NEIGHBORHOOD DEALER...**TRUCK RENTING & LEASING
 1946 **DENNY'S...**RESTAURANTS
 1946 **DENNY'S...**FOODS-CARRY OUT
 1946 **DENNY'S...**CAFES
 2005 **HILL, JAMES L DDS...**DENTISTS
 2019 **WEBB POOL & SPA...**SWIMMING POOL EQUIPMENT & SUPLS (WHLS)
 2019 **WEBB POOL & SPA...**SWIMMING POOL EQUIPMENT & SUPPLIES-MFRS
 2021 **FINEST BLENDS BARBERSHOP...**BARBERS
 2037 **BRAND X METHOD POWERLIFTING...**EXERCISE & PHYSICAL FITNESS PROGRAMS
 2055 **BJ'S RENTALS...**RENTAL SERVICE-STORES & YARDS
 2055 **BJ'S RENTALS...**CONTRACTORS-EQUIPMENT & SUPLS-RENTING
 2102 **CENTURY 21...**FEDERAL GOVERNMENT CONTRACTORS
 2102 **CENTURY 21...**REAL ESTATE
 2102 **CENTURY 21...**REAL ESTATE BUYERS & BROKERS
 2102 **CENTURY 21...**REAL ESTATE INSPECTION
 2102 **GUERRERO, PATTI...**REAL ESTATE
 2102 **JIM ROY...**NONCLASSIFIED ESTABLISHMENTS
 2102 **SAN VICENTE MORTGAGE...**REAL ESTATE LOANS
 2102 **SAN VICENTE MORTGAGE...**LOANS
 2102 **SANDERLING RENAL SVC...**SERVICES NEC
 2117 **MEDICAL ASSISTANTS REGL SVC...**PHYSICIANS & SURGEONS EQUIP & SUPLS-WHLS
 2119 **MOM'S PIE HOUSE...**FOODSCARRY OUT
 2119 **MOM'S PIE HOUSE...**RESTAURANTS
 2119 **PRICE SERVICE VACUUM CTR...**VACUUM CLEANERS-REPAIRING & PARTS
 2119 **PRICE SERVICE VACUUM CTR...**CLOCKS-REPAIRING & PARTS
 2130 **COLDWELL BANKER...**REAL ESTATE
 2130 **COLDWELL BANKER...**REAL ESTATE INSPECTION
 2130 **SHARON QUISENBERRY...**NONCLASSIFIED ESTABLISHMENTS
 2134 **MINER'S DINER...**FOODSCARRY OUT
 2134 **MINER'S DINER...**RESTAURANTS

1709 **ALBERTO GARNICA...**RESIDENTIAL
 1729 **HAROLD ROSSON...**RESIDENTIAL
 1922 **JOSEPH LINN ROOFING...**ROOFING CONTRACTORS
 1970 **FIRST CHRISTINA CHURCH-RAMONA...**CHURCHES
 2021 **ALEX DORNBACH...**RESIDENTIAL
 2021 **GUY THRAP...**RESIDENTIAL
 2144 **DANIEL CLAYCOMB...**RESIDENTIAL
 2337 **DESIGNRIGHT BUILDERS INC...**NONCLASSIFIED ESTABLISHMENTS
 2337 **DESIGNRIGHT BUILDERS INC...**BUILDING CONTRACTORS
 2337 **LAMONT CLARK...**RESIDENTIAL
 2337 **RESCUED PUP BOUTIQUE...**HUNTING & TRAPPING
 2455 **MARK KIRKLAND...**RESIDENTIAL
 2509 **DEE DOUGHERTY...**RESIDENTIAL
 2655 **LANI THORNTON...**RESIDENTIAL

1905 **LESLIE'S SWIMMING POOL SUPLS...**SWIMMING POOL EQUIPMENT & SUPLS-
RETAIL
1905 **LESLIE'S SWIMMING POOL SUPLS...**SWIMMING POOL EQUIPMENT & SUPLS
(WHLS)
1910 **1ST CHOICE GARAGE DOOR REPAIR...**GARAGE DOORS-REPAIRING
1910 **RAMONA MOBIL MART...**CONVENIENCE STORES
1910 **STARS...**SERVICE STATIONS-GASOLINE & OIL
1925 **BIG APPLE BAGELS...**BAKERS-RETAIL
1925 **BIG APPLE BAGELS...**BAGELS
1935 **O'REILLY AUTO PARTS...**AUTOMOBILE PARTS & SUPPLIES-RETAIL-NEW
1935 **O'REILLY AUTO PARTS...**BATTERIES-STORAGE-RETAIL
1936 **RAMONA AUTOMOTIVE...**AUTOMOBILE REPAIRING & SERVICE
1936 **SMOG CHECK STATIONS...**AUTOMOBILE INSPECTION STATIONS-NEW/USED
1939 **BEAR AUTO-VEHICLE REGISTRATION...**LICENSE SERVICES
1939 **BEAR AUTO-VEHICLE REGISTRATION...**VEHICLE & DRIVERS LICENSING
SERVICES
1939 **ELLSWORTH ENTERPRISE MFG...**FEDERAL GOVERNMENT CONTRACTORS
1939 **FLIGHT TECHNOLOGY CORP...**ENGINEERS-AERONAUTICAL
1939 **LOW PRICE AUTO GLASS...**GLASS-AUTO PLATE & WINDOW & ETC
1939 **SPORTSCAR MARKETPLACE...**NONCLASSIFIED ESTABLISHMENTS
1939 **SUN VALLEY BODY & PAINT...**AUTOMOBILE BODY-REPAIRING & PAINTING
1939 **SUN VALLEY BODY & PAINT...**RECREATIONAL VEHICLES-REPAIRING & SVC
1939 **TANGUAY'S RAMONA TRUCK & AUTO...**AUTOMOBILE REPAIRING & SERVICE
1946 **DENNY'S...**RESTAURANTS
1946 **DENNY'S...**FOODS-CARRY OUT
2005 **HILL, JAMES L DDS...**DENTISTS
2019 **WEBB POOL & SPA...**SWIMMING POOL EQUIPMENT & SUPPLIES-MFRS
2019 **WEBB POOL & SPA...**SWIMMING POOL EQUIPMENT & SUPLS (WHLS)
2021 **A COUNTRY CLIP PET GROOMING...**PET WASHING & GROOMING
2037 **PRESTIGE II AUTO...**AUTOMOBILE AIR CONDITIONING EQUIPMENT
2037 **PRESTIGE II AUTO...**AUTOMOBILE BODY-REPAIRING & PAINTING
2055 **BJ'S RENTALS...**RENTAL SERVICE-STORES & YARDS
2055 **BJ'S RENTALS...**CONTRACTORS-EQUIPMENT & SUPLS-RENTING
2102 **ATM...**AUTOMATED TELLER MACHINES
2102 **CENTURY 21...**REAL ESTATE
2102 **CENTURY 21...**OFFICES OF REAL ESTATE AGENTS & BROKERS
2102 **CENTURY 21...**REAL ESTATE BUYERS & BROKERS
2102 **GUERRERO, PATTI...**REAL ESTATE
2102 **JIM ROY...**NONCLASSIFIED ESTABLISHMENTS
2102 **RODOLFF REALTY...**REAL ESTATE
2102 **SAN VICENTE ESCROW...**REAL ESTATE-RENTAL SERVICE
2102 **SAN VICENTE ESCROW...**ESCROW SERVICE
2102 **SAN VICENTE MORTGAGE...**LOANS
2102 **SAN VICENTE MORTGAGE...**REAL ESTATE LOANS
2102 **SAN VICENTE REAL ESTATE SVC...**REAL ESTATE
2115 **JIM DART...**RESIDENTIAL
2117 **HIGH VALLEY APPLIANCE...**APPLIANCES-HOUSEHOLD-MAJOR-REPAIRING
2117 **MEDICAL ASSISTANTS REGL SVC...**PHYSICIANS & SURGEONS EQUIP &
SUPLS-WHLS
2119 **MOM'S PIE HOUSE...**RESTAURANTS
2119 **PRICE SERVICE VACUUM CTR...**CLOCKS-REPAIRING & PARTS
2119 **PRICE SERVICE VACUUM CTR...**VACUUM CLEANERS-REPAIRING & PARTS
2130 **COLDWELL BANKER...**REAL ESTATE
2130 **COLDWELL BANKER REAL ESTATE...**OFFICES OF REAL ESTATE AGENTS &
BROKERS
2130 **FAX, KREG...**REAL ESTATE
2130 **SHARON QUISENBERRY...**NONCLASSIFIED ESTABLISHMENTS
2134 **MINER'S DINER...**RESTAURANTS

1709 **ALBERTO GARNICA...**RESIDENTIAL
1729 **HAROLD ROSSON...**RESIDENTIAL
1922 **JOSEPH LINN ROOFING...**ROOFING CONTRACTORS
1970 **FIRST CHRISTINA CHURCH-RAMONA...**CHURCHES
2021 **GUY THRAP...**RESIDENTIAL
2144 **DANIEL CLAYCOMB...**RESIDENTIAL
2337 **DESIGNRIGHT BUILDERS INC...**NONCLASSIFIED ESTABLISHMENTS
2337 **RESCUED PUP BOUTIQUE...**HUNTING & TRAPPING
2345 **T BLAKEY...**RESIDENTIAL
2443 **JACQUELINE LEONARD...**RESIDENTIAL
2443 **MICHAEL LEONARD...**RESIDENTIAL
2509 **DEE DOUGHERTY...**RESIDENTIAL
2509 **DEQUITTA DOUGHERTY...**RESIDENTIAL
2509 **MICHAEL DOUGHERTY...**RESIDENTIAL
2531 **TYLER REESE...**RESIDENTIAL
2655 **LANI THORNTON...**RESIDENTIAL

1905 **LESLIE'S SWIMMING POOL SUPLS...**SWIMMING POOL EQUIPMENT & SUPLS-
RETAIL
1910 **RAMONA MOBIL MART...**SERVICE STATIONS-GASOLINE & OIL
1925 **COLORFUL NAIL...**MANICURING
1925 **SALON BLONDIES...**BEAUTY SALONS
1935 **O'REILLY AUTO PARTS...**AUTOMOBILE PARTS & SUPPLIES-RETAIL-NEW
1936 **RAMONA AUTOMOTIVE...**AUTOMOBILE REPAIRING & SERVICE
1939 **BEAR AUTO-VEHICLE REGISTRATION...**LICENSE SERVICES
1939 **ELLSWORTH ENTERPRISE MFG...**PRODUCT DESIGN/DEVELOPMENT
CONSULTANTS
1939 **RAMONA MOTORS...**AUTOMOBILE DEALERS-USED CARS
1939 **SUN VALLEY BODY & PAINT...**AUTOMOBILE BODY-REPAIRING & PAINTING
1939 **TANGUAY'S RAMONA TRUCK & AUTO...**AUTOMOBILE REPAIRING & SERVICE
1939 **YAKKEY RACING...**MOTORCYCLES & MOTOR SCOOTERS-RPR & SVC
1946 **DENNY'S...**RESTAURANTS
2005 **HILL, JAMES L DDS...**DENTISTS
2019 **LINDA'S NAIL COTTAGE...**MANICURING
2019 **WEBB POOL & SPA...**SWIMMING POOL EQUIPMENT & SUPLS (WHLS)
2021 **A COUNTRY CLIP PET GROOMING...**PET WASHING & GROOMING
2037 **PRESTIGE II AUTO...**AUTOMOBILE BODY-REPAIRING & PAINTING
2055 **BJ'S RENTALS...**CONTRACTORS-EQUIPMENT & SUPLS-RENTING
2102 **CENTURY 21...**REAL ESTATE
2102 **GUERRERO, PATTI...**REAL ESTATE
2102 **RODOLFF REALTY...**REAL ESTATE
2102 **SAN VICENTE ESCROW...**ESCROW SERVICE
2102 **SAN VICENTE MORTGAGE...**REAL ESTATE LOANS
2102 **SAN VICENTE REAL ESTATE SVC...**REAL ESTATE
2119 **PRICE SERVICE CTR...**TELEVISION-CABLE & CATV
2121 **HEARTS & CRAFTS...**RUBBER & PLASTIC STAMPS
2130 **COLDWELL BANKER...**REAL ESTATE

1729 **SALLY ROSSON...**RESIDENTIAL
2045 **EVA GAXIOLA...**RESIDENTIAL
2345 **DOREEN HARVEY...**RESIDENTIAL
2455 **DENISE THORNTON...**RESIDENTIAL
2509 **MICHAEL DOUGHERTY...**RESIDENTIAL
2543 **ASHLEY HERRERA...**RESIDENTIAL
2543 **CAROL AHLSTRAND...**RESIDENTIAL
2543 **DEAN HERRERA...**RESIDENTIAL
2543 **KODY AHLSTRAND...**RESIDENTIAL
2655 **JOHN BAUMANN...**RESIDENTIAL
2655 **LANI THORNTON...**RESIDENTIAL
2655 **LANI THORTON...**RESIDENTIAL

1910 RAMONA MOBIL MART...SERVICE STATIONS-GASOLINE & OIL
1910 RAMONA MOBIL MART...GASOLINE SV STATION
1925 BIG APPLE BAGELS...RETAIL BAKERIES
1925 COLORFUL NAIL...BEAUTY SHOPS
1925 REALTY WORLD RAMONA...MORTGAGE BANKERS
1925 REALTY WORLD RAMONA...REAL ESTATE
1935 KRAGEN AUTO PARTS...AUTOMOBILE PARTS & SUPPLIES-RETAIL-NEW
1935 KRAGEN AUTO SUPPLY...AUTO, HOME SUPS STR
1936 RAMONA AUTOMOTIVE...GENERAL AUTO REPAIR
1936 RAMONA AUTOMOTIVE...AUTOMOBILE REPAIRING & SERVICE
1939 BEAR AUTO-VEHICLE REGISTRATION...BUSINESS SVS NEC
1939 ELLSWORTH ENTERPRISE MFG...MRKTING CONSULT SVCS
1939 ELLSWORTH ENTERPRISE MFG...PRODUCT DEVELOPMENT & MARKETING
1939 FLIGHT TECHNOLOGY CORP...ENGINEERS-AERONAUTICAL
1939 FLIGHT TECHNOLOGY CORP...ENGINEERING SERVICE
1939 GRECO SYSTEMS...MFG ELECTRONIC COMPUTERS WHOL
COMPUTERS/PERIPHERALS
1939 LOWEST PRICE AUTO GLASS...GLASS
1939 LOWEST PRICE AUTO GLASS...GLASS-AUTO PLATE & WINDOW & ETC
1939 PACIFIC SAW & LAWN MOWER LLC...LAWN MOWERS
1939 RAMONA MAC...BUILDING CONTRACTORS
1939 RAMONA MOTORS...COMM/OFF BLDG NEW CON
1939 RAMONA TRUCK & AUTO...AUTOMOBILE REPAIRING & SERVICE
1939 SUN VALLEY BODY & PAINT...AUTO BODY REPAIR
1939 TANGUAYS RAMONA TRUCK & AUTO...GENERAL AUTO REPAIR
1946 DENNYS...RESTAURANTS
1946 DENNYS RESTAURANT...CAFE/DINER/FAMILY REST
2005 JAMES L HILL DDS INC...DENTIST'S OFFICE
2005 JAMES L HILL INC...DENTISTS OFF,CLINIC
2005 JAMES L HILL INC...DENTISTS
2019 LINDAS NAIL COTTAGE...MANICURING
2019 LINDAS NAIL COTTAGE...BEAUTY SHOPS
2019 WEBB POOL & SPA...SPG,ATHLETIC GOODS
2021 A COUNTRY CLIP...ANIMAL SERVICES
2021 A COUNTRY CLIP PET GROOMING...PET WASHING & GROOMING
2021 A COUNTRY CLIP PET GROOMING...GROOMING SVCS PETS
2021 RAMONA COUNTRY CRAFTS...CRAFT GALLERIES & DEALERS
2021 RAMONA COUNTRY CRAFTS...MISC RETAIL STORES
2037 HOPE VINEYARD CHRISTIAN...RELIGIOUS ORGANIZ
2037 HOPE VINEYARD CHRISTIAN...CHURCHES
2055 B JS RENTALS INC...HV CONSTR EQP RENT
2055 RENTX EQUIPMENT RENTAL...CONTRACTORS-EQUIPMENT & SUPLS-RENTING
2115 ADANAC BUSINESS SVC...SECRETARIAL & COURT REPORTING SERVICES
2115 MC KENZIE ELECTRONIC DESIGN...ELECTRICAL,ELECTRONIC
2117 MEDICAL ASSISTANTS REGIONAL SE...WHOL MEDICAL/HOSPITAL
EQUIPMENT
2117 MEDICAL ASSISTANTS REGL SVC...MEDICAL EQUIP,SUPPS
2117 MYSTIQUE BEAUTY LOUNGE...COCKTAIL LOUNGES
2119 PRICE SERVICE CTR...TELEVISION-CABLE & CATV
2119 PRICE SERVICE CTR...CABLE & PAY TV SVS
2121 RAMONA PUMP & SUPPLY...WATER WELL DRILLING
2121 SAPPHIRE BOOKS...RET GIFTS/NOVELTIES RET USED MERCHANDISE RET MISC
MERCH
2121 SAPPHIRE BOOKS...OFFICE FORMS,SUPPS
2130 ASSOCIATES REALTY...REAL ESTATE AGT,MGR
2130 ASSOCIATES REALTY...REAL ESTATE
2130 CHERYL HOTCHKISS...REAL ESTATE
2130 CHERYL HOTCHKISS...REAL ESTATE AGT,MGR
2130 COLDWELL BANKER...REAL ESTATE AGT,MGR
2130 COLDWELL BANKER...REAL ESTATE
2130 WEST COAST ESCROW RAMONA...ESCROW SERVICE

1709 ALFREDO CARNICA...RESIDENTIAL
1709 NORMA CERVANTES...RESIDENTIAL
1922 JOSEPH LINN ROOFING...ROOFG, SHEET MET WK
1922 JOSEPH LINN ROOFING...ROOFING CONTRACTORS
1970 FIRST CHRISTIAN CHURCH...RELIGIOUS ORGANIZ
1970 FIRST CHRISTIAN CHURCH...CHURCHES
1970 WILLIAM ZABRISKIE...RESIDENTIAL
2144 DANIEL CLAYCOMB...RESIDENTIAL
2509 MATT DOUGHERTY...RESIDENTIAL
2509 MICHAEL DOUGHERTY...RESIDENTIAL
2531 RAYMOND C ALCARAZ...RESIDENTIAL
2655 ERIC M THORSON...RESIDENTIAL

1905 PAYLESS SHOE SOURCE...CUSTOM AND ORTHOPEDIC SHOES
1910 RAMONA MOBIL MART
1935 KRAGEN AUTO PARTS
1936 RAMONA AUTOMOTIVE...ENGINE REPAIR
1936 SMOG CHECK STATIONS
1939 ANDERSON AUTO ELECTRIC...ENGINE REPAIR
1939 ENTERPRISE RENT A CAR
1939 FLIGHT TECHNOLOGY CORP
1939 MED ASSIST BILLING CONSULTANTS
1939 POINTE MNFT MOBILE HOME SALES
1939 RAMONA MAC
1939 RAMONA TRUCK & AUTO...ENGINE REPAIR
1939 SUN VALLEY BODY & PAINT...INTERIOR REPAIR SERVICES
1939 SUN VALLEY MOTORSPORTS
1939 YAKKEY RACING
2005 HILL JAMES L DDS...SPECIALIZED DENTAL PRACTITIONERS
2019 WEBB POOL & SPA...EDUCATIONAL AIDS AND ELECTRONIC TRAINING MATERIALS
2021 A COUNTRY CLIP PET GROOMING
2021 RICK'S VIDEO REPAIR
2037 HOPE VINEYARD CHRISTIAN
2055 RENTX EQUIPMENT RENTAL
2102 ROUTE 67 ROADHOUSE...STEAK AND BARBECUE RESTAURANTS
2115 ADANAC BUSINESS SVC
2115 CHAPLAN ROOFING
2115 LIVERMORE PUMP
2115 NEWCOMB JACQUELINE PHD
2115 RAMONA PUMP...ENGINE REPAIR
2117 COMPUTER SMART
2119 DISH NETWORK CENTER-SAN DIEGO
2119 PRICE SERVICE CTR
2121 SAPPHIRE BOOKS...HOME FURNISHINGS AND APPLIANCES, SECONDHAND
2130 COLDWELL BANKER ASSOCIATES

1729 HAROLD E ROSSON...RESIDENTIAL
1970 FIRST CHRISTIAN CHURCH
1970 WILLIAM ZABRISKIE...RESIDENTIAL
2144 ALBERTA L LOCKRIDGE...RESIDENTIAL
2144 LEON A HOWETH...RESIDENTIAL
2144 LEON HOWETH...RESIDENTIAL
2509 MICHAEL DOUGHERTY...RESIDENTIAL
2531 RAYMOND C ALCARAZ...RESIDENTIAL

MAIN				92065 CONT				MAIN AV N			
	* FLETCHER MARY K	760-789-2500	5		* UNWEYWAY INC	760-789-6960	4		* SC		
	DMD				* UNWEYWAY INC	760-789-5910	4		* SC		
	* FLETCHER-CAMERUCCI	760-789-2500	5	2340	XXXX	OO			* VI		
	MARY DMD			2344	* GLENN'S AUTOMOTIVE	760-789-2900	8		* VI		
	* HABIB Jamal	OO	+1		* MIKES LAWINMOWER	760-788-1361	5		* VI		
	* MYERS J RONALD DC	760-789-2520			RPR				* VI		
	* MYERS GARY B DD	760-789-1191			* RAMONA MUFFLER	760-789-8800	3	221	* VI		
	* NOWACK DUANE C	760-789-7002			* RAMONA PRECISION	760-789-2021	8	223	* VI		
	DOS				MACHINE			224	* VI		
	* RAMONA CHIRO CLINIC	760-789-2520			* WILSON GLASS	760-789-8087	7	225	* VI		
	* SMART DENTAL CORP	760-789-3340			* WILSON GLASS	760-789-8047	0	227	* VI		
	* SWARTZ CHRIS DDD	760-789-3340		2366	* PRUDENTIAL CA	760-789-8050	0	231	* VI		
	ORTHODONTIST				REALTY			232	* VI		
1735	* BETTER HEARING	760-789-8367	+1		* SOUZA John	OO	0	235	* VI		
	SYSTEMS			X	KALBAUGH S				* VI		
	* BLOCK H&R	760-789-3510		2405	FOX Louis	760-788-9819	7	241	* VI		
	* COMPREHNSV PHYS	760-789-1424			* PETERSON'S	760-789-2027			* VI		
	THERAPY SERV				ANTIQUES COLLECT-				* VI		
	* KAYSER MARY J OYM	760-788-0960	9		LS				* VI		
	* P R RAMONA	760-789-1424	7		* RAMONA BARBER	760-789-4251	3	300	* VI		
	* RAMONA ANIMAL	760-788-0960			SHOP				* VI		
	HSPTL				* ROCK HOUSE TOY	760-788-9846	9		* VI		
	* RAMONA BOOKKEEPING	760-789-3510	7		TRAIN STATION				* VI		
	* RAMONA HOME	760-788-8148	+1	2430	* FARMERS INS AGENT	760-789-9022	7		* VI		
	JOURNAL				* FARMERS INS AGENT	760-788-1181	0		* VI		
	* SPIRIT OF JOY	760-788-7456	7		* JENKIN WILLIAM	760-788-1181	7		* VI		
	LUTHERAN CHURCH				* FARMERS INS AG				* VI		
1740	XXXX	OO			* SELLIN	760-789-9022	9		* VI		
1743	* ELLER TIRE&BRAKE	760-788-7560	7		STEVEFARMERS INS				* VI		
	* FARKASH John	OO	0		GROUP				* VI		
1748	* SUN VLY FEED CO	760-789-3333	0		* SOUTHWEST TRAILER	760-788-8900	0		* VI		
1750	* RAMONA FURNITURE	760-789-8645	0		SALES				* VI		
	* RAMONA NAILS	760-789-2518	6	2475	* CHEERS OF RAMONA	760-789-0270			* VI		
X	DAY				WYNOLA				* VI		
1801	* JAMES Karl	OO	0	2525	* GASOLINE ALLEY	760-787-9700	+1		* VI		
	* TACO BELL	760-788-7597	3		* HARPER Cecil	OO	0	300	* VI		
1809	* OIL CHANGERS	760-789-5426	+1	2537	* BUSHEY Chestley	OO	0	311	* VI		
1811	* BIG O TIRE STORES	760-789-6464	6		* LIVERY FEED&RANCH	760-789-5582			* VI		
1834	* ARSHAM FREDERIC MD	760-789-2529		2548	* BOLL WEEVIL RAMONA	760-788-1392			* VI		
	ARSHAM Jerald	760-789-8722		2560	* MANN James	OO	+1	322	* VI		
	* FABRIKANT JERRY	760-789-6563	3		* MORGENTHAU Ronald	OO	0	330	* VI		
	DPM				* RON'S TIRE&BRAKE	760-789-3600	0		* VI		
1835	* LITTLE CAESAR'S	760-788-0480	9		INC				* VI		
	PIZZA			X	ETCHEVERRY				* VI		
1847	* RALLY'S HAMBURGER	760-788-3750	4	2649	XXXX	OO			* VI		
	RESTAURANTS			2674	* EDWARD Cory	OO	0		* VI		
1850	XXXX	OO		X	HOPE				* VI		
1853	* HAIRCUT BLVD	760-788-2988		2867	* THOMPSON Marilee	OO	0		* VI		
	* OLGA'S BEAUTY	760-788-0463	9	2903	* HOBERT Michael	OO	0		* VI		
	SALON				* RIGLE DAH	760-787-0983	0		* VI		
	* RADIO SHACK DEALER	760-789-0066	3	2925	* MCNORT Michael	OO	0		* VI		
			2931	* ROUTHIER Edmond	OO	0	337	* VI			
	* RAMONA	760-788-5482	4	3438	* SAN DE MOTORS	760-789-0777	3	338	* VI		
	DONUTS&YOGRT			3601	* ANDRECHT Venus	OO	+1	X	* VI		
	* SUBWAY	760-788-2929	3		COLES Amber M	760-789-3356	+1	411	* VI		
	SANDWICHES&SALADS				HEAR Chad	760-789-8083	0		* VI		
1855	* KMAAT	760-788-7886	2		MCWHORTER James	760-789-5846			* VI		
1864	XXXX	OO			MCWHORTER Margaret	760-789-2570		423	* VI		
1880	XXXX	OO		3725	XXXX	OO			* VI		
X	PALA				* 392 BUS	161 RES	94 NEW		* VI		
1905	* PAYLESS	760-789-7853	4						* VI		
	SHOESOURCE			+MAIN (01) 92084 VISTA					* VI		
1910	* RAMONA MOBILE	760-788-7800	2	127	* FAITH BASED	760-630-9532	+1		* VI		
	MART				COMMUNITY DEVL				* VI		
1935	* KRAGEN AUTO PARTS	760-789-7109	8		* VISTA VILLAGE	760-724-8822	+1		* VI		
	* KRAGEN AUTO PARTS	760-788-9473	0		BUSINESS ASSOC				* VI		
	WHOLESALE			221	* GRUWELLASSOCIAT-	760-945-0053	+1		* VI		
1936	* NORMAN Stephen	OO	0		ES INC				* VI		
	* RAMONA AUTOMOTIVE	760-789-2621			* MEDNET MEDICAL	760-945-0050	+1		* VI		
	* SMOG CHECK STATION	760-789-2621			MANAGEMENT SRVS				* VI		
1939	* ANDERSON AUTO	760-789-9466	0		* RONCONE RONALD M	760-758-0630	+1		* VI		
	ELECTRIC				DDS				* VI		
	* FLIGHT TECHNOLOGY	760-789-6960	0	240	* A HEALTHCARE	760-945-4700	+1		* VI		
	CORP				CENTER				* VI		
	* RAMONA MAC	760-789-3734	4		* A-1 MEDICAL	760-945-4700	+1		* VI		
	* RICHARDSON PONTIAC	760-788-9670	+1	245	* BACK TO THE BASICS	760-941-8316	+1		* VI		
	BUICK GMC				REAL EST CO				* VI		
	* SUN VALLEY	760-788-4449	0	334	* MASTER COPY	760-631-5964	+1	530	* VI		
	BODY&PAINT			344	* CUTTING EDGE	760-726-2832	+1		* VI		
	* TANGUAY	760-788-6961	9		GRADING INC				* VI		
	AUTOMOTIVE				* 10 BUS	0 RES	10 NEW		* VI		
1946	* DENNY'S RESTAURANT	760-788-8878	9						* VI		
1950	XXXX	OO							* VI		
X	LETTON								* VI		
2005	* HARDIE W	760-789-0247	9						* VI		
	RICHARDSON JR DDS								* VI		
	* HILL JAMES L DDS	760-789-2330							* VI		
	* STEINSTRICH MICHAEL	760-789-0247							* VI		
	A DDS								* VI		
2019	* BRANDONS SPA&POOL	760-789-7704							* VI		
	1								* VI		
2021	* A COUNTRY CLIP PET	760-788-3722	7						* VI		
	GROOMING								* VI		
	* COUNTRY CLIP & PET	760-788-3722	7						* VI		
	GROOMING								* VI		
	* RICKS VIDEO RPT	760-789-5039	6						* VI		
2037	* DAY COMPANY	760-788-1533	+1						* VI		
	MAILWORKS								* VI		
	* RENTX EQUIPMENT	760-789-0931	0						* VI		
	RENTALS								* VI		
X	JULIAN								* VI		
2110	* NELSON Harlan	OO	+1						* VI		
2115	* NEWCOMB	760-789-6045	+1						* VI		
	JACQUELINE PHD								* VI		
2117	* COMPUTER SMART	760-789-6640	9						* VI		
	* SAPPHIRE BOOKS	858-486-0043	8						* VI		
2119	* DIRECT TV CENTER OF	760-788-7542	9						* VI		
	SO COUNTY								* VI		
	* CISH NETWORK	760-788-7542	9						* VI		
	DEPTEN OF SO CO								* VI		
	* PRICE SERVICE	760-788-7542	9						* VI		
	CENTER								* VI		
2121	* SAPPHIRE BOOKS	760-788-5670	8						* VI		
2130	* ASSOCIATE REALTY	760-788-1861	+1						* VI		
	COLDWELL BKR								* VI		
	* COLDWELL BKR	760-789-2110							* VI		
	REALTY								* VI		
	* DARMSTANDLER H	OO	+1						* VI		
2134	XXXX	OO							* VI		
2136	XXXX	OO							* VI		
X	HUNTER								* VI		
2200	* INLEED VALLEY AUTO	760-789-0513	8						* VI		
	SALES								* VI		
2220	* ELSTON HAY SALES	760-789-5020							* VI		
2230	XXXX								* VI		
2260	* COUNTRY PETALS	760-788-8998	0						* VI		
	MILLS Debbie	760-787-2197	+1						* VI		
2291	* DAY COMPANY	760-788-6710	8						* VI		
	GENERAL CONTR								* VI		
	* PROGRSV PROPERTIES	858-874-6710	8						* VI		
	INC								* VI		
X	ROTANZI								* VI		
2300	XXXX	OO							* VI		
2317	* COUNTRY TIME	760-789-4141	0						* VI		
	* ON THE ROAD AGAIN	760-788-9807	7						* VI		
	* RAMONA MOTOR	760-789-3094	6						* VI		
	WORKS								* VI		
2330	* BISHER'S QUALITY	760-789-1488	9						* VI		
	MEATS								* VI		
	* CONTENDER	760-789-6609	0						* VI		
	PLUMBING								* VI		
	* FIRST MANDARIN REST	760-789-7690							* VI		
	* IVAN OSMAK	760-788-0222	9						* VI		
	SADDLERY								* VI		
	* REEDY William	OO	+1						* VI		

786
VERMEL AV

[illegible]

11 MAY NOT BE REPRODUCED, ENTERED INTO A COMPUTER OR PHOTOCOPIED, IN ANY MANNER WHATSOEVER.

COMPUTER OR PHOTOCOPIED IN ANY MANNER WHATSOEVER EXCEPT AS AUTHORIZED IN WRITING BY HAINES &

BY MANNER WHATSOEVER EXCEPT AS AUTHORIZED IN WRITING BY HAINES &

000000

.....

LEWIS ED BAYLE 710-540-1111

MAIN AV S 92028

410 RECKERS 723-1450 51 54

VEREDA BARRANCA

VEREDA CALLADA 9202

VERGARA 92117

VERLA LN 92027

00 2 VERLEY CT 92117
69 5

VERMEL AV 82025

99	5	2004	WOODWARD JOHN A	745-64
		2014	XXXX	00

VERMONT AVE 93025

RIGHT HAINES & CO., INC. INFORMATION ON THIS PAGE

VERMONT A.W. 33335

120.....	APARTMENTS	11
	CHEATWOOD BYRON	482-5455

SHELBURN DAVID	489-1214 +6
SHELBURN PATRICIA	489-1214 +6

201 XXXX 00

1	JOHNSON LYNN	741-3735 +6

9	2002	CARPENTER REN	743-1388	1
		CASTANEDA DANL	489-2792	2

4	GORE RICHARD	746-7503	4
	GORMAN CLIFF	341-0963	+8

MAY NOT BE KEYPUNCHED. ENTERED INTO A COMPUTER

FACTORY

1980

MAIN AV N

MAIN	92065 CONT
716* TURKEY INN	789-0471 6
720 XXXX	00
723 XXXX	00
724* EL NOPAL	789-9823 9
728* SOURCE FAM CLOTHING	789-1311+0
729* RAMONA CHMBR COMM	789-1311+0
733* RAMONA TEEN CENTER	789-1311 7
733* RAMONA TOWN HALL	789-9265 9
733* VALLEY APPLNCAFRNTR	789-2300
733* OGDEN'S AUTO PARTS	789-3553 7
738* CAE BOOTSHOE REPAIR	789-1493+0
745 MILES HARRY A	789-0234
746* CHEQUERS THE	789-0065 5
* RADIO SHACK DEALER	789-0065 6
* THE CHEQUERS	789-0065 1
751* MILLERS SHOE STORE	789-3939 6
754 XXXX	00
756* RAMONA AUTO PRT SPY	789-2024
758* CROWN SHOP STAT	789-4550 8
760* CATHY&PAULS CPTS	789-0306 8
765 XXXX	00
773* BANK OF AM RAMONA	789-1300
780* RISING SUN NTR FDS	789-0591 9
* SMITH CABINETS	789-4530+0
801* ABCO CRPTS	789-4925+0
* WINDOW CREATIONS	789-3385+0
802* CHEVRON STA RAMONA	789-0183 7
803* BUSHEYS AUTO PARTS	789-2400+0
825* FPNDS CHURCH RAMONA	789-1844+0
826* AGRI SPECIALTIES	789-1611 9
* KENS KOUNTRY KTCHN	789-2121+0
* KOUNTRY KITCHEN	789-2121
* NEW DIMENSIONS HOMS	789-3737 9
* RAMONA DISPOSAL SV	789-0216 8
828* FARMAS INS GENTS	789-442 9
* KAY KENNETH E	789-4960 9
PRATT DEBBIE	789-3628 8
PRATT LEROY D	789-3628 8
* SANTA MARIA DRFTNG	789-4960 8
* VINES INSURANCE AGC	789-4422 7
835* ALL STATES PROPRT	789-4640 9
* TAYLOR MABEL V	789-4899+0
838* RAMONA CASH GROCERY	789-0150
845* BOST THOS G	789-6290+0
* CALZONA CRAFTS	789-5500+0
* NEW YORK LIFE AGNT	789-0132+0
REEVE THEODORE E	789-0132+0
RIVERA JUAN	789-4639+0
* WACKY TS	789-5095+0
865 DEKICK JOHN B MD	789-3151 7
866* CITY BARBER SHOP	789-0148
HARTWELL JOHN K	789-1295 9
872* MCCOWANS MKT	789-0370
885* JESSIES UNION 76 SV	789-1750
902* BLANCHARD MOBIL SV	789-1680 1
907* PIZZA HUT RAMONA	789-4190 9
918 XXXX	00
920 XXXX	00
922* DOSS SYLVIA	789-6456+0
923* MR EDS AUTO REPAIR	789-4030 7
924* APARTMENTS	00
13 ALBRIGHT CORINNE A	789-5246 9
8 BADZIK MARY	789-2642 1
DIENKELFED GATHA	789-1200
2 FUGLSETH MATHA	789-1631+0
GALE MABEL	789-0159+0
HALLIDAY CHARLOTTE	789-5576+0
1 HANSON BERTHA G	789-0138
15 LARSON LAURA	789-1291
13 MARSHALL HOMER E	789-2963 5
9 MAHON MARTHA	789-0206 8
SKUDVIG RAKEL	789-1631+0
TIPTON M O	789-1460 8
924 MCCOY GLENNE	789-0642+0
926 CALLAHAN OMA	789-2739 7
932* HAYES ELIZETH F	789-4226 8
933 SMOYER KRIST	789-5604+0
939* RAM VLY CHRSTN CNTR	789-3497+0
948* JACKS TELEVISION	789-1740
960 XXXX	00
966 HUNTING NELLIE	789-2002 5
968* J KOOPMANS TV SALES	789-0651+0
969* WOODWARDS CNTRY ST	789-0480+0
970* N CNTY ACTION PRGM	789-1667+0
972 XXXX	00
974 XXXX	00
976* FRUITFUL VINE THE	789-4516+0
978 XXXX	00
984* KILBOURN REALTY	789-1600 9
1012 XXXX	00
1015* BUSHEYS ARCO	789-3830 7
1025* KENTUCKY FRIED CHKN	789-6427+0
1028* EL RACHITO TACO SH	789-0637+0
1045* BOBS BARBER SHOP	789-1556 7
STEPHEN RALPH B	789-2021 6
1056* JACK IN THE BOX	789-9869 7
1076* SEVEN ELEVEN 2011	789-1712 9
1077* STMARYS EPSCL CH	789-6924+0
1102* CAS	789-6144+0
* CAS ANSWERING SRVC	789-3510 9
* R C POOL SUPPLY	789-2361+0
1114* BLOCK HAR	789-3510+0
* RAMCOM	789-6390+0
* RAMONA'S SERVICES	789-0637+0
* RAMONA TAXI	789-0911 9
* SHARAMITARO S J	789-2195+0
1126 XXXX	00
1137 XXXX	00
1151 XXXX	00
1152* RAMONA ANIMAL CLINC	789-2299+0
* WEECH HUGH N DVM	789-2299+0
1160 GAGIN A O	789-4814+0
1162 REINHARDT DALE A	789-3415 9
1173* OXBOW VETERINARY	789-4760 8
1174* CARPENTER JACK V	789-4790+0
* WELSH REALTY	789-1001
1175 XXXX	00
1210* MAXWELLS TEXACO STA	789-1043 4
1252* MACKENZIE LIQUORS	789-0073 5
1259 WISE ANNIE MRS	789-0776
1270* CARMICHAEL FIBERGLS	789-0885 1
* COUNTRY HOMES RLTY	789-0426 8
* TEEPEE ROOM THE	789-3755 7
1307 XXXX	00
1308* HOME FED SVG&RAMON	789-0221
1326* SADDLE BAG DELI	789-9250+0
* SUN VALLEY MARKET	789-1155 4
* SUN VALLEY MARKET	789-1155 4
* ANDERSONS ICE CREAM	789-6210+0
1334* NEW DIMENSION	789-5474+0
1336* THE INN PLANT SHP	789-3441+0
1347* DCARLOS	789-4340 8
1350* DARRS LIQUOR	789-1336 5
1410* FIRST NATL BK SNGO	789-0843 8
1502 XXXX	00
1512 MELGOSA MANUEL	789-4791 9
* OCEANSIDE SVNGS&LNM	789-5094+0
1514 XXXX	00
1520* JERI STOLL REALTOR	789-1205 6
* STOLL JERI REALTOR	789-1205 6

MAIN	92065 CONT
1522* RAMONA READING CLINC	789-0694 8
1530* MCDONALDS RSTRNTR	789-5490+0
* SILVER FOX RLTY	789-2110+0
1582* JACINO PA	789-1538+0
1703* D&M REALTY INC	789-0209 5
HUSTON KEN	789-2611+0
* PARKS&JENKINS CPAS	789-4262 9
* PARKS&JENSEN	440-3542 9
* PHILLIPS JOHN G	789-2611 5
* PHILLIPS JOSEPH A	789-2611 5
* SCARRETTA JOSEPH A	789-2611 5
1721* FEGHALI REALTY	789-3377 9
GERBER LOUIS A DDS	789-2500+0
* HARRIS REEDHEAD	789-5000 9
MEYERS HENRY	789-2525+0
MITCHELL C H	789-2525+0
* REID JEREMIAH F	789-6680+0
* WESTERN MUTL ESCROW	789-2846 9
1740* RAMONA FLORIST&GIFT	789-1852 9
1746* RAMONA NURSERY	789-1950 4
1750* HURRICANE FENCE CO	789-4142 7
KIRKHUFF CHAS	789-3627+0
* POWAY FENCE CO	789-3211
1834* KUMLER HARRY A	789-1417+0
1850* OGDEN RONALD H	789-4221+0
* FLASH ELECTRIC	789-4068+0
* KWAIST RONALD	789-3996 9
1864* POTTED PETUNIA NRSRY	789-1285 9
1880 XXXX	00
1905 XXXX	00
1936* RAMONA AUTOMOTIVE	789-2621 9
1939* BUCKEYE CHEVRLT OLD	440-4545+0
* BUCKEYE CHEVROLET	789-2201+0
2005* SCHAEFER W E 3D DDS	789-2330 9
* SCHWARTZ DENTAL CRP	789-3340 9
* SWARTZ DENTAL CORP	789-3340 9
2019 XXXX	00
2021* DONUT DEPOT	789-2307 9
2037* RAMONA AUTO SALES	789-2650+0
* B RAMONA AUTO SERVICE	789-5305+0
* C GIVENS BILL TRNSMNS	789-5305+0
2055* RAMONA EOPMT RNTLS	789-0931 3
2115* C&M PROFESSNL SRVC	789-6370+0
* CM APPLANCE&RPR	789-2381+0
2117* ACE HARDWARE	789-2141+0
* ACE HARDWARE	789-2165+0
2130 XXXX	00
2134* HOMESTAR INVSTMNT	789-2263+0
2136 XXXX	00
2220* SMITHS FLOOR COVERI	789-1641+0
2330 BUILDING	00
* IN PLANT SHOP	789-3441 9
* MCMORROW ADOBE HMS	789-0585+0
* POTT BELLY SHOP THE	789-4567 9
* RAMONA HAIR PEOPLE	789-3701 9
* RAMONA INTERIORS	789-6025+0
* RAMONA LIGHTING LTD	789-4150 9
* RAMONA LUMBER CO	789-1080+0
* RAMONA MATS	789-3044+0
* WINDSOR REALTY INC	789-0383 9
* WINTER HEATINGAIR	789-3467 9
2330 LEWIS FRED	789-6380+0
2344 XXXX	00
2366* APPLANCE SALES	789-4251 9
2405* CALIF STRUCTURES	789-4400+0
* HELP	789-4400+0
* HOMEOWNERS EXCH	789-4400 9
* MANNING NEWAUSED FR	789-4007+0
2475 XXXX	00
2525* QUICK SERVICE GAS	789-4710 9
2537* ANOMAR HEATING	789-3666 8
2548* BROOME REALTY	789-0806+0
* CENTURY 21	789-1501+0
* CENTURY 21	789-0608+0
* CENTURY 21 BROOME	789-0608 9
* CENTURY 21 BROOME	789-0608 9
* RED CARPET REALTORS	789-4600 6
* RED CARPET RLTRS	440-1402 8
2624 XXXX	00
2674 XXXX	00
2903 BISHOFF W RAY	789-2713+0
3438 MORRISON DRILLING	789-4412 9
* 221 BUS 101 RES	116 NEW

MAIN AV N 92028 FALLBROOK

MAIN	92028 FALLBROOK
100* PORT CLOTHING	728-7696 3
101* VILLAGE STATIONERS	728-8316
105* AHREND WILLIAM	728-7613 7
* FALLBRK CAMERA SHOP	728-7613 7
109* CANDY COTTAGE	728-0685 9
* CANDY COTTAGE THE	728-0685 9
110* WESTERNER THE	728-1462 3
113* FRIENDLY OWL THE	728-8050 7
114 XXXX	00
115* JAMES	728-2611 6
116* MARSHALL STUART	728-8331 9
118* MARSHALLSWEARING	728-8331 5
* SWEARINGEN BUD	728-8331
118* PANT STATION	728-1837 6
119* CALDRON THE	728-1505 1
* CALDRON	728-1505 9
* COUNTRY STAIRCASE	728-1288 7
H&H DRAPERIES	728-1288 7
* SHADY LAKE PLANTS	728-0561 9
* VILLAGE FEATHERBED	728-4426 7
122* FALLBRK PHARMACY	728-1607
123* BARKOWS MUSIC STORE	728-7186
127* FURNITURE ETC	723-1111+0
128* STITCHERY NOOK THE	728-4173 8
130* CALIF INTERIOR ARTS	728-5444+0
* CALIFORNIA INT ARTS	728-5444 8
136* COUNTRY COVER	728-6984+0
189 XXXX	00
200 XXXX	00
201* SPENCE SHOES	728-2102
205* WESTERN AUTO ASC ST	728-1064
209 XXXX	00
211* CRICKET SHOP THE	728-5508 7
213* FRIDAYS CHILD GIFT	728-4955 7
217* MACLENNANS HOME SHP	728-1351 9
218* VILLAGE SALON BTY	728-7454 8
223* KITCHEN SHOP	728-0365 8
225 XXXX	00
231* MISSN THEATRE	728-8444
MITTERLING DONALD E	728-8445
235* FANGI FREE COIFFURE	728-8188
241* WEDDINGS BAKERY	728-2327
300 BUILDING	00
* CATHERS REALTY	728-5766+0
* CENTURY 21	728-5766+0
* CHPT STEVE L TRCT	728-2906 8
* DONART JAMES G	728-6670 9
21* ESTES NEAL INS	728-8391 3
15* FALLBRK ANSWERING SV	728-1167
* FALLBRK CHMB OF COM	728-5845+0
* FALLBRK TELE SCRTY	728-1167 4
* FALLBROOK CHMBR CWR	728-5845 9
15* HILLERY BILLY A	728-1167 6
* KOOYMAN JAS P	728-7920+0

VERMONT ST

VERMONT ST	92025 CONT
VEREDA CALLADA	743-5670 8
947 SWOR RONALD I	746-2688 3
1005 CLAUDON STANLEY C	743-6389+0
SMITH K K	743-6389+0
1010 VUK ROBT	489-0167+0
1015 FOSTER ROBERT P	741-5623 9
1019 CHURCH J J	747-5212+0
1020 HELLER HARRY	745-6031 9
1029 XXXX	00
1040 CARR K D	743-2746+0
* O BUS 13 RES	8 NEW

VERGARA 92117 SAN DIEGO

5317 OLFIN RICHARD	279-3090 5
5320 AHLMAN MARY	277-2178 9
5321 LAFFERTY JOHN P	278-6653
5331 BLEICH GORDON J	00
5340 XXXX	00
5345 XXXX	00
5357 DREWETT ROBT	278-3563
5381 IMANA JORGE G	277-4294+0
5393 XXXX	00
* O BUS 9 RES	1 NEW

VERLA LN 92027 ESCONDIDO

1610 XXXX	00
1624 WALLACE BURGE M	747-8073 2
1628 BUTTS WALTER J	747-4724 4
1646 JOHNSON CARLOS S	743-7470 6
1650 PAULEY GEO	746-8473 4
PAULEY SOOZEE	746-7494 4
* O BUS 6 RES	0 NEW

VERLEY CT 92117 SAN DIEGO

4408 XXXX	00
4409 STARBUCK WILLIAM L	268-3666 9
4419 RUTLEDGE WM R	277-1640+0
4429 HAGEDORN RICHARD D	279-6287
4439 XXXX	00
4459 SCHAAF ANDREAS H	278-9144+0
* O BUS 6 RES	2 NEW

VERMEL AV 92025 ESCONDIDO

1904 XXXX	00
1914 EWING JEANNE	746-6232 5
1915 THURMAN JAS D	743-1962 8
1924 KREIN ANDREW C JR	745-8333
KREIN MARY JANE	745-8333
1925 XXXX	00
1934 TATMAN GRACE	745-7028 3
1944 KYLE ERNE	743-4294+0
1954 KUTCHER ERNEST	746-2907
1964 PRATT JAS	741-7384+0
1971 TOLBERT THOMAS M	741-5702 9
1974 INNIS M B	743-8167 9
ERKME L M	746-1733
2004 WOODWARD JOHN A	745-5442 4
2014 FOX MICHAEL	741-0213 7
2015 LAMAR RANDALL	747-0271 8
2022 SMITH TERRY	747-8358+0
2023 ELLEDGE HERMAN D	746-3560 2
2030 FALLET JAS H	745-4867
FALLET JOANNE	745-4867
2031 HARKINS CHAS R	745-2558 1
2038 KRAUSE ROBT G	747-8758 2
2039 MORIS ROBT W	745-1975 3
2046 ROBINSON PETER A	743-3342 9
2047 LOUX JOHN S JR	746-6055 1
2055 FORD DARRELL D	746-5773 4
FORD JO	741-7157 9
2060 GARDNER CHAS P	747-4422 1
2063 RUMSEY GEO R	741-8780+0
* O BUS 29 RES	4 NEW

VERMONT 92065 RAMONA

1709 XXXX	00
1713 MARTIN G R	789-3079 6
1729 ROSSON HAROLD E	789-2196 5
1970* FIRST CHRSTN CH RAM	789-2371
2045 VUKOVICH STEVE	789-2013 9
2144 JOHNSON GALE J	789-1681 7
JOHNSON LARY G	789-1681 7
2509 BUNKERS ROBT C	78

..MAIN	92065 LUNT..
524*	RAMONA WOMANS CLUB 789-9813
529*	NATL AUTO CLR DR SV789-0080+5
	*RAMONA BODY SHOP 789-0080
555	NIELSEN E A 789-0211
557*	PASSEL BENJAMIN 789-0993 1
	*RAMONA STGE STP LCR789-0993
	*STAGE STOP LIQUORS 789-0993+5
567	XXXX 00
578*	SADWAY SHELL SERV 789-0500 2
579*	RAMONA CLEANERS 789-1140
601*	ANZA BEAUTY ROOM 789-1829 2
	*CENTURY 21 REAL EST789-0606 4
	*HAROLD R 789-0010 2
	*UJAGGIO SHELIA 789-1829 2
	*FARMERS INS GROUP 789-0010 2
	*SWANSON CARL A 789-0605+5
605*	CHEROKEE TRNG POST789-2543+5
611*	RAMONA SENTINEL THE789-1350
615*	RAMONA INS AGENCY 789-1500+5
	*VANORDALE INS AGC 789-1500+5
619*	RAMONA BOOK STORE 789-2839 4
620*	US POST OFFICE 789-1220
621*	YE OLDE YARN COT789-2636+5
626*	BONHAM BRS MORTUARY789-1678
629*	NW PIONEER THE 789-2892+5
630*	WALTERGLAW CAFE 789-0400+5
636*	GERTRUDE'S BTY SHOP 789-1231
638*	RAMONA FLORISTGIFT789-1852
642*	WHITINGS FEED STORE789-0511
645	JOHNSON ARTHUR D 789-1672+5
	*RAMONA CHMBR CMCRCE789-1311 2
648	XXXX 00
649*	WRIGHTS MENS WEAR 789-1840
	*AUS SOIL CONSERVATN 789-1800
652*	SALS PLRG OF RAMONA789-1440 2
	*SALS PLUMBING INC 789-1440 0
654	XXXX 00
668	XXXX 00
677*	RAMONA PHARMACY 789-0180
	*RAMONA & H NEWS 789-1111 4
	*REXALL PHARMACY RAM789-0180
680*	RAMONA TEXACO SERV 789-2985 4
681*	GENAS DRESS SHOP 789-1722
701*	KUTZNER CO INC THE 447-2323+5
	*KUTZNER CO THE 789-2323+5
	*RAMONA OUTDOOR CNTR789-3000+5
	STOCK RAY G 789-2323+5
704*	UTDIEM MARKETS 20 789-9849 4
707*	RAMONA SADDLERY 789-0945 4
711*	GODDARD DRAFTING 789-0771 4
	*RAMONA BLUEPRINT 789-0771+5
713*	RAMONA GLASS CO 789-0122 4
716*	TURKEY INN 789-9802
720*	SIT N WASH 789-9842 2
723	XXXX 00
724	EL NOPAL 789-9823 1
728	XXXX 00
729*	M C A RAMONA 789-2473+5
733*	VALLEY APPLNCEFURN 789-2300 1
	*VALLEY SV TYVAPPLNCT48-4520 2
734*	PETERSON TIRE CO 789-1177 1
738*	DEES HSE OF DO NUTS789-9831 3
745	MILES HARRY A 789-0234
746*	CHEQUERS THE 789-0066+5
	*WELVERNAS CERAMIC 789-0066+5
	*THE CHEQUERS 789-0066 1
751*	VALLEY SV TYVAPPLNCT789-0590 1
754	XXXX 00
756*	RAMONA AUTO PRT SPY789-2024 0
758	XXXX 00
760*	KARISMA HAIR FASHNS789-1886 4
765	XXXX 00
773*	BANK AMER NTESA 789-1300
	*BANK OF AMER 443-2186+5
780	XXXX 00
802*	RAMONA CHEVRON STA 789-0183 3
803*	WESTERN AUTO ASSOC 789-0100 3
825*	FRIENDS CH RAMONA 789-1844 4
826*	KOUNTRY KITCHEN 789-2121 0
828	GUNNETT RUTH E 789-2798 4
832	SKELTON JOHN A 789-0200 4
835	GIUNTI CHAS 789-2319+5
	*SOUTHWST PROP UNLTO789-2160+5
838*	RAMONA CASH GROCERY789-0150
845	BRAND HENRIETTA 789-1949+5
	WILSON G 789-2514+5
865	CROSS JAS A MD 789-1223+5
	DEKOCK JOHN B MD 789-1223 2
	*SAN VCITE HEALTH SV789-1223+5
	SHIMA GARY J MD 789-1223+5
866*	CITY BARBER SHOP 789-0148
866*	HOLDAN FELIPE 789-2480+5
872*	MCCOWANS MKT 789-0370
885*	JESSIES UNION 76 SV789-1750 0
902*	BLANCHARD MOBIL SV 789-1680 1
920	MCDONALD F E 789-2970 4
922	XXXX 00
923*	CUPPS FORGN CAR CTR789-2464 4
	*RAMONA RADIATOR SV 789-2464 4
924	APARTMENTS.....
8	BADZIK MARY 789-2642 1
14	BUXTON MARY 789-2960 1
2	DIERENFELD GEO 789-1240
3	FUGLSETH MARTHA 789-1631 0
10	GALE MABEL 789-0159 4
11	GREEN VIOLE L 789-2918 4
1	HANSON BERTHA G 789-0138
15	LARSON LAURA 789-1291 0
	MARIN ANTONIA 789-2197+5
	MARSHALL HOMER E 789-2963+5
	PEÑA MARTHA 789-2090+5
6	SKUDVIG RAKEL 789-1631 0
A	VOELKER M 789-2347 4
924	APARTMENTS.....
926	XXXX 00
930	XXXX 00
932	XXXX 00
933	XXXX 00
939	CROWNER ARTHUR J 789-2035+5
948*	JACKS TELEVISION 789-1740
960	XXXX 00
962*	PERNS GIFTS&STATNRS789-2008+5
966	HUNTING NELLIE 789-2002+5
968	XXXX 00

..MAIN	92065 CONT..
969*	WOODWARDS FEED&SPLY789-0480
970	XXXX 00
972*	RAMONA PRINTING CO 789-2008+5
974	HUNTING GUY 789-2835 3
	HUNTING MILORED 789-2835 3
976	XXXX 00
978	SEVERTSON PATTY 789-2990+5
980	SIMMONS C N 789-0116+5
982	XXXX 00
984*	KILBOURN REAL EST 789-1600 0
1012*	RAMONA ANIM CLNC 789-2299 4
	*S BAN S SAOULERY 789-3240+5
1015*	RAMONA A R C O SERV789-1122+5
1045	CAMPANELLA BURT D 789-2021+5
	*STEPHEN RALPH B 789-1670 0
	*STEVENS RALPH B 789-1670 0
1045*	UTZIG SVL 789-1022+5
1076*	BORIS BARBER SHOP 789-1556
1102*	COUNTRY HOMES RLT 789-0424 3
	*HOEFER GENE 789-0624 4
1114*	DEL NIDO MOTEL 789-0622
1126	CRAIG JOHN R 789-3350+5
	LOUSBURY R A 789-3350+5
	MALLEN VIRGINIA 789-1124+5
	*VIRGINIA ANSWANG SV789-2442+5
1137*	PEARSON E LEASOC 789-1843 3
	*RAMONA REALTY 789-2500 3
1151	XXXX 00
1160	XXXX 00
1162	XXXX 00
1174*	WELSH REALTY 789-1001
1175*	MOLEHAVEN ANTIQUES 789-2289+5
1210*	MAXWELLS TEXACO STA789-1043 4
1252*	MACKENZIE LIQUORS 789-0073+5
1259	WISE ANNIE MRS 789-0776
1270*	CARMICHAEL FIBERGLS789-0685 1
	*MICHELLES 789-2957 4
1307*	HOME FED SVG LN DPT462-2391+5
1326*	SVN VALLEY MARKET 789-1155 4
1347*	SANTA MARIA INN 789-0288
1350*	DARRS LIQUOR 789-1336+5
1410*	ESCONDIDO NATL BANK789-2333+5
	*ESCONDIDO NTNL BNR 789-0843 1
1445	BOWLING VIVIAN 789-0584
1502*	JERI STOLL REALTOR 789-1205+5
	*STOLL JERI REALTOR 789-1205+5
	STOLL MAUEL 789-1205+5
1512	XXXX 00
1514	XXXX 00
1520	XXXX 00
1530	MARTIN WM 789-0300+5
	*OLSON ALLEN J INC 789-0031+5
1703*	DGM REALTY INC 789-0209+5
	*PHILLIPS JOHN G 789-2611+5
	*PHILLIPSGCIARRETTA789-2611+5
	*SCIARRETTA JOSEPH A789-2611+5
1740	ISACIA JOAN 789-2025 4
	WROTEN CLARK R 789-2751+5
1748*	RAMONA NURSERY 789-1950 4
1850*	COLE WM HLTH FOS 789-0591 3
1864	CORLEY GEO D 789-2978 4
	RICHARDSON JOHN R 789-2378 4
1905*	DIAMOND PHOTOGRAPHIC 789-2337+5
	MITCHELL C H MD 789-2525+5
1930*	SINGER CHEVROLET 789-2201+5
2019*	MOBILE MART INC 789-1426+5
2021	XXXX 00
2055*	RAMONA EQPMT RNTLS 789-0931 3
2115*	NUTRITION INFRMTN 789-2421+5
2117*	RAMONA BUILDERS SPLY789-2141 4
2130	MEERS BOBBY 789-1554+5
2132*	LINTON EXCAVATING 789-3010+5
2134*	SVN VALLEY REALTY 789-2522+5
2136	XXXX 00
2220*	CARPET PLACE 789-2667+5
	*SMITHS FLOOR COVRNG789-1641+5
2366	XXXX 00
2674	CECERE EARL V 789-1439 3
NO	*CHRUDEEN LAWRENCE B 789-0916 2
	* 132 BUS 93 RES 70 NEW

MAIN E 92020 EL CAJON

101*	DEPENDABLE STR 442-1695 4
	*MR DEPENDABLE 442-1695 3
102*	ELMS 444-1040
110*	DIAMOND MART 444-2021 2
	*FANFARE RECROG STOD447-2555 4
	*RONDEL AUDIO ENTPRS447-2555+5
	*RONDEL AUDIO ENTPRS447-2555+5
113*	ANTHONYEMARY STROPE444-0449+5
115	XXXX 00
116*	GRAYSON MUSIC CO 442-7788 4
117*	BIGTALL LAUFERS SH442-7543 0
	*LAUFERS BIGTALL 442-7543 1
	*MR BIGEMR TALL 442-7543 1
118*	GILS JEWELRY 444-5760
120	XXXX 00
123*	CAMERA MART 440-3641+5
124	SHADE TROL 440-5511+5
	*SUN CONTROL TMS THNGS440-5511+5
130*	MKS TYPWRTR 442-3790 1
	*ELCAJON TYPWRTR 442-3934 1
	MEINMART RICHARD C 442-6012+5
131*	PENNEY J C CO 442-1611
132*	VALLEY BOOK STORE 447-9068+5
134	XXXX 00
140*	KIMS SHOES 444-1804
142*	VALLEY SEWING CENTR444-5498 3
143*	SIGHT&SOUND 440-2900 3
	*SIGHT&SOUND MGNVOR440-2900+5
144*	TASTY BAKE SHOP 440-0505 3
149*	MALIED BTY PROCTS 442-4272
	*EMPIRE BTY SUPPLY 442-4272
	*WIG CITY 442-4272
153	JEWEL RAMA 447-4000 2
156*	PETRUCELLIS 442-8080 4
	*PETRUCELLIS HR SYL447-9991 4
160*	NUTRITION CENTER 442-7212+5
161*	MARSIS 442-3401

..VERLANE DR	92119 CONT..
8709	BARNETT JOHN M 465-3721
8715	XXXX 00
8721	PETTUS RICHARD E 460-0847
8724	KOLB CHAS R 466-2942
8727	MADHAVAN MURUGAPPA 462-3535 4
8730	LOUN LAUREN M 465-9528 1
8733	IAVELLI CARL D 461-3924 2
8736	FOSTER C L 463-5926+5
8739	BENT WM W 461-2655+5
8740	MC LAUGHLIN JAS M 461-3053 4
8741	KREIN MORRIS E 460-2433 4
8747	BOWMAN J V 463-4501+5
8750	AMSHINGER JACOB J 460-2553 0
8753	KOHLER RICHARD C 461-3166+5
8756	SPOSATO FRANCIS T 460-3275+5
8762	ANDERSEN JOHN B 460-5433 2
8765	RAMALMO JOE 460-7380 2
8785	SARGENT ROBT E PHD 469-8569+5
8786	AGOSTA ANTHONY 465-6215
	* O BUS 52 RES 10 NEW

VERLEY CT 92117 SAN DIEGO

4408	SPIES KIMIYO 292-7993+5
	SPIES RICHARD 292-7993+5
4419	DYKSTRA DALE R 560-1010+5
4429	HAGWOOD RICHARD D 279-6287
4439	CRAWFILL CHAS 279-1785 4
	JORGENSEN BETTY 279-1785 4
4459	STEBBINS PAT 278-3582 4
	* O BUS 7 RES 3 NEW

VERMEL AV 92025 ESCONDIDO

1904	XXXX 00
1914	EWING JEANNE 746-6232+5
1915	KILMAN BEVERLY 746-0316 1
	KILMAN THEODORE 746-0316 1
1924	KREIN ANDREW C JR 745-8333
	KREIN MARY JANE 745-8333
1925	ALBRIGHT CHAS B 747-0301 4
1934	TATMAN GRACE 745-7028 3
1944	XXXX 00
1954	KUTCHER ERNEST 746-2907
1964	TAYLOR BYRON M JR 746-3068 2
1971	HEATH ROBT B 747-8409+5
1974	WEDeking ROBT A 745-0126 3
1984	ERSKINE L M 746-1733
2004	WOODWARD JOHN A 745-6442 4
2014	FOX CHARLINE 743-4850 4
	FOX CHAS H 746-0312
	FOX DALE P 746-0312 3
2015	PERRY RAYMOND H 747-7629 2
2022	XXXX 00
2023	ELLEDGE HERMAN D 746-3560 2
2030	FALLET JAS H 745-4867
	FALLET JOANNE 745-4867
2031	HANKINS CHAS R 745-2558 1
2038	KRAUSE ROBT G 747-8758 2
2039	MORIS ROBT W 745-1975 3
2046	WESTFALL BRIAN 743-4981 4
	WESTFALL JEAN R MR 746-7148 4
	WESTFALL PHILIP 743-4981 4
	WESTFALL RANDY 743-4981 4
2047	LOUX JOHN S JR 746-6065 1
2055	BUSS BARBARA 745-7982
	FORD DARELL D 746-5773 4
2060	GREINER CHAS P 747-4422 1
2063	KIRSCHER JOHN V 745-5183 1
	* O BUS 35 RES 2 NEW

VERMONT 92103 SAN DIEGO

3419	XXXX 00
3430	WATERMAN WHITNEY JR298-8517+5
3431	SOSNA SAM L 295-3674
3451	XXXX 00
3657	WILLIAMS KIRT 295-9634
3663	WILLIAMS JAS O 298-1678+5
3675	DIETRICH L M 295-9332 4
3685	XXXX 00
3692	BURKE HOWARD 298-2288 4
3702	BERG MARION J 295-9454 4
3712	JONES JAS M 298-1623
3716	XXXX 00
3718	HAMMILL G S 298-8718
	PAYNE GERALDINE M 298-8718
3720	LOPEZ JOHNNY B 298-4539 4
	LOPEZ JUDY J 298-4539 4
3721	POSADA DORIS 291-8515 1
3723	INGLEDEW H D 298-0392
3728	WICKSTEIN TILLIE 297-3156 4
3736	XXXX 00
3741	REED JAS M 299-0224 4
3749	PEPIN ARTHUR J 291-2452
3751	PULLEN W A 295-4031 4
3753	BAKER BILLIE G 297-3405
3754	SMITH J MICHAEL 296-0814 3
3762	DARROUGH C E 297-0026+5
3765	PANGBURN BEN JR 298-2588
3767	GRAHAM EARL G 295-5855
3771	BIRCH CLARENCE MRS 296-0528
3774	HEIGHES L I 296-2576+5
3779	THOMPSON MAUDE H 296-1352
3783	DUNCAN D 298-2900+5
3795	MARTIN JOHN 298-2770
3815	ALVAREZ JORGE 299-9048+5
	ANGLIN G W MRS 296-2378
	SILBER GEO W MD 295-3948+5
3820	BARKER J 295-1481+5
4060	FLEMING STEVEN M 295-9040 1
4062	WELCH J V 296-4313 0
4064	BURKE JEAN M 295-8406
4071	PRIVEE JAS 295-6842 3
4075	RECORD C E 295-0542 0
4076	MCKNIGHT A S 295-9483
4082	LEATHERWOOD S F MRS295-3349

SAN DIEGO		4115 E. MAIN ST.	
..VERMONT		92103 CONT..	
4089	MCKNIGHT JOHN R	298-1426	
4106	PAYLER WALLACE G	295-4383	
4111	WOOLF WM C	297-0857+5	
4112	ERWIN CECILIA MRS	296-2969	
4117	BUCKLEY PAULA L	296-4186+5	
	BUCKLEY PETER R	296-4186+5	
4120	CRIDER CLAIR	295-0937	
4122	BUSHONG DERRAL JR	299-8115+5	
4126	SHORTT ANDREW L	295-9121	
4127	PINKERTON JAS N	291-1742	
4128	RICK BOBBI	298-0146 3	
4129	ANGELES G	295-0397	
4132	LINDER G P	299-4839 4	
4134	XXXX	00	
4145	LINDER RICKY	298-9556 3	
	LINDER ROSIE	298-9556 3	
4149	OPDYCKE J EVAN	295-1238	
4150	XXXX	00	
4152	BOWER EDWIN J	295-4618	
4154	GREEN JOS B	298-3544	
4176	XXXX	00	
4178	KELLY MICHAEL K	298-1765	
* O BUS		66 RES	12 NW

3026	KALLICK SAML	465-2766	*RAMONA BOOKKEEPING SV789-1291+0
3030	FASLIK VINCENT R	463-0139	611*RAMONA SENTINEL THE789-1350
3050	AUSTIN LEAH M MRS	466-7644+0	615 SZARD EMOGNE
	AUSTIN ROBT C ENS	461-3299+0	789-0077+0
	BRUCE JOHN R	460-3558+0	*RAMONA COUNTY LIBRY789-0430
	CARLSON GERALD R	469-5211	*SD CO LIBRARY
	JOHNSON DONALD G DR	463-9931+0	620*US POST OFFICE
	KING D E	461-2886+0	789-1220
	MILLER GED E	463-8493+0	621*MARQUERITES RTY SHPT789-0420
	SCHWARTZ CHAS J	465-1967	628*BOONHAM MRS MORTUARY789-1678
	THOMAS LOLA E VALYN	461-3526+0	630*ELF PATIO CAFE
	VAUGHT ROBERT G	460-7726	789-9822
3122	REEG ALMA MRS	460-4036	634*GERTRUDIES RTY SHOP
	DIMAIO J	461-2005+0	789-1231
	JONES W D	463-2615	638*RAMONA FLORISTEGIFT789-1852
3150	LENN GRV CHRSTY	466-6104	640*WHITINGS FFD STN789-0511
3240	*ANDRISANI M DR	463-9201	648 FLOYD NARREL WAYNE
	*BRIMHAUGH S C JR	463-9201	789-1949
	*EARLY THOS R MD	463-9201+0	FLOYD VELMA
	*FESSLER MYRON D MD	463-9201	789-1949
	*GRIURES FOWIN C MD	463-9201	649*WRIGHTS MENS WEAR
	*HATTOX FRANK W DR	463-9201	789-1840
	*HERBERT WESLEY R MD	463-9201	AUSUS SOIL CONSERVATN
	*HITT DONALD I MD	463-9201	652*SALES PLUMBING INC
	*LENN GRV CLINCL LAB	463-9201	789-1440+0
	*LENN GRV MEDICL GRP	463-9201	654*LOMAN S
	*LENN GRV MDCL PHARM	466-3266	789-1222
	*LENN GRV PHYS THRPY	463-9201	662*SD CO AGRICLTN DEPT
	*LINER VICTOR H MD	463-9201	789-1340
	*PASSICK DALE A MD	463-9201	668*FEA AUTO REPAIR
	*PHILPOTT RICHARD L	463-9201+0	789-2551+0
	*RHEIN LEROY W MD	463-9201+0	677*RAMONA PHARMACY
	*SMITH SAM W MD	463-9201	789-0180
3260	RANKIN L B	465-8249	*REXALL PHARMACY RAM
3272	LILLIE T W	466-6542	789-0180
3276	PERGER LILLY M	469-6747	681*GENAS DRESS SHOP
3278	RICHMOND PAULINE	465-6382	789-1722
	RICHMOND W J	465-6382	701*SD CO JUSTICE CRTS
3280	BROWN ILA	463-5914	789-0050
3282	*BROWN MAYTGM HML	469-2144	*SD CO SHERIFFS DEPT
	*BROWNS APPLIANCES	469-2144	789-1200
3288	CHASSY GILBERT MD	466-0023	*SHERIFFS DEPARTMENT
3290	STEPHENS H R	466-5200+0	707*CARLOS BERTHA
3308	*ACE AUTO SUPPLY	STRA460-6147	711*GRAYSON MUSIC CNTR
3338	*SONKA BROS	466-8369	789-0066+0
3340	*SD CO JAIL	232-3811	713*LANE ERNEST L
3358	*ELECTRIC & GAS CO	447-2411+0	789-0172+0
	*GASELECTRIC CO	447-2411+0	*RAMONA GLASS & MIRROR
3385	*SD GASELECTRIC CO	447-2411	789-9802
3440	*FREEDOM CO	461-1900+0	723*RAMONA CHAMBR CMCR
3442	*GROVE SHOF SERVICE	463-8383	789-1311
3448	*JERT KISH SCH BALL	465-6101	724*THE PLACE
3462	*LENN GROVE TAILOR	466-8467	789-9822
3466	*WHITES TYPEWRTR	SL5465-6201	728*FASHION RFSALE
3482	*LCP AUTO PARTS	469-2151	789-0112
3492	*COADY SCHOOL MUSIC	463-3450	733*STEVENSON JOHN D
	*GOODBODY PATRICIA	463-3450	789-0590
3496	*SPORTSMANS CLUM	466-9978	*VALLEY APPLNC SFRVS
3504	*RUGMASTER CO	286-2581	789-9823+0
3510	*STAPLIGHT PLUMBING	463-1271+0	745 MILES HARRY A
3516	*GROVE CLEANERS	466-1781	789-0234
	*GROVE QJALTY CLNRS	466-1781	746*FRFRNS GIFT SHIP
3524	GONZALES ANGEL	465-7776	789-1623
3564	MAUPIN LYDA	466-1663	*STOKER JOS H
3568	*CRESCO	460-1020	754*VALLEY HMOVRESPT
	*FERGEN CO INC	460-1020	789-1355
	*KERSHNER DONNELLEY	460-1020	756*RAMONA AUTO PART
	*47 BUS 67 RES 23 NEW		SV789-2024+0
			758*PCDCUS PET SHFD
			CO789-1122
			765*DECKHO JOHN B MD
			789-1223+0
			773*BAK AMER NTESA
			789-1300
			800*TAILLAG CH

MAIN 92050 NATIONAL CITY

13*GENFS UNION SERVICE 477-1985+0
22*BULLOCKS SERVICE 477-9795
* 2 BUS 0 RFS 1 NFW

MAIN 92059 PALA

NO # FREEMAN CHAS A 742-3707
NO # FREEMAN RORT F 742-3433
NO # LEDESMA MIGUEL G 742-3769
* O BUS 3 RES 0 NEW

MAIN 92028 RAINBOW

P.O. ADDRESS FALLBROOK, CALIF

NO LISTINGS

MAIN 92065 RAMONA

201 WALSH JAS L	789-0772
228R0CKGAS SERV CD INC789-1275	
330 KELLY EDWIN G	789-0984
346 WEAKEY HAROLD E	789-1203
354 GUNNETT L	789-0980
390 GINGER LEI	789-0986+21
42150 CD RD RAMONA 39	789-2122
453R0PESION AUTOMVLT	789-1154
499R0BISHER TRUCK LIME	789-1550
503 ADAMS ONDA	789-1733
RAEDEL X O	789-0131+0
RAEDEL RUTH E	789-0131+0
*SANTA MARIA CBMT SH789-1210	
524R0RAMONA WOMANS CLUB	789-0983
529R0RAMONA RONY SHOP	789-0080
555 NIELSEN E A	789-0211
557WEEF LIQUOR	789-0993
*RAMONA STGE STP LOR789-0993	
567R0WENS ANTIQUES	789-2541+0
*BOWENS VCUH CLNR SH789-2541+0	
578R0RAMONA SHELL SERV	789-0500
579 MEAD A O	789-1250
*RAMONA CLEANERS	789-1140
601STROUT REALTY	789-0606
605R0WENS DOLORES L	789-1281+0
PUCKETT ROBT E	789-1281+0

STIMPSON WANDA
8549 DIGIACOMO ARTHUR
8561 LANGLAND HAROLD W
8562 MEIRING STANLEY A
8573 PARKER CLAUDE W
8580 COX M P
8585 STAHKE PARKER J
8595 HEIM A M
8603 BAUMGARDNER J F
CLARK PETER D JR
8614 BLEDSOE MARTHA MRS
8624 FULTON DOROTHY MRS
FULTON JOANNE F
FULTON JOHN F
8625 FAIRBAIRN WM C
8635 BURBANO GEORGE JR
8650 RICH KARL RICHARD
8657 ROMERO CHAS J
8675 MCCLUER TERENCE W
8703 YOUNG JOE W
8709 BARNETT JOHN M
8715 CALL JOHNNIE M
8721 PETTUS RICHARD E
8724 KOLB CHAS R
8727 DELANEY JAS
8730 LONG LAUREN M
8733 CARB DENHAM L
8739 FLOYD JOHN H JR
8740 WATERMAN CHAS A
8750 ASHINGER JACOB J
8753 COLVIN JAY R
8756 MONKS WM R
8762 ANDERSEN JOHN B
8765 RAMALHO JOE
8785 SARGENT ROBT E
8786 AGOSTA ANTHONY
* 0 BUS 48 RES 465-1351 469-4395 469-4251 460-8107 465-3249 465-1077 469-3825 465-6923 COR461-0326+0 461-0326+0 466-0944 469-4710 465-4182 469-4710 469-3461 460-7286 469-2013 460-3602+0 463-3068 469-8106 465-3721 465-7405+0 460-0847 466-2942 463-7152 465-9528 465-2632 465-6740 465-2617 460-2553+0 463-1725 460-5262 460-5433 460-7380 469-8569 465-6215 6 NEW |

VERLY CT 92117 SAN DIEGO
4408 SPIES RICHARD R
4419 MCNEAL RONALD L MRS
4429 HAGEWOOD RICHARD D
4439 GIACALONE ANTHONY
GIACALONE BETTY
* 0 BUS 5 RES 278-1345+0 279-1683+0 279-6287 279-1785 279-1785 2 NEW |

VERMEL AV 92025 ESCONDIDO
1914 KASDAN NORMA
KASDAN SHELLEY B
1915 ASHFORD FRANK L
1924 KREIN ANDREW C JR
KREIN MARY JANE
1925 MEYER ALBERT E
1944 DANELL ARTHUR E
1954 KUTCHER ERNEST
1964 TAYLOR BYRON M JR
1971 SHERIDAN RICHARD T
1974 WEDEKING ROBT A
1984 ERSKINE L M
2004 WALLACE MARJORIE E
2014 FOX CHAS H
2015 CLEVELAND HARRY C
CLEVELAND JOANN
2023 ELLEDGE RUSSELL DR
2030 FALLET JAS H
FALLET JOANNE
2031 VANLONDERSELE MSNRY
2038 GUNDERSON BETTY
GUNDERSON DALE
2039 MORIS ROBT W
2047 KAISER RICHARD L
2055 BUSS BARBARA
BUSS DONALD D
2060 WILSON LESTER K
2063 BARRERAS FRANK
DEIBERT CAREY
* 1 BUS 28 RES 746-2686 746-5594 746-0316+0 745-8333 745-8333 746-5874 746-6707+0 746-2907 746-3068 747-2589+0 745-0126 746-1733 746-5861 746-0312 746-2597 746-2597 746-3560 745-4867 745-4867 746-3570+0 746-3892 746-3892 745-1975 745-1011 745-7982 745-7982 745-3576 746-3360+0 746-5387 5 NEW |

VERMONT 92103 SAN DIEGO
3419 LUDWIG EDMOND J
3430 WATERMAN WHITNEY JR
3431 SOSNA SAM L
3451 BAILEY MADGE B
BAILEY W RADM USN
3657 WILLIAMS KIRT
3663 JONES MARK
3692 ARNOLD CHAS E
3702 BERG ARCHIE MRS
BERG MARION J
WITTEN DOYLE W
3712 JONES JAS M
3716 DELGADO J G
3718 HAMILL G S
PAYNE GERALDINE M
3723 INGLEWED H D
3736 HORN ALBERT L
3741 HADLEY JOHN S
3749 PEPIN ARTHUR J
3751 GAILLARD JOHN L
3753 BAKER BILLIE G
3754 WILSON MARY ANN
WILSON MERVIN G
3762 CORRELL MARGARET G
CORRELL MARGARET G
3765 PANGBURN BEN JR
3767 GRAHAM EARL G
3771 BIRCH CLARENCE MRS
3774 HEIGHS LAURA MRS
3779 THOMPSON MAUDE H
3795 MARTIN JOHN
3815 ANGLIN G W MRS
BENNETT WILTON L
BROCKTON JERRA W
LEACH DOROTHY A
LOPEZ RICHARD H
SEELA RUSSELL L 295-1071+0 298-6222 295-3674 295-2227 295-9662 295-9634 295-0458 295-7694 295-9454+0 295-9454+0 298-1327+0 298-1263 291-5518+0 298-8718 298-8718 298-0392 298-1477 291-6570+0 291-2452 298-7012+0 297-3405 298-8707+0 298-8622+0 295-8436 296-0807 298-2588 295-5855 296-6528 296-1056 296-1352 296-2770 296-2378 296-2093 291-2652+0 295-3354+0 298-3044 296-4734+0 |

3820 BRADSHAW ERIC T
4062 WELCH J V
4064 BURKE JEAN M
4075 RECORD C E
4076 MCKNIGHT A S
4082 LEATHERWOOD S F MRS
4089 MCKNIGHT JOHN R
4106 PAYLER WALLACE G
4111 FINCHER K G SR
4112 ERWIN CECILIA MRS
4117 OWENS ROBT L
4120 CRIDER CLAIR
4126 SHORT ANDREW L
4127 PINKERTON JAS N
4128 GARRISON G
4129 ANGELES G
4132 MIZRAHI MOISE B
4134 ORSINI JOHN
4138 GUERRA RAMON
4145 MOSHER EDNA
MOSHER HENRY M
4149 OPDYCKE J EVAN
4150 CLARKE JOYCE L
LANNING GEO E
4151 ENRIGHT ROY
4152 BOWER EDWIN J
4154 GREEN JOE B
4176 CRUICKSHANK STEWART
GRANT DAVID
4178 KELLY MICHAEL K
* 0 BUS 67 RES 295-5667+0 296-4313+0 295-8406 295-0542+0 295-9483 295-3349 298-1426 295-4383 298-1897+0 296-2969 298-2805 295-0937 295-9121 291-1742 298-2089+0 295-0397 298-3771+0 296-3375 295-0993+0 291-3998+0 291-3998+0 295-1238 295-3454+0 295-3454+0 296-2398 295-4618 298-3544 295-2076 295-2076 298-1765 23 NEW |

VERMONT 92065 RAMONA
NO # ADAMS RALPH R
NO # WHITE W DON
* 0 BUS 2 RES 789-1796 789-0395+0 1 NEW |

VERMONT AV E 92025 ESCONDIDO
110 DUPONT DENNIS D
120 MCCORD FRANK T
MCCORD LAURENA
125 CREW HARRY
129 GARLOW EVERETT H
134 WALKER CAROLE
158 REED HAROLD B MRS
203 BRAZIER M V
207 GREEN DORAN B
216 SAMPSON GRACE L
221 BOE TORVALD
230 THACKER ROBT C
244 WEAVER CLAUDE H
258 ULLERY CHAS
261 MORAN EDW A
263 EDINGTON SUSAN
EDINGTON WAYNE
265 SIMMS W H
* 0 BUS 18 RES 746-5612+0 747-1909+0 747-1909+0 745-0568 745-2052 746-1108+0 745-1154 746-6746 745-3990 746-0355 745-0756 745-6736 745-5423 745-6028 745-8709 745-4299+0 745-4299+0 745-1873 6 NEW |

VERMONT AV W 92025 ESCONDIDO
111 MULLAY NASH
118 REYNOLDS BERTHA
REYNOLDS RICHARD
120 ANDERSON DON
BURKE ED
DOWNING EDW M
IRWIN MARGARET L
MURPHY JAS W
SCHULER M
SHULTZ C L
TITCOMB DANL V
WELCH BILL W
125 WEBB CECILE MRS
137 GORMAN THOS F
143 HENDERSON CHAS H
145 WILLIAMS FORREST
201 CLARK H A
211 HARWOOD PAUL T
431 TOWNSEND CARROLL
475 OOPP DARIAN E
501 OLOS E M
503 KOENIG FRED C
510 BRAINERD MORGAN C
530 COX EDW F
535 DAVIS HAROLD
536 LAUGHLIN IVA
LAUGHLIN JAS F
552 GRAHAM OTIS JOHN
553 DAVIS CHESTER A
557 WITT W DARREL
561 GILLESPIE LARRY
564 DAKES THOS E
565 REIMER WM H
606 CAMPBELL WESLEY E
639 WULFF GEO J
667 WULFF DONALD J
670 ANISODON CLAUDE J
ANISODON SHARON
* 0 BUS 38 RES 746-4086+0 746-1846 746-1846 747-1665+0 746-0259+0 746-7825+0 747-2397+0 746-9654+0 745-1876+0 746-6480+0 746-4056+0 745-3784+0 746-6237 746-8717 745-6914 747-2388+0 745-1303 745-6528 745-6740 746-8159 746-7427 745-6728 745-0626 745-6733+0 745-9018 746-0810 746-0810 745-5474 745-6768 746-3666 746-7949 745-3109 745-1906 745-9830 745-5358 745-7088 746-7822 746-7822 12 NEW |

VERMONT PL 92025 ESCONDIDO
1902 AIKMAN JAS
1907 FRAGAS C K
FRAGAS IRIS V
1908 CREMER W V
1913 HORNE ROBT J
1914 STEVENS DOROTHY E
STEVENS MARK E
1919 CURLEY MIKE
CURLEY ROBT G
1920 BRIGHAM GERALD F
1925 LARSEN PERRY J
1931 ROGERS GRADEX
1937 DENTON DELMAS H 746-3787 745-4594 745-4594 745-8201 745-5258 746-3839+0 746-3839+0 747-3840+0 746-8627 746-9016+0 745-2747 746-2347 745-4333 |

APPENDIX D
PHOTOGRAPHS



1. View of the Site from the east, facing west.



2. View of the Site from the north, facing south.



3. View of the southwestern-most parcel of the Site, facing southeast.



4. View of the Site from the south, facing northeast.



5. View of the Site from the southeastern boundary, facing north.



6. View of the former auto repair area at the northwestern portion of the Site.

Photograph Log

County of San Diego APNs 282-141-32-00, -33-00 and -34-00
Ramona, California





7. View of the former auto repair area at the northwestern portion of the Site.



8. View of trucks at the former auto repair area.



9. View of a typical truck interior.



10. View of paints at the former auto repair area.



11. View of propane and dissolved acetylene tanks at the former auto repair area.



12. View of a typical on-Site dumpster.





13. View of the former office at the auto repair warehouse.



14. View of utility indicators.



15. View of a drum at the former auto repair area.



16. View of unknown liquid at the former auto repair area.



17. View of storage containers at the former auto repair area.



18. View of an air compressor at the former auto repair area.

Photograph Log

County of San Diego APNs 282-141-32-00, -33-00 and -34-00
Ramona, California





19. View of an AST at the former auto repair area.



20. View of staining near containers of tractor fluid at the former auto repair area.



21. View of materials at the northern gravel lot. Note pole-mounted transformer.



22. View of materials at the northern gravel lot.



23. View of sheds at the eastern portion of the Site.



24. View of northwestern-adjointing properties across Vermont Street.

Photograph Log

County of San Diego APNs 282-141-32-00, -33-00 and -34-00
Ramona, California





25. View of a southeastern-adjoining property across Main Street.



26. View of a northeastern-adjoining property.



27. View of the southwestern-adjoining property.

Photograph Log

County of San Diego APNs 282-141-32-00, -33-00 and -34-00
Ramona, California



APPENDIX E
INTERVIEW QUESTIONNAIRE



Due Diligence Environmental Questionnaire

Site Name – 2021 Main Street, Ramona, California

Return to dw@weisenviro.com

Completed by: Lauren Welty

Company or Organization: Woodcrest Real Estate Ventures

Title Project Manager

Date: March 17, 2026

1.) Who is the current owner of the subject property and when was it purchased?

Owner: PrimeTime Development

Purchased: 2019

2.) Who are the past owners of the property and years of ownership (if available)?

Please refer to Title Report.

3.) What was the past use of the subject property?

General Commercial / Automotive/ Vacant

4.) Are you aware of any environmental cleanup liens that are filed or recorded against the subject property?

To my knowledge, there are no environmental cleanup liens filed or recorded against the subject property.

5.) Are you aware of any activity and land use limitations that are in place on the property that have been filed or recorded in a registry?

To my knowledge, I am not aware of any activity or land use limitations that are placed on the property, filed or recorded in a registry.

6.) Are you aware of any specialized knowledge or experience related to the property or nearby properties that is pertinent to potential adverse environmental conditions?

To my knowledge, I am not aware of any potential adverse environmental conditions pertinent to said property or nearby properties.

7.) Did the purchase price paid for the property reasonably reflect the fair market rate for this type of property at the time?

Purchase price of the property was reflective of fair market price for this land use.

8.) If there was a significant difference between the proposed purchase price and fair market value at the time, did you consider whether the purchase price was due to known or suspect contamination at the property?

N/A

9.) Are you aware of commonly known or reasonably obtainable information that would help us to identify conditions indicative of releases or threatened releases of hazardous wastes/materials at the property? Such information includes knowledge of specific chemicals that are present or were once present on the property, spills or other chemicals releases that may have occurred, underground or aboveground storage tanks and environmental cleanups that have been conducted on the property.

Not to our knowledge.

10.) Based on your knowledge and experience related to the property, are there any obvious indicators that point to the presence or likely presence of contamination at the property?

Based on my knowledge and experience related to the property, there are no obvious indicators that point to the presence or likely presence of contamination on the property.

APPENDIX F
QUALIFICATIONS



Dan Weis, R.E.H.S.

ENVIRONMENTAL MANAGER

📍 1938 Kellogg Avenue, Suite 116, Carlsbad, CA 92008

📞 (760) 585-7070 // 📠 (760) 672-6338 // ✉️ dw@weisenviro.com // 🌐 www.weisenviro.com

Professional Summary

Environmental Manager and California Registered Environmental Health Specialist with extensive expertise in environmental science and assessment, environmental and public health, risk assessment, health and safety, remedial design and implementation, strategic planning and project/program design and implementation. Over 20 years of professional experience and achievement. Successful completion of projects for a wide range of clientele including, but not limited to, local government entities, developers (affordable housing and market rate), educational institutions, Federal government entities, law firms, architectural and engineering firms, lending institutions, life insurance companies, conservancies, commercial/industrial real estate owners/managers, insurance companies, wireless telecommunication carriers and real estate developers. Extensive experienced in the completion of assessment, construction and remediation quality assurance during the completion of urban redevelopment/brownfields projects and public works projects, many of which have been located in downtown areas of San Diego, Los Angeles, Oakland, San Francisco, and other urban communities throughout the State of California. Proven ability to train and mentor professional, technical and support staff. Manages a comprehensive health and safety program. Holds a Master of Science in Public Health with an emphasis in environmental health science, risk assessment, health and safety, toxicology and environmental policy. Registered Environmental Health Specialist #8172 in the State of California.

Education and Professional Certification

- University of Delaware, Bachelor of Arts, 1995
- San Diego State University, Master of Science, Public/Environmental Health, 2001
- State of California Registered Environmental Health Specialist #8172
- Centers for Disease Control and Prevention National Center for Environmental Health Division of Emergency and Environmental Health Services - Environmental Health Training in Emergency Response
- Occupational Safety and Health Administration (OSHA) 40 Hour Hazardous Waste Operations and Emergency Response Standard (HAZWOPER) Training and Annual 8 Hour HAZWOPER Refresher Training
- OSHA 8 Hour HAZWOPER Supervisor Training

Relevant Skills and Qualifications

- Proven ability to manage staff and programs/projects in challenging and diverse environments and regulatory settings. Consistently meets project schedules, goals, deadlines and budgetary restrictions.
- Completed or managed over 3,000 due diligence related environmental assessments and completed or managed over 500 subsurface environmental investigations of soil gas, soil, groundwater and other media. Investigations have included human health and ecological risk assessments, evaluations of indoor air conditions based on interpretations of subsurface conditions, underground storage tank (UST) evaluation/closure and hazardous waste characterization/management. Subsurface activities performed include the completion of soil borings using various drilling technologies, soil and groundwater sampling, installation and sampling of groundwater monitoring wells, free product evaluations, exploratory trenching and real-time delineation using mobile analytical laboratories and other soil screening technology.
- Managed over 100 remediation or construction management related projects primarily related to source removal of subsurface contaminants, including but not limited to, petroleum hydrocarbons, chlorinated solvents, heavy metals, organochlorine pesticides and other agricultural related chemicals, dioxins and furans and polychlorinated biphenyls. Has also assisted in cost recovery efforts from private parties and State/Federal funding programs for environmental assessment and remediation work and has served as an expert witness during legal proceedings pertaining to environmental related claims.
- Strong collaboration and negotiation skills with environmental regulatory agencies regarding project planning, initiation, status, approvals and implementation. Direct experience in interfacing with members of regulatory agencies including but not limited to the United States Environmental Protection Agency (EPA), California EPA Department of Toxic Substances



Control and Office of Environmental Health Hazard Assessment, County of San Diego Departments of Environmental Health (DEH), Public Works and Planning and Land Use, San Diego Air Pollution Control District, South Coast Air Quality Management District, Riverside County DEH, San Francisco City and County Department of Public Health (DPH), Arizona Department of Environmental Quality, County of Los Angeles County DPH and other local Certified Unified Program Agencies. Develop, manage and implement compliance and best practices efforts with Federal and State laws and regulations.

- Conducted and/or managed hundreds of public/environmental health related assessments including electromagnetic field surveys, radionuclide surveys, indoor air quality investigations, radon surveys, drinking water assessments, asbestos containing materials and lead-based paint surveys and mold/microbial evaluations.
- Recovered over \$10,000,000 of assessment and cleanup costs for clientele from various sources including State of California Cleanup Funds, United States Environmental Protection Agency Brownfield grants and private parties including major oil companies.
- Responsible for facilitating a safe and healthy work environment in concert with the mission of the company while ensuring compliance with applicable Federal, State, and local regulations.
- Published technical papers pertaining to geogenic concentrations of metals in San Diego County, radioactive dating and pollutant chronologies in estuarine sediments and various urban runoff related implications.
- Delivered presentations pertaining to various environmental topics including human health risk assessment to membership at local and national trade conferences

Project Experience

- 14th and Island, San Diego, California – Development of Site Mitigation Plan, contaminated soil management and disposal concurrent with site construction activities at the superblock construction site in downtown San Diego and achievement of regulatory closure with the County of San Diego Department of Environmental Health.
- 2198 Market Street, San Francisco, California – Phase I and II Environmental Site Assessments, supplemental subsurface investigation, Site Mitigation Plan development, contaminated soil management and disposal concurrent with site construction activities and negotiation/achievement of regulatory closure with the City of San Francisco Department of Public Health.
- Former EZ Serve, 9305 Mission Gorge Road, Santee, California – Closure report preparation and San Diego Regional Water Quality Control Board interface and negotiation/achievement of regulatory closure under State of California low-threat policy.
- French Field – Former Vista Burn Dump, Oceanside, California – Oversight of the capping of a former burn dump/landfill facility and restoration for public use as a sports facility. Negotiation and achievement of regulatory closure with the California Department of Toxic Substances Control with concurrence from the San Diego Regional Water Quality Control Board and the County of San Diego Local Enforcement Agency.
- Indoor Skydiving Facility, 1401 Imperial Avenue, San Diego, California – Development of Soil Management Plan and contaminated soil management and disposal concurrent with site construction activities in downtown San Diego.
- Lemon Grove Avenue Realignment Project, Lemon Grove, California – Development of Impacted Soil Management Plan, Community Health and Safety Plan and Worker Health and Safety Plan and oversight of the implementation of such plans during construction activities.
- North Side Interior Road and Utilities Project at San Diego International Airport, San Diego, California - Subsurface assessment, development of Soil Management Plan and Work Health and Safety Plan and implementation and monitoring of soil management strategies.
- Olympic and Hill, Los Angeles, California – Removal of multiple underground storage tanks and underlying contaminated soil and achievement of regulatory closure with the City of Los Angeles Fire Department.
- San Ysidro - U.S. Land Port of Entry, San Diego, California – Subsurface assessment and development and implementation of soil management strategies.
- VA Medical Center Long Beach, 5901 East 7th Street, Long Beach, California - VA Long Beach: Seismic Corrections – Mental Health, Community Living Center and Chiller Replacements Project – Asbestos containing materials and lead-based paint surveys and preparation of abatement contractor bid specifications.

